

DOCUMENT NUMBER 131256

## U. S. PUBLIC LAND SURVEY MONUMENT RECORD


## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 26, 27, 34, and 35,  
T.35N., R.15E.

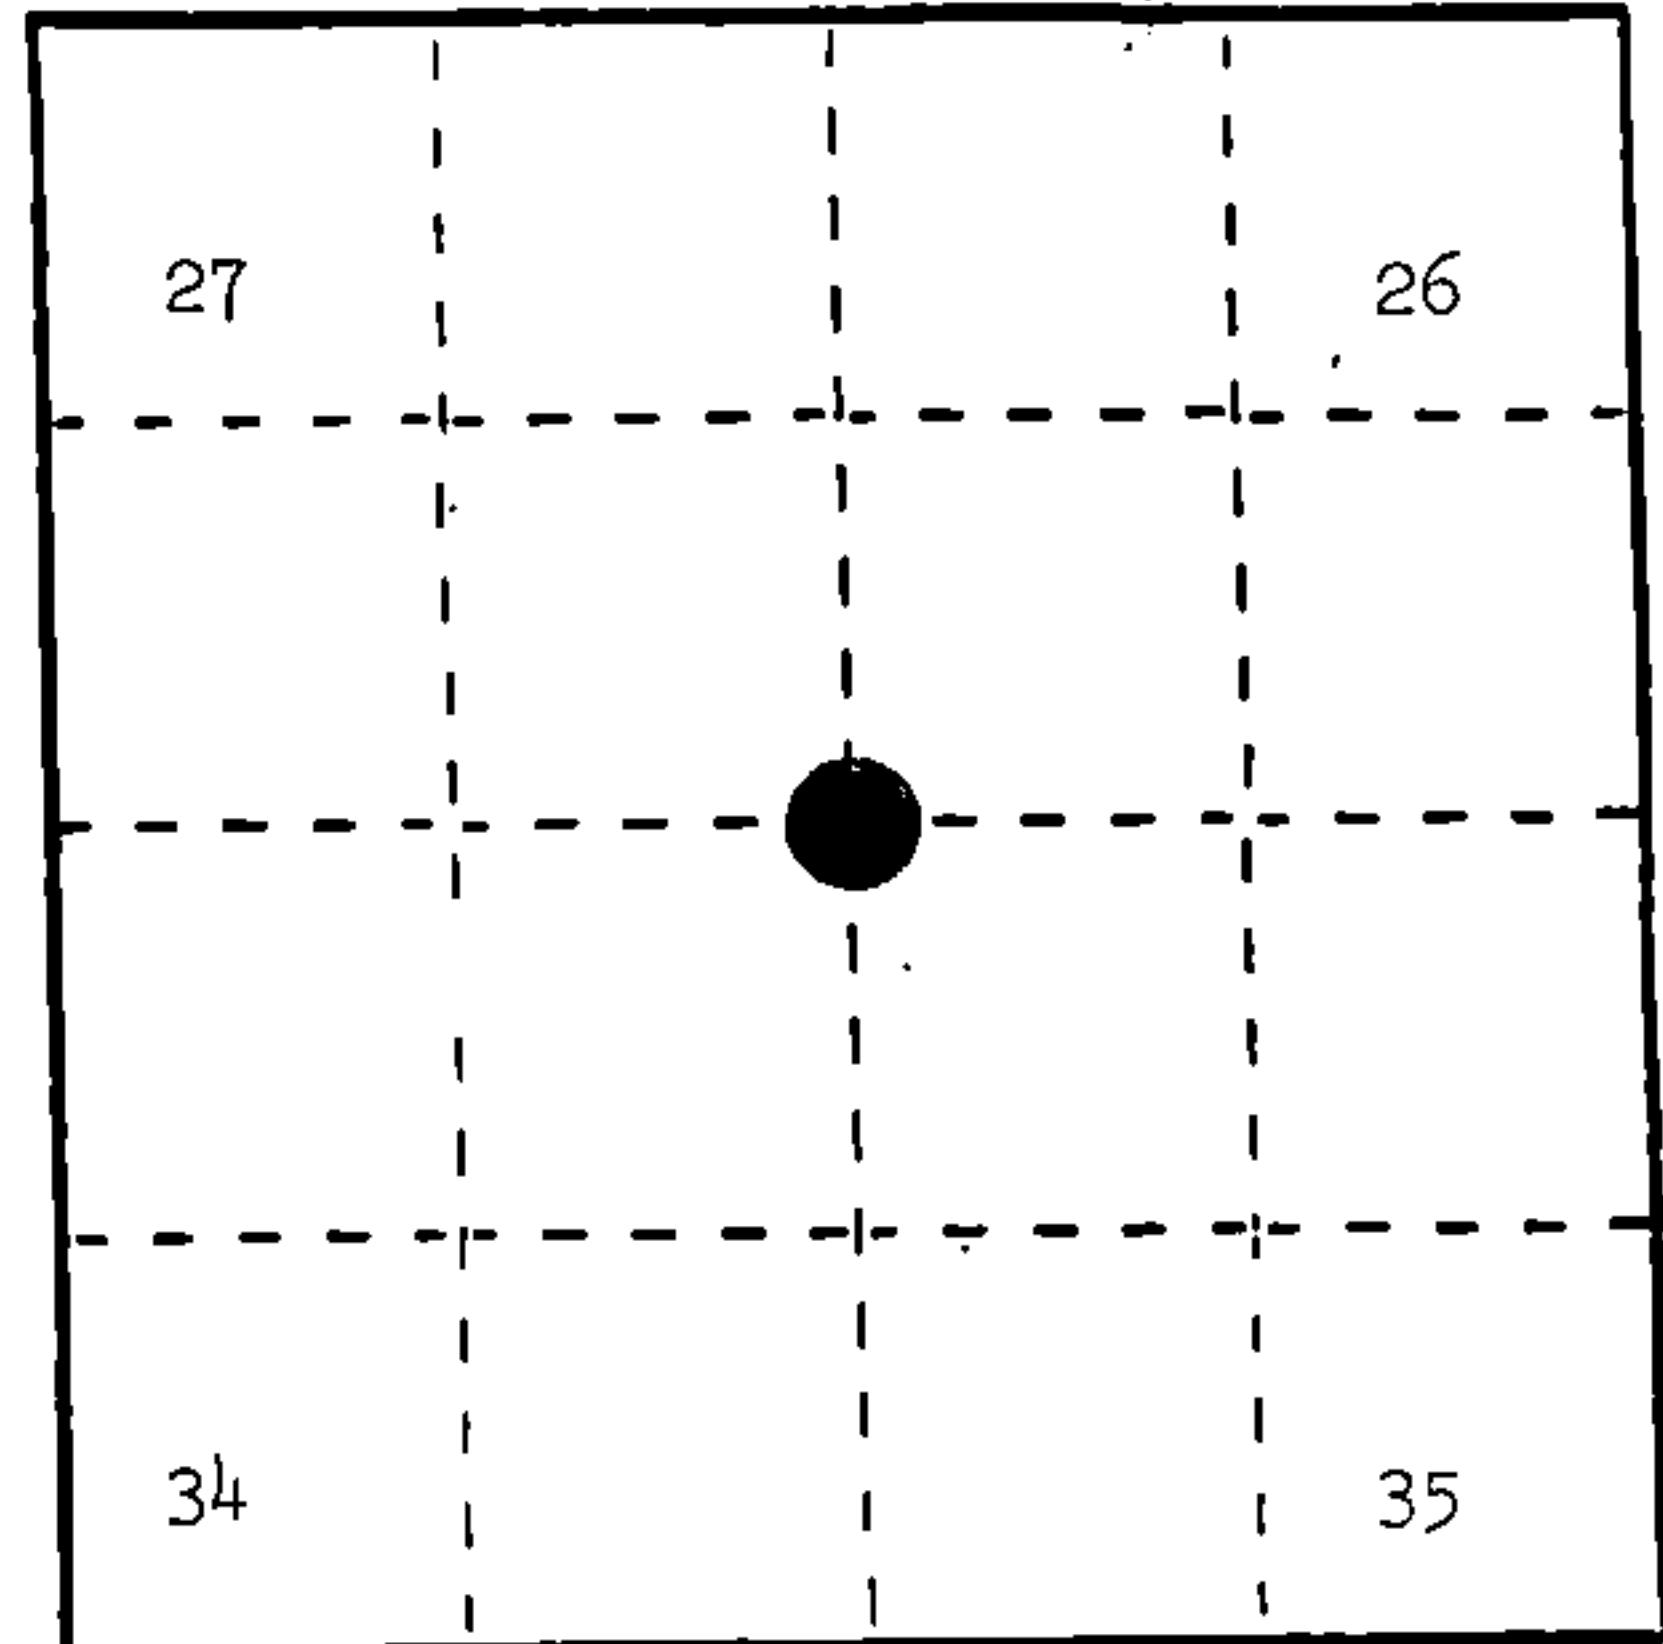

REGISTER'S OFFICE  
Forest County, Wis.

Received for record this 8th day  
of October A.D., 1986 at  
1:25 o'clock P.M. and recorded  
in Vol. CORNER RESTORATIONS  
page V-17

Paul Aschenbrenner  
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Sugar, 14", N.64°W., 18 links; Ironwood, 8", N.48°E., 28 links; Sugar, 12", S.33°E., 32 links; Sugar, 14", S.77°W., 68 links.

In 1906, N. Smith ran exterior of Section 35 and called 3 of original witnesses standing--set 1/16 corners (20.06½ East) and (20.45½ South).


In 1935, Karl Wild found a squared post and placed a location poster on a 5" Elm, ½ chain west of corner.

In 1986, Alan Harrison found an Elm post with location poster lying on pile of rock. Found stump remains of an Elm at N.75°E., 10.23 feet; a stump hole at S.77°W., 44.9 feet; a large turnout of 2 or more trees at N.64°W., 11.9 feet. Placed a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)  
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 4", N.18°E., 6.96 feet
3. Black Cherry, 8", S.19°E., 23.72 feet
4. Sugar, 4", S.54°W., 9.51 feet
5. Sugar, 6", N.45°W., 8.68 feet
6. Steel Sign Post, South, 1.90 feet

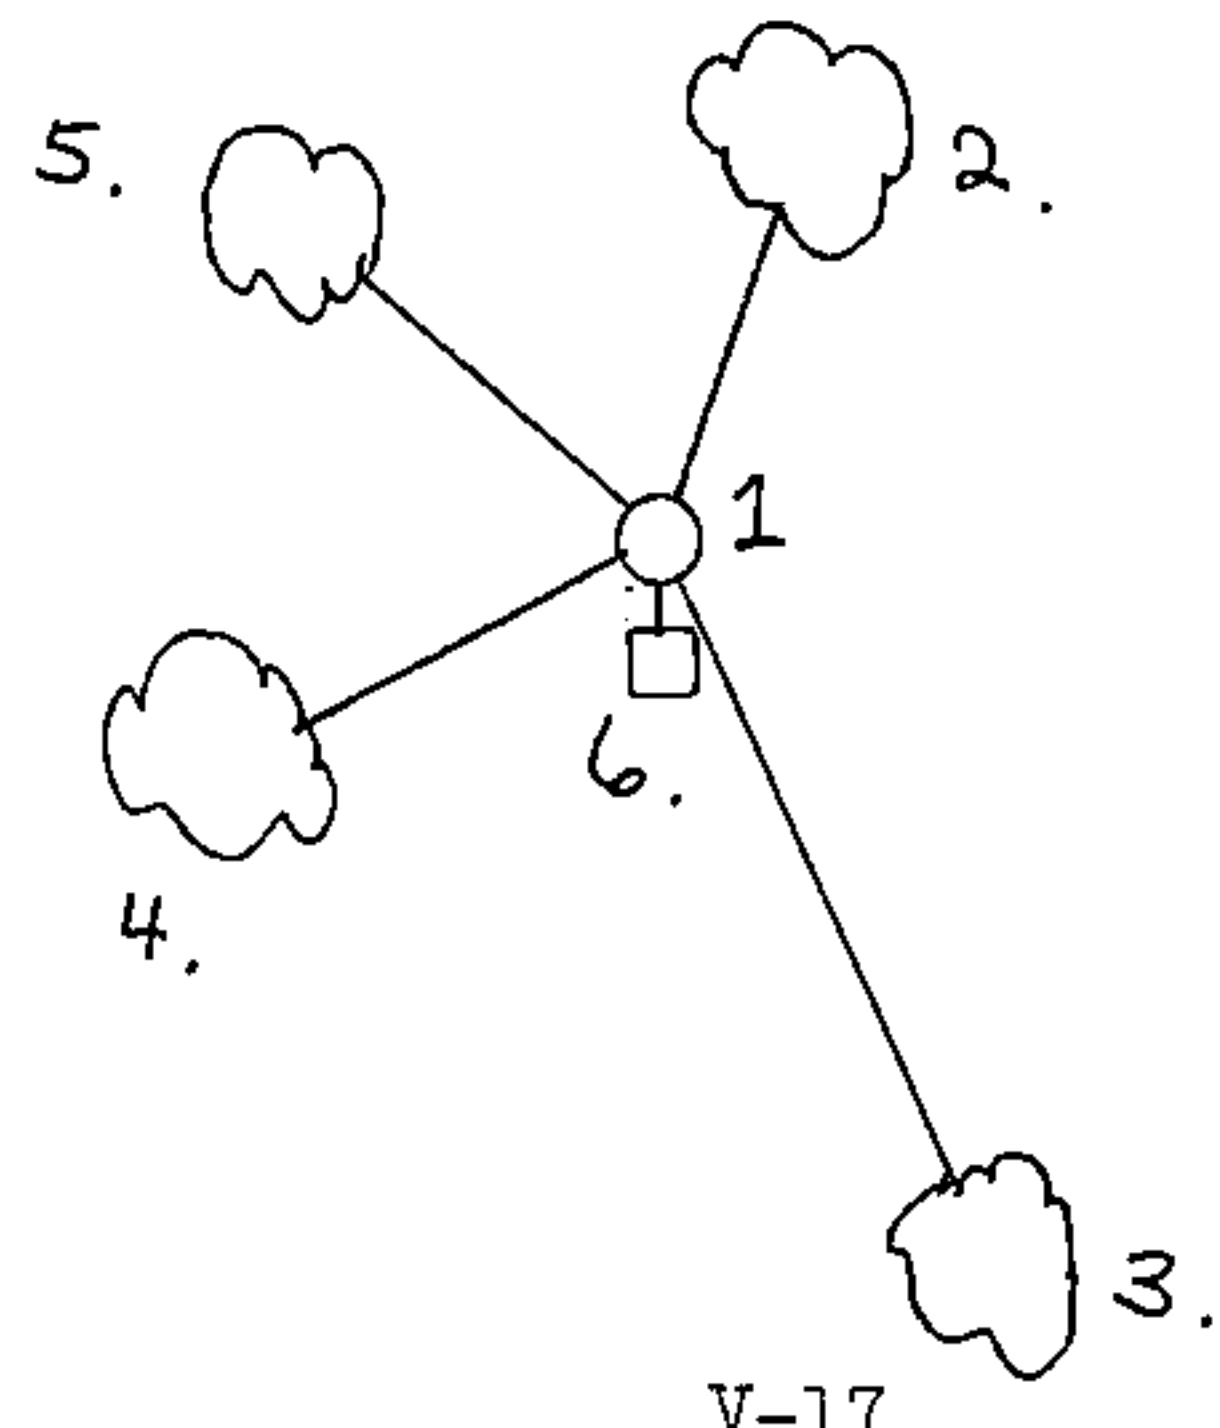

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison  
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 9/11/86  
Signature Date

