DOCUMENT NUMBER 141582





U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through 1).

(a) Identify the corner by reference to the U.S. public land survey system.

O - Corner monument restored.

Quarter corner to sections 34-35, T.35N.,

R.16E., Forest County, Wisconsin,

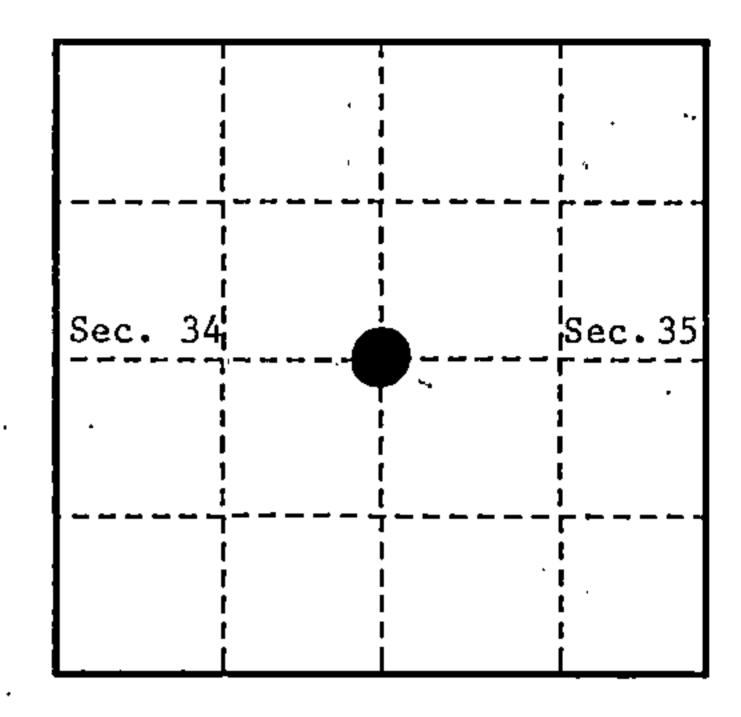

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the manument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Birch, 12", N.34°W., 12 links (7.92 feet); Sugar, 12", N.38°E., 38 links (25.08 feet).


۲

In 1935, L. Sobczak (C.C.C.) found a Birch tree for the corner and put a metal poster on the same.

In 1990, Alan D. Harrison (R.L.S.) searched the area and found no evidence of corner or B.T.'s. Corner restored by single proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, If the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, Iron prother equally durable material.)
- Show a plan view drawing depicting the relevent monuments and reference tles which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
 - 1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
 - 2. Basswood, 12", N.51°E., 13.21 feet.
 - Sugar, 4", S.33°E., 40.77 feet.
 - Sugar, 4", N.48°W., 29.18 feet.
 - Steel Sign Post, 6', North, 0.80 feet.

REGISTER'S OFFICE Forest County, Wis. Received for record this ______day of *A.D.*, 19.21 at 2:25...o'clock P.M. and recorded VOLCORNER KESTORATIONS

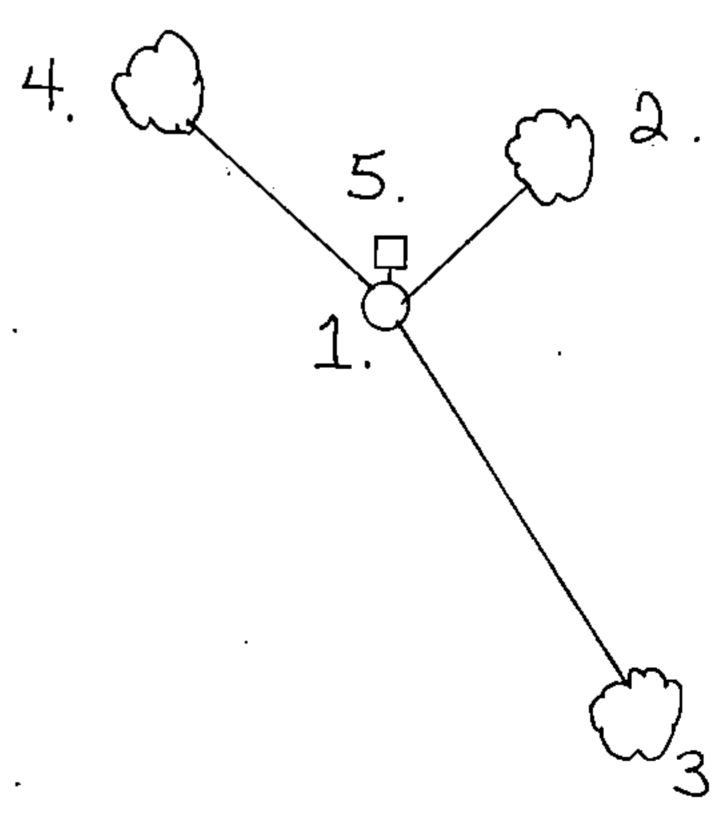

4351634766

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as proviously restored or reestablished and (i) the corner as restored or reestablished, and (2) to at least 2 of the wilness monuments shown on the drawing in (d), above.

数据, 1945年 1966年 1


None.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location 7

No.

(g & h) Was the corner reestabilshed through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

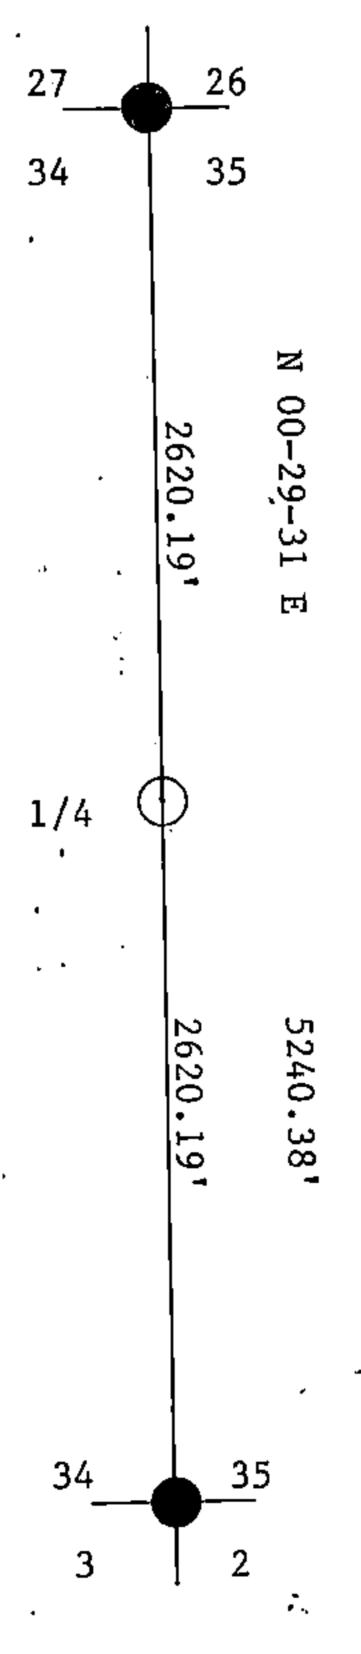

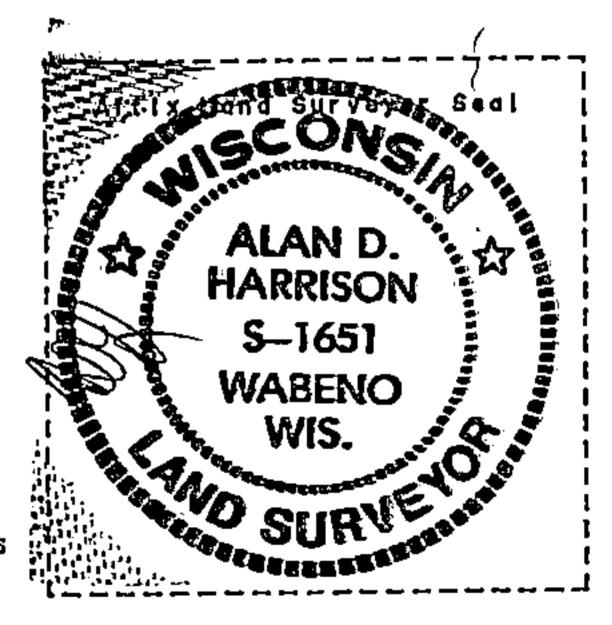

(1) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature.

Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards (Acting)

District Ranger