

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 1 and 2;
 T.35N, R.15E., and Sections 35 and 36,
 T.36N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 142904.62233-N
 2334251.60403-E

Geographic Coordinates
 45-32-58.38980-N
 088-34-20.34362-W

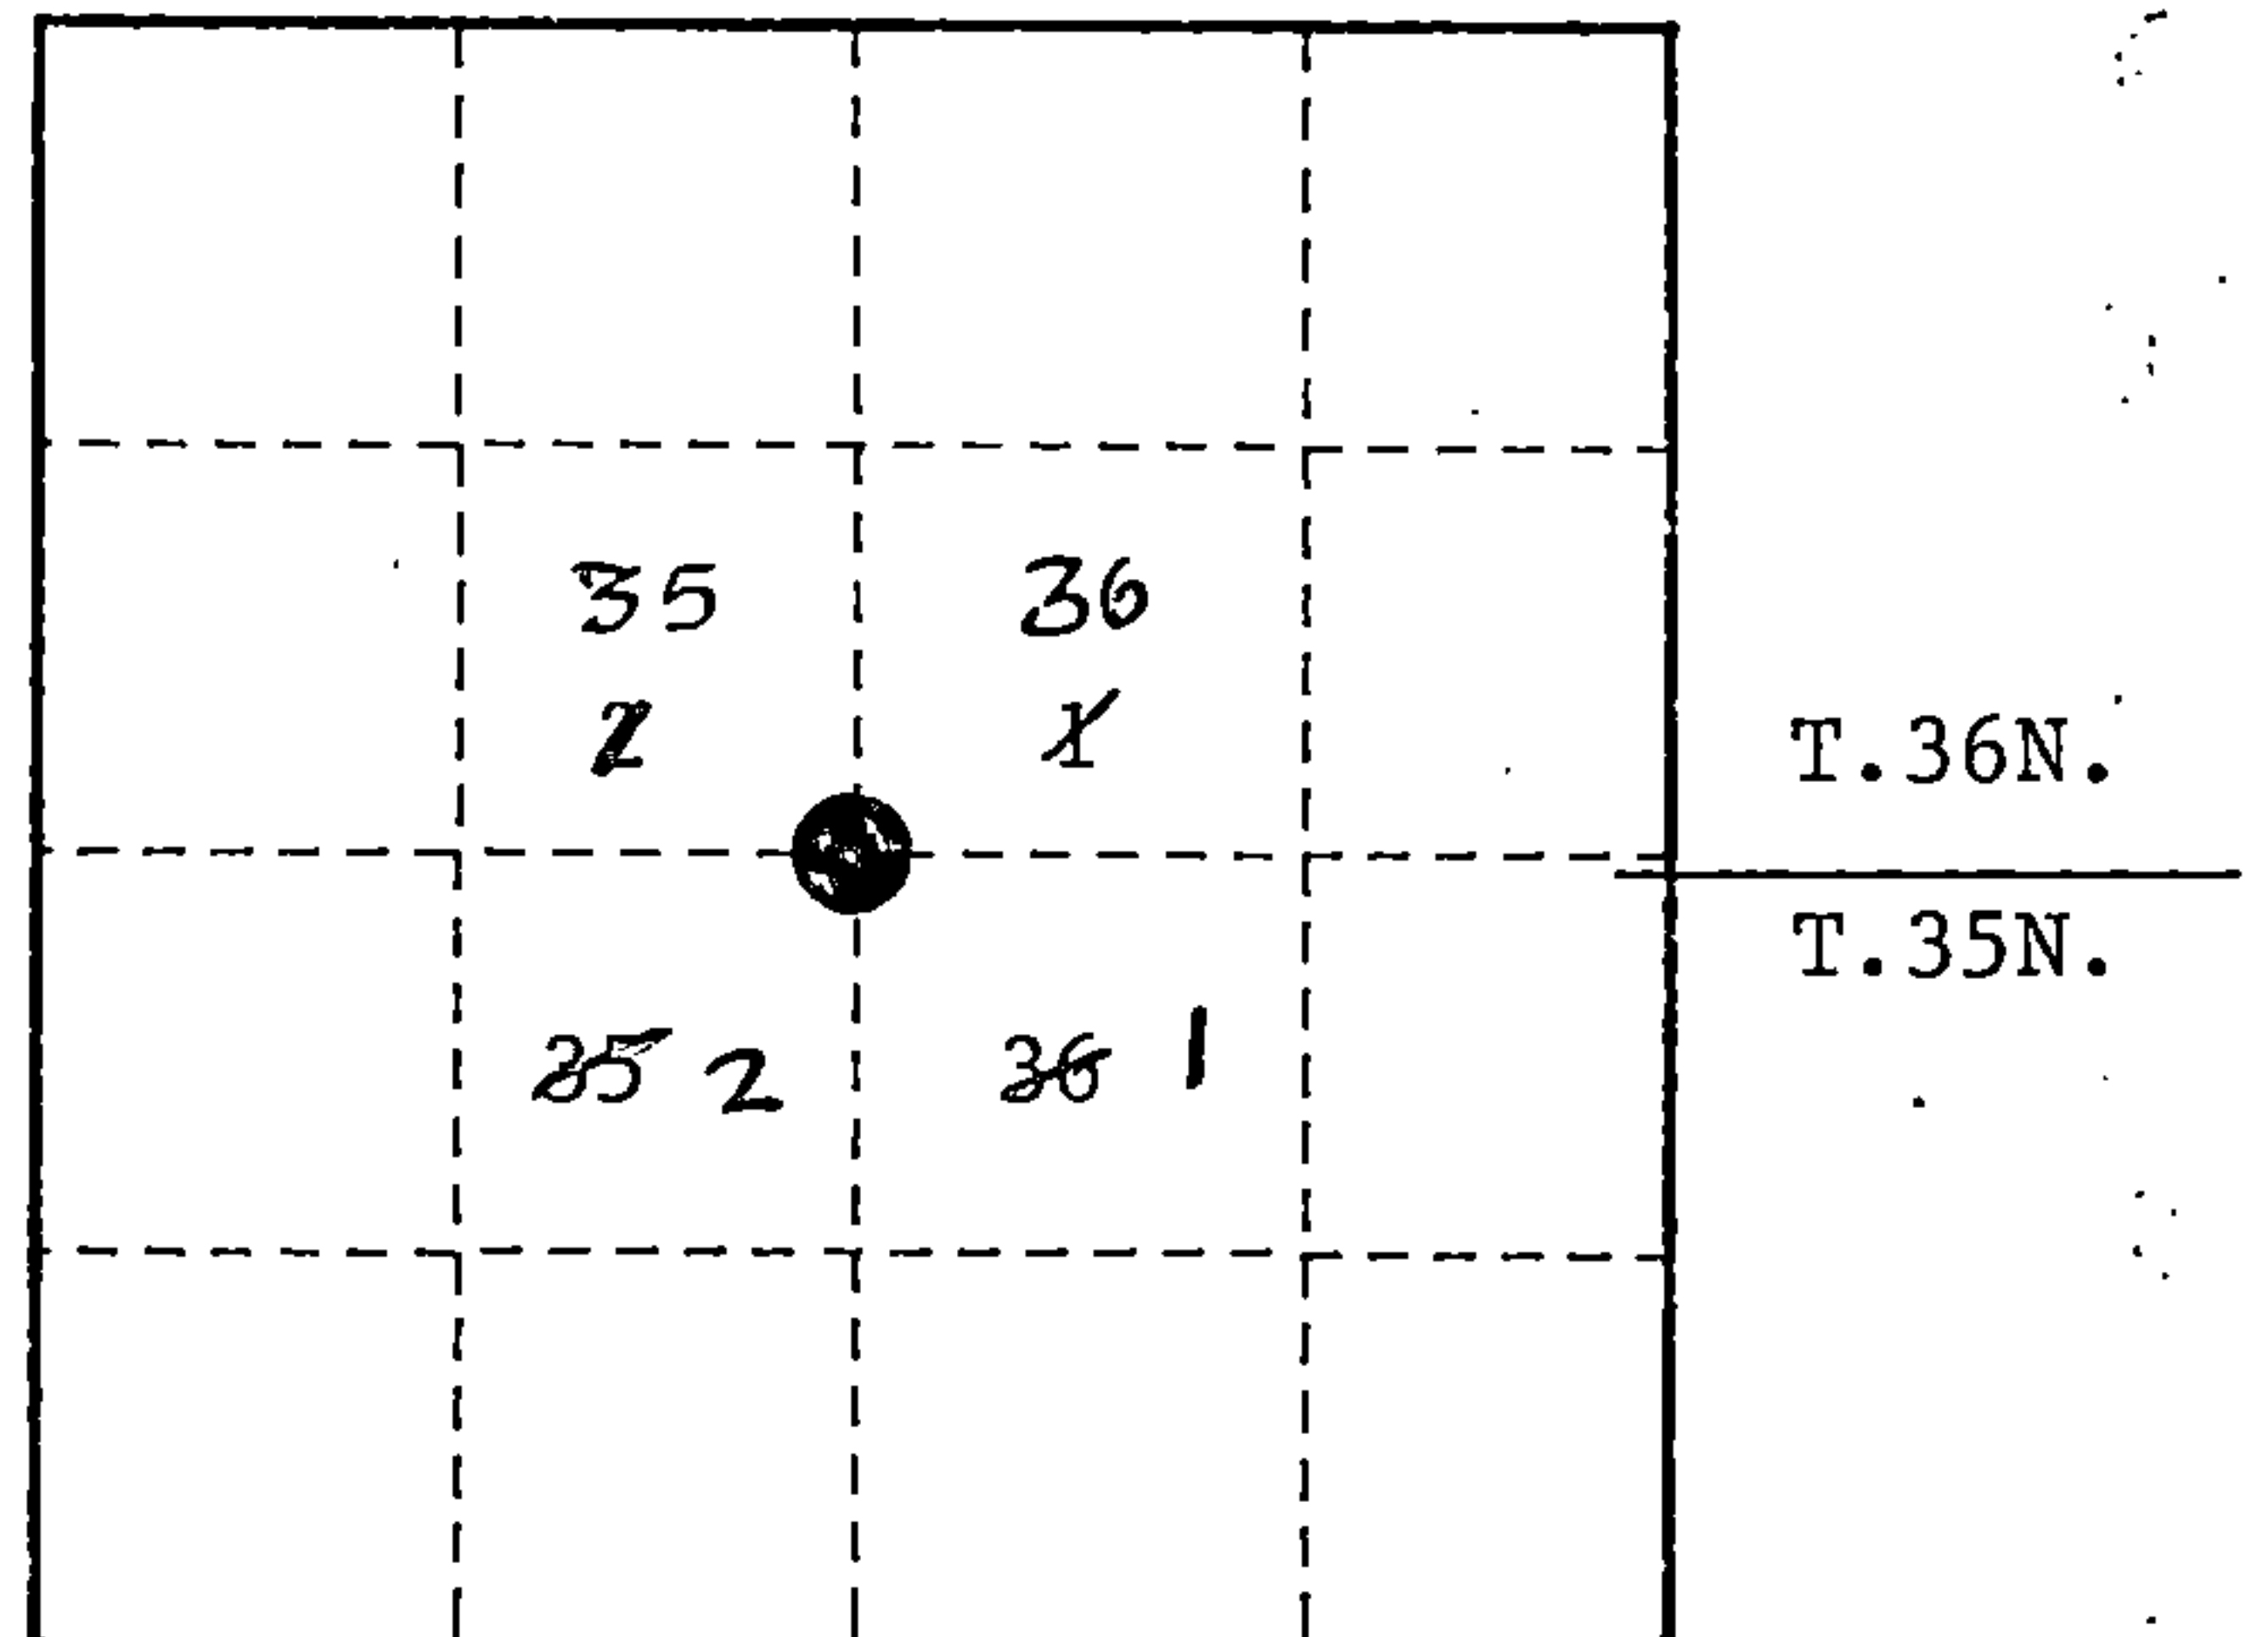

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1857 by Artemas Curtis. Set wood post and the following bearing trees; Hemlock, 10", N.76°W., 27 links, Hemlock, 16", N.53°E., 41 links, Yellow Birch, 16", S.61°E., 59 links, Yellow Birch, 6", S.34°W., 26 links.


In 1982, Milo Stefan, RLS, found stump remains of 3 original bearing trees by survey of town line east and west and from distances of original line tree west. Set a 2" x 36" Aluminum Monument and the following bearing trees; Black Spruce, 4", N.16°E., 20.12 feet, Red Maple, 7", S.69°E., 37.25 feet, Black Spruce, 7", S.26°E., 31.89 feet, White Birch, 10", S.41°W., 9.86 feet, Steel Sign Post, west, 1.90 feet.

On 11-17-93, Alan Harrison, RLS, found the monument and bearing trees as by Milo Stefan in 1982. The Southeast Black Spruce is dead and he cut down the White Birch for G.P.S. observations. Also made 2 new bearing trees; Red Maple, 7", S.02°W., 36.82 feet, Red Maple, 6", S.70°W., 29.59 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" Aluminum Monument with tablet stamped to identify corner.
2. Black Spruce, 4", N.16°E., 20.12 feet.
3. Red Maple, 7", S.69°E., 37.25 feet.
4. Red Maple, 7", S.02°W., 36.82 feet.
5. Red Maple, 6", S.70°W., 29.59 feet.
6. Steel Sign Post, West, 1.90 feet.

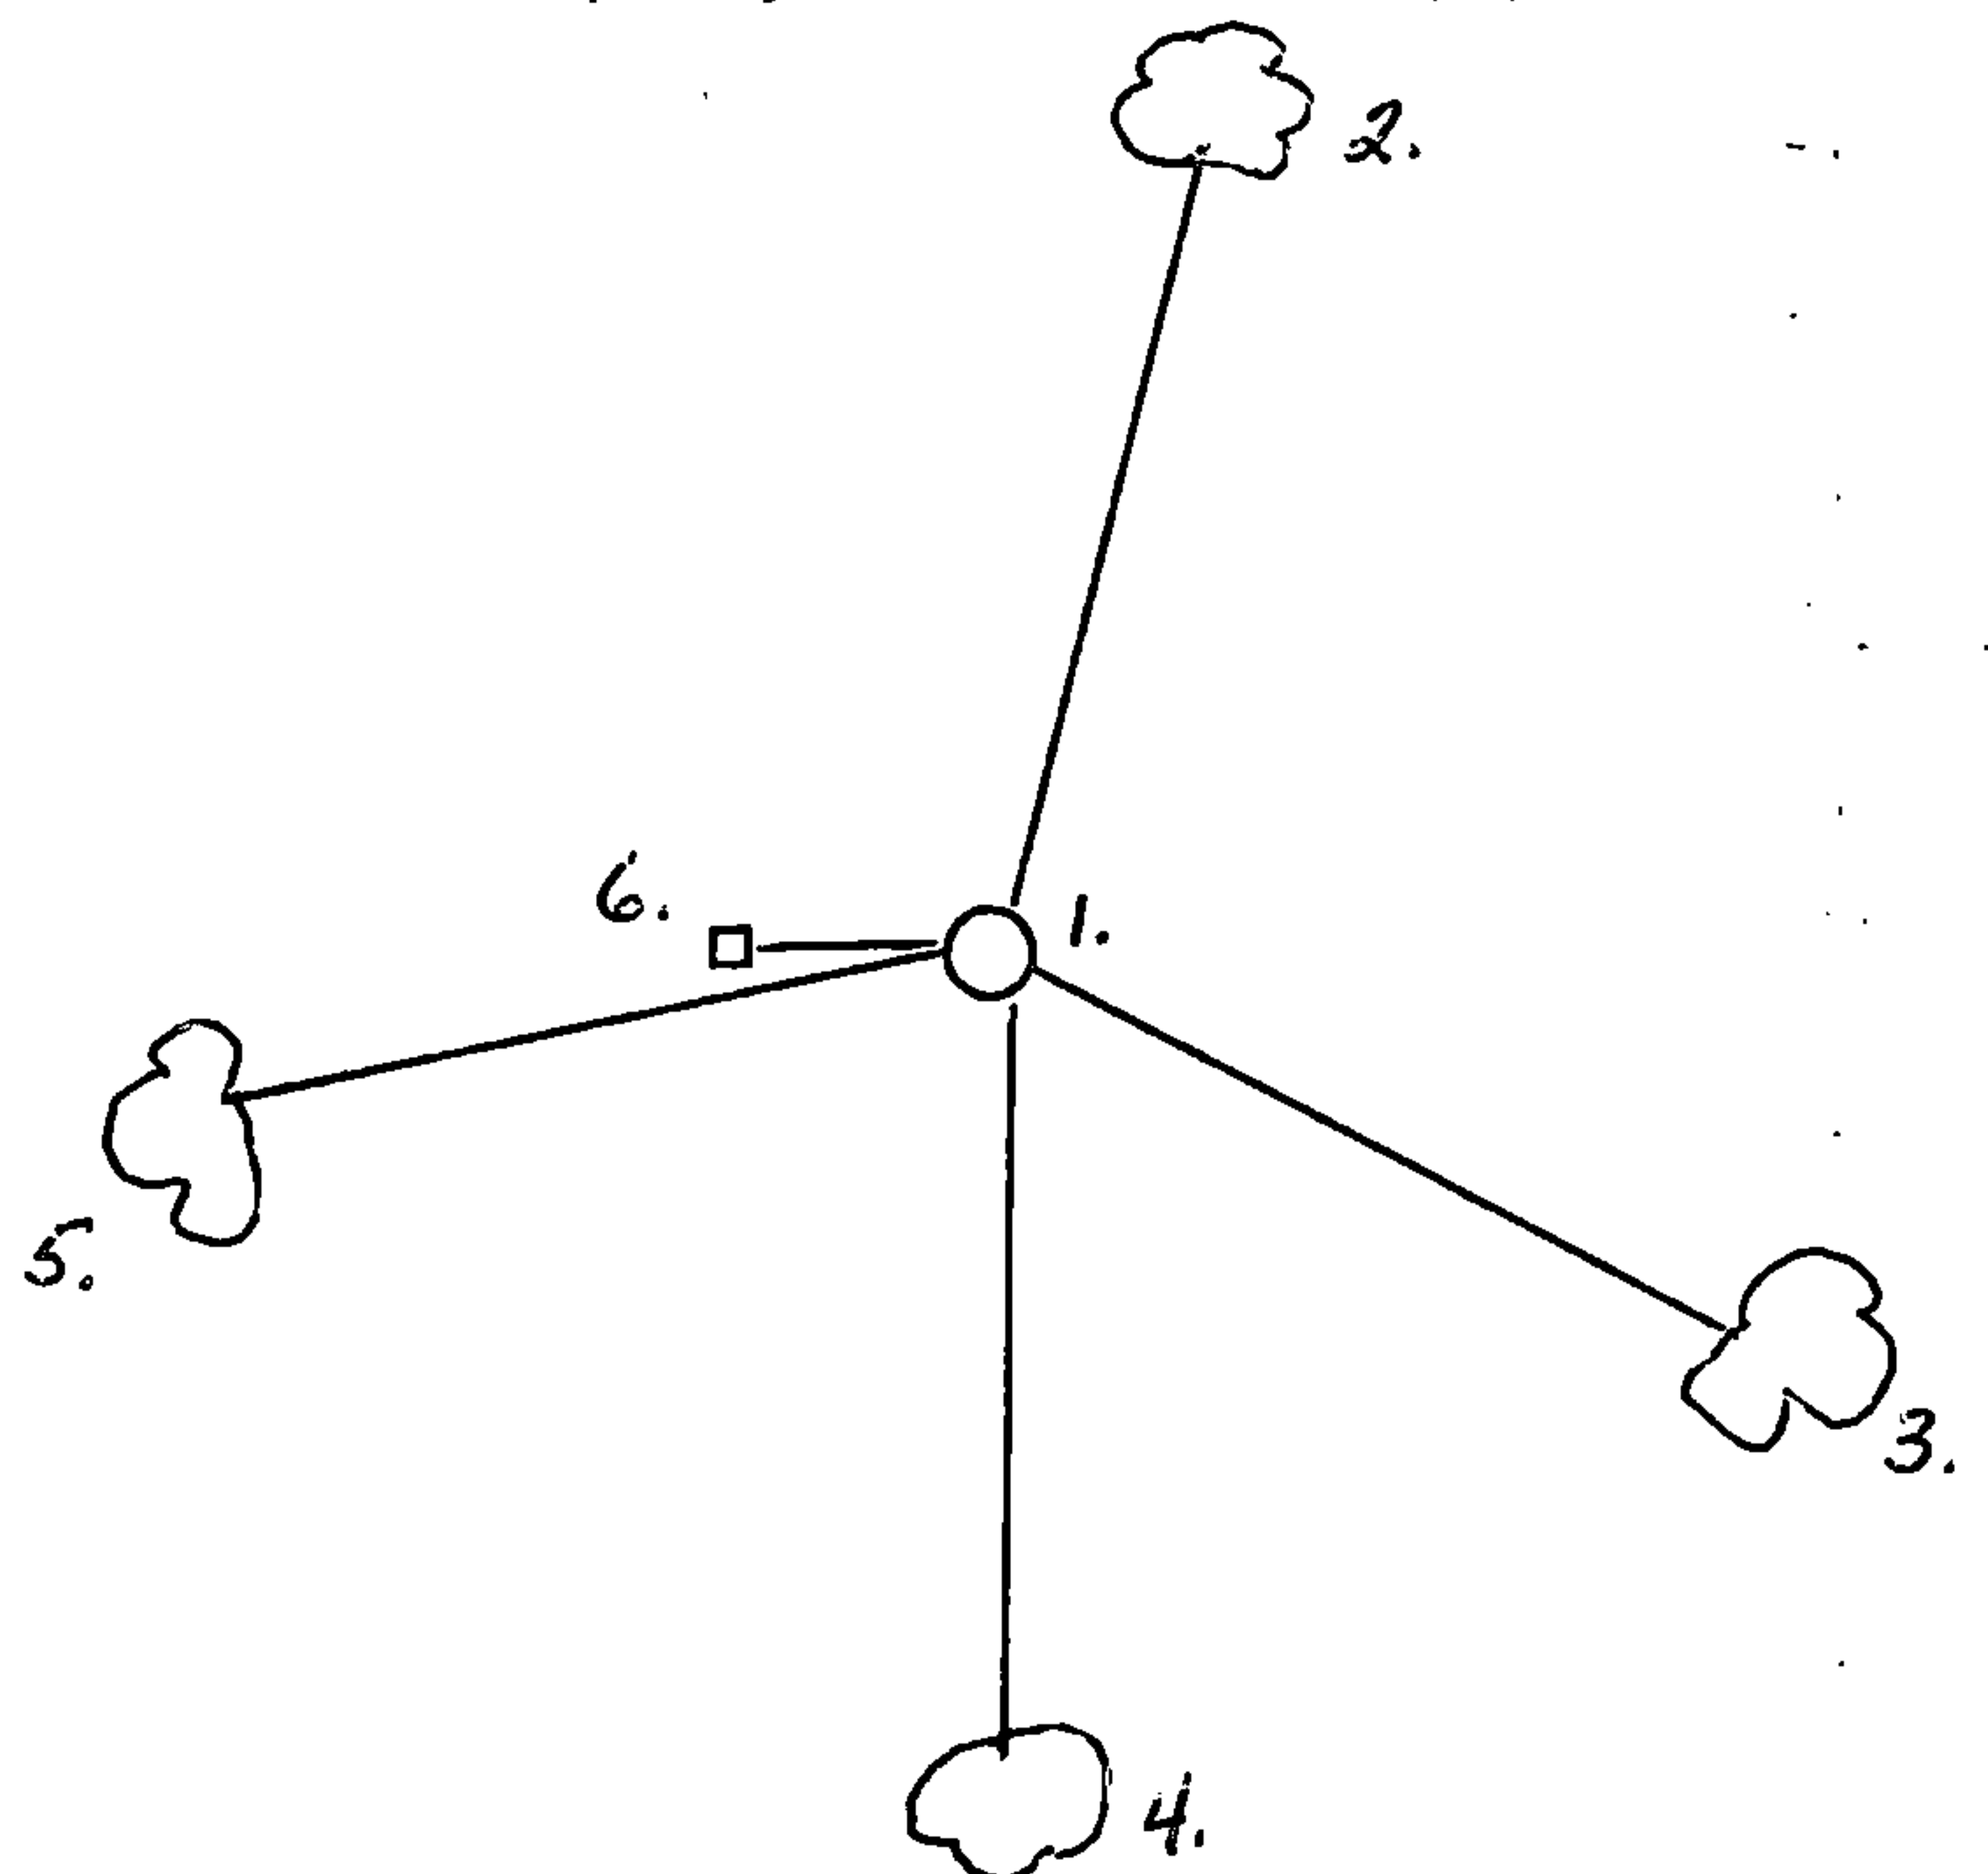

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)


(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of December, A.D., 1994 at
9:00 o'clock A.M. and recorded
in Vol. Green Restorations
page 36-15, A-21

Leah Clithero, Deputy
Register of Deeds

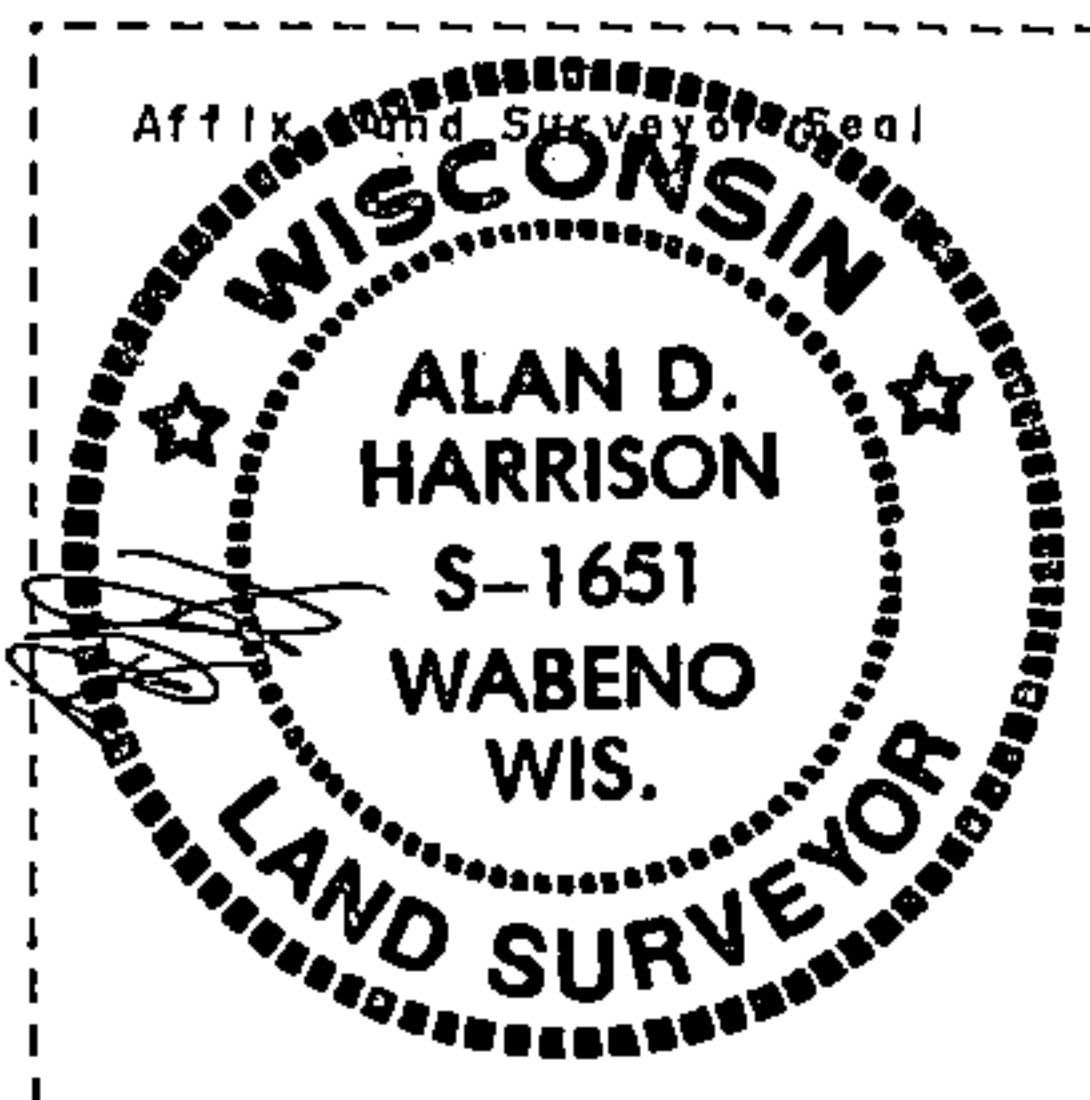

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

10/26/94

Date

CERTIFICATE READY FOR FILING:

Sue Vap

District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Corner to Sections 1, 2, 35, and 36, T.35-36N., R.15E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 14th day
of March, A.D., 1986 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page A-21
Paul Aschenbrenner
Register of Deeds

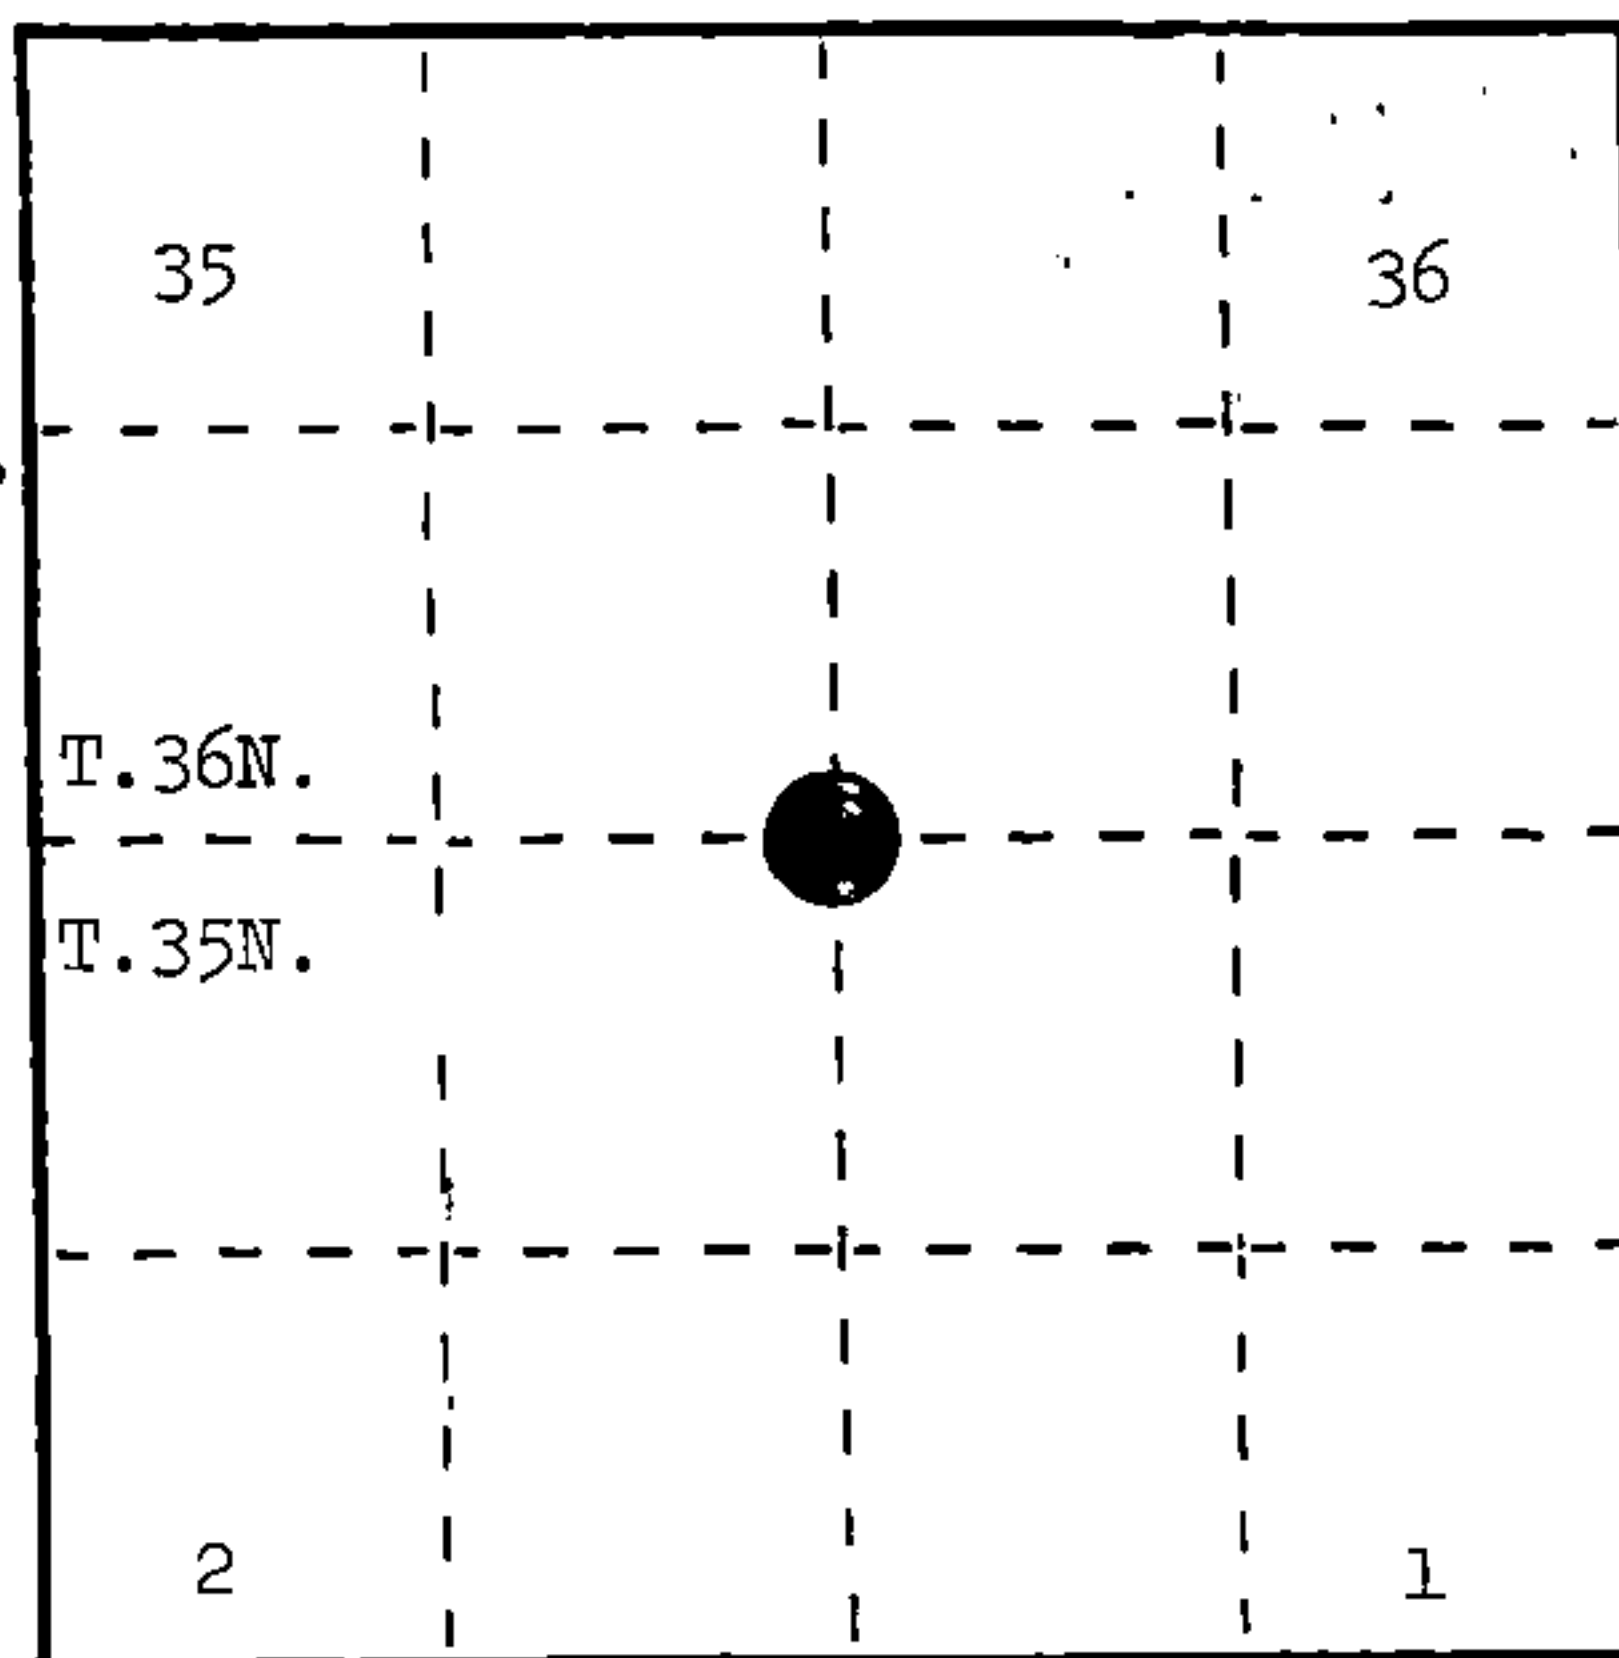

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post and made the following BTs: Hemlock, 10", N.76°W., 27 links; Hemlock, 16", N.53°E., 41 links; Yellow Birch, 16", S.61°E., 59 links; Yellow Birch, 6", S.34°W., 26 links.

In 1982, Milo Stefan found stump remains of three of the original bearing trees by survey of town line east and west and from distances of original line tree west. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Black Spruce, 4", N.16°E., 20.12 feet
3. Red Maple, 7", S.69°E., 37.25 feet
4. Black Spruce, 7", S.26°E., 31.89 feet
5. White Birch, 10", S.41°W., 9.86 feet
6. Steel Sign Post, West, 1.90 feet

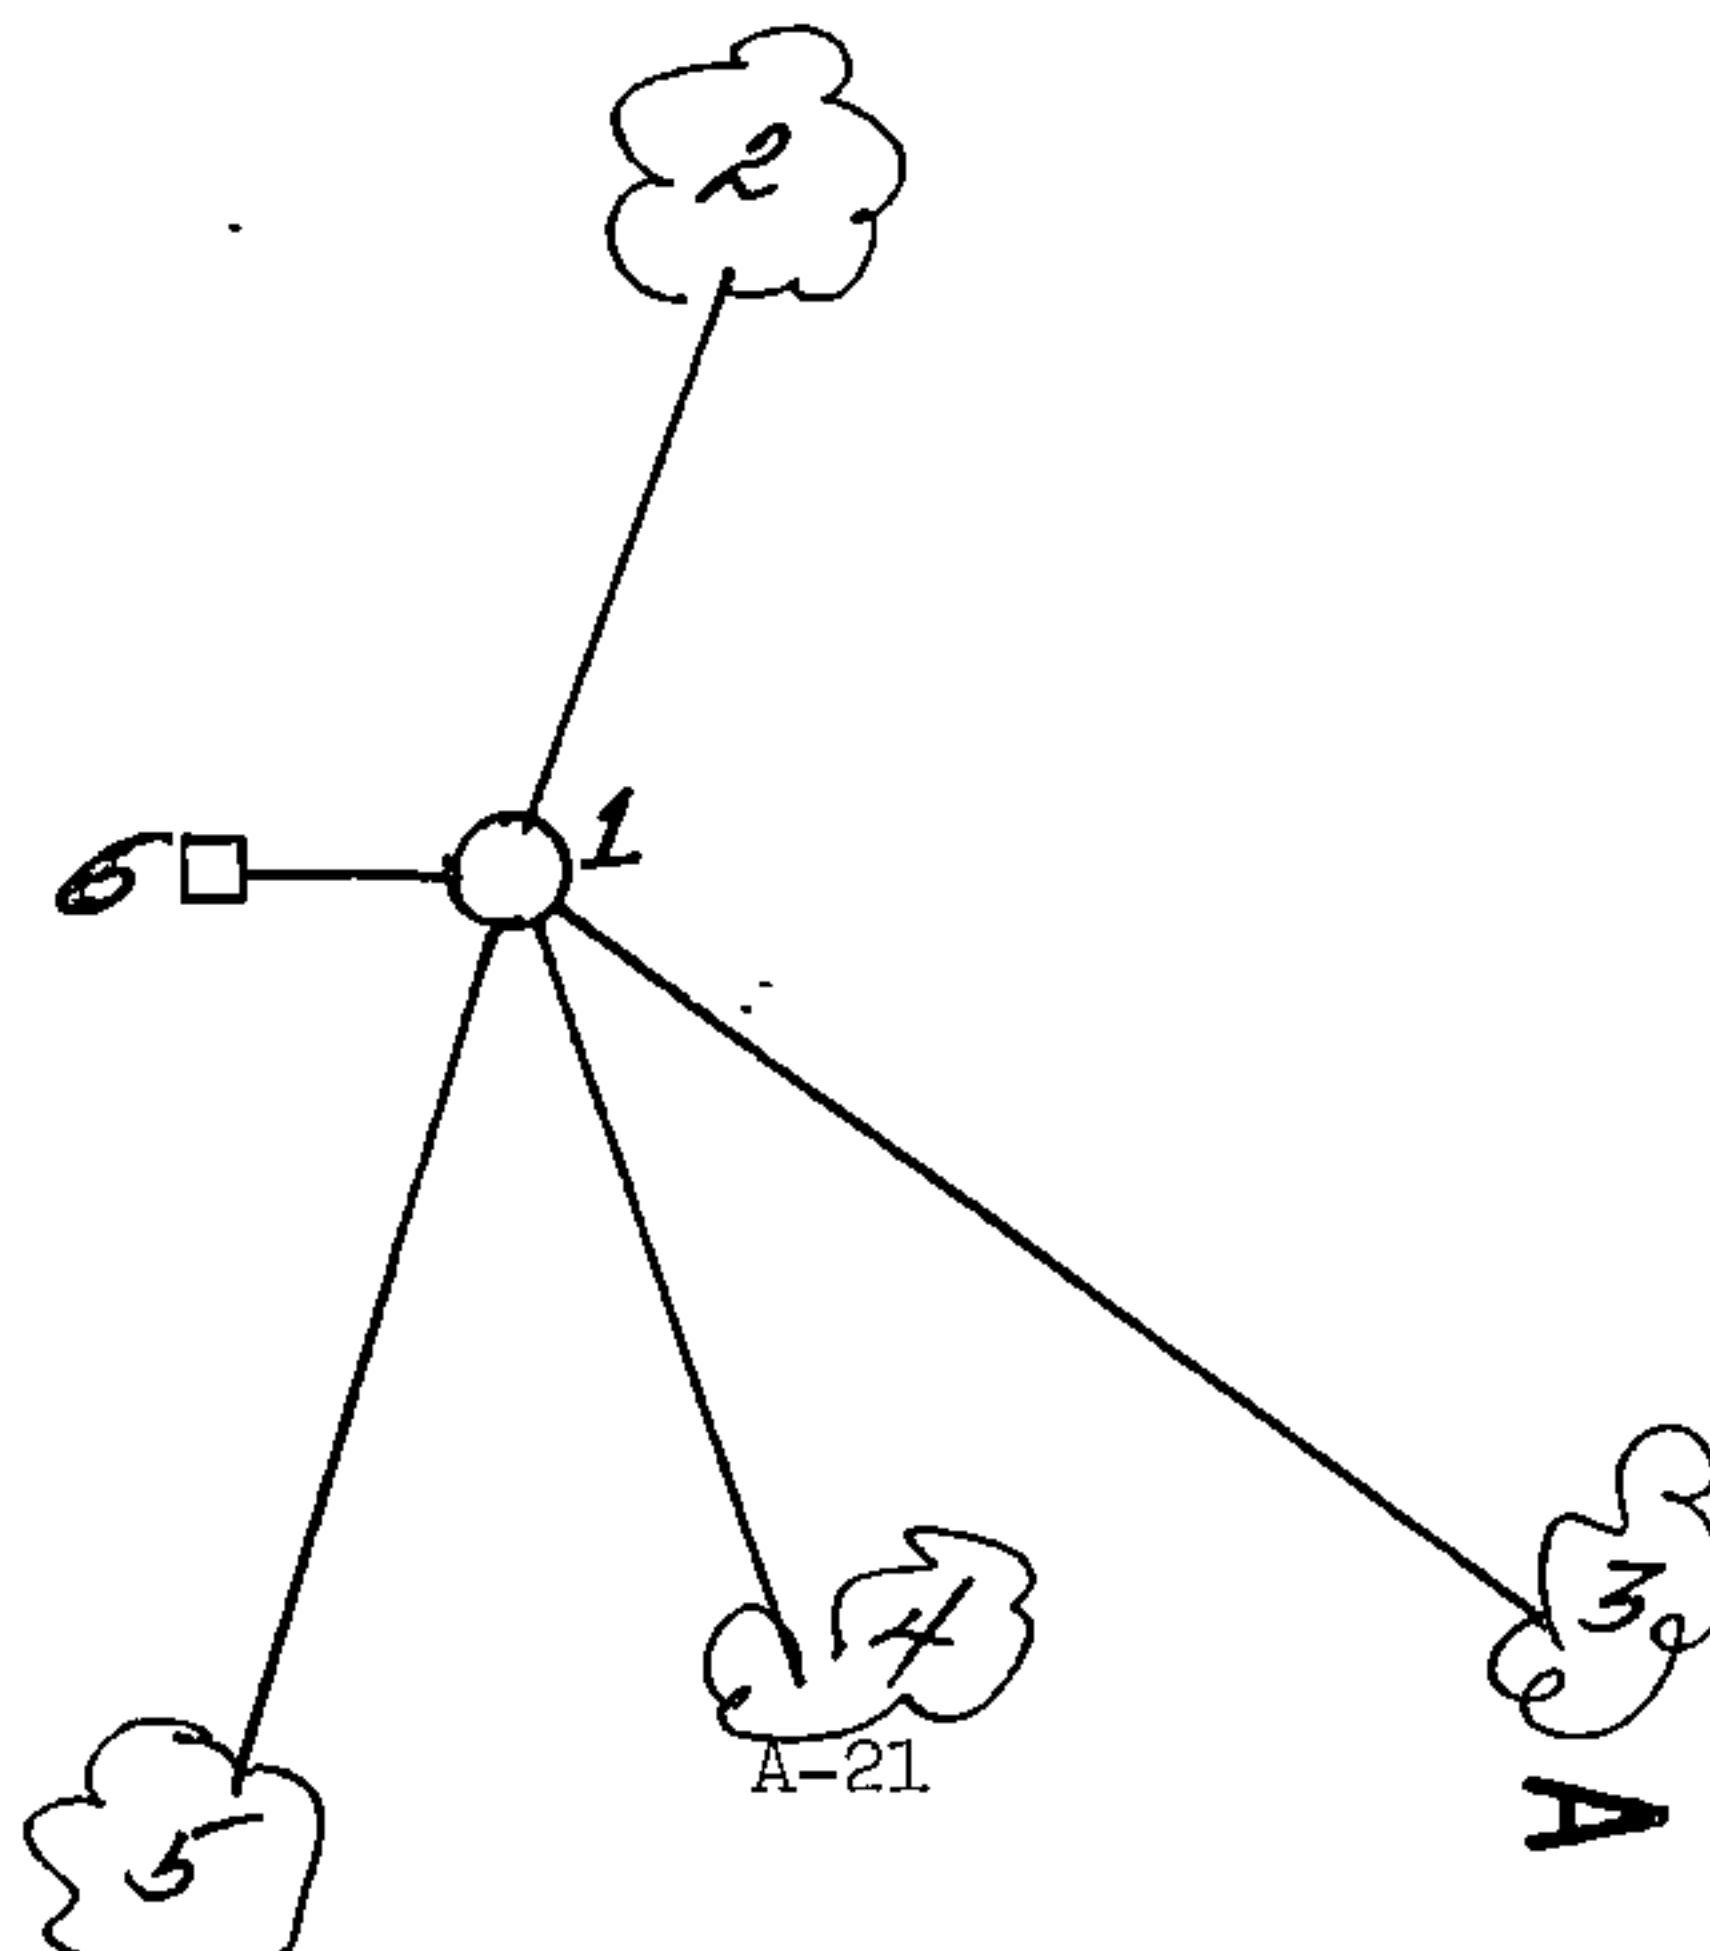

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Yes, plantation post with location poster, N.52°E., 113 feet.


- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal

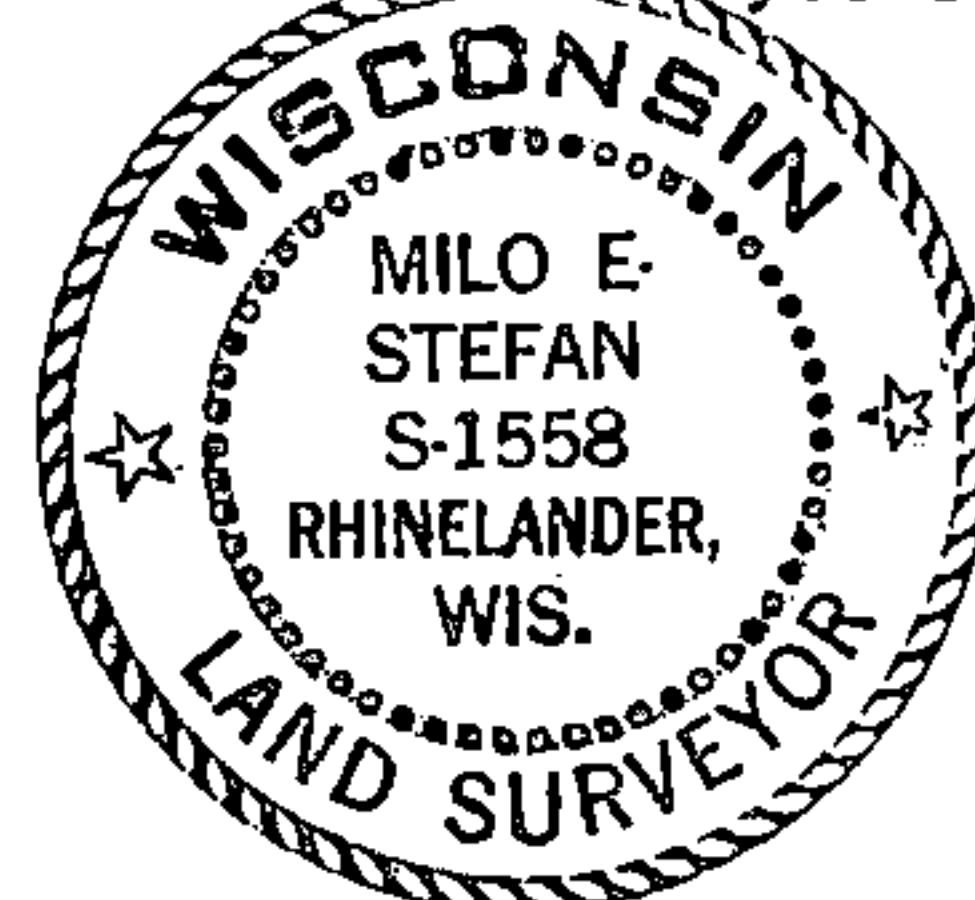

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date