

142942

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Corner Common to Sections 1, 2, 11 and 12,
 T36N-R16E

Index Number E-21 (T36N-R16E)

Forest County, Wisconsin

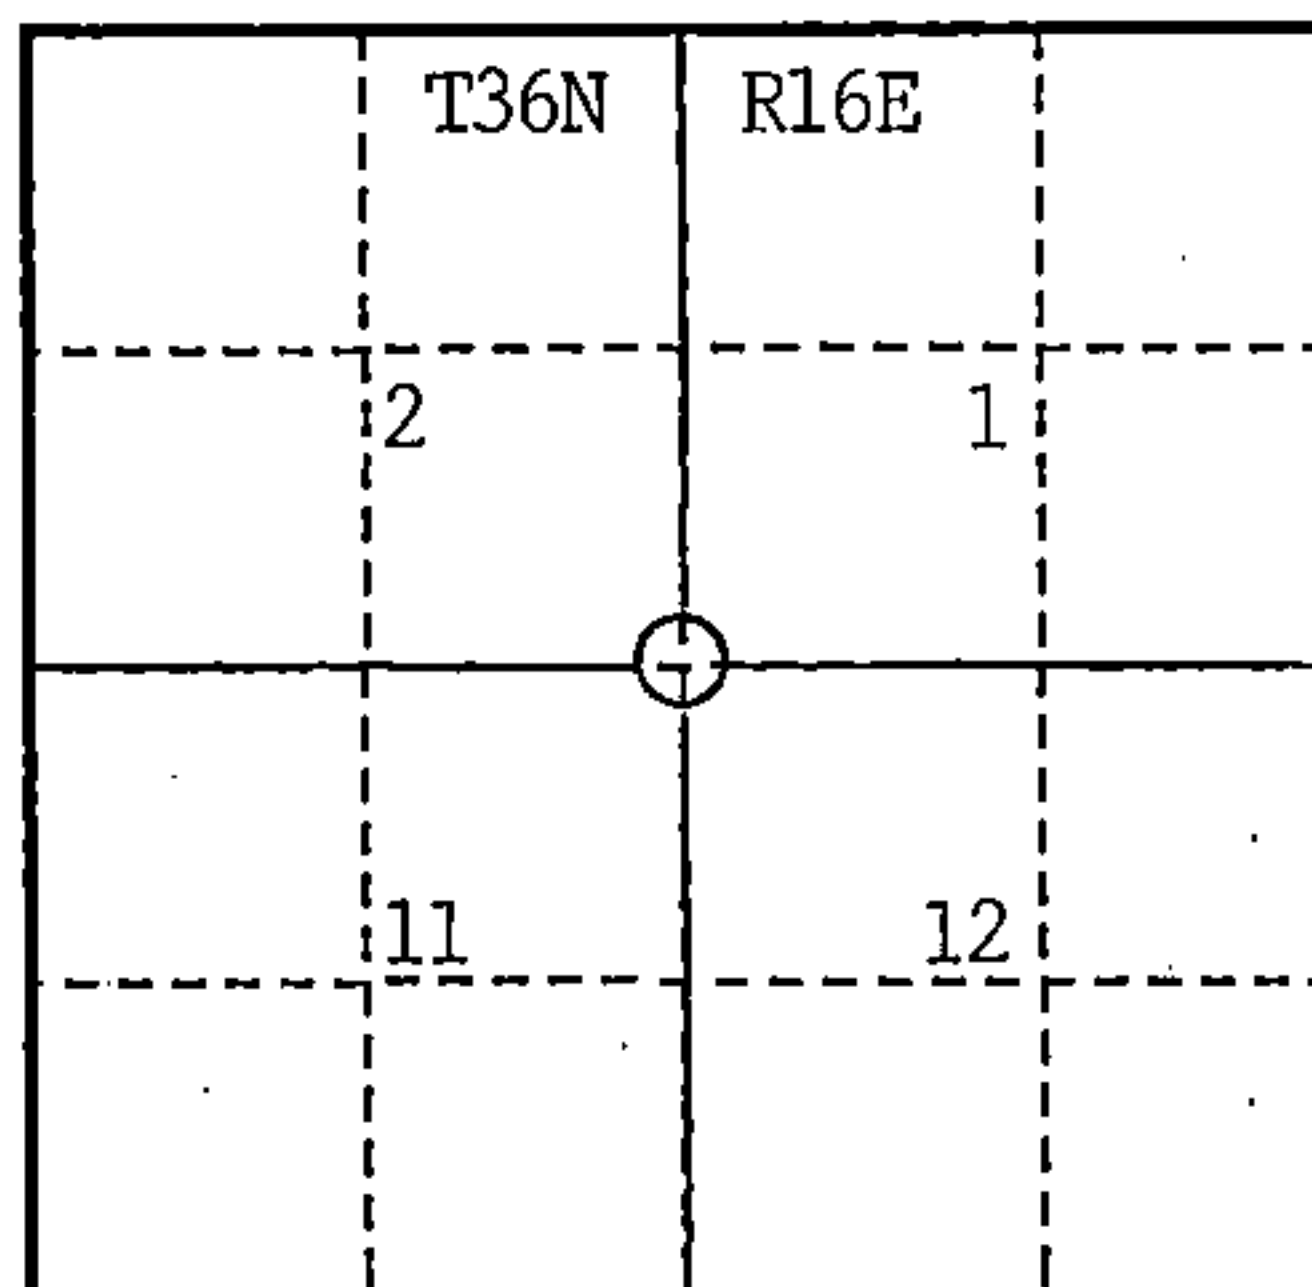

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - Original post set by James McBride, witnessed by 10 Sugar N42W 40 lks.;
 16 Sugar N71E 67 lks.; 20 Hemlock S15E 50 lks.; 20 W. Birch S55W 32 lks.


Found no record of prior corner recovery or restoration.

1991 - Coleman Engineering Company located corner search area from traverse survey between NW corner Sec. 1 and W $\frac{1}{4}$ corner Sec. 12, and SW corner Sec. 2 and S $\frac{1}{4}$ corner Sec. 1. Found 1" x 12" iron bolt with a 1 $\frac{1}{2}$ " square head buried 0.5' below grade in west track of north-south gravel trail road. Original corner monument and BTs likely were lost prior to, or during, trail road construction. No apparent evidence of lines or occupations was evident. Distances and directions to controlling corners in cardinal directions are in general agreement with original survey. Iron bolt was likely established during an earlier unrecorded survey. Position was accepted as the most probable location of the original corner and was restored with a standard monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 $\frac{1}{2}$ " x 36" Aluminum monument with position stamped on cap.
2. Sugar 6" N57°E 25.55 feet.
3. Sugar 9" S38°E 40.82 feet.
4. Sugar 12" S65°W 17.16 feet.
5. Sugar 8" N64°W 52.31 feet.
6. Steel sign post Northwest 11.52 feet.

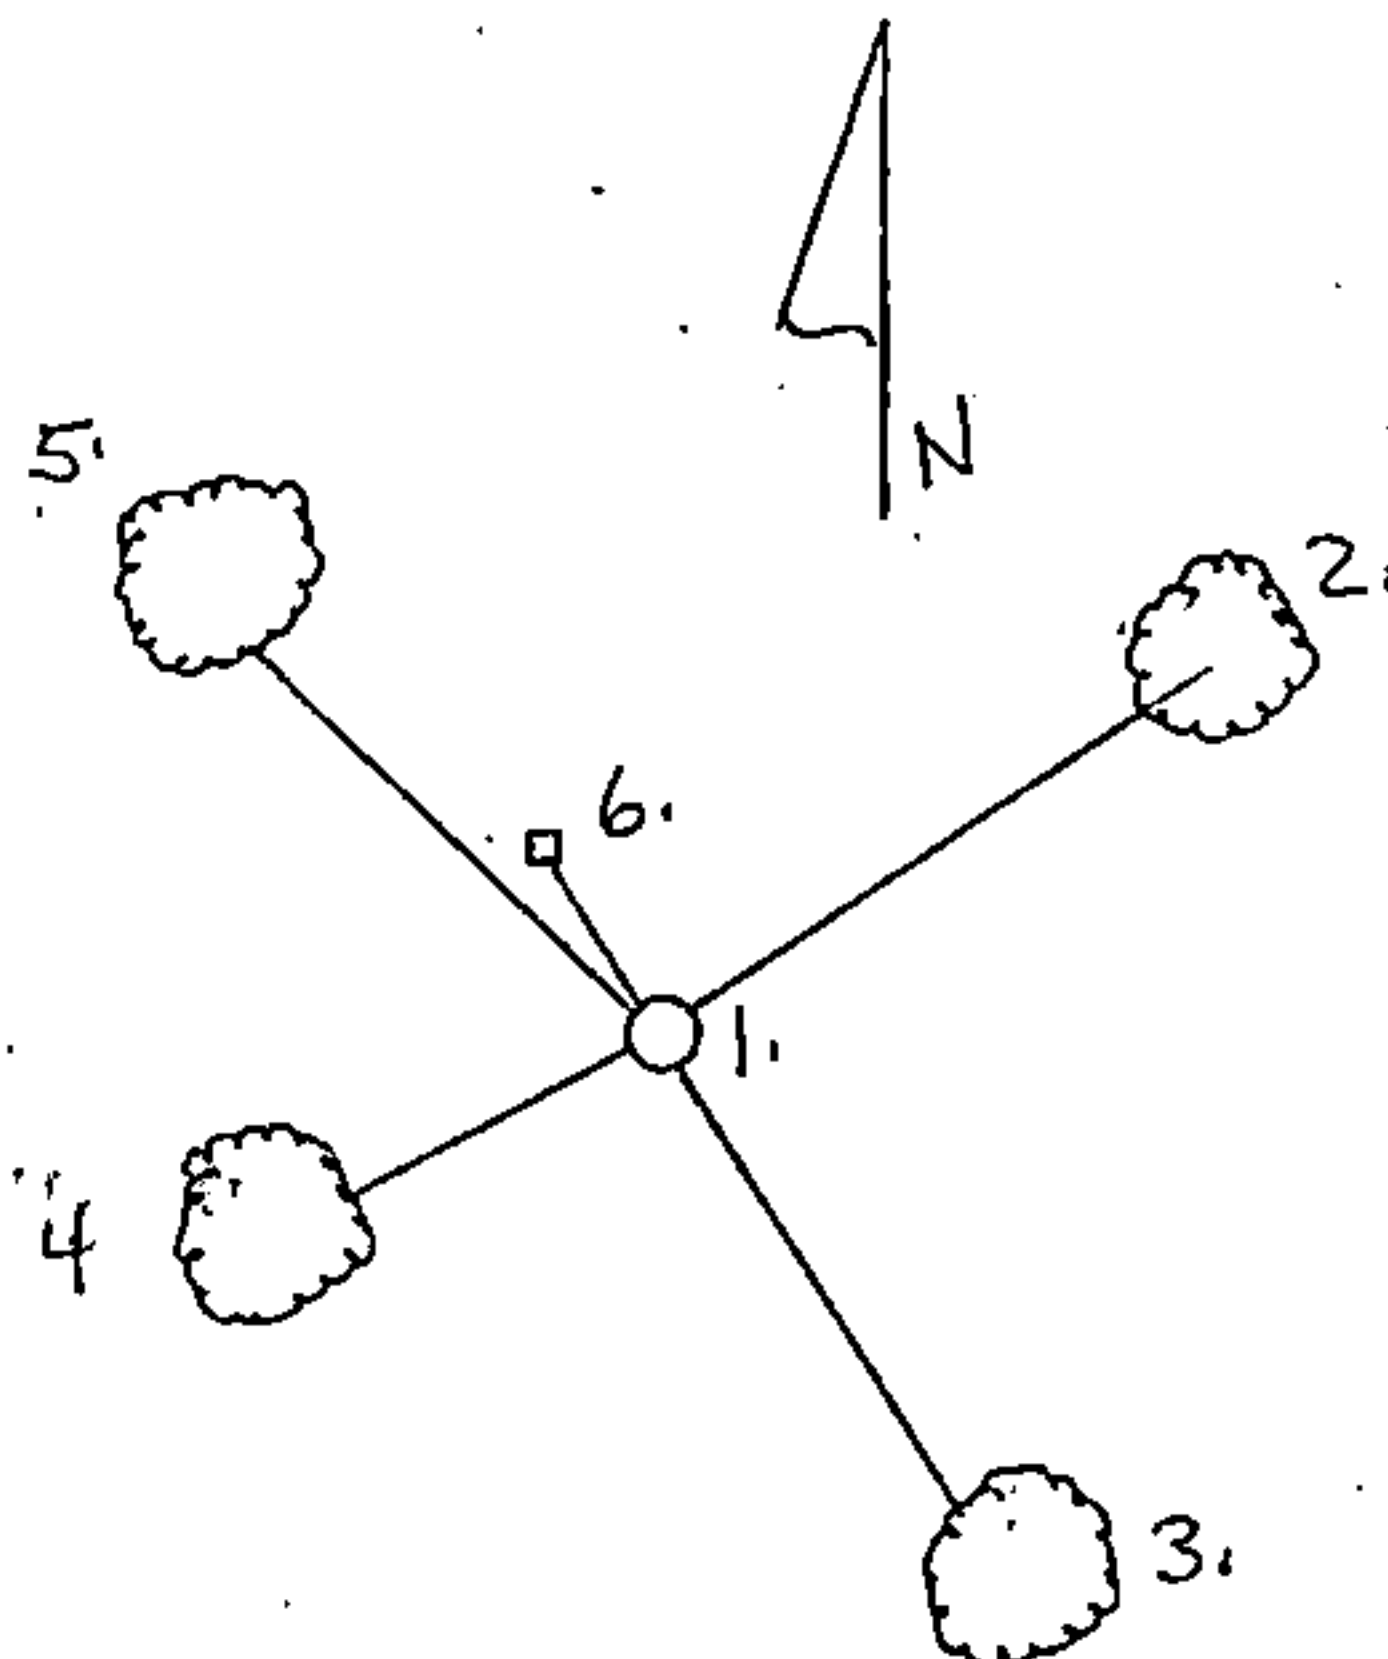

REGISTER'S OFFICE }
 Forest County, Wis.

Received for record this 8th day
 of October, A.D., 1991 at
2:00 o'clock P.M. and recorded
 in Corner Restorations
 page E-21

Paul H. Schreiner
 Register of Deeds

43616020000

E-21

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Accepted position of found monument as most probable true corner location.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) Found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Charles F. Clark, RLS 1767
COLEMAN ENGINEERING COMPANY

- (1) I, Charles F. Clark
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Charles F. Clark

Signature

August 22, 1991

Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards
Acting District Ranger

