

# U.S. PUBLIC LAND SURVEY MONUMENT RECORD

H-25  
Index No. ....

State of Wisconsin }  
County of FOREST } ss.

History of original corner establishment:

Not an original survey corner.

I, John Schulke, do hereby  
certify that on the 25th day  
of August, 19 89, I found  
evidence of the South Sixteenth  
corner of Sections 7 and 12  
Township 37, North, Range  
12 East Fourth Principal Meridian,  
as described hereon; and that from this evidence  
I established a new monument and accessories  
as described hereon to perpetuate the original  
location of this corner.

Description of corner evidence found:

In 1971, Jean Resvick established corner in subdivision survey of Section 7, T37N, R13E.

The following corner references: White Spruce 6" S19°E 29.0 ft.  
Black Ash 5" S38°W 15.4 ft.

Resident witnesses:


In 1989, John Schulke recovered 2" inside dia. galvanized iron pipe capped with a 3" dia.  
brass tablet and a 11" dia. Spruce S19°E a distance of 28.95 ft. from the  
monument. Found a wood post 2.5 ft. Northwest of the monument.

Description of monument and accessories I established to perpetuate the original location of this corner.

Blazed, scribed, tagged and painted the following corner references:

Red Maple 7" N05°W 17.28 ft.

DOCUMENT NUMBER  
139252

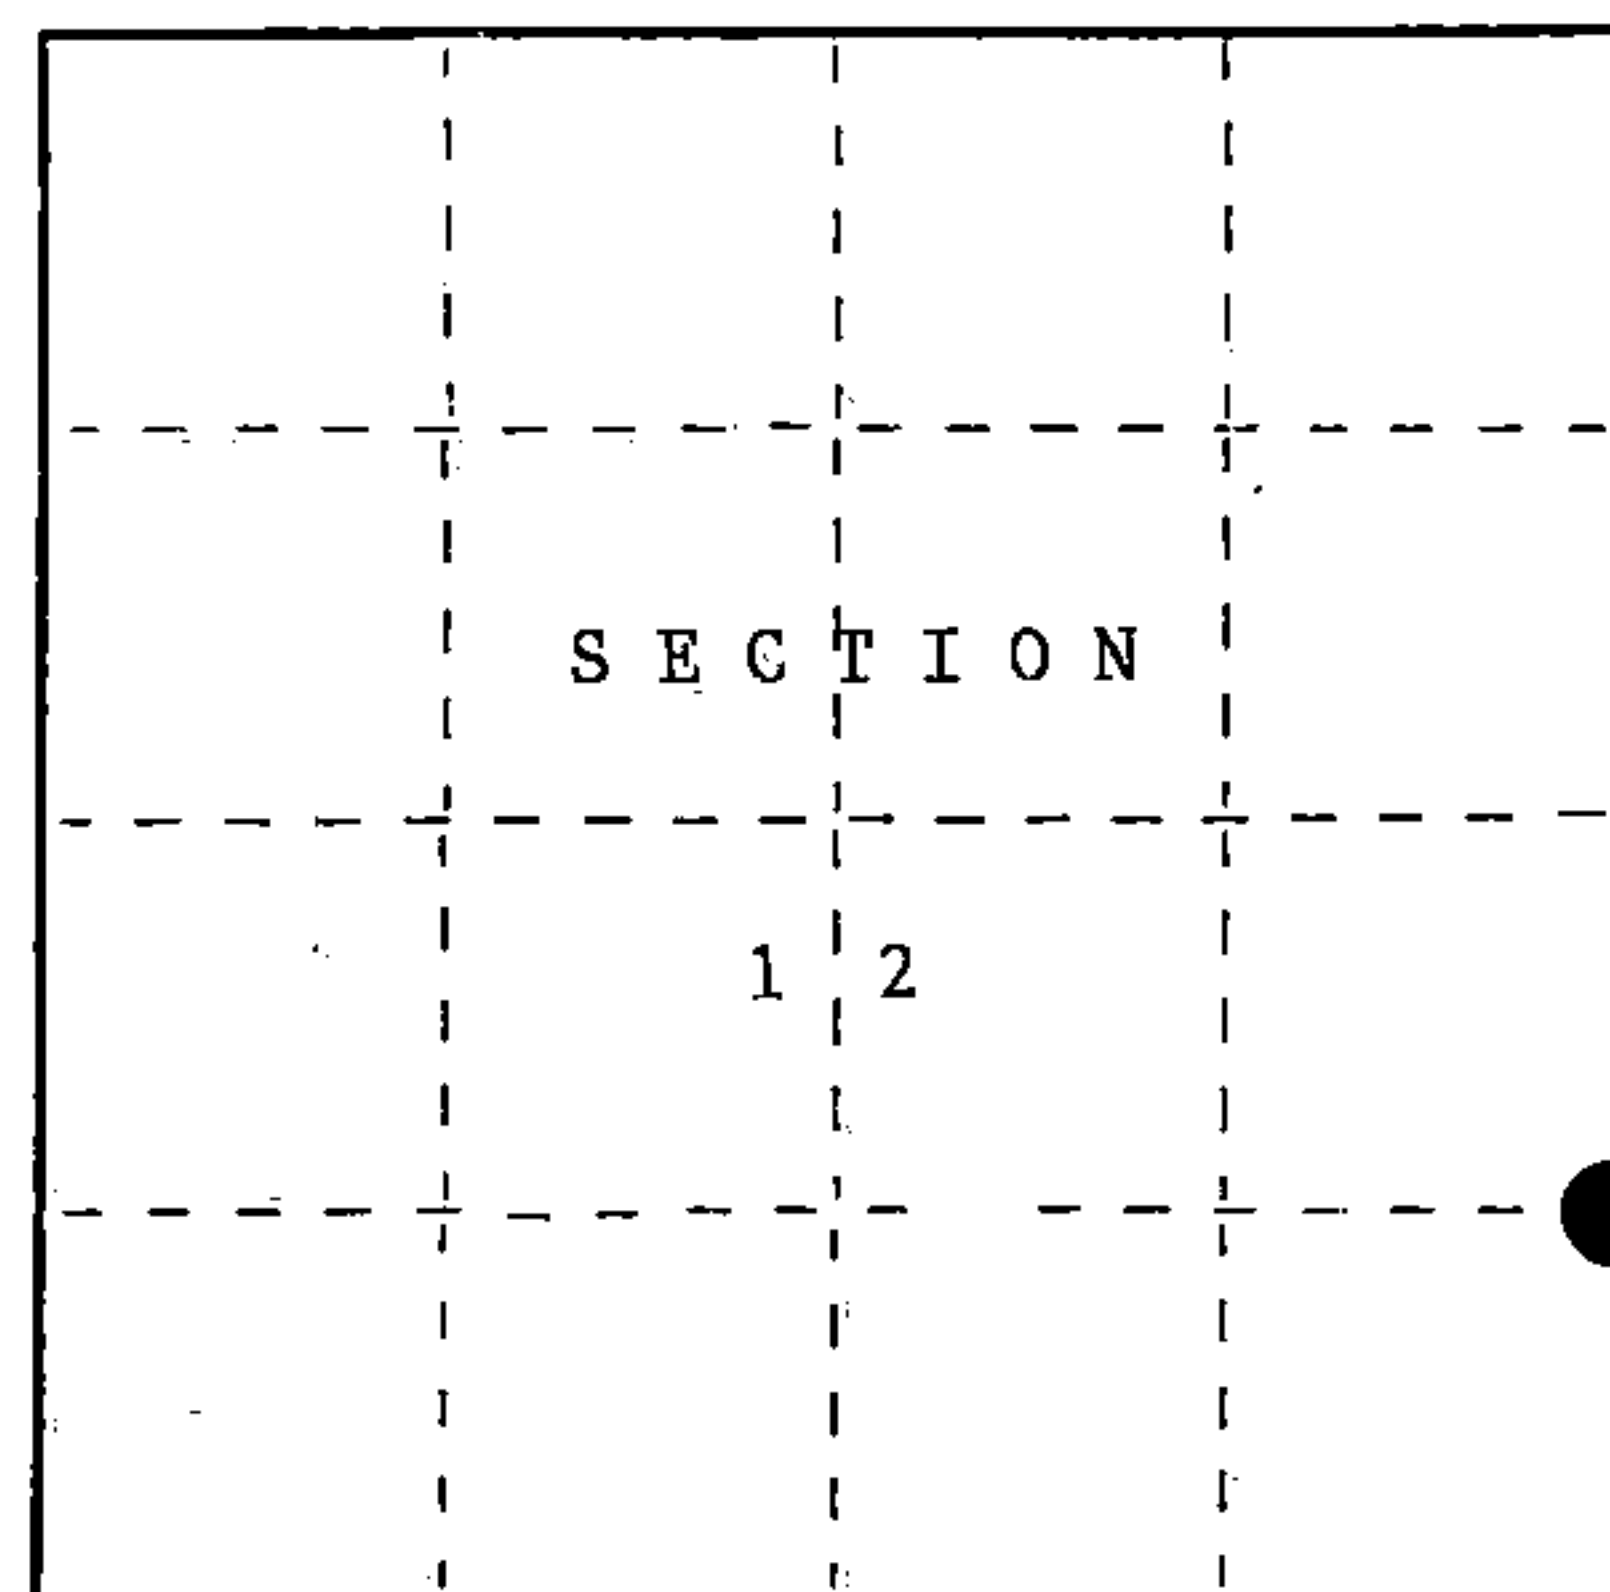

○ = Corner monument restored.

Dated at Ludington, MI, ~~XXXX~~, this 6th day of November, 1989

Signature John C Schulke Title Register Land Surveyor Registration No. S-1665  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within  
instrument was filed in this office for record on the 8th day of March, 19 90  
at 1:00 o'clock P. M.

Paul H. Schreiner  
(Register of Deeds)

By \_\_\_\_\_ Deputy

43712121000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Found original corner

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

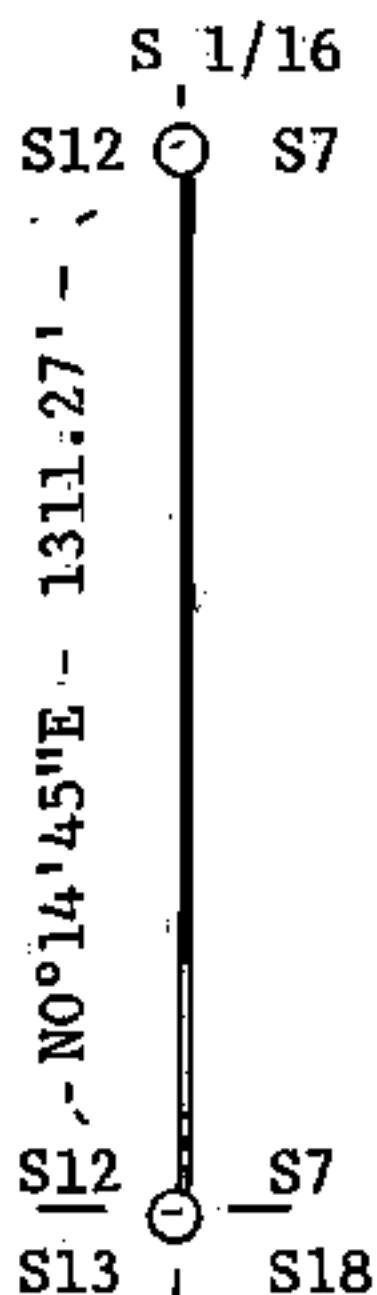

SIXTEENTH CORNER  
S12 | S7

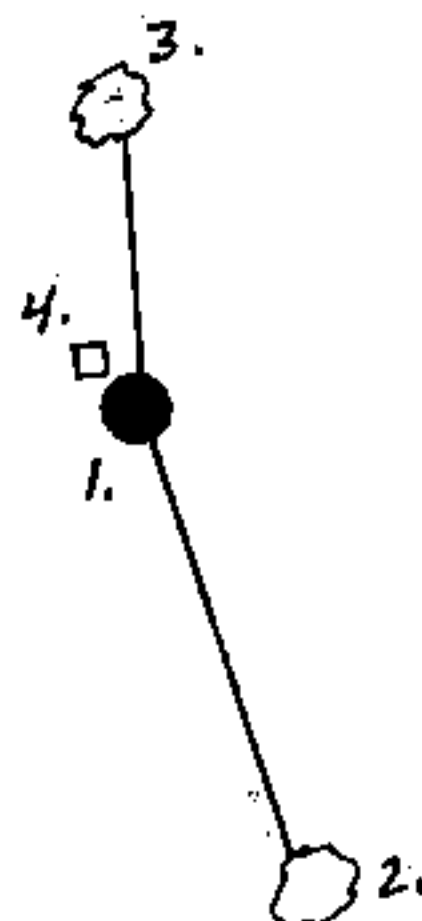

1. 2" dia. galvanized iron pipe capped with a 3" dia. brass tablet.
2. Spruce 11" S19°E 28.95 ft.
3. Red Maple 7" N05°W 17.28 ft.
4. Wood post Northwest 2.5 ft.

### LEGEND


— Boundary line marked to Forest Service standard.

NOTE: Bearings are referenced to solar observations.

John Schulke

(RLS-1665)

(i) I, John Schulke, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

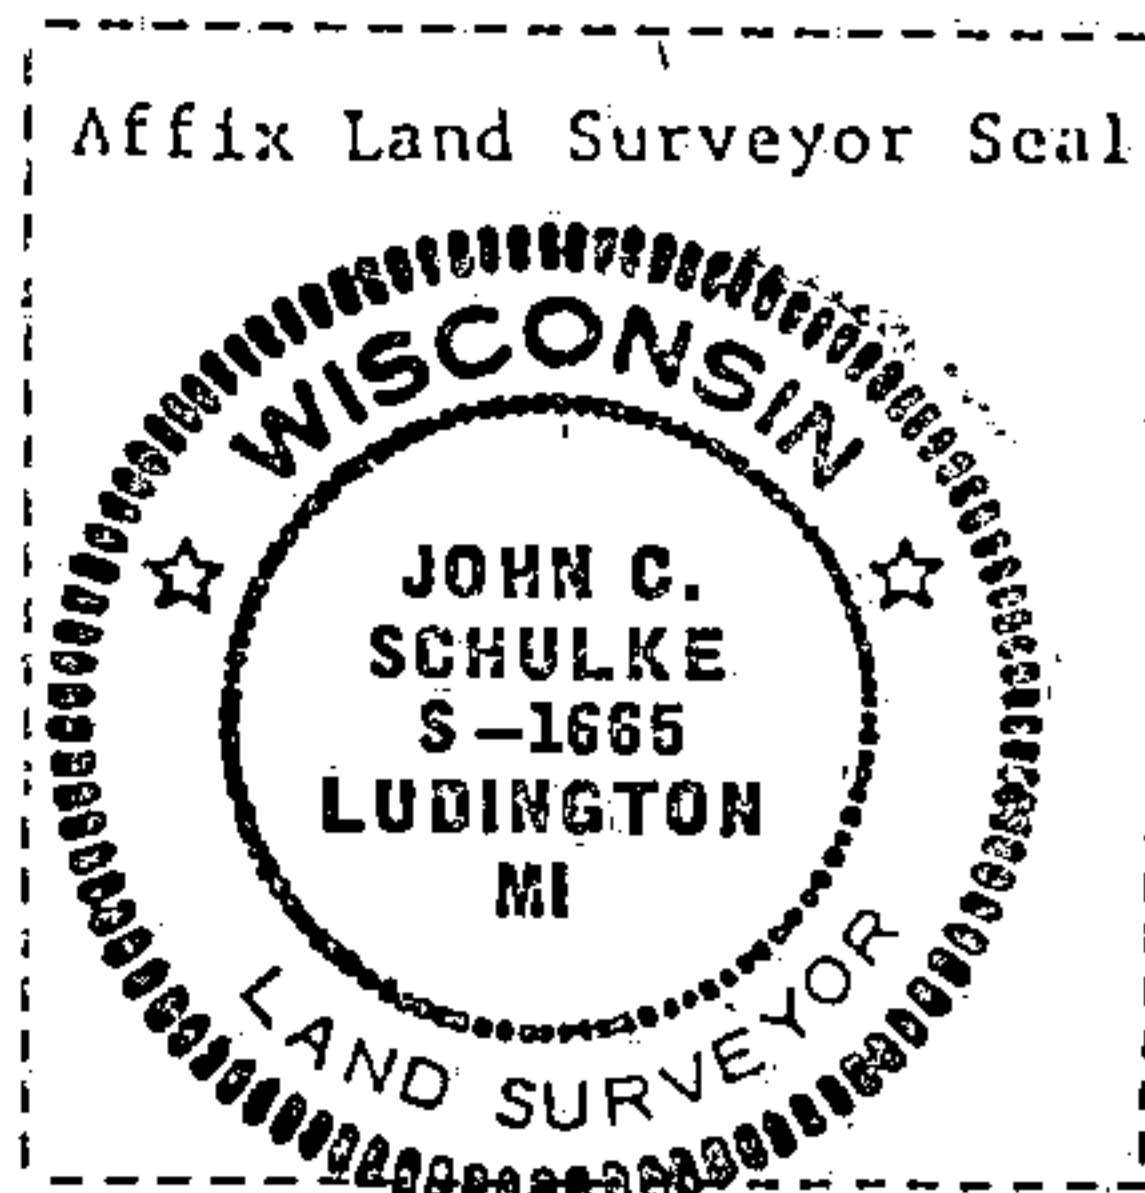

Signature John C. Schulke

Date Nov 6th, 1989

Survey requested by: Dale B. Stange

District Ranger

Date 1989

Stock No. 26273

H.C. Miller Company

FORM NO. 985-A