

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 5 day of June, 1975, I found evidence of the East One Sixteenth corner of Sections 14 and 23 Township 37 North Range 13 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Established in July, 1921 by J.R. Ritter
Cedar 6, N70E 22 Lks.
Cedar 6, N45W 5 LKS.

Description of corner evidence found:

Scribed Cedar post 0.5 ft. from fence corner
Fallen Cedar, scribed bears N70E 14.5 ft.
Cedar stump, bears N45W, 3.3 ft.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced scribed post with 2 inch inside diameter galvanized iron pipe, 3 feet long, filled with concrete, with brass cap stamped: T37N, R13E, S14, E1/16, S23, 1975, S-802
Blazed and scribed the following new bearing trees:
Cedar 8, N58E, 22.77 ft.
Cedar 8, S59E, 36.22 ft.
Set steel sign post 0.5 ft. north of monument.

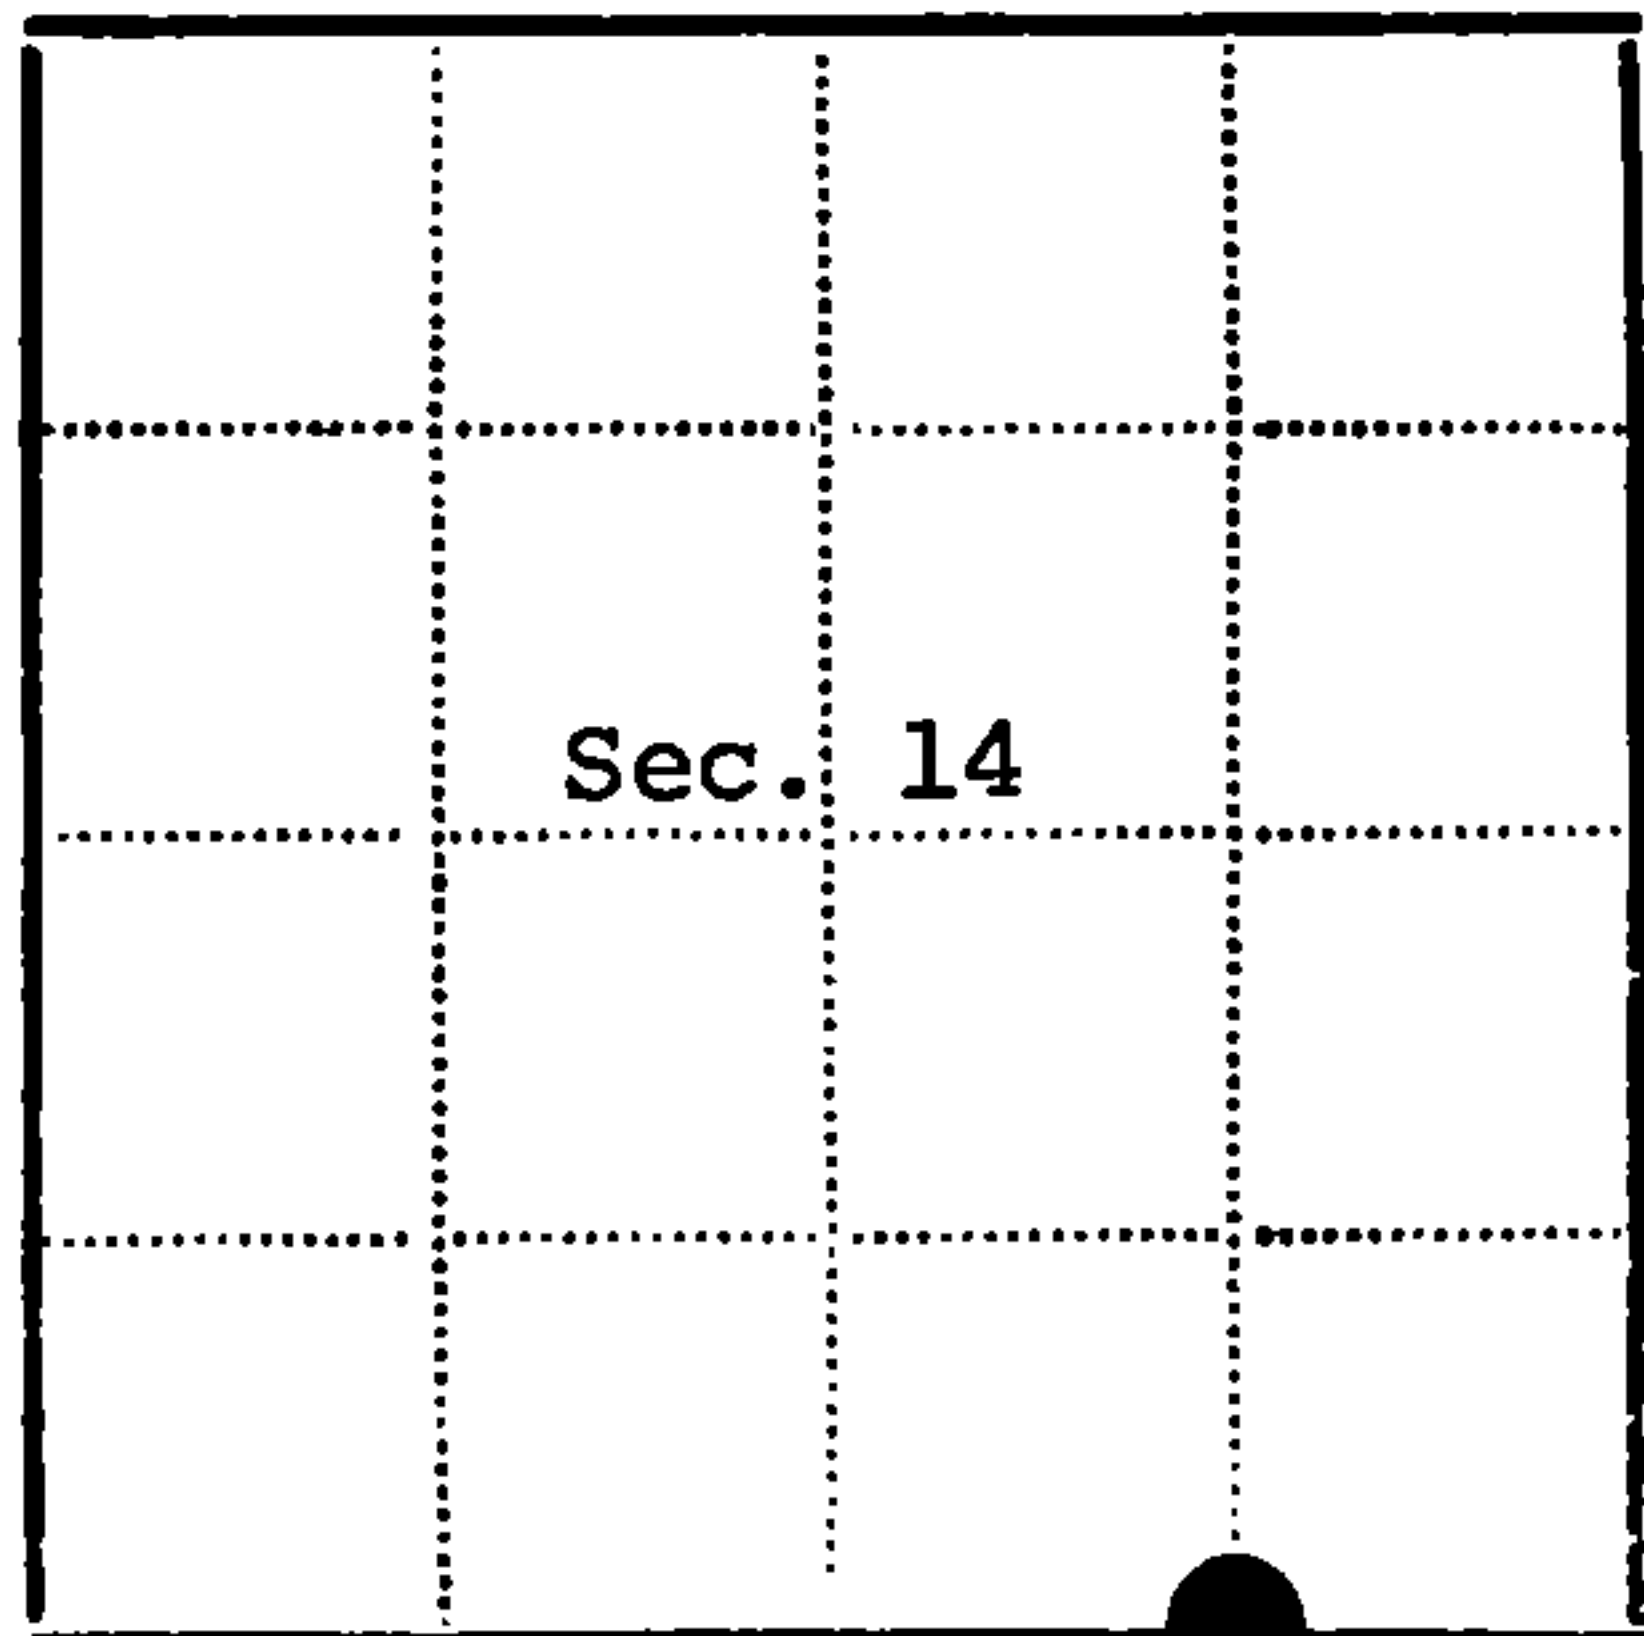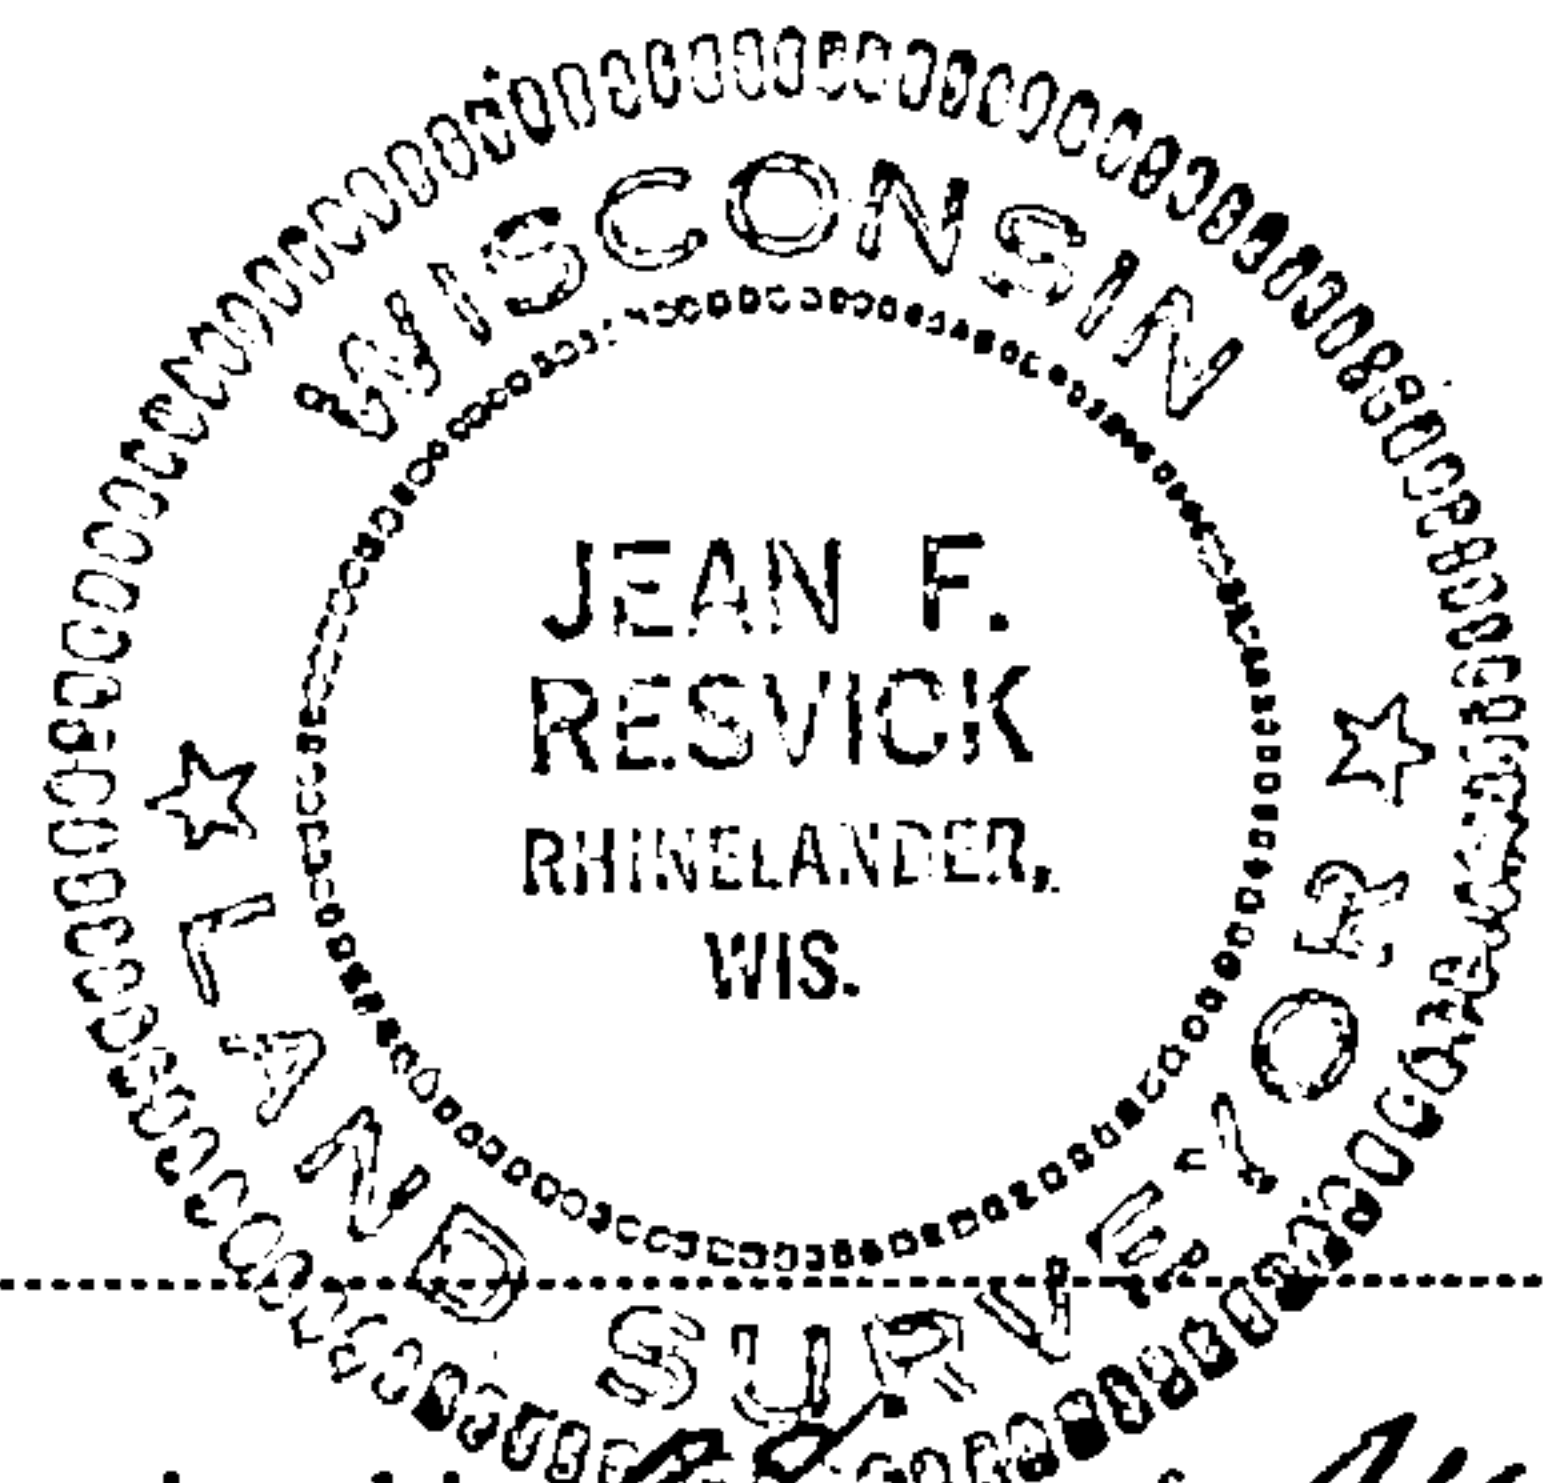

● - Corner monument restored
□ -

Resident witnesses

Dated at Rhinelander Wisconsin, this 22 day of Aug 1975.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 108564

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 14th day of January 1976, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzmy Title Register of Deeds

Township 37N Range 13E Section 14 Index No. N-20 Page No.

43713140010

220