

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through 1).

(a) Identify the corner by reference to the U.S. public land survey system.

On Corner monument restored.

O - Corner monument restored.

Section corner to Sections 12 and 13, T.37N., R.14E., and Sections 7 and 18, T.37N., R.15E., Forest County, Wisconsin.

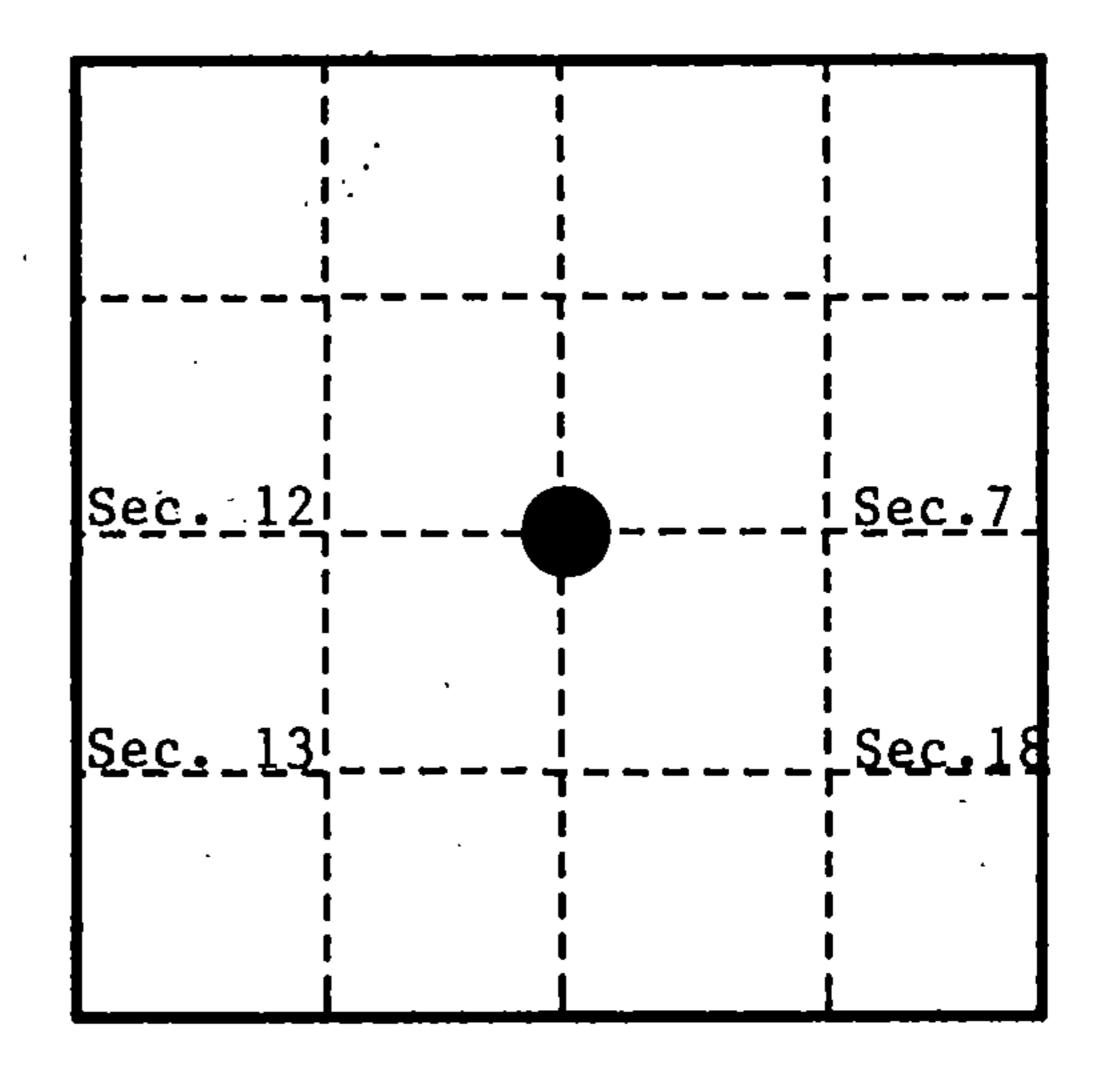

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, Artemas Curtis set a wood post with following BT's: Hemlock, 6", S.55°W, 44 links (29.04 feet); Hemlock, 10", N.64°W., 30 links (19.80 feet); Sugar, 7", N.18°E., 22 links (14.52 feet); Maple, 15", S.65°E., 1 link (0.66 feet).

In 1934, Hemmings found Hemlock stake in place with a metal poster on it.

In 1979, P. Hansen found no evidence of the corner set by single proportionate measure, $2\frac{1}{2}$ " x 36" aluminum monument stamped to identify corner with the following BT's: White Spruce, 6", N.71°E., 30.10 feet; Maple, 5", S.8°W, 38.90 feet, $1\frac{1}{2}$ " x 5' iron pipe 25 feet north for witness pipe, 18" above the ground.

In 1991, Alan D. Harrison found corner as per Hansen. Found Maple dead. Added new reference.

- (c) in the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron orother equally durable material.)
- (d) Show a plan view drawing depicting the relevent monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 1) 2½" x 36" aluminum monument stamped to identify corner
- 2) Spruce, 6", N.71 E., 30.10 feet
- 3) Balsam, 9", N.35°E., 61.75 feet
- 4) Balsam, 6", S.21 E., 56.68 feet
- 5) Balsam, 8", S.60°E., 56.60 feet
- 6) Steel sign post, South 1.43 feet

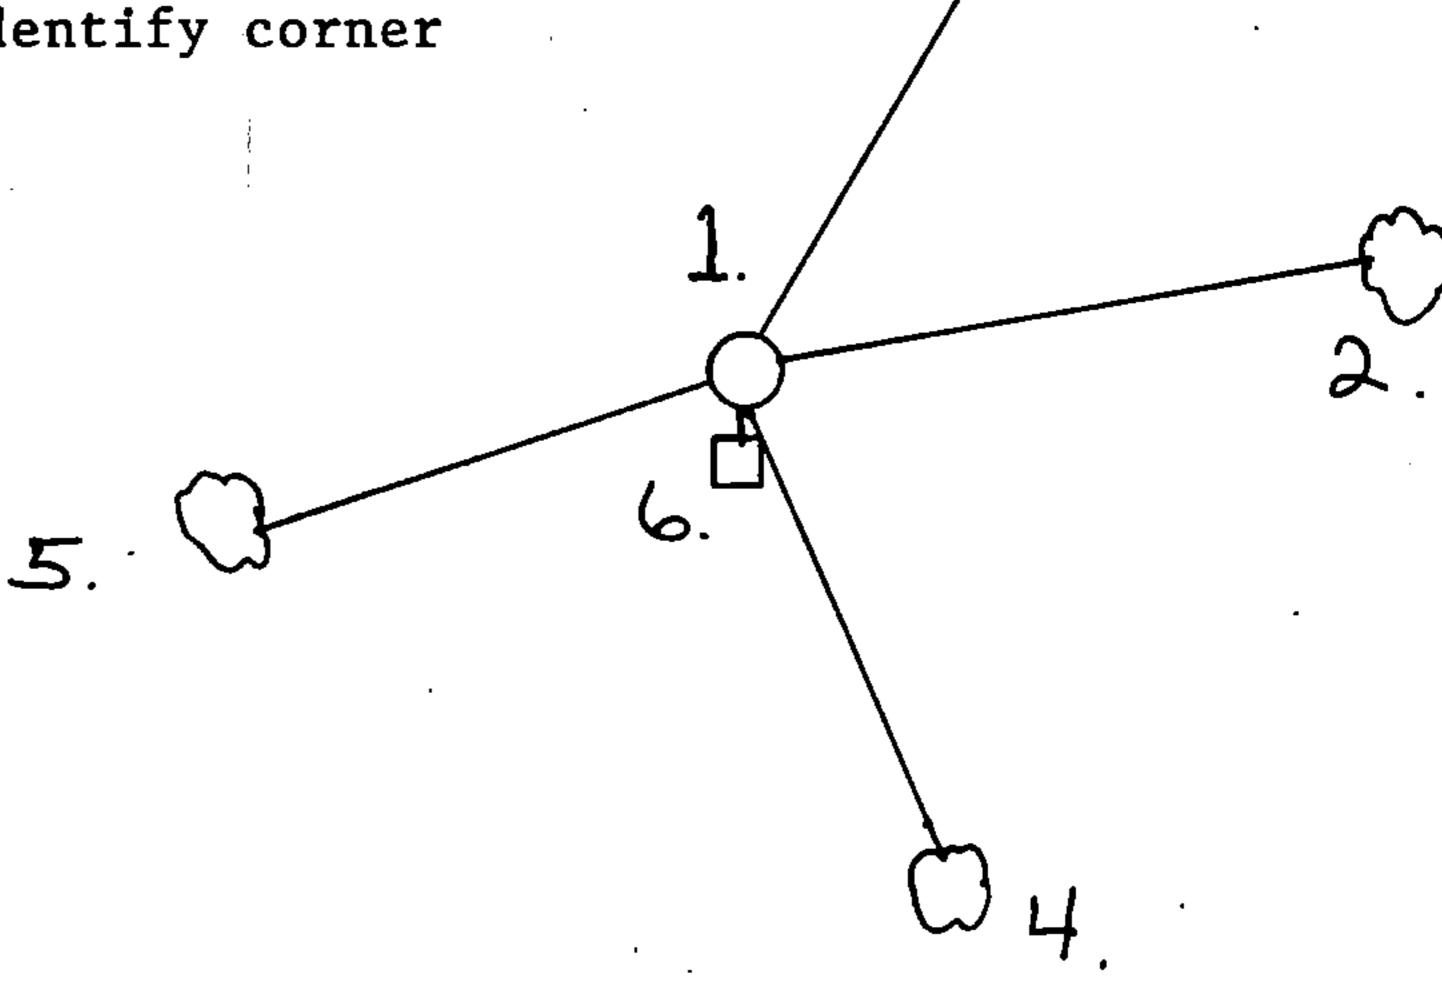

Book 3, Page 28

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (i) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location 7
 - 2) a found perpetuated location
- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) i, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Affix Land Surveyor Seal

CONS

ALAN D.

HARRISON

S-1651

WABENO

WIS.

O SURVEYOR

SURVEYOR

SOLUTION

SURVEYOR

SOLUTION

SURVEYOR

SURVEYOR

SURVEYOR

SURVEYOR

SOLUTION

SURVEYOR

SOLUTION

SURVEYOR

SOLUTION

SURVEYOR

SOLUTION

SOLUTIO

SOLUTION

SOLUTION

SOLUTION

SOLUTION

SOLUTION

SOLUTION

SO

Signature Describer

14/92

Date

CERTIFICATE READY FOR FILING:

District Ranger

O = Corner monument restored.

State of Wisconsin

County of Forest

I...Philip T. Hansen , do hereby

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original corner established by A. Curtis, Deputy Surveyor, in 1858. No records of any subsequent survey.

Description of corner evidence found:

No evidence of any corner recovered.

Corner established by single proportion from traverse and computation from section corner 13, 18, 19 and 24 to section corner 1, 6, 7 and 12. Computed distance 10485.336 feet at bearing N 0 11 31 W. Set section corner 7, 12, 13 and 18 at 5242.068 feet intermediate, as proportioned to the original distance.

Description of monument and accessories I established to perpetuate the original location of this corner. Set a 2-1/2" Berntsen A-1 Federal Monument (Forest County) projecting 18" above ground. Cap stamped:

Marked NBT's -White Spruce 6" N71°E 30.10 feet Maple 5" S8°W 38.90 feet, scribed BT. Set a 1-1/2" x 5' iron pipe 25' north for witness pipe, 18" above ground.

R14E T37N R15E **S498 - 1979**

Dated at Rh	inelander	., Wis., this 27	th day	of July	, 19 7 9
Signature.		-	-		sistration NoS=498
Office of Register instrument was f	of Deeds, County of	ord on the	t 13th	day of Novembe	certify that the within
at 8:30 o'clock	k M.				•
((Register of Deed)	5	,	DOCUMENT	No. 117081