


## U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.  
 O = Corner monument restored.

Quarter Corner Common to Sections 1 and 6,  
 Township 37 North, Range 15 and 16 East,  
 Forest County, State of Wisconsin.

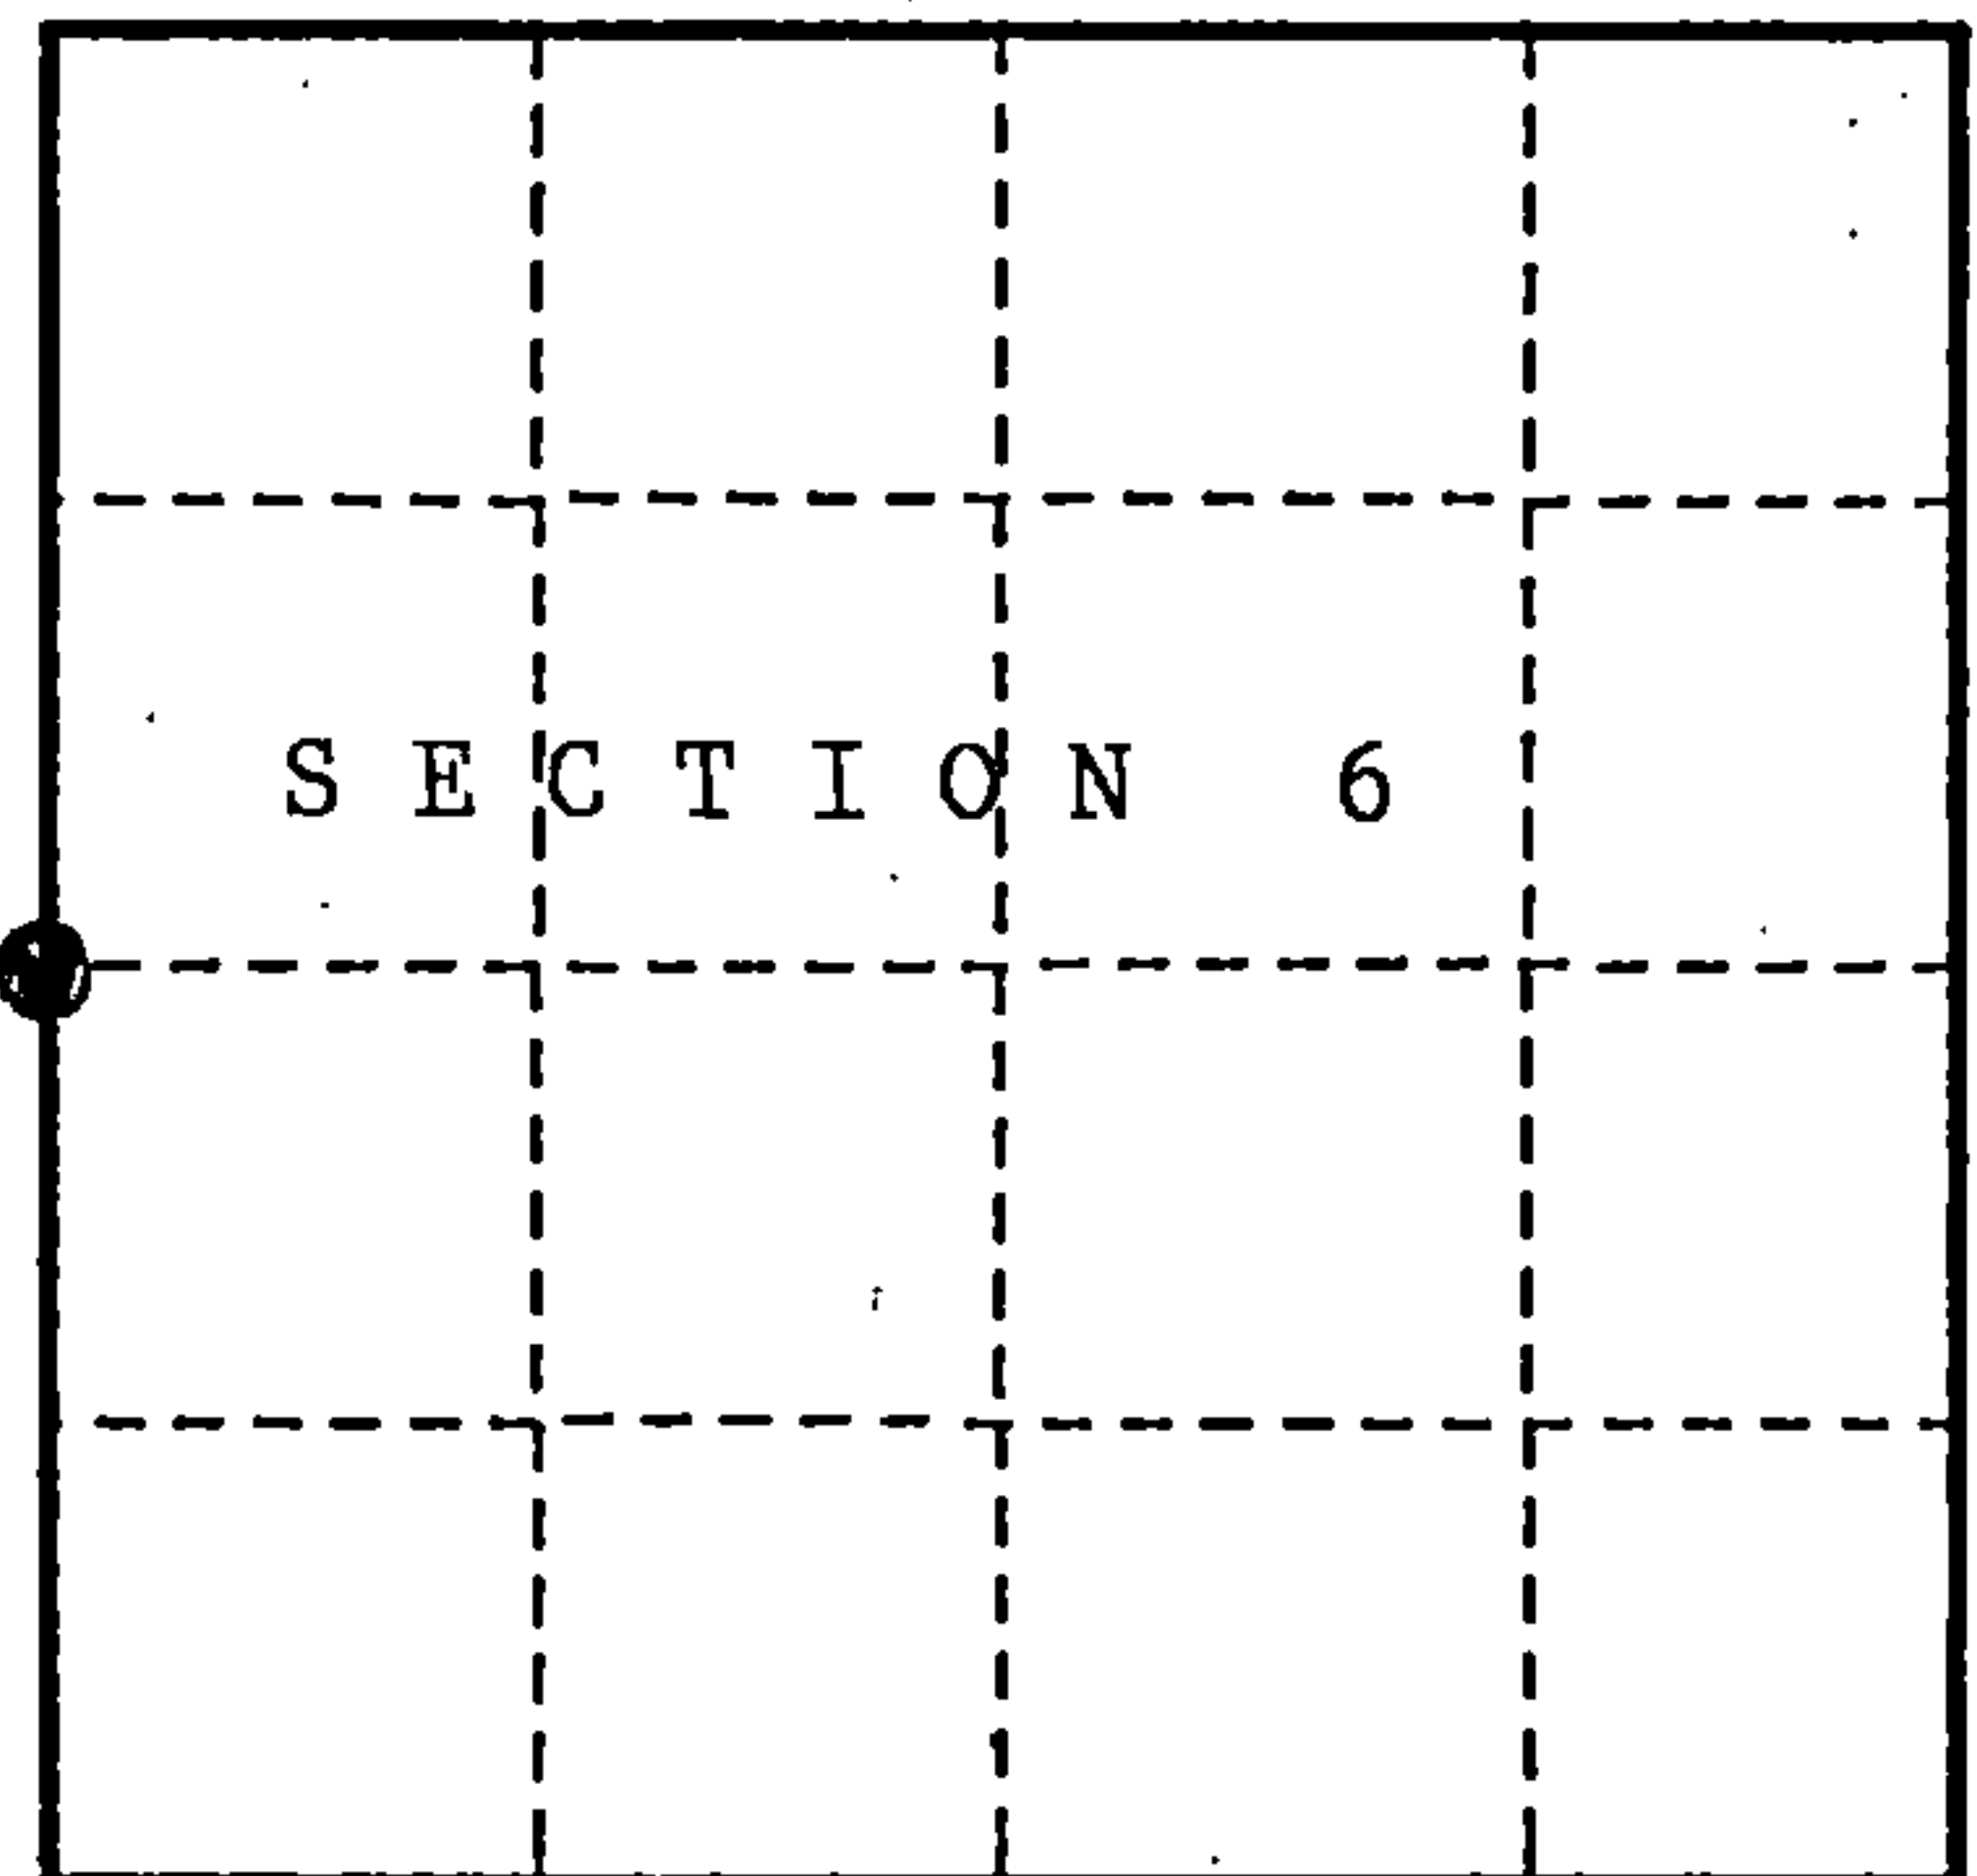

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post at the corner with the following bearing trees:  
 Hemlock 16" S87°W 49 lks. Yellow Birch 8" East 2 lks.

In 1973, Jean Resvick recovered scribed cedar post and recovered the following bearing trees: Birch stump East 8 lks. Hemlock remains S87°W 49 lks.

The swamp calls to the North and South fits GLO notes.

Replaced wood post with a 2" dia. galvanized iron pipe, filled with concrete with a brass cap stamped to identify the corner. The following corner references:

Maple 7" S23°E 32.34 ft. Y Birch 6" N86°W 47.35 ft.  
 Steel post SW 1.0 ft.

In 1982, Kim Pritzlaff recovered monument in place and the 1973 corner references described on the Certified Land Corner Restoration form filed in the Forest County Register of Deed's Office, Document #104442.

In 1990, John Schulke recovered monument in place and the following corner references:

Triple Red Maple 8" S21°E 32.24 ft.  
 Y. Birch 8" N87°W 47.37 ft.  
 Steel sign post SW 1.0 ft.

The following new corner reference:

Sugar Maple 6" S25°W 31.97 ft.


- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" dia. galvanized iron pipe with a brass cap stamped to identify the corner.
- Triple Red Maple 8" S21°E 32.24 ft.
- Y. Birch 8" N87°W 47.37 ft.
- Sugar Maple 6" S25°W 31.97 ft.
- Steel sign post SW 1.0 ft.

T37N, R15E

T37N, R16E

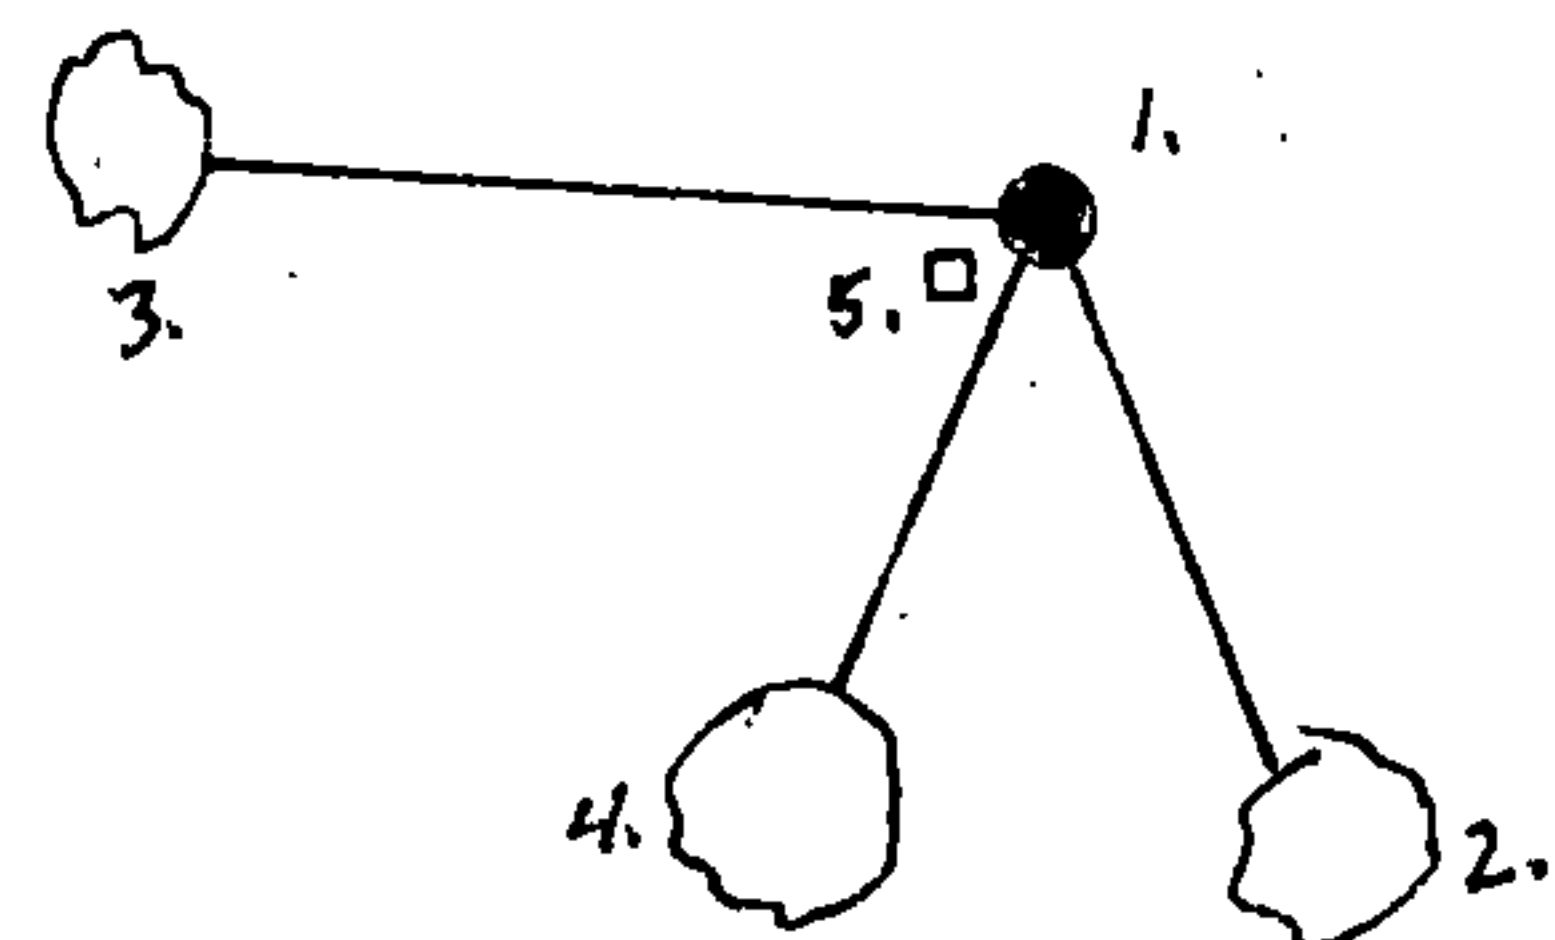

REGISTER'S OFFICE  
 Forest County, Wis.

Received for record this 19th day  
 of December, A.D., 1990 at

8:45 o'clock A.M. and recorded  
 in Vol. Corner Restorations

page 2

Paul Achenbrenner  
 Register of Deeds

100 1001

43715012000

G-1 37-16

2-1

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) found perpetuated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, John Schulke a Register Land Surveyor

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

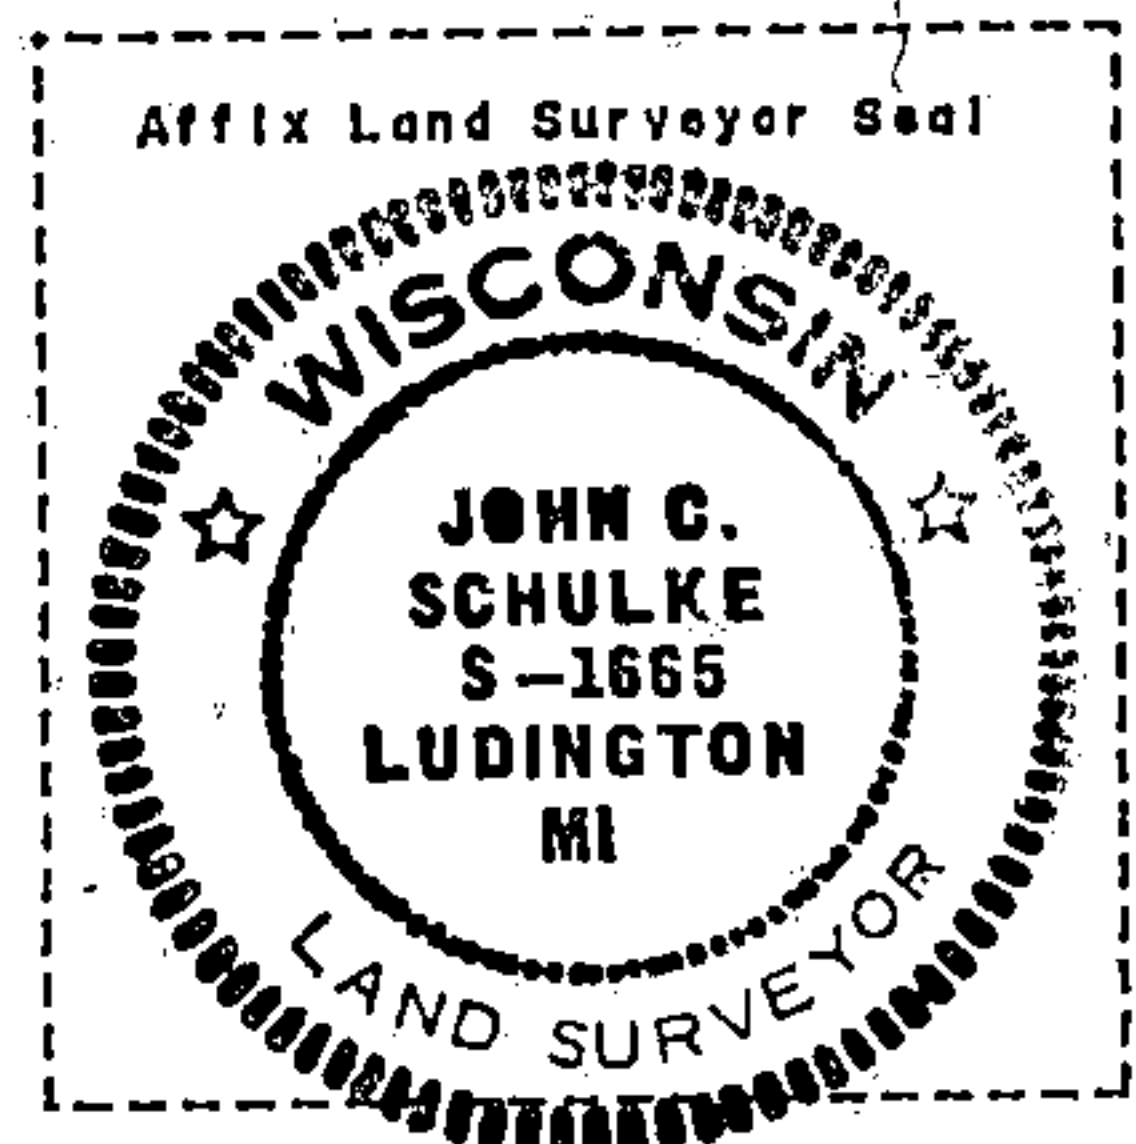

John C. Schulke  
Signature

9/21/90  
Date

CERTIFICATE READY FOR FILING:

Dale B. Staeger  
District Ranger


# U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.  
 O = Corner monument restored.

Quarter Corner Common to Sections 1 and 6  
 T37N, R15-16E, Forest County, Wisconsin

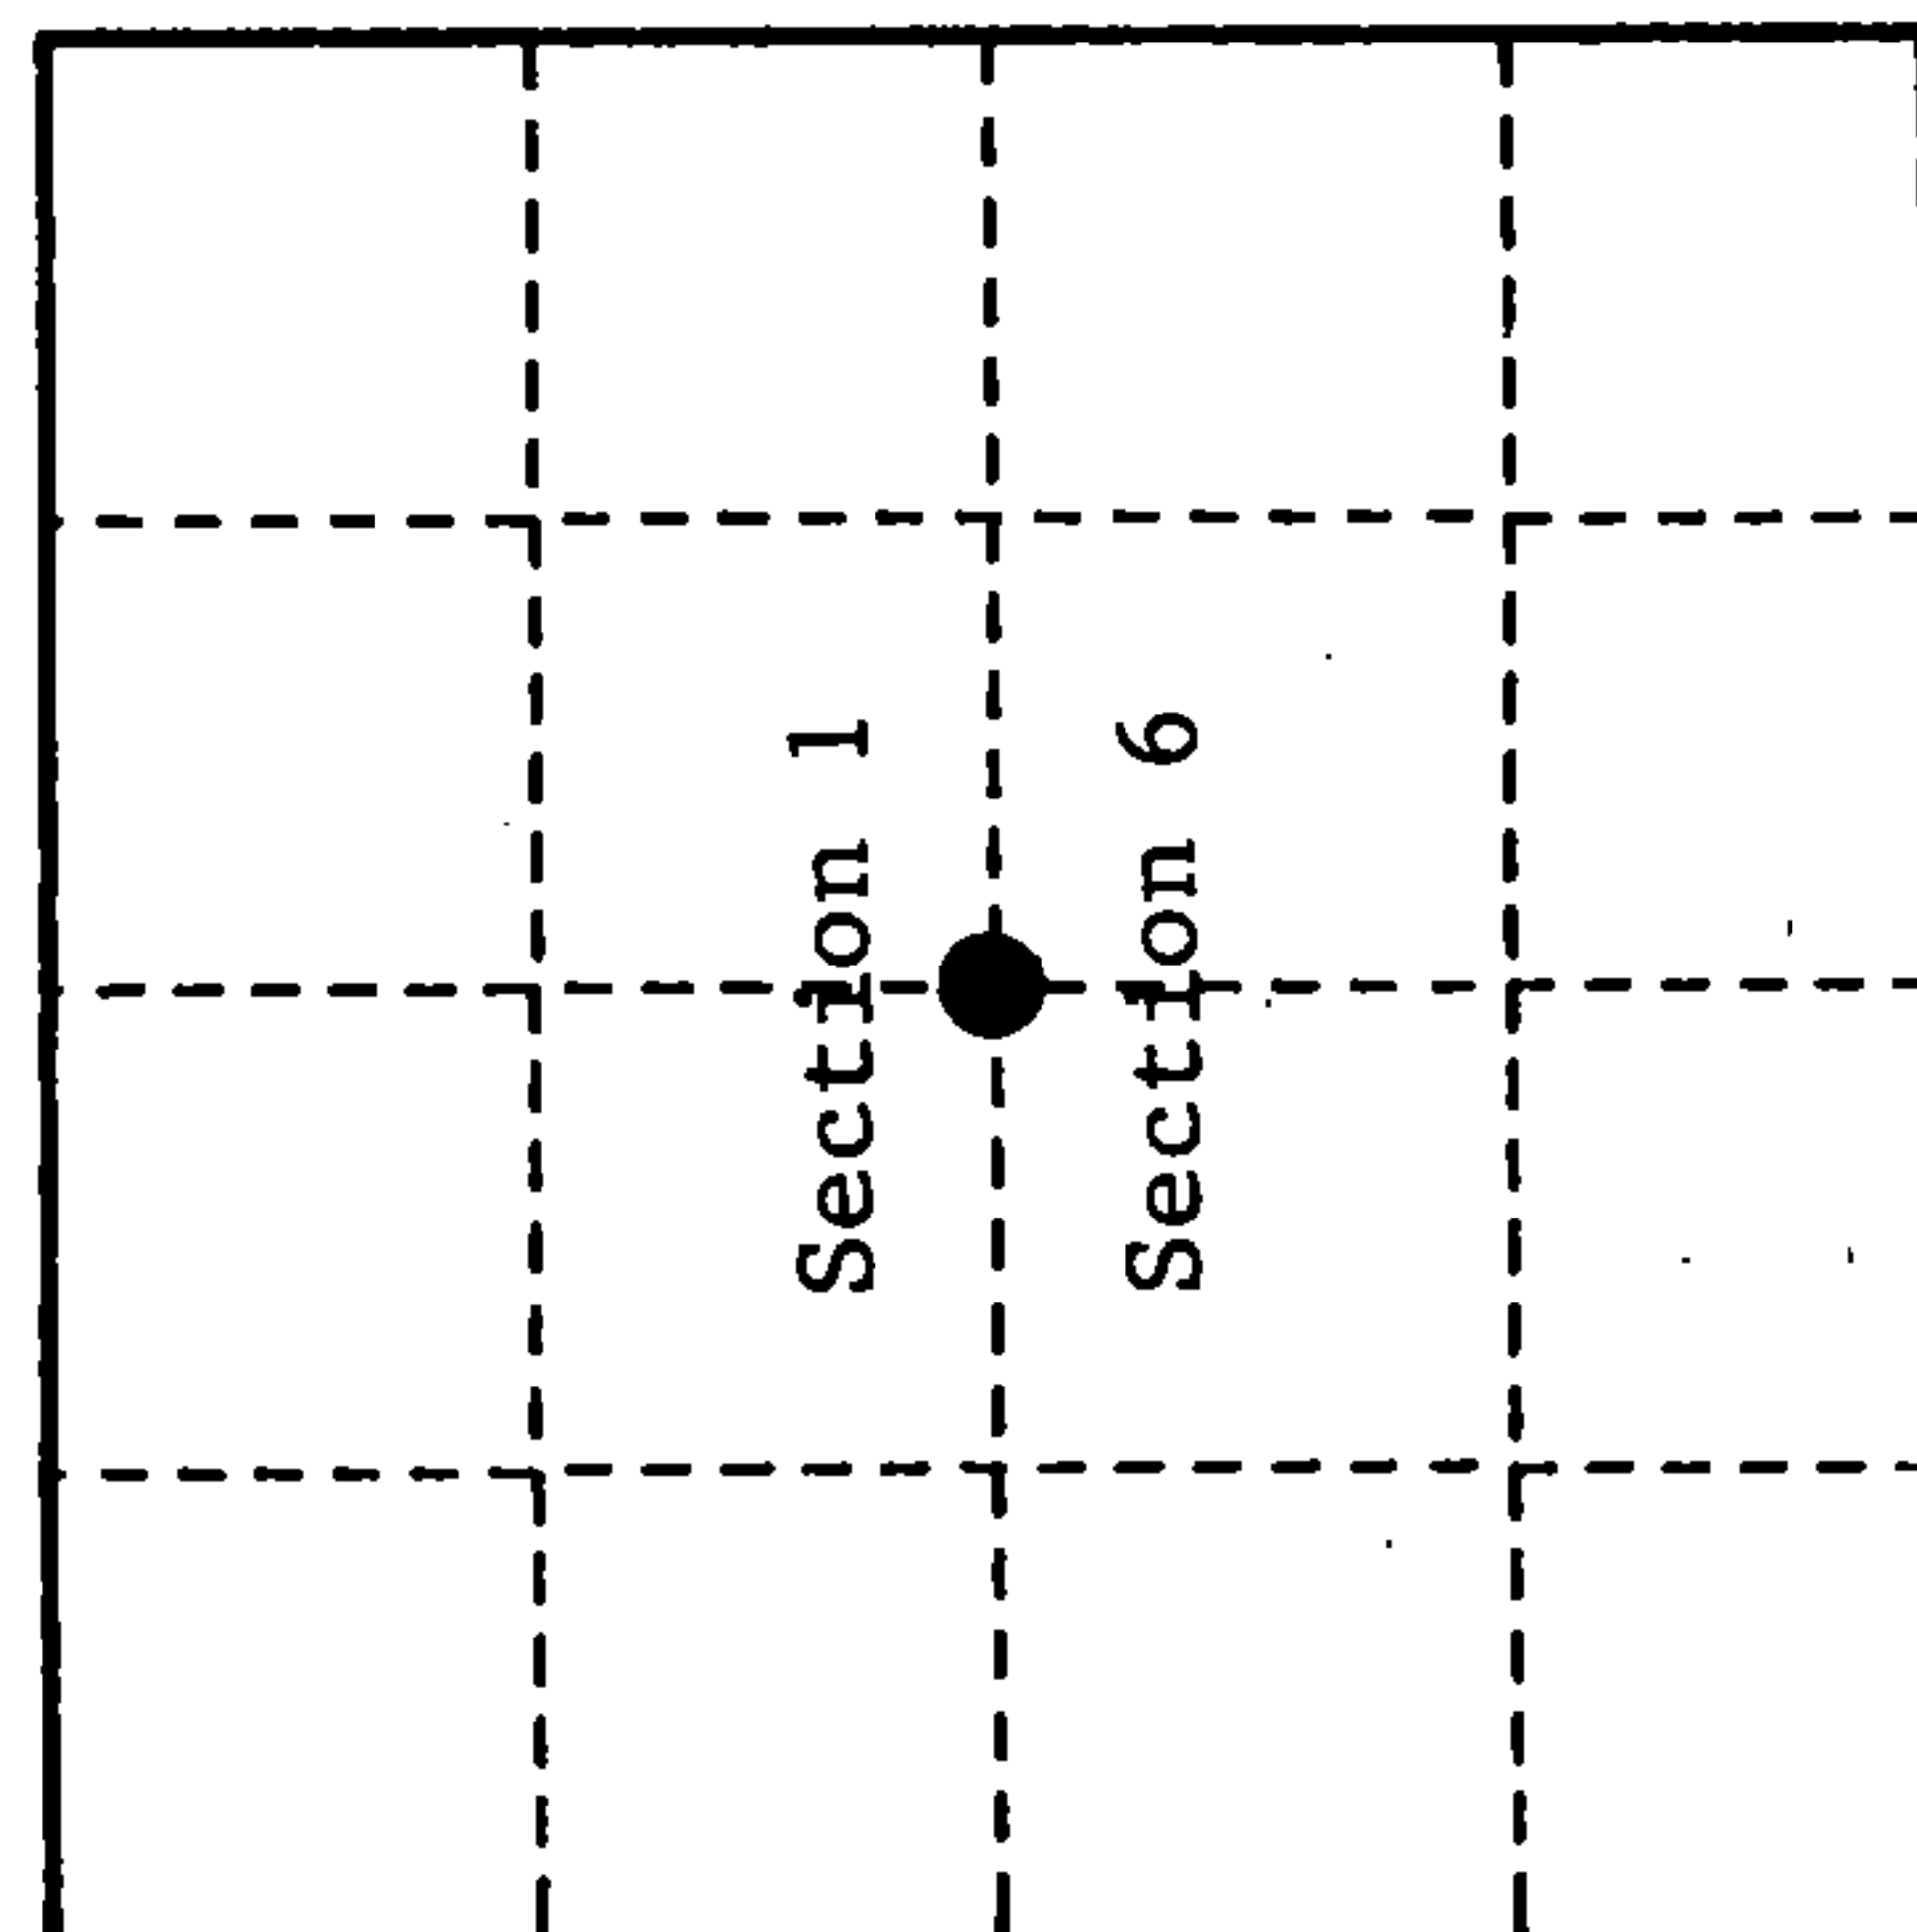

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Government Survey in 1857 by Artemas Curtis.

In 1973, Jean Resvick, a Land Surveyor with the U.S. Forest Service, found a 6"x6" scribed cedar post badly rotted and in concurrence with original bearing tree evidence. In place of post, set a 2" diameter galvanized iron pipe, 3 feet long, with a brass cap stamped: T37N, R15E, R16E, 1/4, S1, S6, 1973, S-802, from which the following bear:


Maple	7"	S 23°E	32.34 feet
Yellow Birch	6"	N 86°W	47.35 feet
Steel sign post	SW		1.0 feet

On 9/9/99, Gary L. Pisoni, RLS found above monument and assessories as described below. See previous Land Corner Certificate dated September 21, 1973.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Maple, 10", S23°E, 32.34 feet
2. Yellow Birch, 9", N 86°W, 47.35 feet
3. Steel sign post, SW, 1.0 feet
4. Maple, 6", S 30°W, 31.97 feet (NBT)

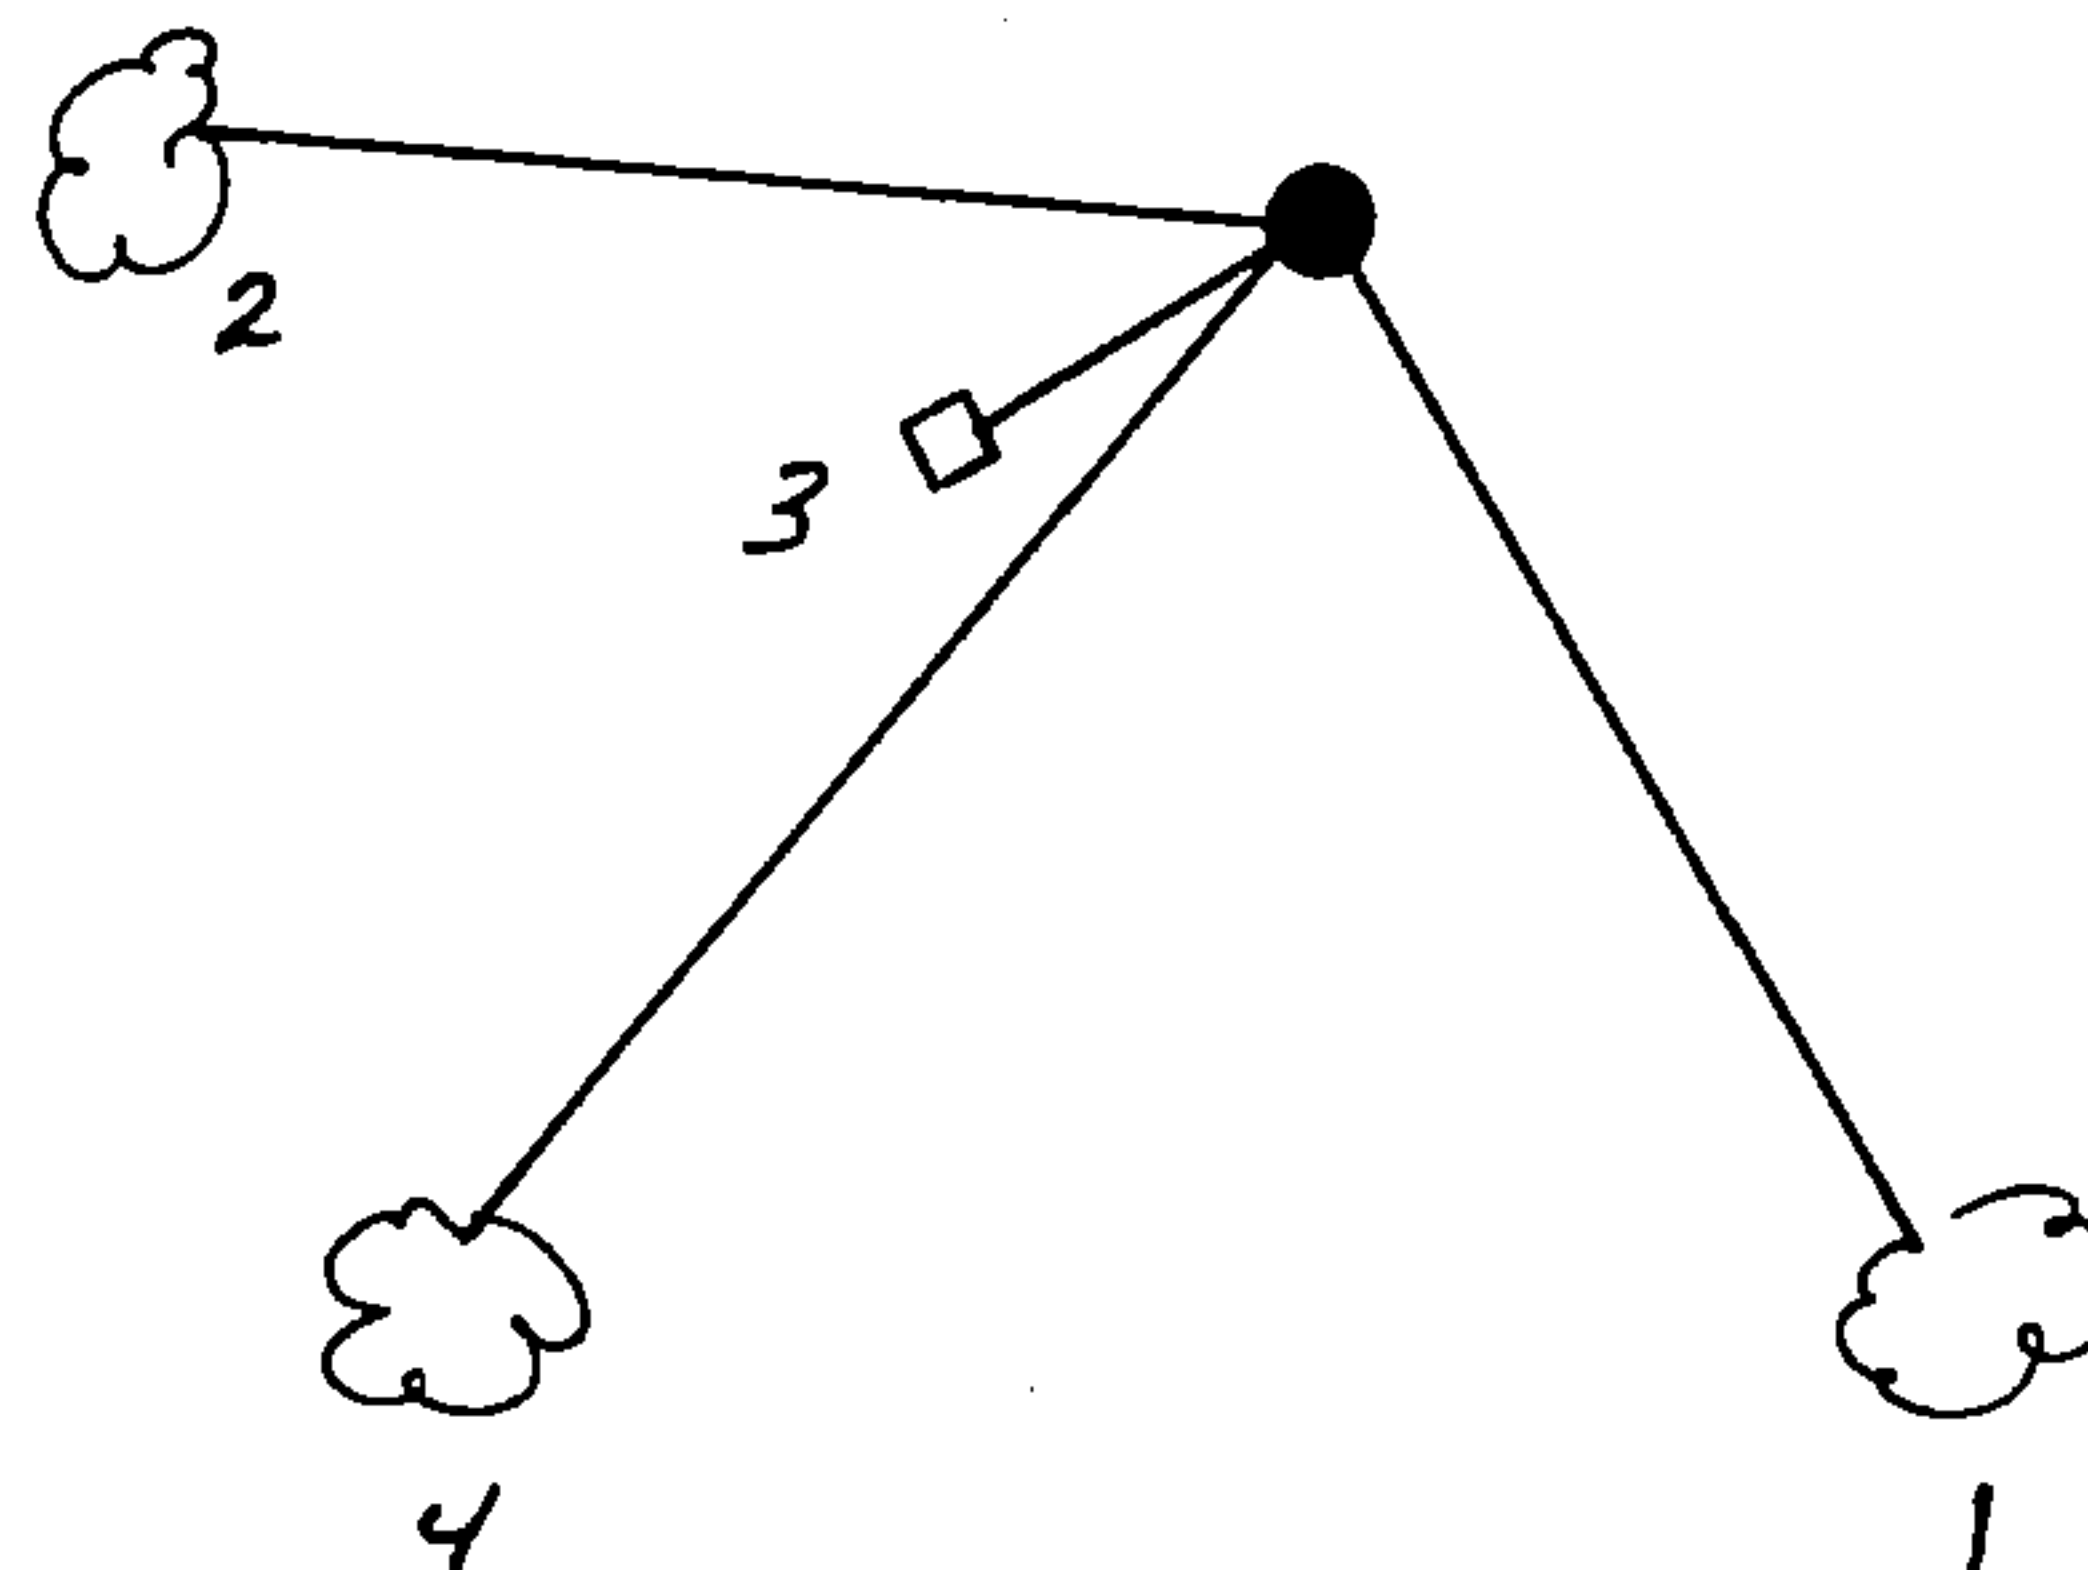

REGISTER'S OFFICE  
 Forest County, Wis.  
 Received for record this 27th day  
 of October A.D. 1999 at  
10:05 o'clock A.M. and recorded  
 in Vol. Corner Restoration  
 page C-25  
Kay Swanson, Deputy  
 Register of Deeds

43715012000



- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from accepted evidence.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Gary L. Pisoni  
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

*Gary L. Pisoni*


10-1-99

Date

CERTIFICATE READY FOR FILING:

*[Signature]*

District Ranger

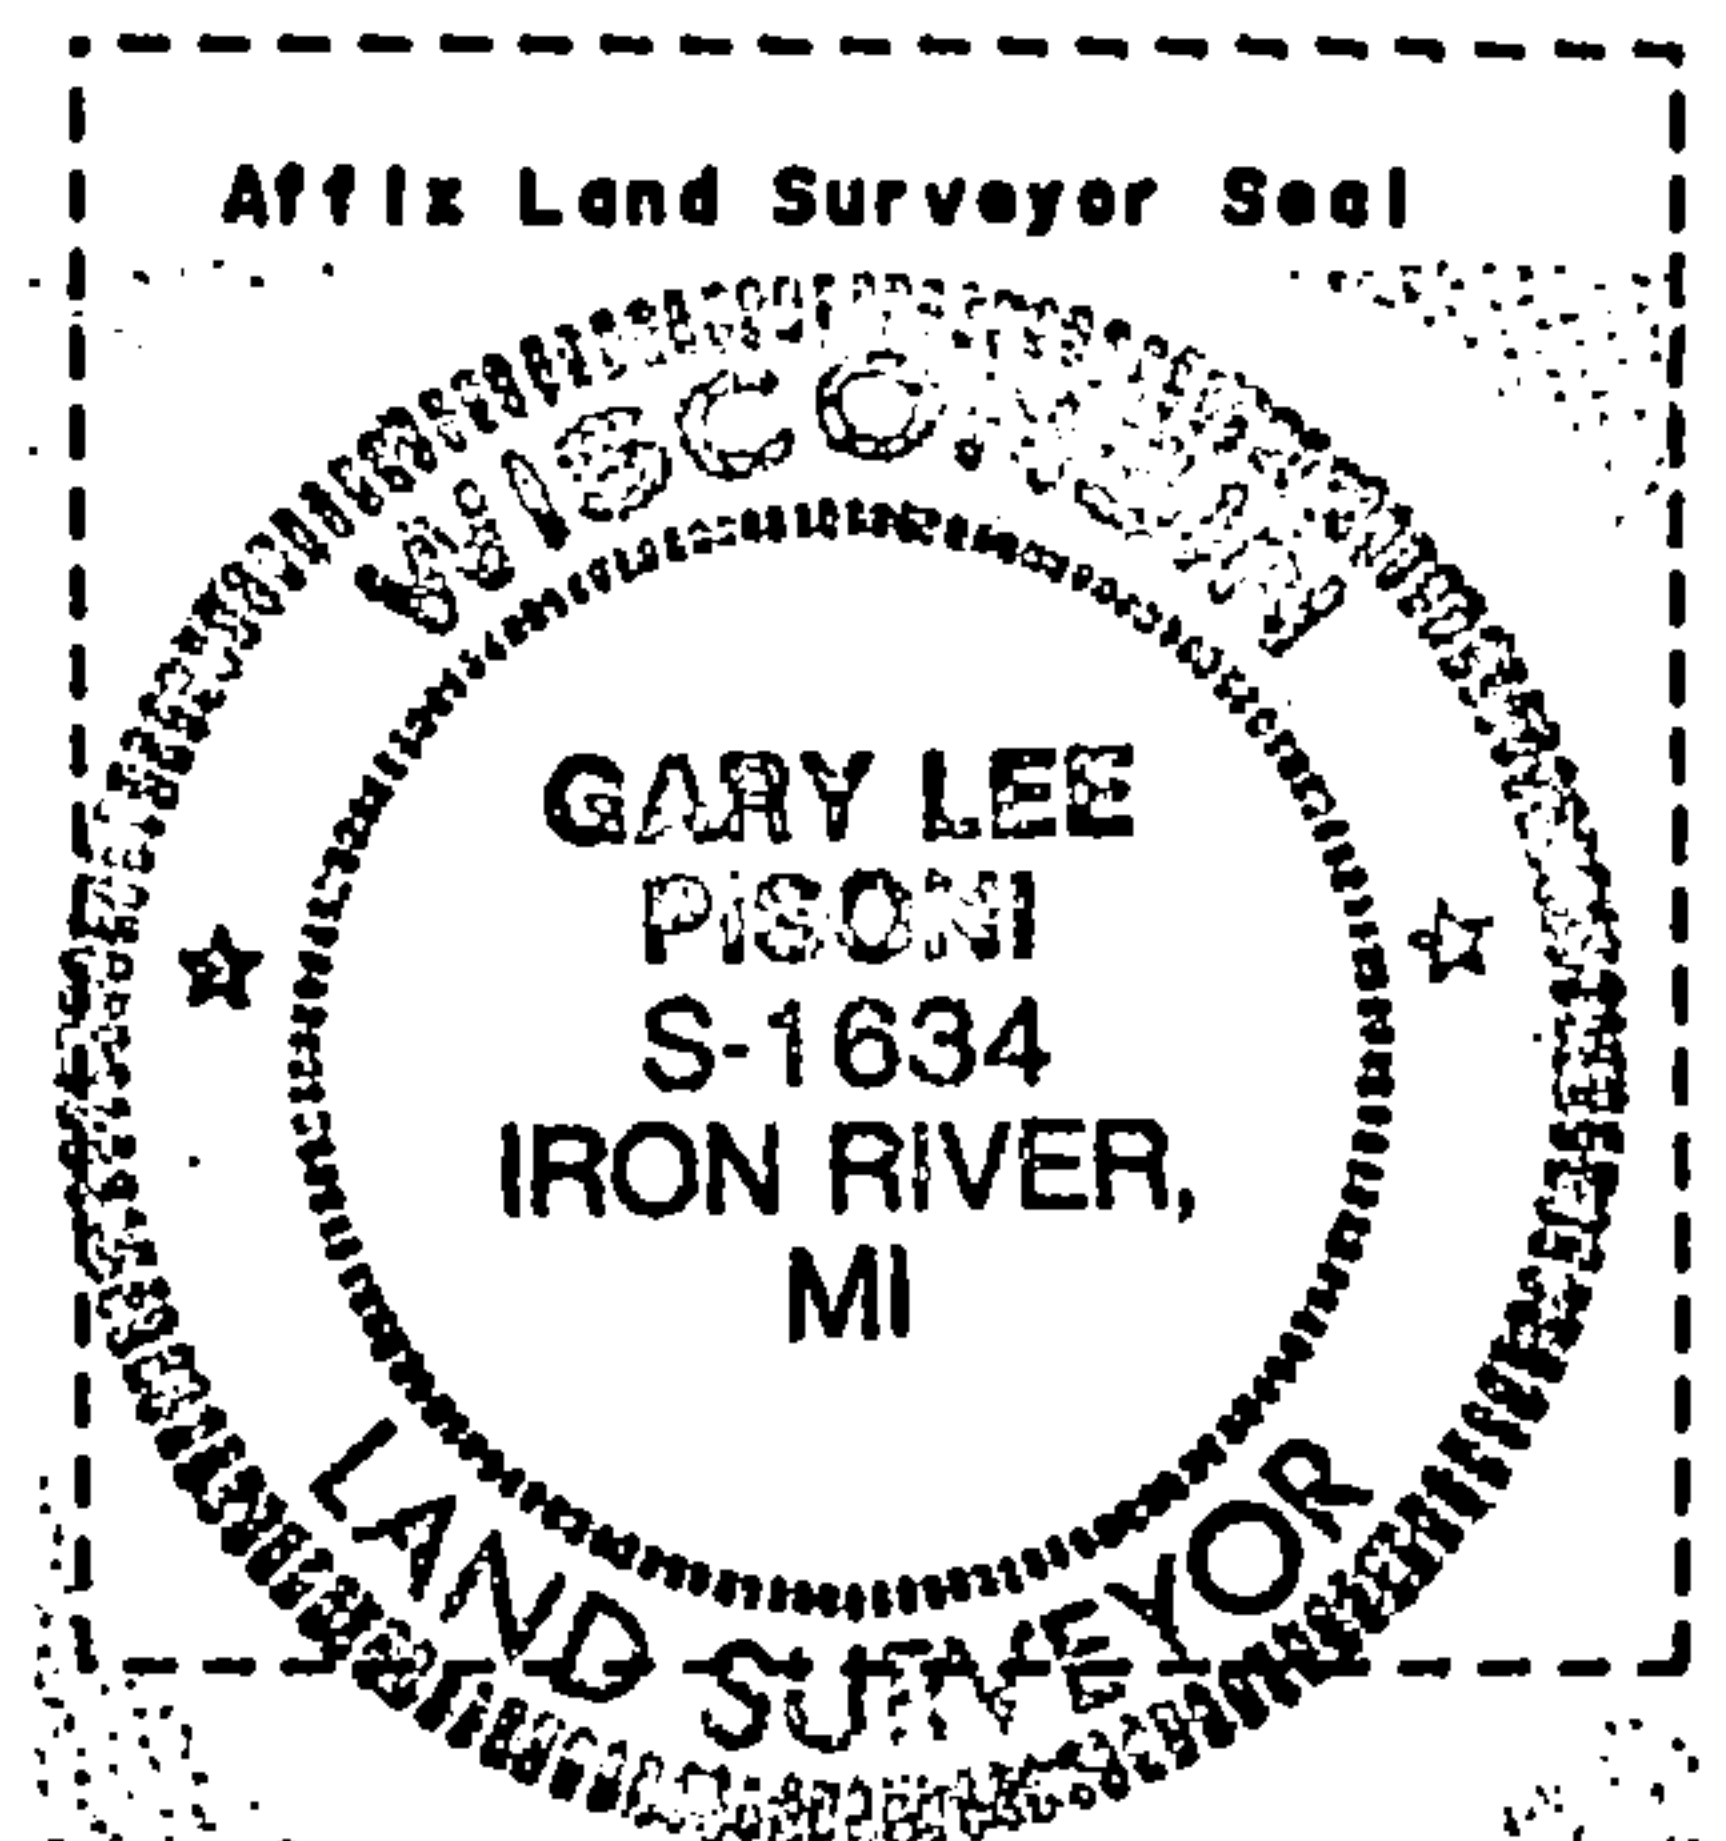

## CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

SS.

I, Jean F. Resvick, do hereby certify that on the 15 day of May, 1973,  
I found evidence of the East quarter corner of Section 1  
Township 37 north, Range 15 east, Fourth Principal Meridian, as described  
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-  
petuate the original location of this corner:

## Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis

40.0 chains north between Section 1 and 6, set post

Hemlock 16, S87W, 49 lks.

Yellow Birch 8, East 2 lks.

2.50 chains north enter swale bears NE

4.00 chains north leave swale bears NE

14.50 chains north enter swamp bears NW

18.50 chains north leave swamp bears SW

22.50 chains north enter swamp bears NW

31.00 chains north leave swamp bears SW

Description of corner evidence found:

6x6 scribed cedar post badly rotted

Birch stump east, 8 lks.

Burned Hemlock remains, S87W, 49 lks.


Natural calls both north and south check

18.50 chains south enter swamp bears NE

25.00 chains south leave swamp bears NE

## Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post found with a 2 inch inside diameter, galvanized iron pipe, 3 feet long, filled  
with concrete to weigh 5 pounds per foot, with brass cap stamped:

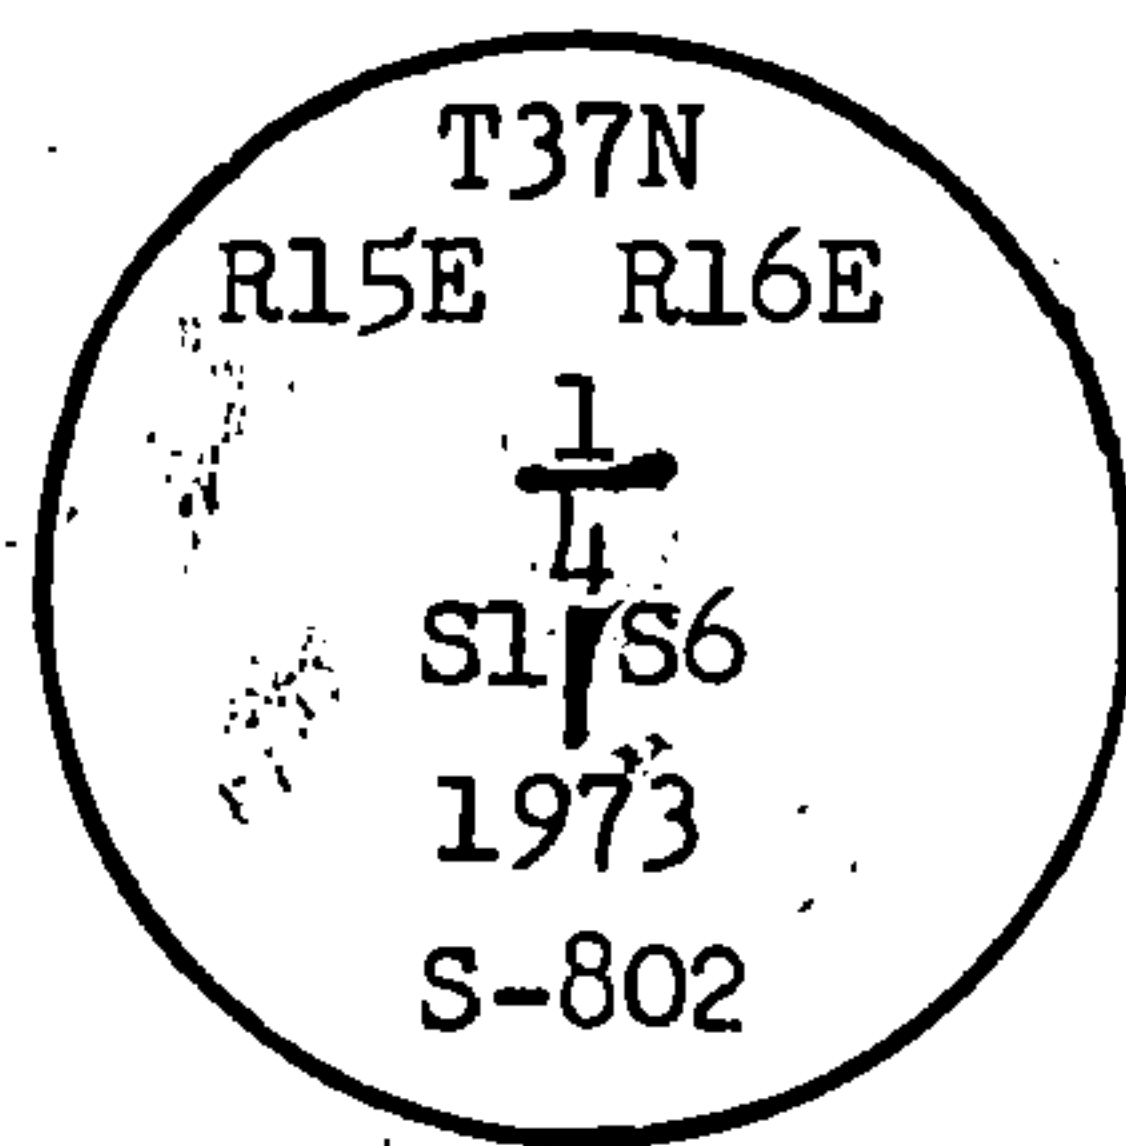


Blazed and scribed the following new bearing which bear from monument:

Maple 7, S23E, 32.34

Yellow Birch 6, N86W, 47.35

Steel sign post set 1.0 foot SW of monument

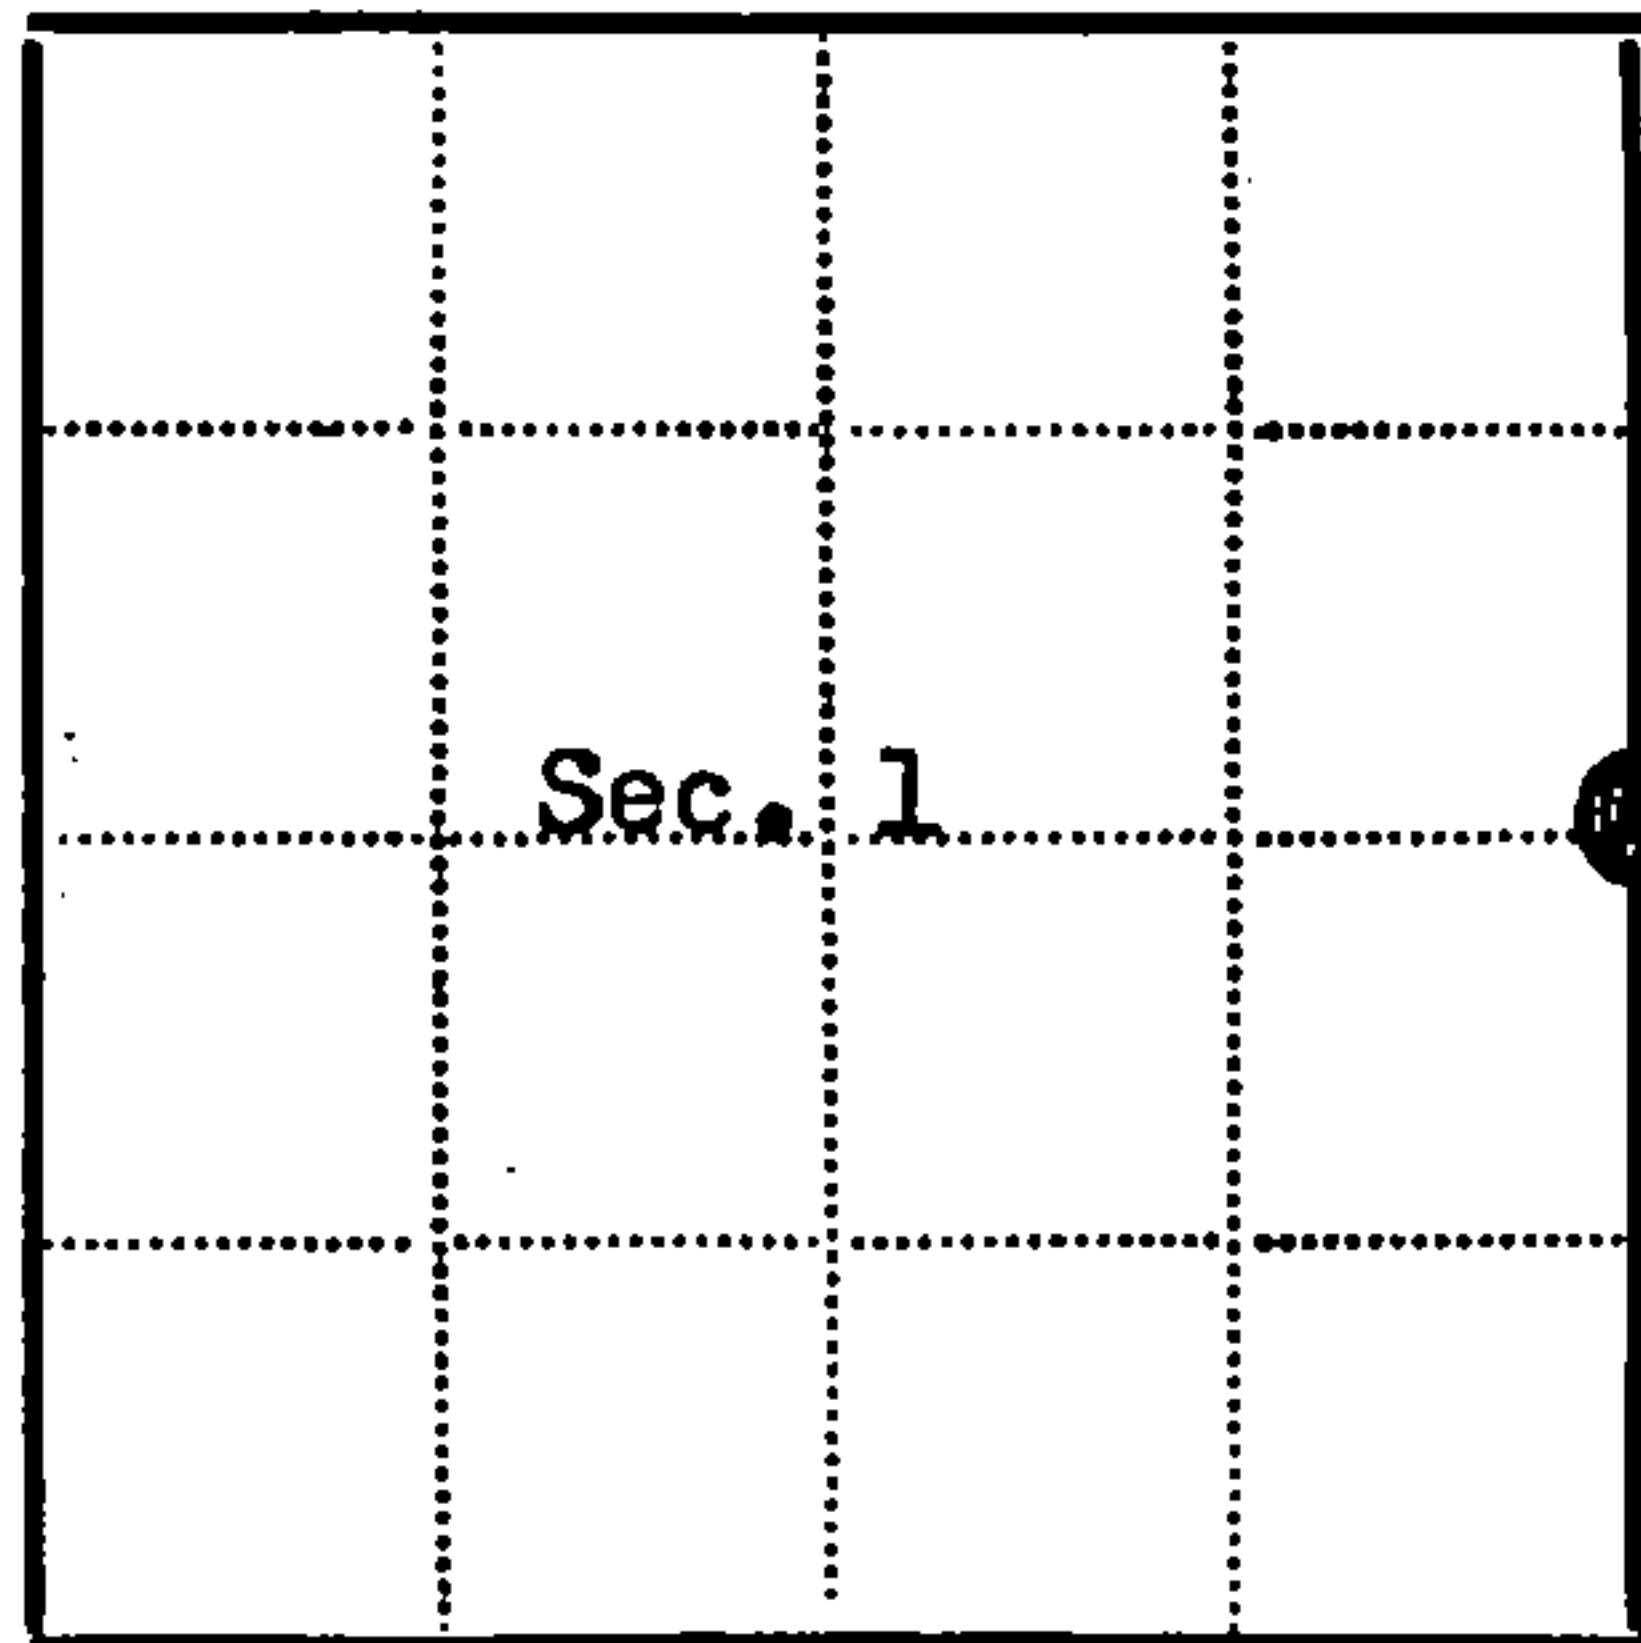

● = Corner monument restored

□ =

Resident witnesses

Dated at Rhineland

19 73

Wisconsin, this 15 day of May

Signature Jean F. Resvick

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT NUMBER

104442

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record  
on the 13th day of November, 1973, and was filed in Book

Corner Restorations No. C-25 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 37 north, Range 15 east, Section 1, Index No. C-25, Page No.

43715012000

C  
25