


U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Index No. G-21

State of Wisconsin }
County of Forest } ss.

I William B. Cochrane, do hereby
certify that on the 30 th day
of April, 19 92, I found
evidence of the West Quarter
corner of Section 12
Township 38, North, Range
13 East, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

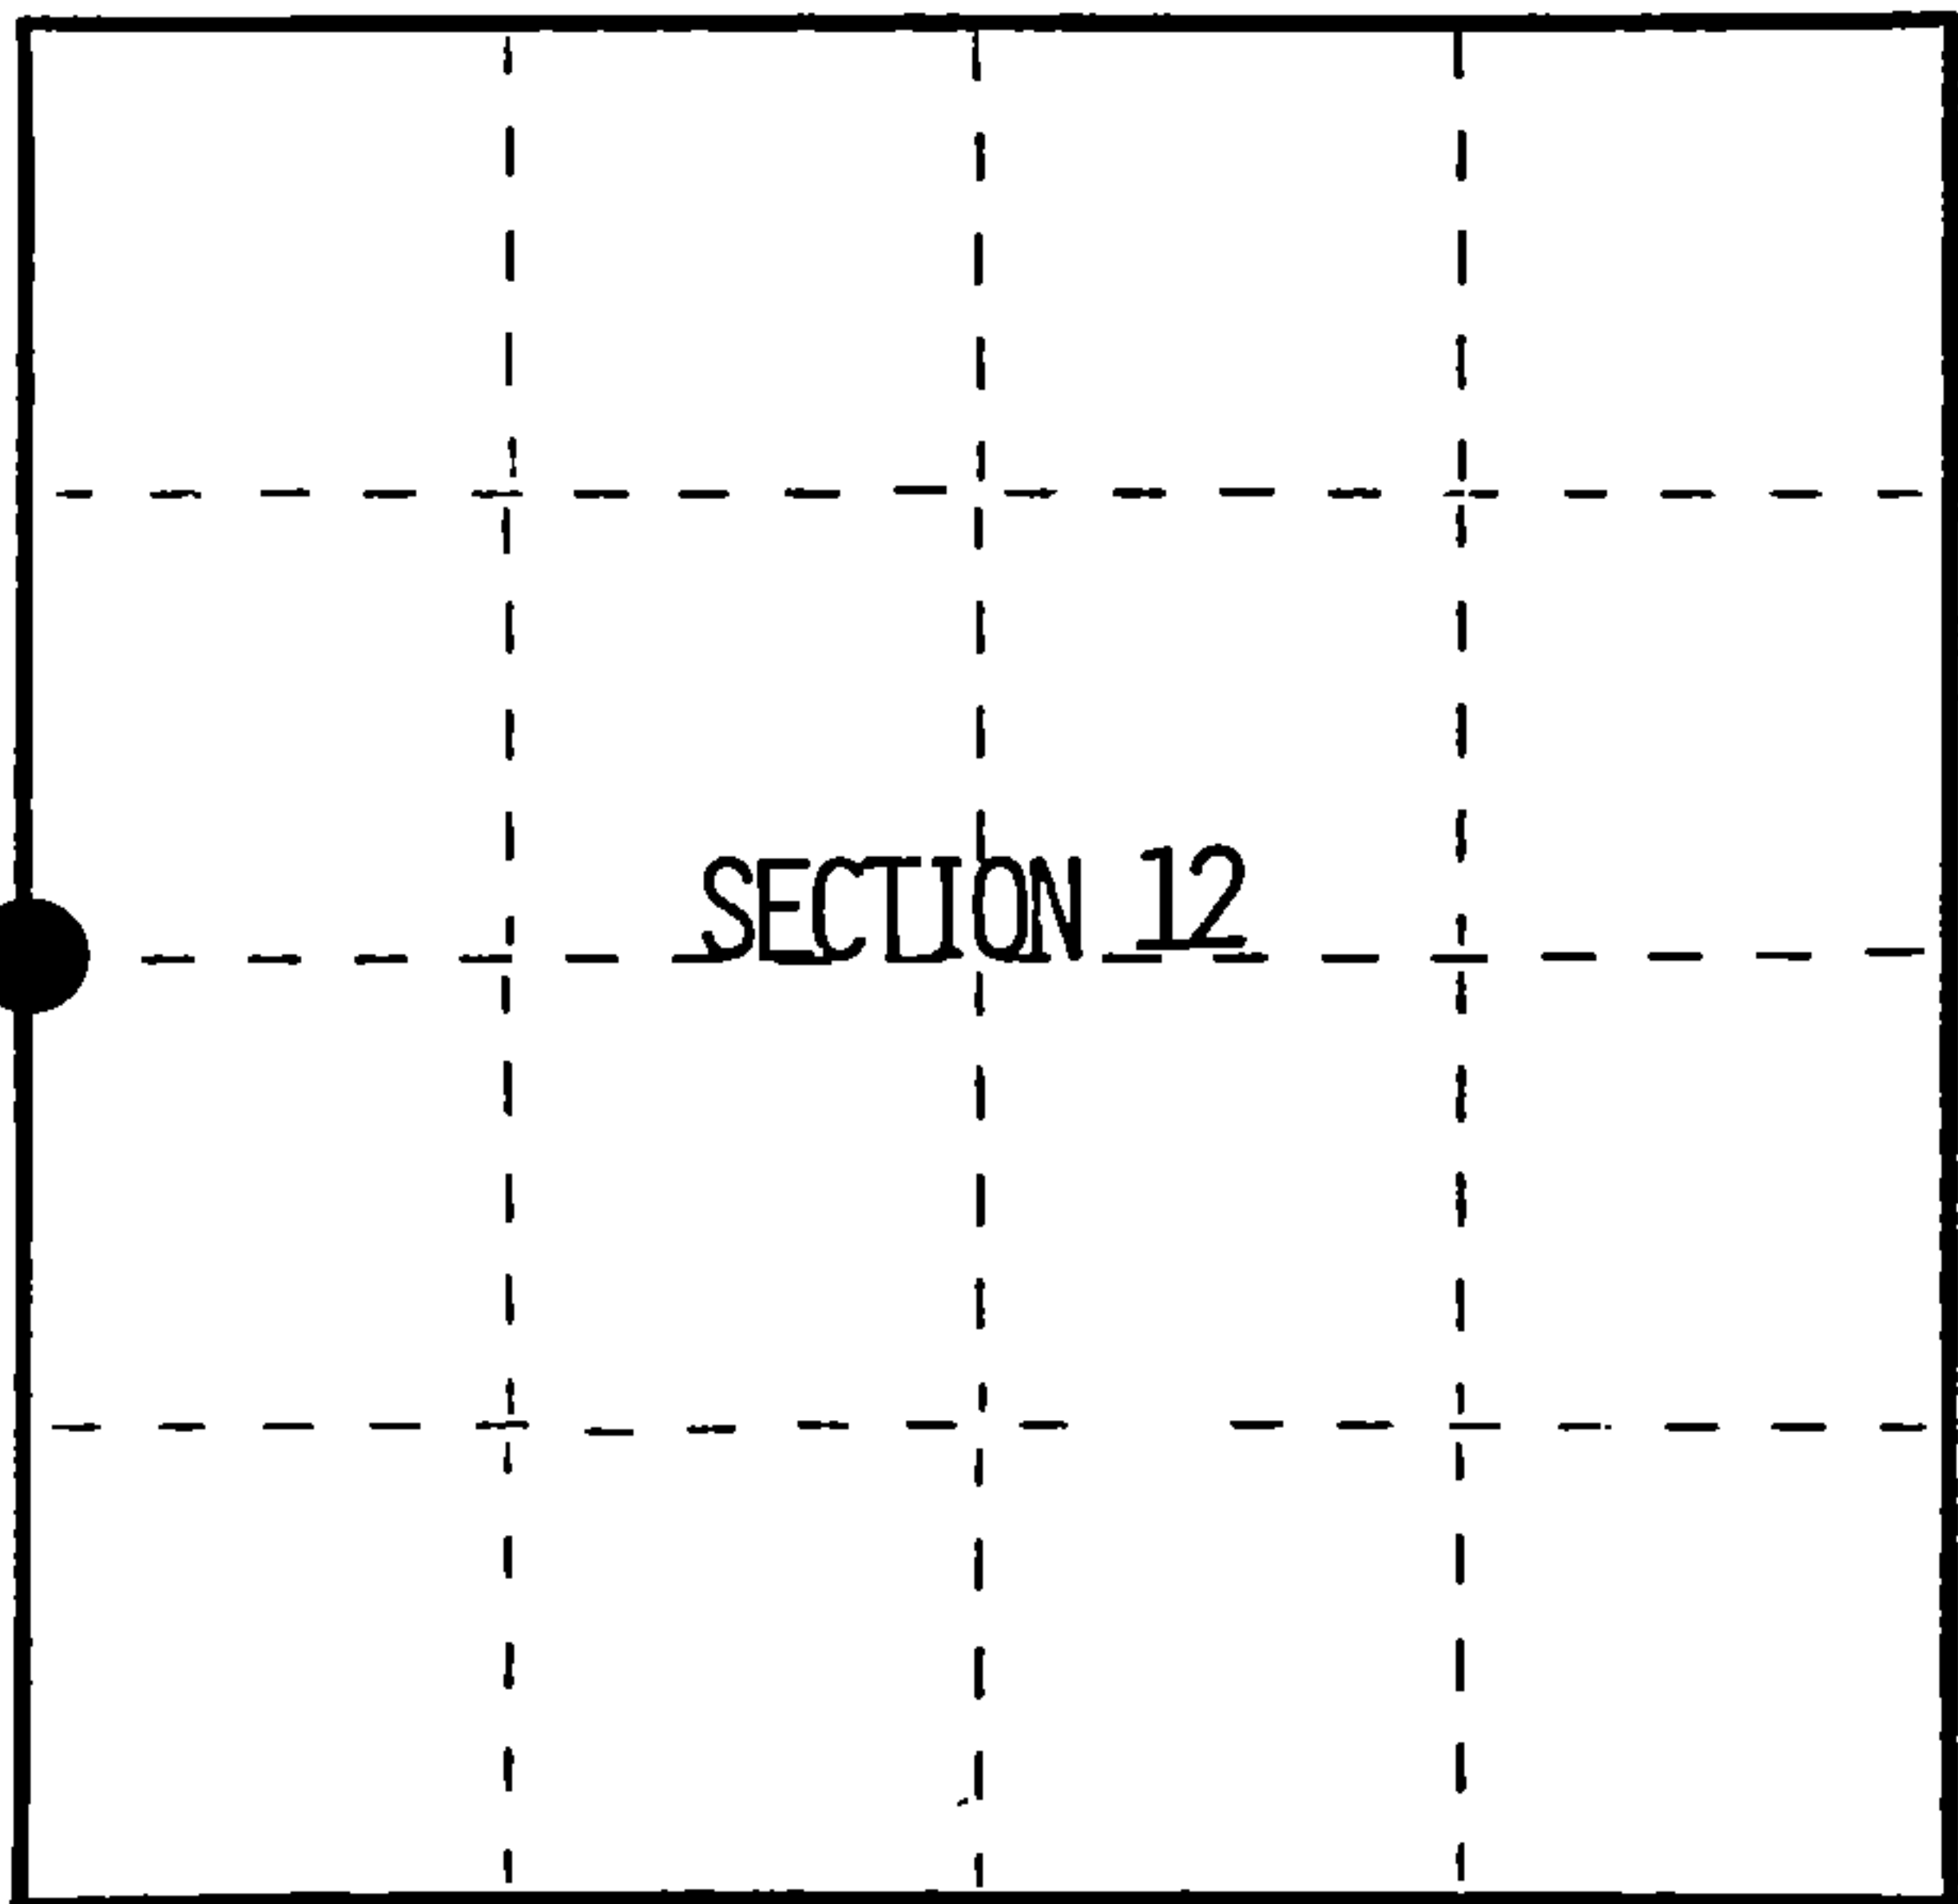

○ = Corner monument restored.

History of original corner establishment:
Original Government Survey by H. & J. L. Nowlin in August 1865.
North between sections 11 and 12 at 40 chains set post from which the following bear:
Maple 12" N05°E 20 lks
Spruce 10" S14°W 13 lks

Description of corner evidence found:

No corner evidence was found.

Description of monument and accessories I established to perpetuate the original location of this corner.
Corner position set by proportionate measurements one and one half mile North and
South, and using the center line of State Highway 55. At the corner position set a
Railroad spike flush in the road surface from which the following bear;
Balsam 9" S37°W 69.00 feet
Balsam 10" N62°W 47.06 feet
Reference monument 2½"X36" aluminum pipe with an aluminum cap stamped: Reference
monument, T38N, R13E, 1/4, S11, S12, 1992, West 33.00ft, S-1107.
Steel sign post East 33.50 feet

Dated at Hiles, Wis., this 4 th day of January, 19 95

Signature William B. Cochrane Title Land Surveyor Registration No. S-1107
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 23rd day of August, 19 96
at 2:30 o'clock P. M.

(Register of Deeds)
By [Signature] Deputy

FORM NO. 985-A

H.C. Miller Company

Stock No. 26273

156556

43813112000


- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Re-established through lost corner proportionate methods.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

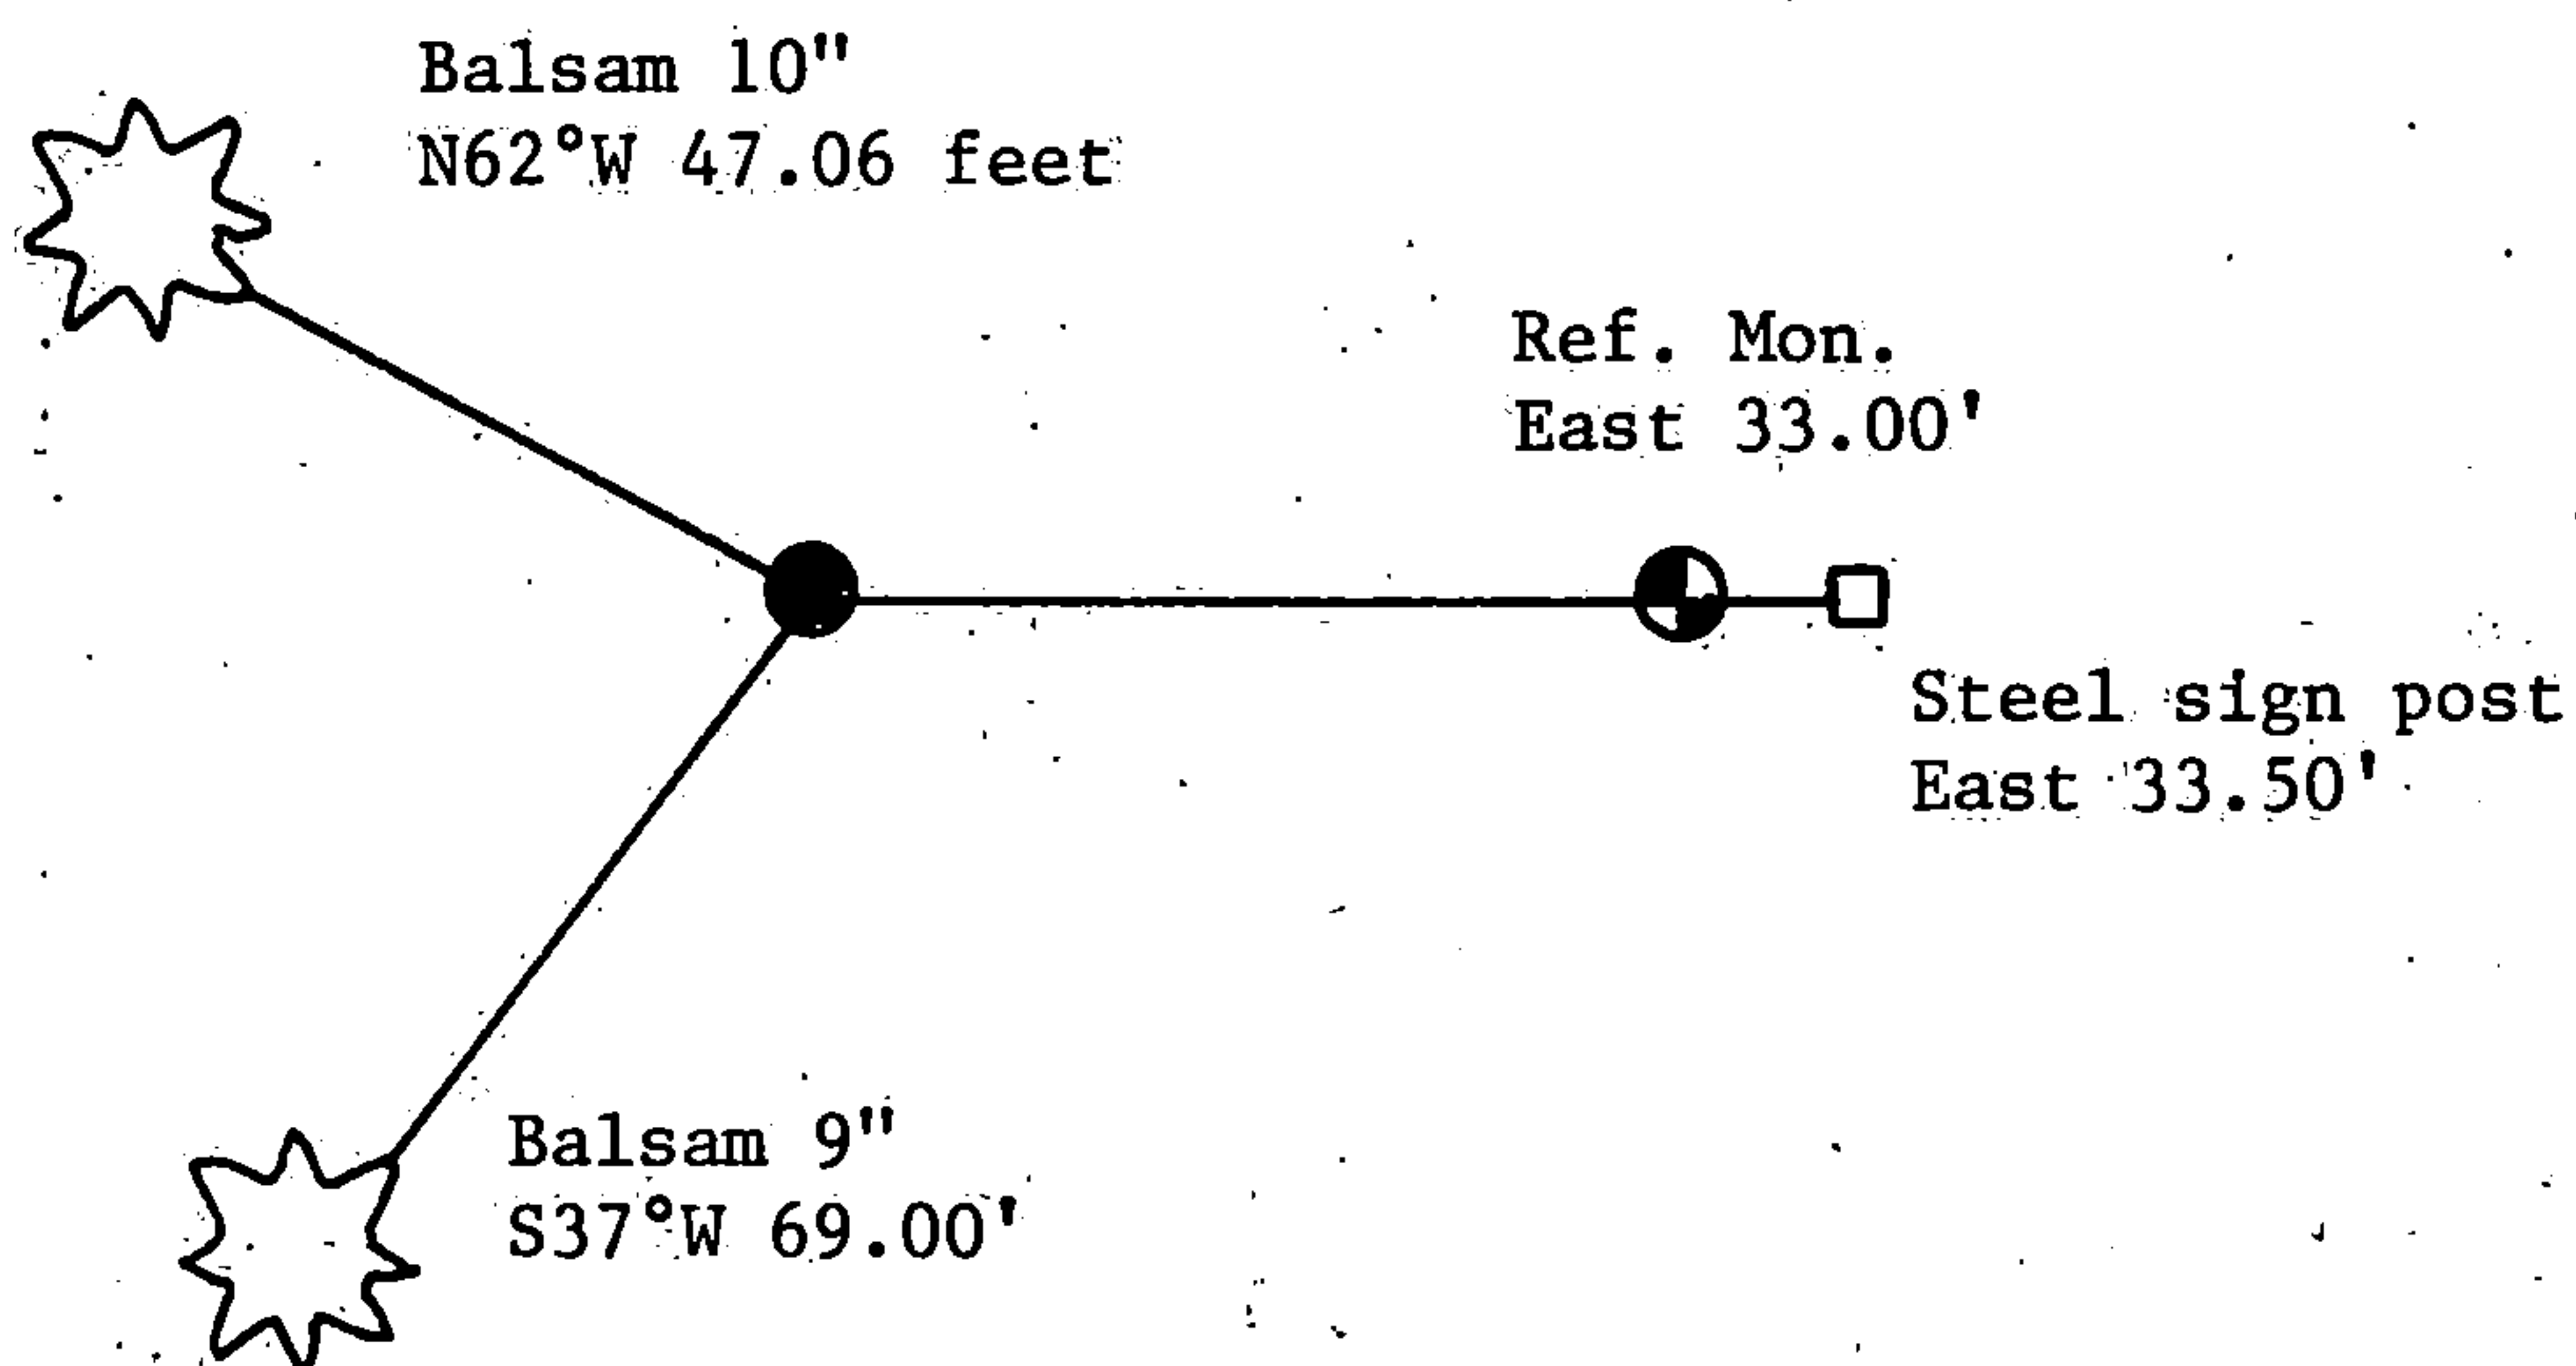

William B. Cochrane

- (i) I, William B. Cochrane
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

