

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Section corner to Sections 1-6-31-36,
T.37-38N., R.13-14E., Forest County,
Wisconsin.

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 20th day
of March A.D., 1990 at
1:00 o'clock P.M. and recorded
in Vol. Casey Postations
page 1-1.

Paul H. Leinenweber
Register of Deeds

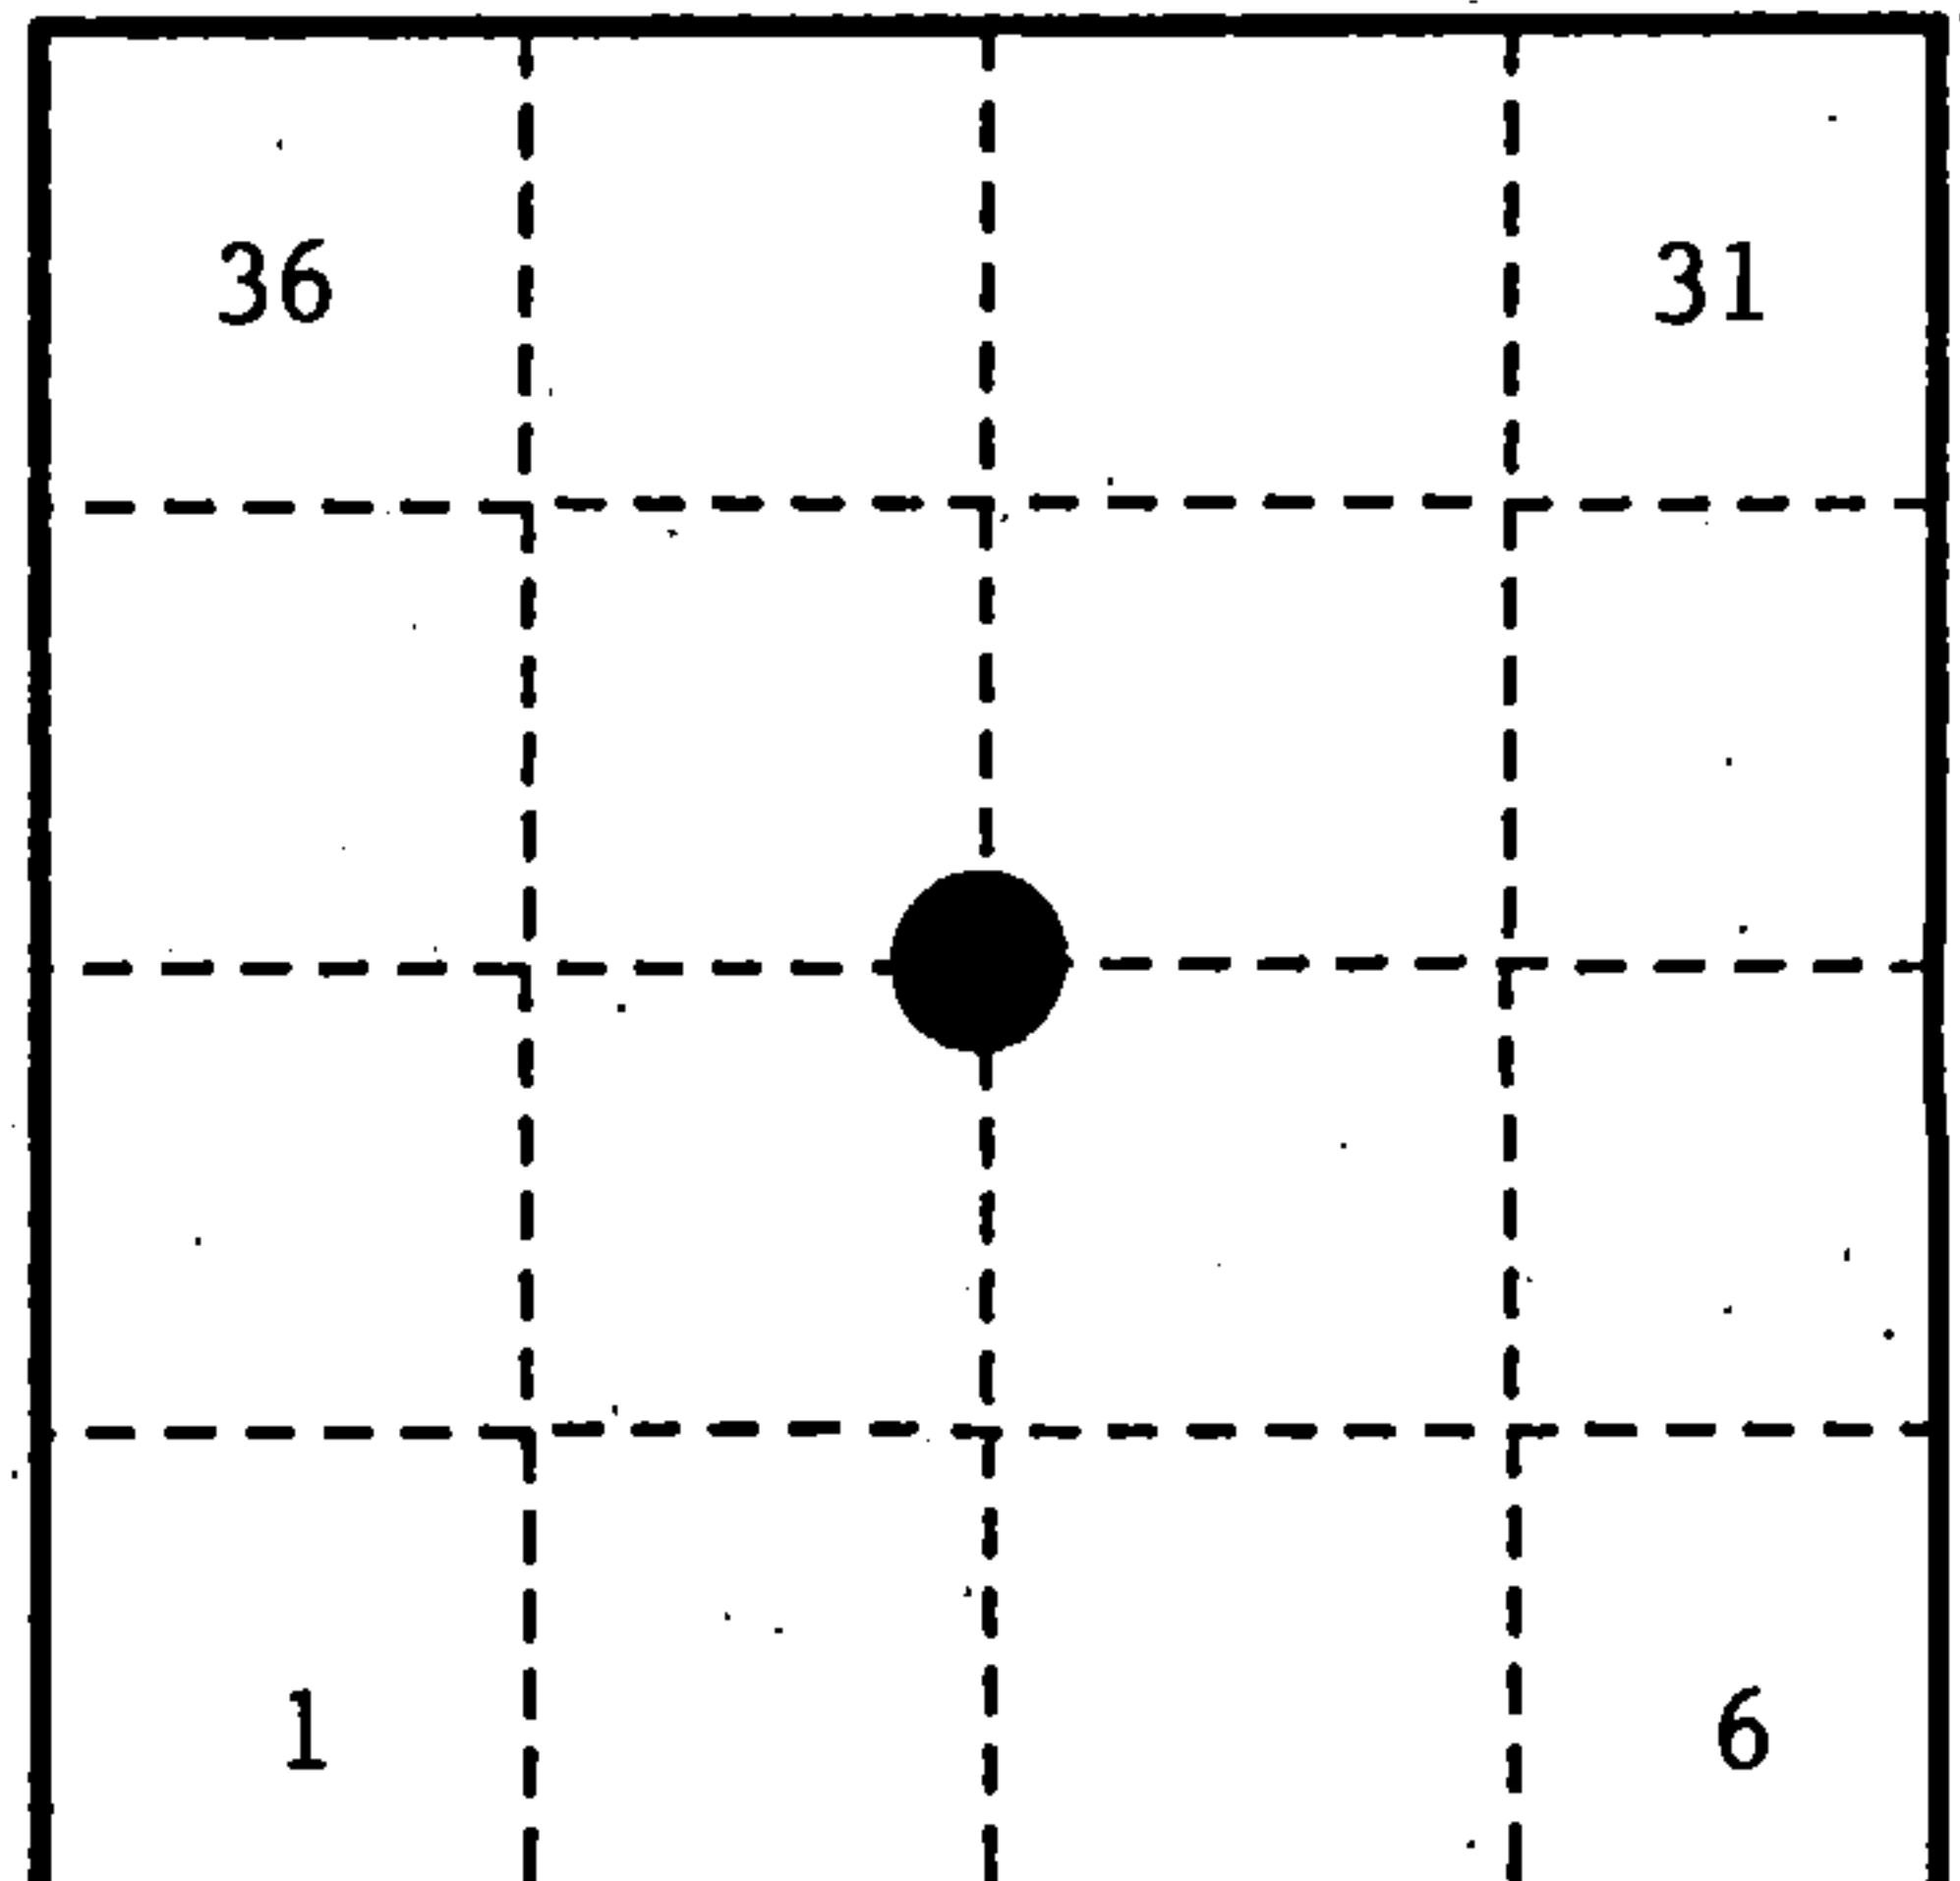

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Alfred Millard set a wood psot with the following B.T.'s: Hemlock, 12", N.54°E., 35 links (23.10 feet); Tamarack, 12", N.57°W., 22 links (14.52 feet); Tamarack, 12", S.12°W., 37 links (24.42 feet); Tamarack, 10", S.78°E., 32 links (21.12 feet).


In 1982, John Fisher (RLS) found no evidence of original or subsequent corner, placed corner at proportionate measure with the following B.T.'s: Hemlock, 10", S.31°E., 50.54 feet, Red Maple, 10", N.85°W., 27.12 feet; Sugar Maple, 7", N.23°E., 18.71 feet; White Spruce, 12", S.84°E., 20.38 feet; Steel Sign Post, East, 1.00 feet.

In 1990, Alan Harrison (RLS) found monument and accessories as per Fisher with the Southeast B.T. down. Replaced the Southeast B.T.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Red Maple, 12", S.31°E., 43.44 feet (new)
3. Red Maple, 10", N.85°W., 27.12 feet
4. Sugar Maple, 7", N.23°E., 18.71 feet
5. White Spruce, 12", S.84°E., 20.38 feet.
6. Steel Sign Post, East, 1.00 feet.

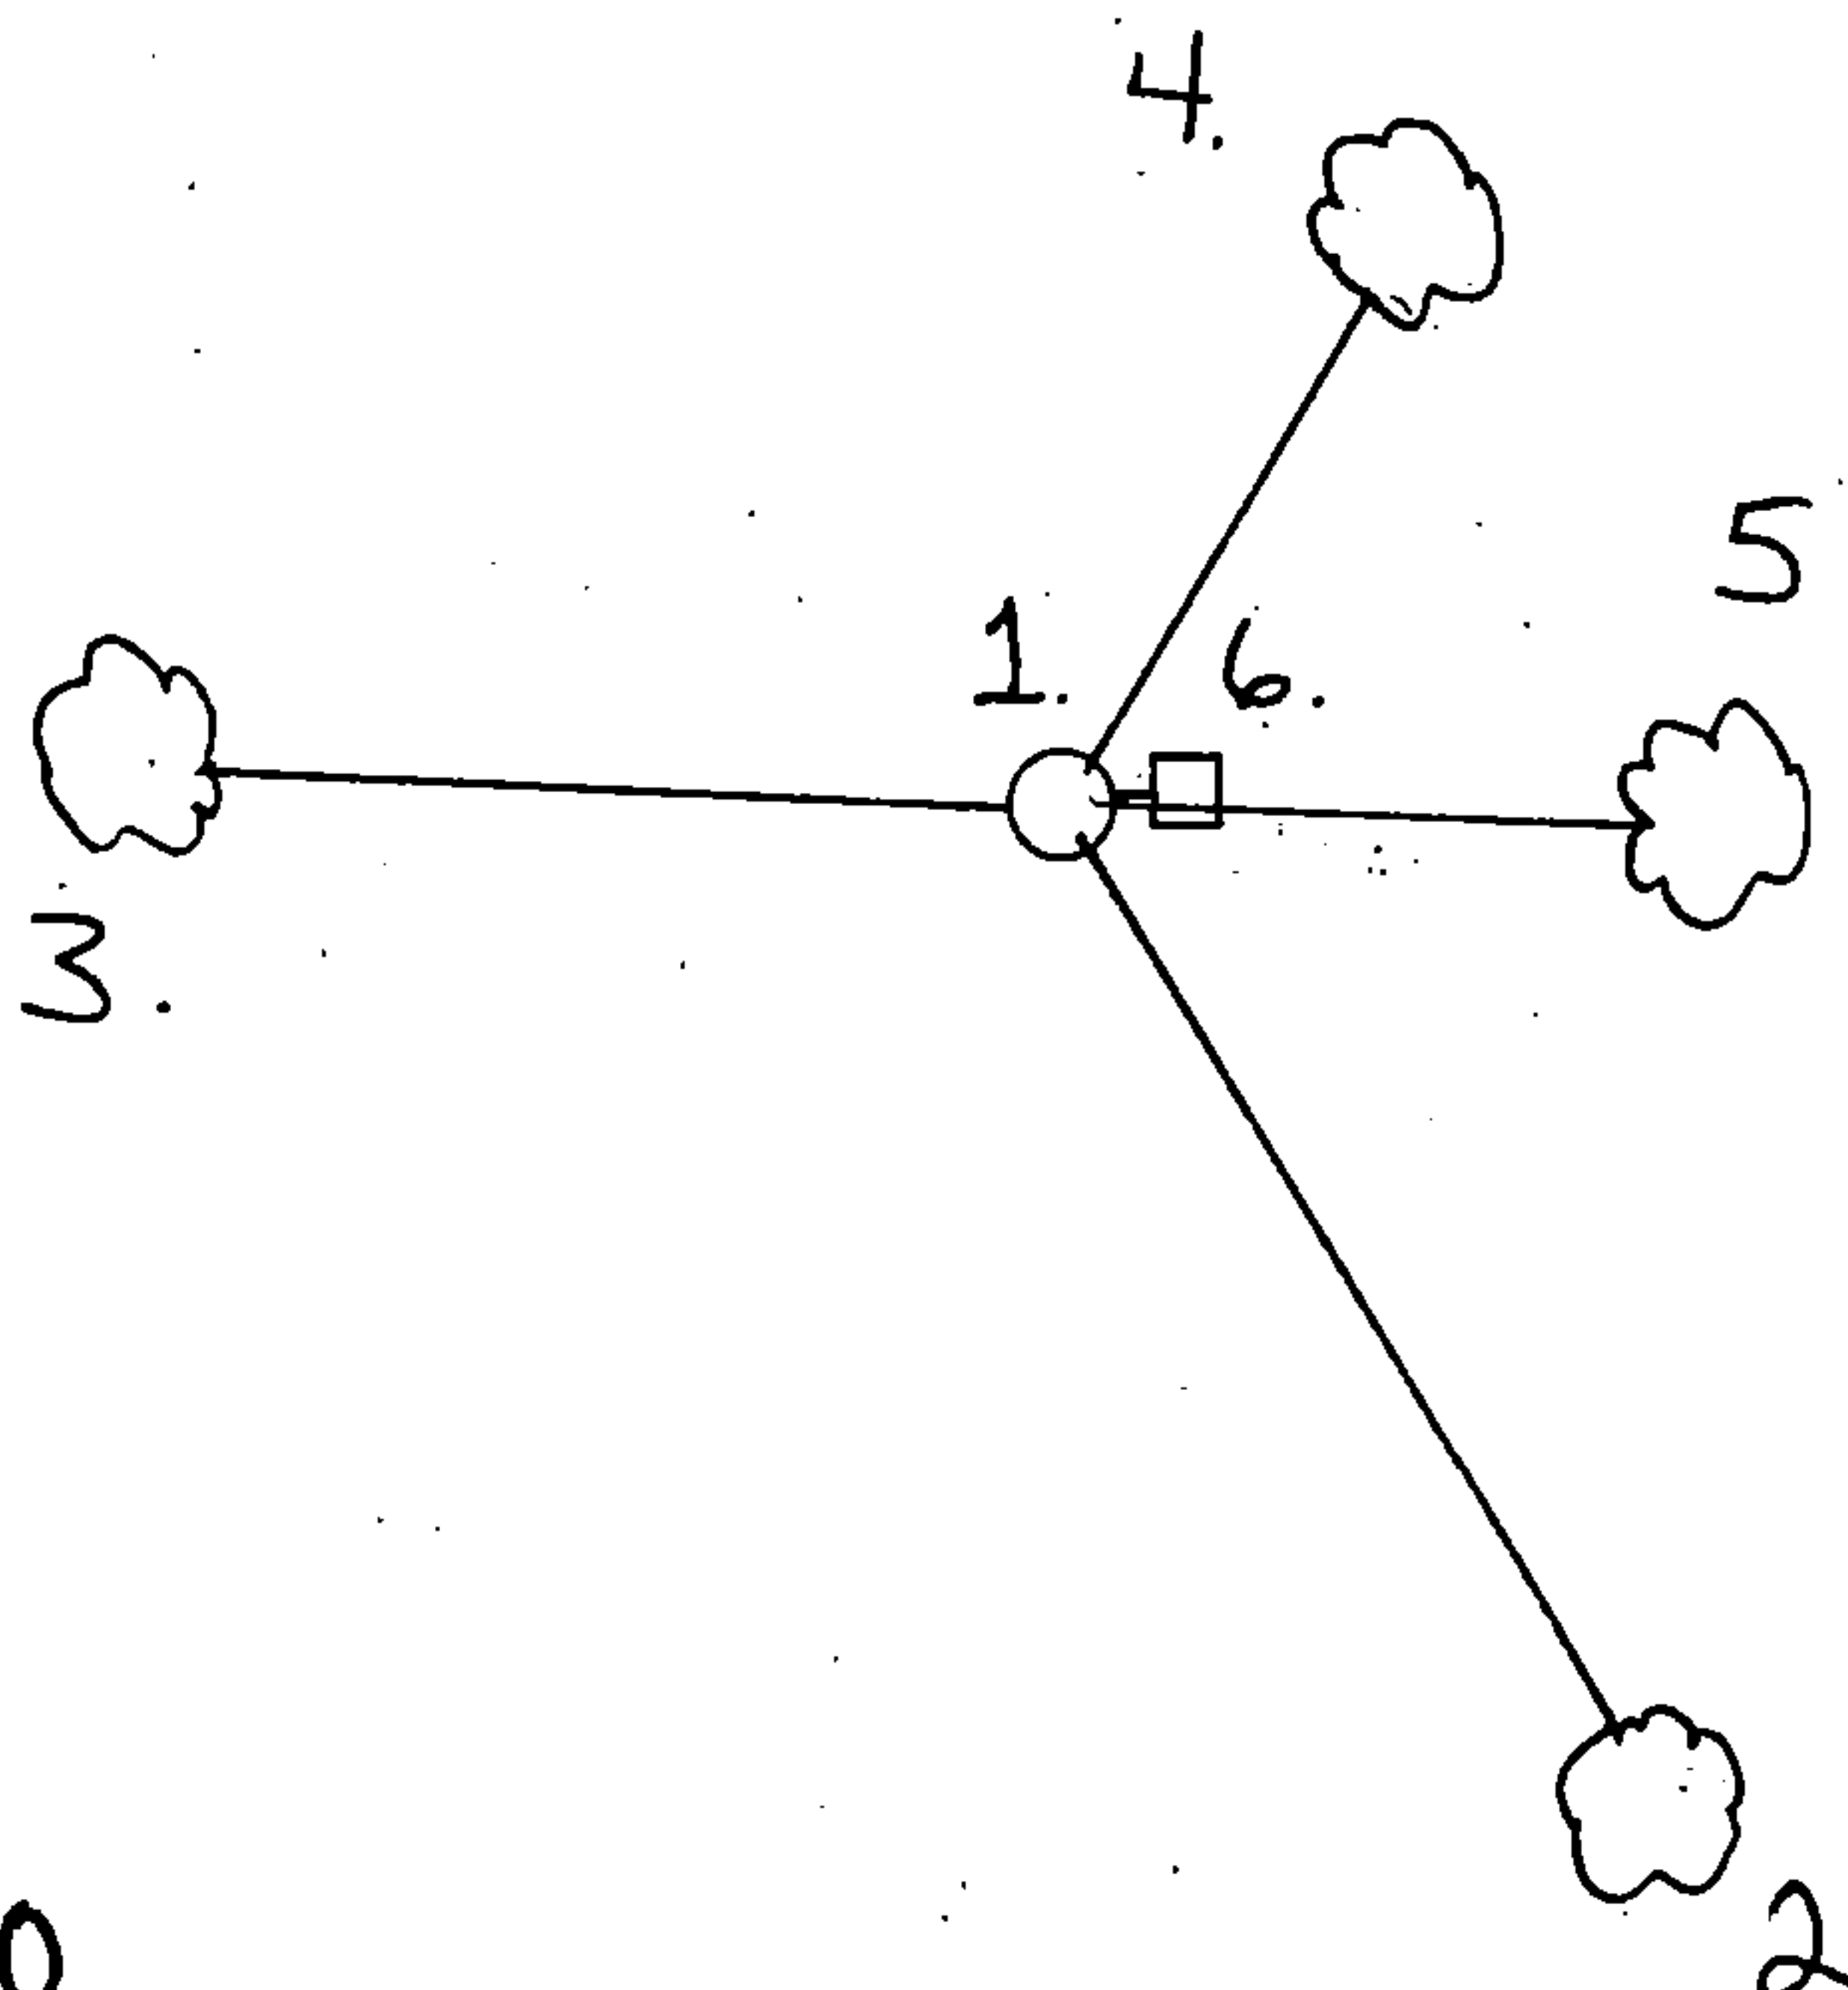

4381336 0000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

10/10/90

Date

CERTIFICATE READY FOR FILING:

Dale B. Stege
District Ranger

