J.S.	PUBLIC	LAND	SURVEY	MONUMENT	RECORD
------	--------	------	--------	----------	--------

Index	N 1 =	Α	_	19
Index	$N \cap$			•

State	of Wisco	nsin	} ~~		
County of	Forest	\ 	. } 55.		
State of Wisconsin County of Forest I. William B. Cochrane do hereby certify that on the 15th day of September 19 83, I found evidence of the North Quarter corner of Section 2 Township 37, North, Range 15 East Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.					
Resident wi	tnesses:				
TonyTill	man	•·••••••••••••••••••••••••••••••••••••			
••••••••••••••••••••••••••••••••••••••		• • • • • • • • • • • • • • • • • • • •	~~~~~~~~~~~		
	· · · · · · · · · · · · · · · · · · ·		*****		
	i i	! :			
	! !!.	 			
	;	! !			
	SECT 1	}H -5 ¦			
	[
	 	!			
	·	\ 			
	<u> </u>	1			

O = Corner monument restored.

History of original corner establishment:

Original Government Survey in 1857 by Artemas Curtis. West Between sections 2 and 35, 40.00 chains, set quarter corner post to sections 2 and 35. From which the following bear:

Y.	Pine	16"	N18°E	41 1ks.
Y.	Pine	16"	S81°E	65 1ks.

Description of corner evidence found:

6"x6" squared post, from which the following bear:

Y. Pine, stump,

N18°E

41 1ks.

I accept the location of the 6"x6" squared post as the original corner position, in concurrence with original B.T. evidence.

Description of monument and accessories I established to perpetuate the original location of this corner.

In place of 6"x6" squared post, set a 2½" diameter aluminum pipe monument, 5 feet long, with an aluminum cap stamped: T38N R15E, 1/4, S2, S35, T37N, 1983, S-1107. From which the following bear:

В.	Spruce	7''	N24°E,	41.84 feet
В.	Spruce	5"	S82°E	11.25 feet
В.	Spruce	5''	s28°W	34.76 feet
В.	Spruce	411	N48°W	26.50 feet
Sto	eel sign	post	West	1.00 feet

Dated at Hiles	., Wis., this.	llth	day of	March		85
Dated at Hiles Signature William B. Cochrane	Title	Land Su	urveyor	R	egistration NoS-1	.107
(County Surveyor, Register	ed Land Surve	eyor, or othe	er duly authorized o	official)		
Office of Register of Deeds, County of instrument was filed in this office for rec	Fores	st	••••••	, I herel	by certify that the v	within
instrument was filed in this office for rec	ord on the	24th	day d	of April	19	85
at 1:00 o'clock P. M.			•			
Paul Aschen	Grane	ريم				
(Register of Deeds	5)					


Describe any material discrepancy between the location of the corner as restored or (e) reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from original evidence.

(gkn) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

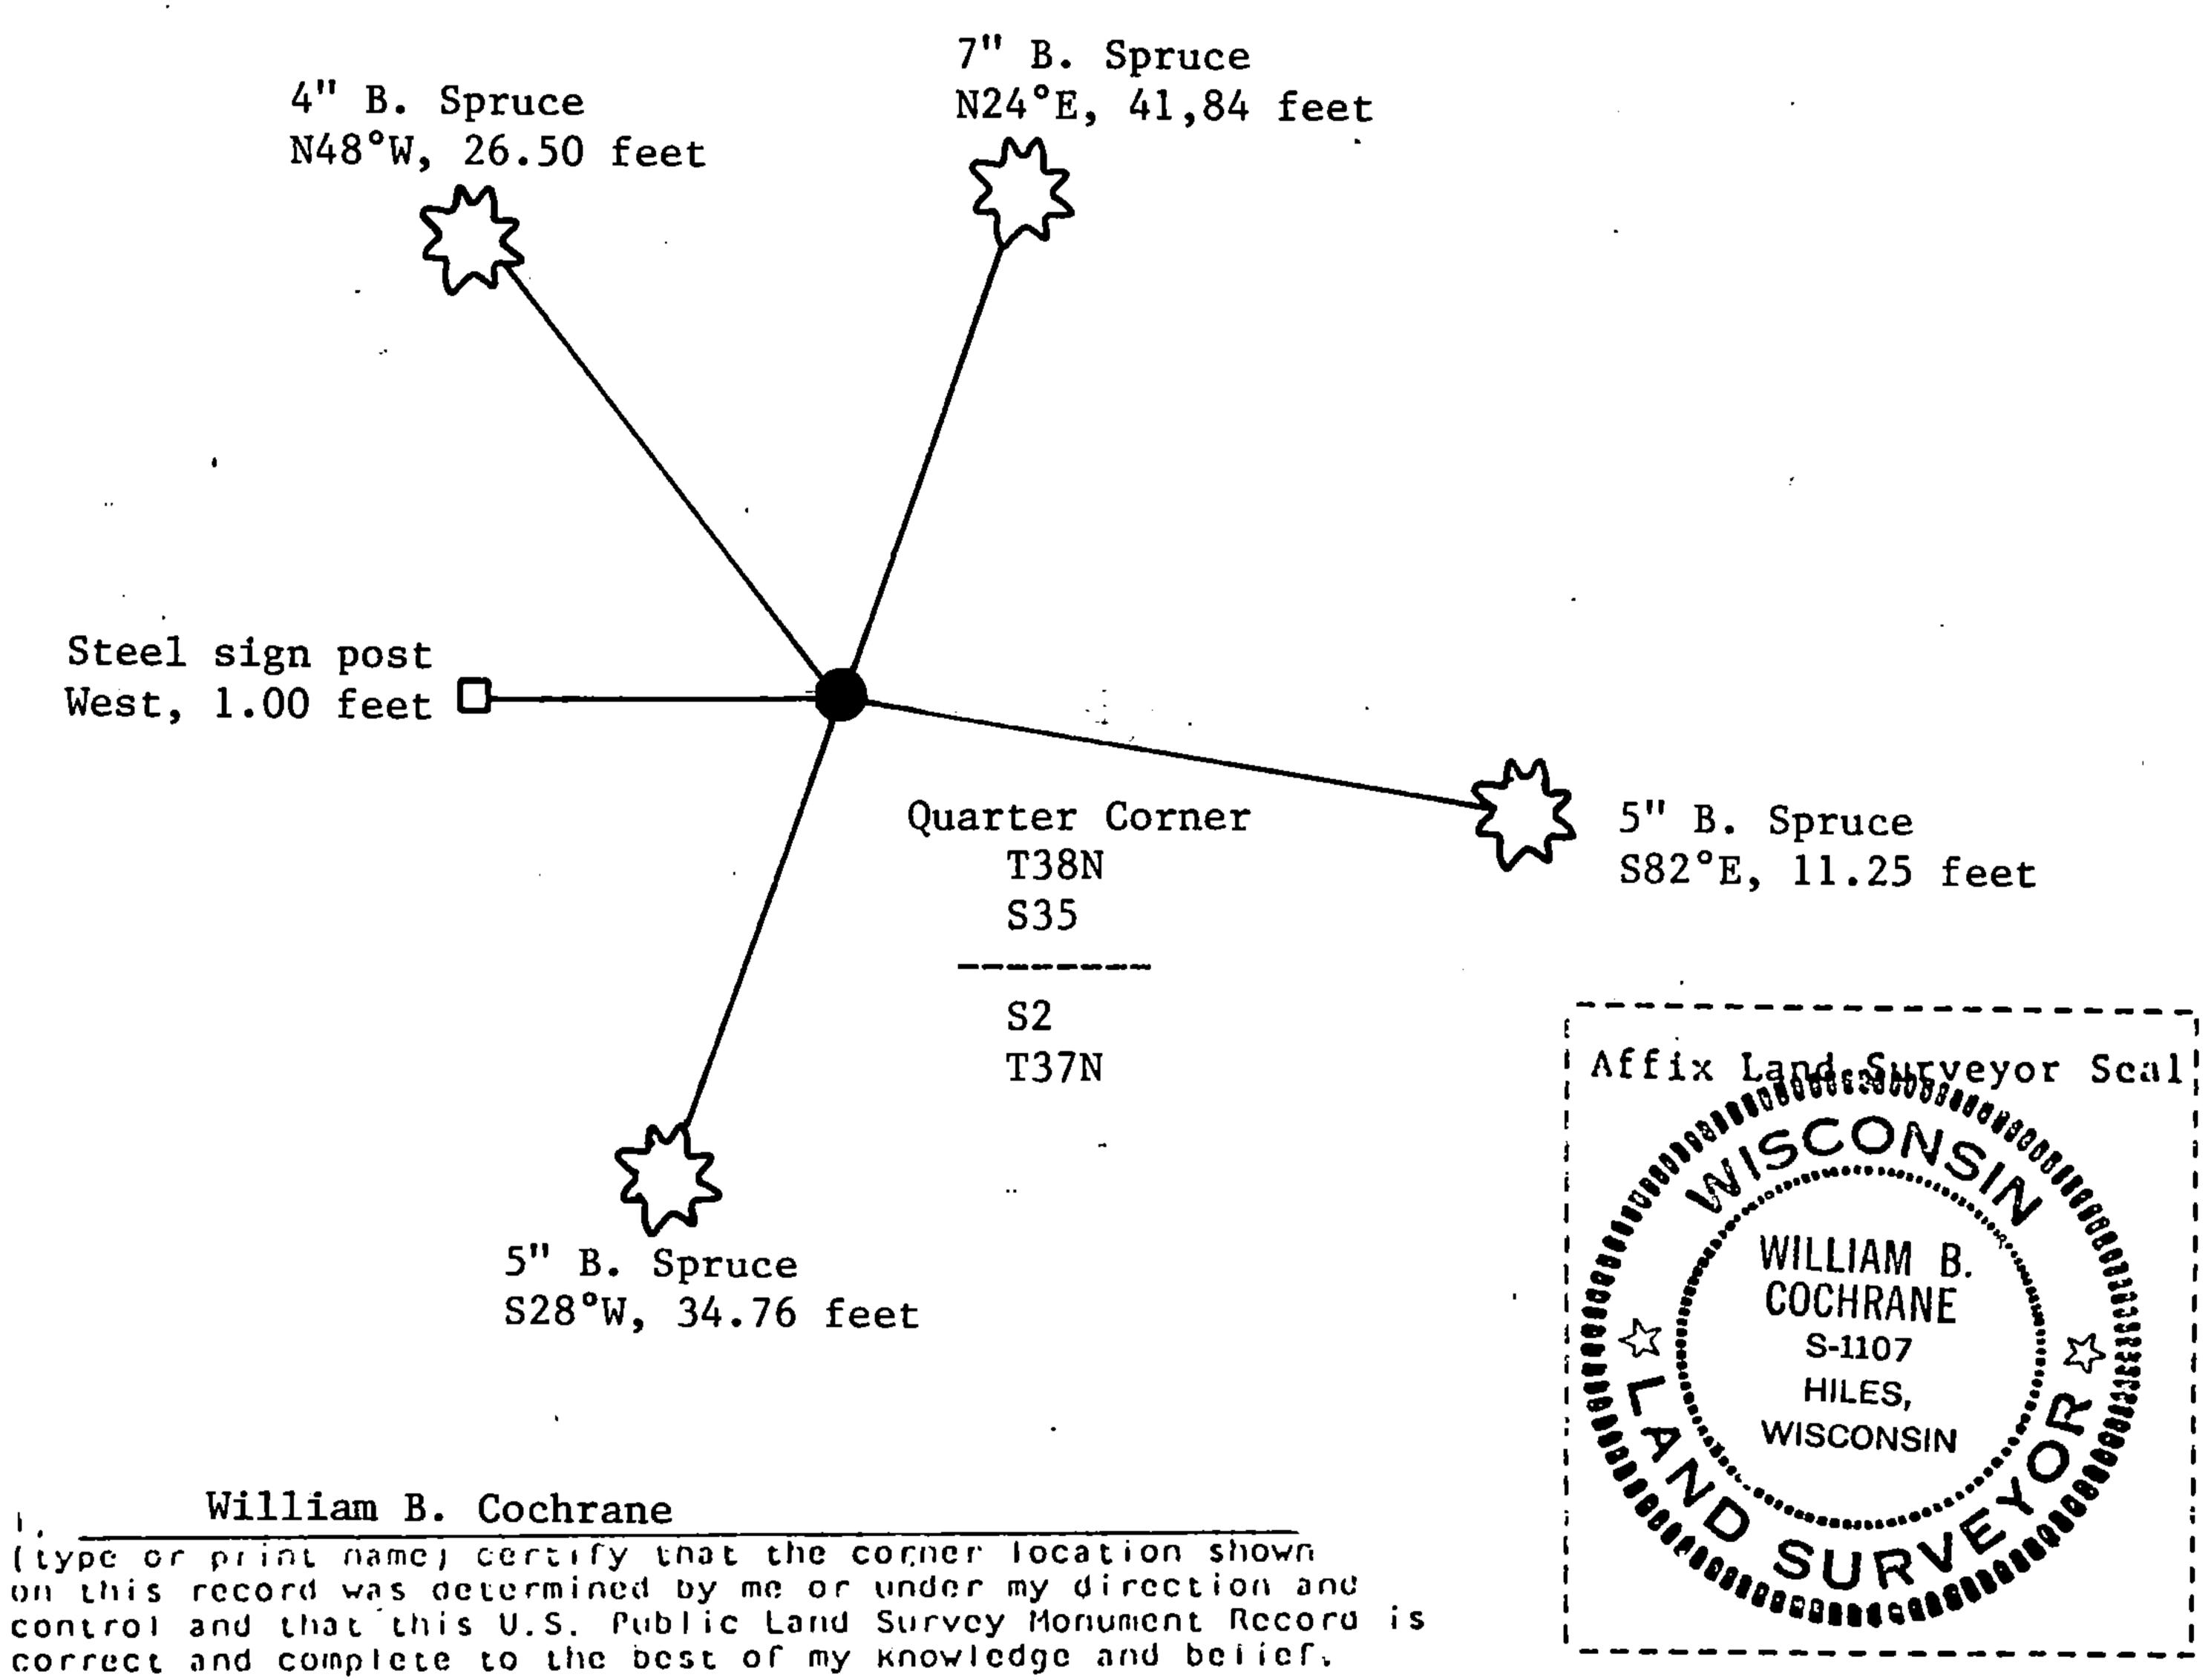

(i)

Signature