4.C.Miller Company	
H. S.	

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

State of Wisconsin County of Forest I William B. Cochrane, do hereby certify that on the 20th day	History of original Original Govern between Section from which the	ment Survey s 2 and 3, 4 following be	in 186
of August , 19 85, I found evidence of the West Quarter corner of Section 2	Fir	8'' 6''	S33
Township	South 25 chs., South 41.5 chs. Description of corn	_	ip id:
as described hereon to perpetuate the original location of this corner.	Found a 4"x4" S	Squared Cedar	Post,
Resident witnesses:	Leave swamp Sou Enter swamp Sou		
Tony Tillman	I accept the lower with original because the second		
	Description of mon	ument and acces	ssories I
State Plane Co-ordinates N- 266.046.6300 E-2,326,775.5140	In place of woo $2\frac{1}{2}$ feet in the S-1107. From wh	ground, with	an al
	Balsam Cedar Steel Sign	8'' 14" n Post	S67 N60 NW
SECTION 2	Dated at	Hiles	, \
	Signature William (C	ounty Surveyor. Re	gistered
	Office of Register of instrument was filed at 3:30 o'clock.	f Deeds, County d in this office fo	of
	Jan	Register of	Doeds)

O = Corner monument restored.

365 by William E. Daugherty and Alex McDill. South corrected chains, set Quarter Section Post to Sections 2 and 3,

Index No. C-17

7 1ks. 5 1ks.

, from which a Fir stump bears S33°W, 7 1ks.

d post as the original corner position in concurrence ence and swamp calls.

established to perpetuate the original location of this corner.

inch diameter aluminum pipe monument, 3 feet long, luminum cap stamped; T39N, R14E, 1/4, S2, S3, 1985, new blazed and scribed bearing trees bear;

alsam	811	s67°W	64.77 feet
edar	14"	N60°W	41.35 feet
teel Sign	Post	NW	2.00 feet

ated at	Hiles	, Wis., this	17th	day of	March	
gnature.	Main B. Coch	raice Title	Land	Surveyor	Registra	tion No.
	(County Surveyor, R	egistered Land Surveyor	r, or other du	ly authorized of	ficial)	
fice of Regis	ter of Deeds, County s filed in this office fo	of Fore	est 11th	dav o	, I hereby cert f March	ify that the within 1987
3:30 _{o'cl}	ock P. M.					
	Faul Ache	Grenner				
	(Register of					


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from original evidence.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

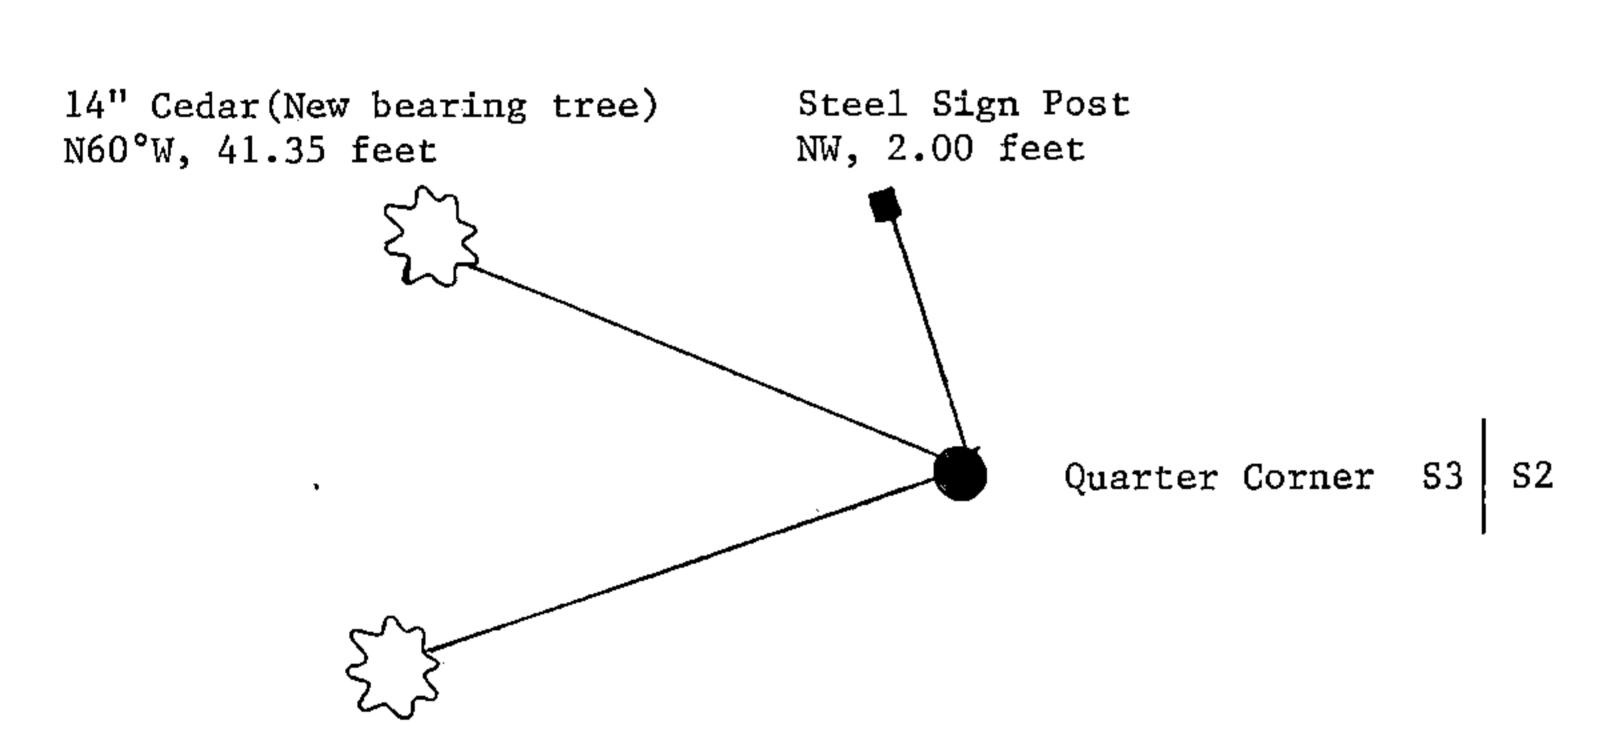

8" Balsam(New bearing tree) S67°W, 64.77 feet

(i) I. William B. Cochrane
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Villiani B. Cochrane October 7, 1980

Survey requested by; Lavar Sour 3-98

District Kanger

Date

Affix Land Surveyor Scal!

WILLIAM B.

COCHRANE

S-1107

HILES,

WISCONSIN