-
23
132
*
NUMBER
CUMENT

110		LAND	CHEVEY	SACSH ISAESIT	DECODO
U.S.	PUBLIC	LAND	SURVET	MONUMENT	RECURD

Index	Nà	R-23
INCEY	INO	

State of Wise	consin } ss.			
County of <u>Forest</u>				
certify that on the certific that on	nochrane, do hereby 10th			
Resident witnesses:				
David Brownell	· .			
State Plane Co-ordinates N- 247,930.9678 E-2,334,958.8730				
SECT	ION 25			
Corner monument	t restored			

History of original corner establishment:

Original Government Survey in 1865 by William E. Daugherty and Alex McDill. East between Sections 24 and 25, at 40 chs., set Quarter Section. Post to Sections 24 and 25, from which the following bear;

Hemlock N40°W 13 1ks. 15" S38°E 19 1ks. Sugar

Description of corner evidence found:

Found a 3" diameter Cedar Post, 3 feet AGL, with red paint on top, from which a Sugar stump hole bears S38°E, 19 1ks.

I accept the post in concurrence with original bearing tree evidence as the orginal corner position.

Description of monument and accessories I established to perpetuate the original location of this corner.

In place of wood post, set a $2\frac{1}{2}$ inch diameter aluminum pipe monument, 3 feet long, $2\frac{1}{2}$ feet in the ground, with an aluminum cap stamped; T39N, R14E, 1/4, S24, S25, 1986, S-1107. From which the following new blazed and scribed bearing trees bear;

0ak	14"	S10°E	11.65 feet
0ak	10 ''	N86°W '	12.76 feet
Steel S	Sign Post	East	1.00 feet

Dated at	пттег	, Wis., this	4/ LII	day of	January	
		Registered Land Surveyor		-		
J	(County Surveyor	, Registered Land Surveyor	r, or other di	uly authorized official	()	
Office of Register	r of Deeds, Cou	nty of Fore	est		, L hereby cert	ify that the within
instrument was f	iled in this office	e for record on the	lith	day of	March	19_ 8 /
at. 3:30 'cloc	k	ſ.		,		
<u></u>	Jaul Az	clenbrenner	~			
	(Registe	r of Deeds)				

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


See drawing below.

(f) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from original evidence.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

10" Oak(New bearing tree) N86°W, 12.76 feet

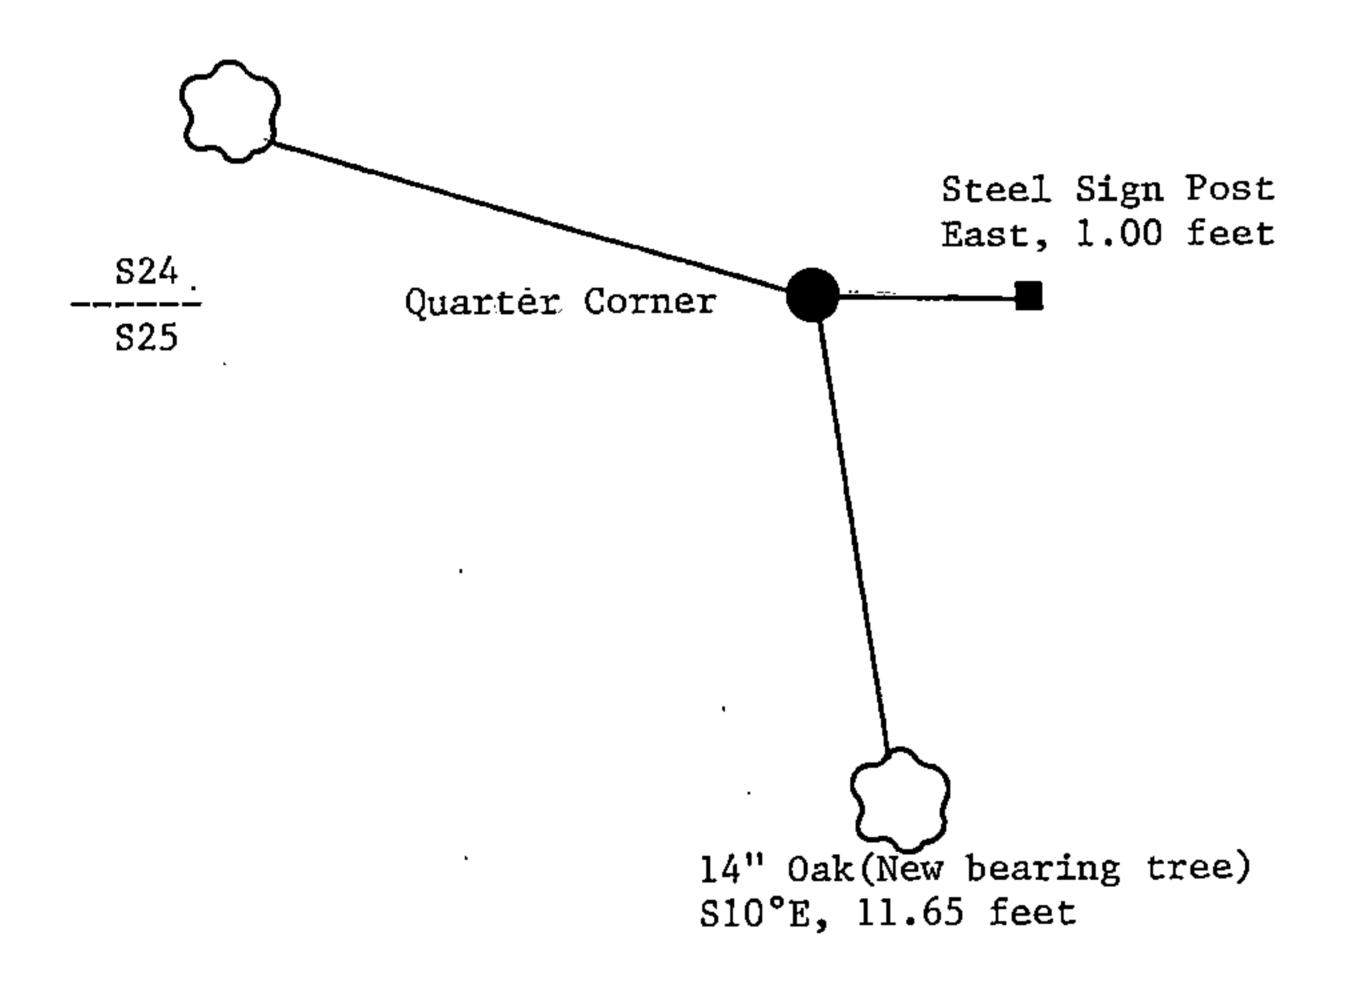

WILLIAM B.
COCHRANE
S-1107
HILES,
WISCONSIN

(i) I. William B. Cochrane

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature Signature Gammany of The Signature

Survey requested by; Sward Century 3-9-8/

District Ranger

Date