## 44018260020

## JRM NO. 985-A H.C.Miller Company (Fright) Stock No. DOCUMENT

US	PUBLIC.	I AND	SURVEY	MONUMENT	RECORD
U.U.	1 00510		2017 4 [7]	TATO (ACIAIT 14.)	

			-
		V-1	1 🔿
		\/ <b>-</b> -	ıu
Index	Nο	Y 🕹	ŁJ
	110.	<u>: •</u>	

State of Wisconsin	Liberary of original source		-	•		-
County of Forest	History of original corne	er establishnjent:			<b>L</b>	
·	Original Governmen	•	<u>-</u>	- Table 1	•	·
I <u>William B. Cochrane</u> , do hereby	Sections 26 and 35	, at 40.29 cl	hains, set Q	uarter Section I	ost, from which	the
certify that on the 18th day	following bear;		•	3		•
of September 19.91., I found evidence of the South Quarter	Birch	511	N88°E	270	1ks.	-
corner ofSection26	Birch	.8"	S81°E	_	lks.	
Township40, North, Range	On 7-13-39, Ray Le	_				a 4"x4"x40"
13 East Fourth Principal Meridian,	wood post for the					
as described hereon; and that from this evidence	Description of corner eva	idence found:				
I established a new monument and accessories	) O7/ G : 1 - 1	7 04 50 1			•	
as described hereon to perpetuate the original location of this corner.	An 874 form dated	/-24-58, desc	cribes a 14"	well point for	the corner posi	tion.
location of this coffier.	Found a 4"x4" wood	l nost laving :	Dongeide a i	lk" diameter wel	1 pino	
Resident witnesses:	†	t post Tyrng o	atongside a :	174 Grameter wes	T bibe.	
•	I accept the well	point and woo	od post ās tl	ne best availabl	e evidence for	restoring
***************************************	the corner positio	n.			•	
					•	
	Description of monumen	t and accessories	s I established t	o perpetuate the orig	ginal location of this	s corner.
	In place of well p	• -		· ·	_	
•	2½ feet in the gro		-	_	_	<del></del>
	S-1107. From which	the following	ng new blazed	d and scribed be	aring trees bea	r;
	Northeast Cor		• • • • • • • • • • • • • • • • • • • •		.8 feet	
	Maple	_	N42°W		7 feet	•
	Steel Sign Po	ST	North	0.5	0 feet	
<del> </del> <del> </del> <del> </del> <del> </del>						
	•					
SECTION 26	Dated at Hile	s .	., Wis., this	19th day of	February	19.92
	Signature William J	2 P. P.	<del></del>	Tond Comment		C 1107
	Signature WALLAGMAN	Surveyor Registers	Title	Land Surveyor or other duly authorized	Regist	tration No. S-1107
	Office of Register of Dee				_	andifee about the suitable
	instrument was filed in t			3/4 day		ertily that the within
	at 10:15 o'elock 1		71 OH (HC		Or	43
		1-1				
	Jan 1	Tockerbra	mner.			
· · · · · · · · · · · · · · · · · · ·	•	(Register of Deeds	)			
O = Corner monument restored.	Ву	·		Deputy		


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from accepted evidence.

(gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

8" Maple (New BT) N42°W, 26.77 feet Steel Sign Post
North, 0.50 feet

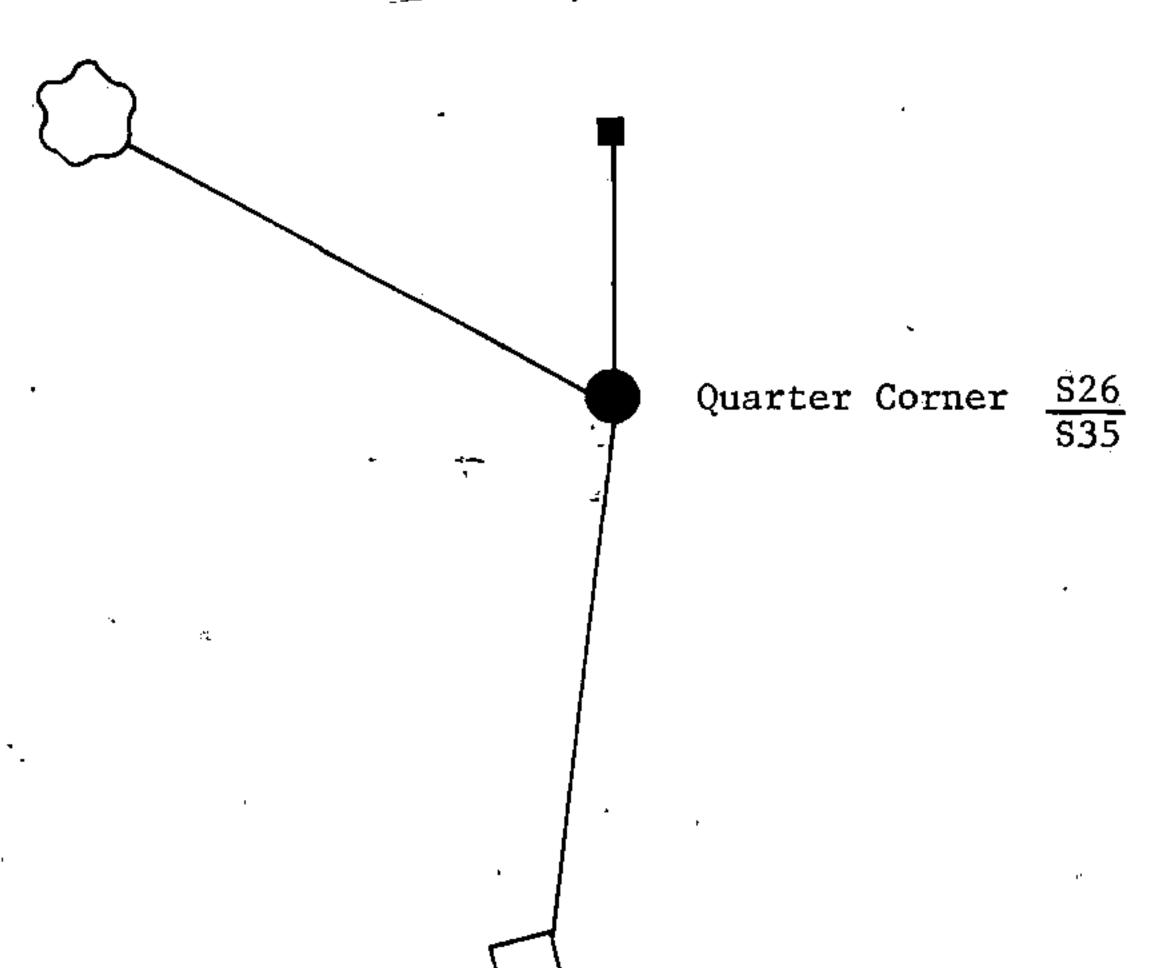

Northeast Corner of Cabin S10°W, 68.18 feet

(i) William B. Cochrane

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature B. Cochrane

May 4 1992

Survey requested by;

Can Gordi

May 4, 1992

Affix Land Surveyor Scal

MISCONE,

WILLIAM B.

COCHRANE

S-1107

HILES,

WISCONSIN

District Ranger

Date