

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Town corner to Sections 1, 6, 31, and 36,
T.34-35N., R.15-16E.

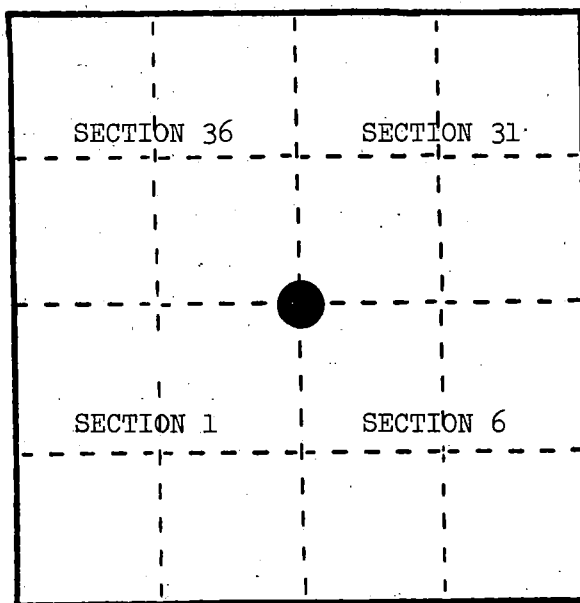

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Hemlock, 40", S.56°W., 65 links; Hemlock, 18", N.42°W., 43 links; Hemlock, 24", N.60°E., 14 links; Linn, 14", S.63°E., 36 links.


June 1, 1965, Resvick and Harris found mound of rock around post point and location poster (unreadable).

September 26, 1983, Milo Stefan found rock mound and pulled for original BTs: Stump hole, N.42°W., 28.4'; Stump hole, N.60°E., 9.24'; Progeny from Basswood stump, S.63°E., 24.00'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. White Ash, 9", N.41°E., 55.58'
3. Sugar, 18", S.81°E., 26.21'
4. Basswood, 6", S.32°W., 26.27'
5. Sugar, 10", N.57°W., 14.82'
6. Steel Sign Post, Northwest, 1.2'

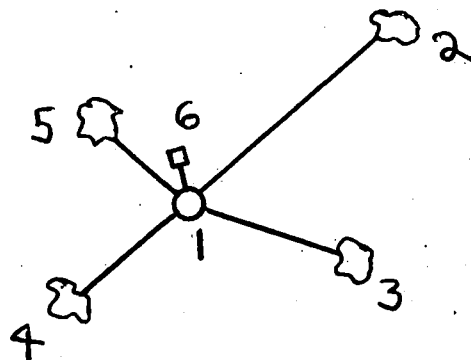

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day

of January... A.D., 1985

at 2:00 o'clock... P.M. and

recorded in Vol. CORNER RESTORATION

on page A-1

Paul A. Schenker
REGISTER

A-1

43515360000

34-16

A
1

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

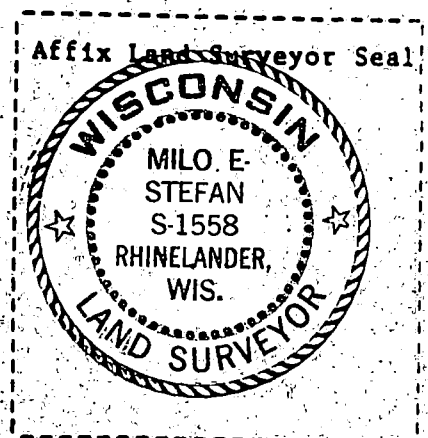

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 6 and 31, T.34-35N.,
R.16E.

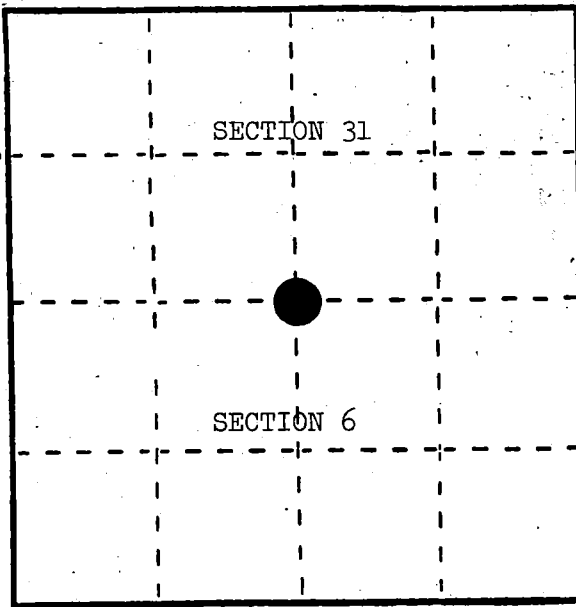

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set quarter section post with the following BTs: Sugar, 14", N.32°W., 19 links; Sugar, 10", S.58°W., 17 links.


June 15, 1936, John Hammes found 4" Cedar stake, put location tag on post.

April 16, 1984, Alan Harrison found Cedar post on ground with tag. Stump hole from post, S.58°W., 11.5'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
- Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Basswood, 5", N.77°E., 18.35'
2. Sugar, 5", S.35°W., 17.01'
3. Black Cherry, 7", N.35°W., 38.35'
4. Steel Sign Post, Southeast, 1.4'
5. 2" x 36" aluminum monument stamped to identify the corner.

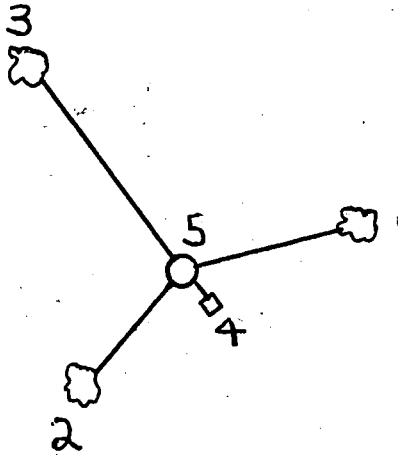

REGISTER'S OFFICE
Forest County, Wis.

Received for record this.....day
of.....A. D., 19.....at

...2:00...o'clock...P.....M. and

recorded in Vol. **CORNER RESTORATIONS**

on page A-3.

Paul H. Schreiner
REGISTER

REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d); above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

Date

11/27/84

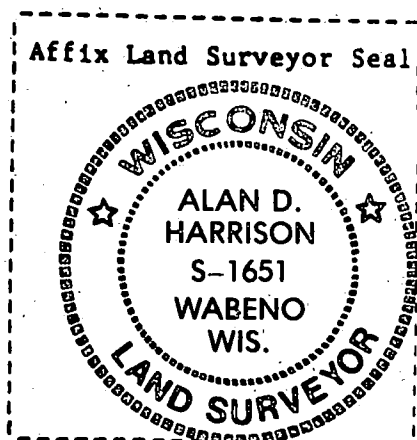

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 5, 6, 31, and 32, T.34-35N., R.16E.

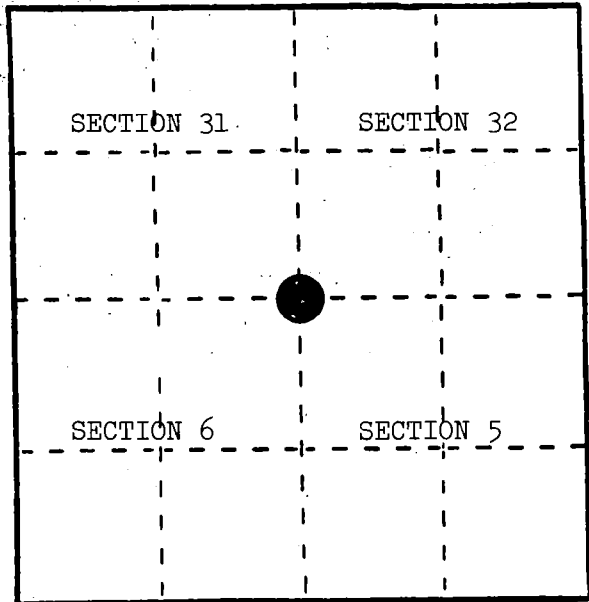

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Yellow Birch, 34", N.62°W., 52 links; Hemlock, 28", N.53°E., 28 links; Hemlock, 12", S.55°E., 38 links; Cedar, 10", S.20°W., 29 links.


December 19, 1934, R. Dangremond found a 28" high wooden post in good condition. Found no original BTs--does not believe to be original. Put metal tag on a post south of corner 8 chains on north side of road.

April 18, 1984, Alan Harrison found rock cairn. Pulled to N.62°W., 34.3', center of large Birch stump; N.53°E., 18.5', center of large Hemlock stump. We placed a 2" x 36" aluminum monument in rock cairn.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Sugar Maple, 7", N.8°E., 34.85'
2. Spruce, 5", S.61°E., 19.35'
3. Sugar Maple, 6", S.84°W., 24.14'
4. Yellow Birch, 4", N.54°W., 33.57'
5. Steel Sign Post, Northeast, 1.8'
6. 2" x 36" aluminum monument stamped to identify the corner.

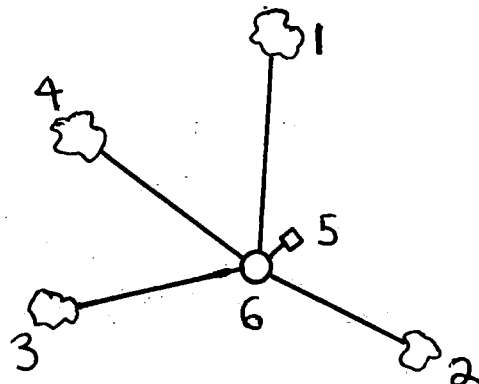

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day

of January, 1985, at

2:00 o'clock, P.M. and

recorded in Vol. CORNER RESTORATION

on page A-5

Paul Aschenbrenner

REGISTER

A-5

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

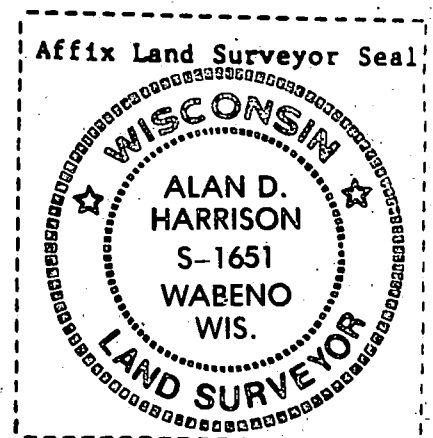

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 4, 5, 32, and 33, T.34-35N., R.16E.

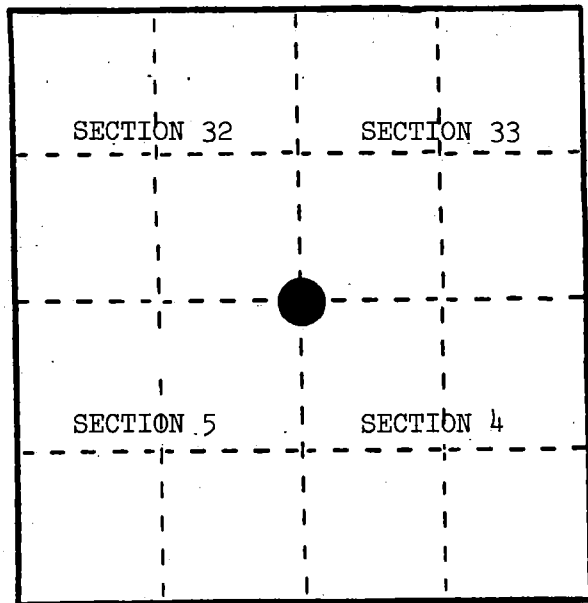

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Tamarack, 10", N.70°W., 106 links; Tamarack, 5", N.30°E., 70 links; Tamarack, 5", S.27°E., 118 links.


January 11, 1935, Dangremond found Tamarack stake 36" high. New Bts: Spruce, 3", N.25°E., 12 links; Spruce, 3", S.10°W., 7 links; Spruce, 3", N.45°W., 15 links.

July 26, 1973, Resvick found Forest Service tag on a Spruce, 6", N.53°E., 15 links; Spruce, 4" snag scribed S-4 BT, S.40°E., 9 links; a 1" squared Cedar stake found 8" below the moss, point of old post found by picket. No evidence of BTs, swamp is deep and could cover the stumps.

October 17, 1983, Alan Harrison found corner as described above. Accepted as the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

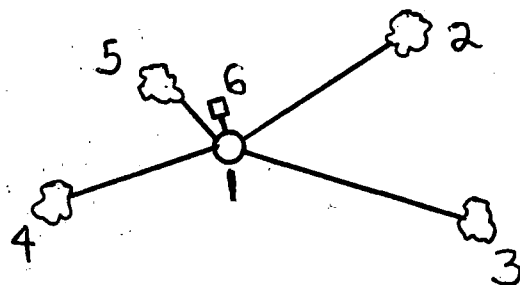

- 2" x 60" aluminum monument stamped to identify the corner.
- Tamarack, 3", N.50°E., 36.38'
- Tamarack, 10", S.72°E., 46.51'
- Tamarack, 9", S.79°W., 39.06'
- Tamarack, 4", N.48°W., 14.03'
- Steel Sign Post, Northwest, 1.4'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of... January... A. D., 1985 at
... 2:00 P. M. and

recorded in Vol. CORNER RESTORATIONS
on page A-9

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(1) I, Alan Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

Date

11/27/84

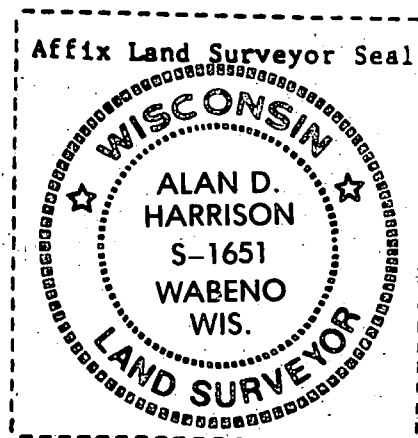

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 4 and 33,
T.34-35N., R.16E.

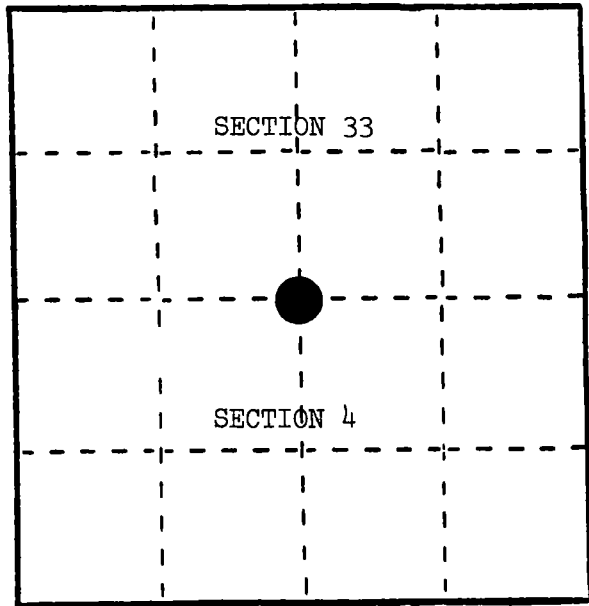

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Yellow Birch, 10", N.5°W., 21 links; Fir, 9", S.37°W., 6 links.


December 20, 1934, Leonard Sobczak found Cedar post 28" high in good condition. Found no original BTs. Put tag on post. Corner is located in swamp 4 chains 56 links south of road. Poster on roadside describes location of corner.

April 16, 1984, Alan Harrison measured 4.56 chains from road south as per 874 slip. Found scribed Cedar stump. Found old post remains and post point in mud and steel sign post left by Resvick. From post point, N.5°W., 13.9', Birch stump remains; S.37°W., 4.0', root system of conifer.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Black Ash, 5", N.64°E., 39.53'
2. Black Spruce, 8", S.40°E., 21.38'
3. Balm of Giliad, 12", S.7°W., 35.70'
4. Steel Sign Post, Northwest, 1.6'
5. Scribed Cedar stump, 12", S.11°E., 25.0'
6. 2" x 60" aluminum monument stamped to identify the corner.

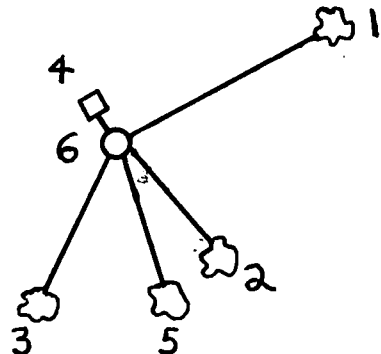

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of... January... A.D., 1985 at

... 2:00 o'clock... P... M. and

recorded in Vol. CORNER RESTORATIONS

on page... 11...
Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated corner.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

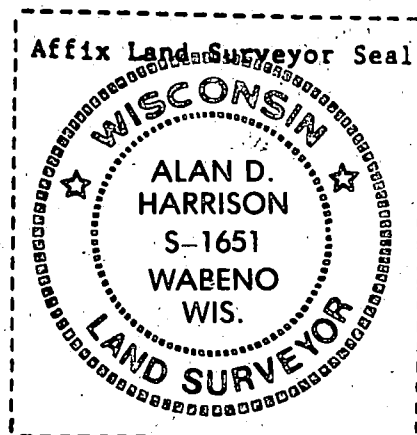

11/27/84


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to 3, 4, 33, and 34, T.34-35N., R.16E.

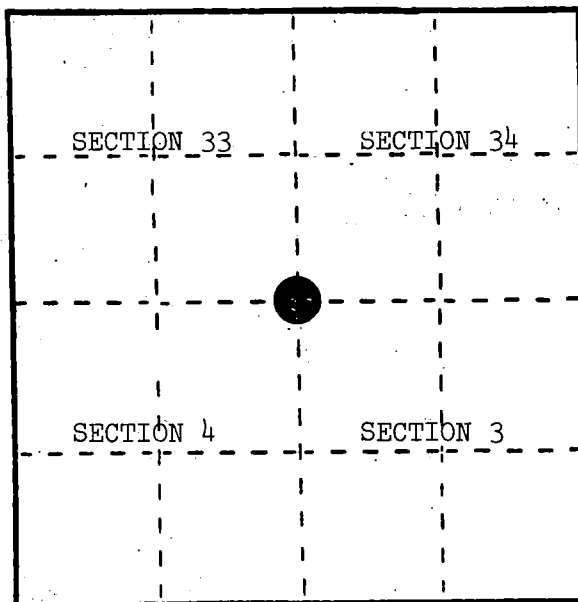

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Hemlock, 12", N.50°W., 11 links; Hemlock, 12", N.16°E., 26 links; Cedar, 12", S.40°E., 4 links; Hemlock, 10", S.43°W., 33 links.


December 13, 1934, L. Sobczak found 24" high Cedar post in good condition. No BTs. Corner is located at edge of swamp, in slash.

October 20, 1983, Alan Harrison found 4" squared Cedar post with metal tag, from which bears: Turned-out Cedar, S.40°E., 2.6'; Hemlock stump, N.50°W., 7.3'; Hemlock stump, N.16°E., 17.2'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Black Ash, 5", N.86°E., 42.06'
- Black Cherry, 5", S.10°E., 36.34'
- Sugar, 5", S.26°W., 60.51'
- Black Ash, 4", N.23°W., 27.95'
- Steel Sign Post, East, 1.2'

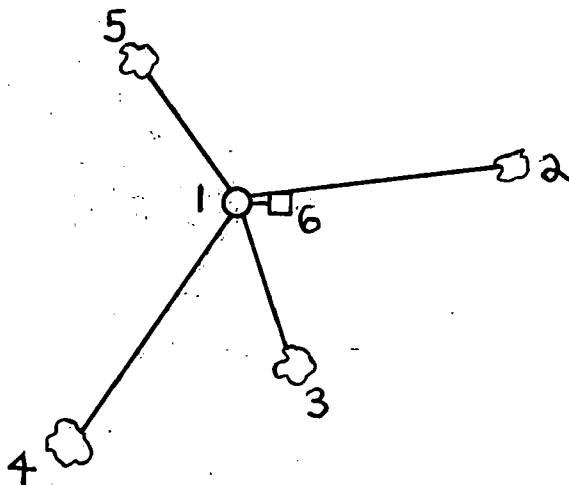

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 23rd day
of January, A.D., 1985 at
... 2:00 o'clock... P...M. and
recorded in Vol. CORNER RESTORATIONS
on page A-13
Paul A. Schenckner
REGISTER

A-13

T34-16

4351633 0000

A
13

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

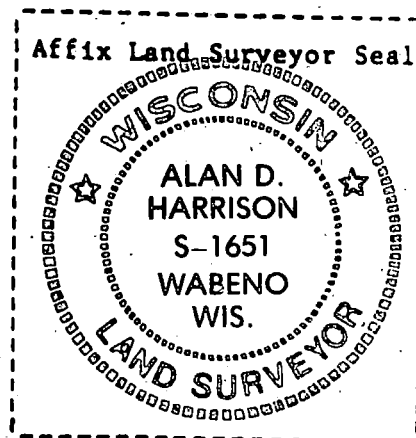


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 3 and 34, T.34-35N., R.16E.

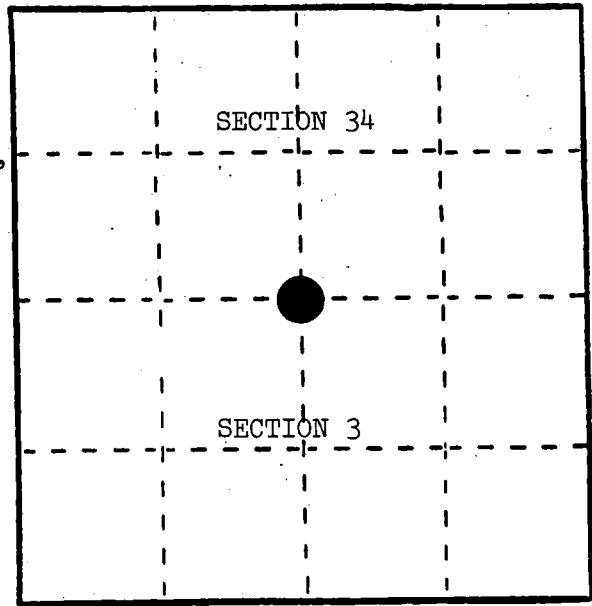

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Cedar, 10", N.32°E., 8 links; Yellow Birch, 10", S.15°W., 14 links.

April 16, 1984, Harrison and Huettl found no evidence of corner. Proportionate position falls in Aspen clearcut. Set quarter at proportionate position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum pipe with aluminum cap stamped to identify the corner.
- Tamarack, 6", N.43°E., 79.31'
- Black Cherry, 3", S.22°E., 34.88'
- Steel Sign Post, 7', Southwest, 1.81'
- Steel Sign Post, 7', Northwest, 1.1'

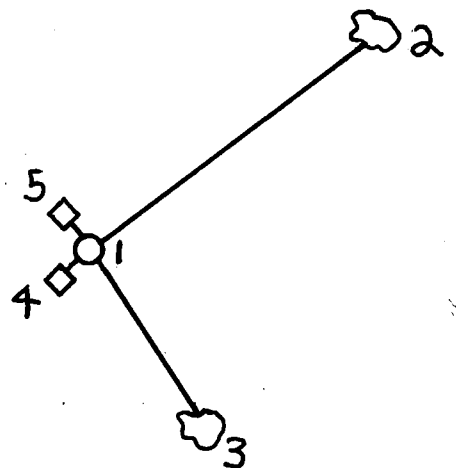

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this 23rd day
 of January, A.D., 1985
 at 6:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATIONS

on page A-15

Don A. Schaeffer
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

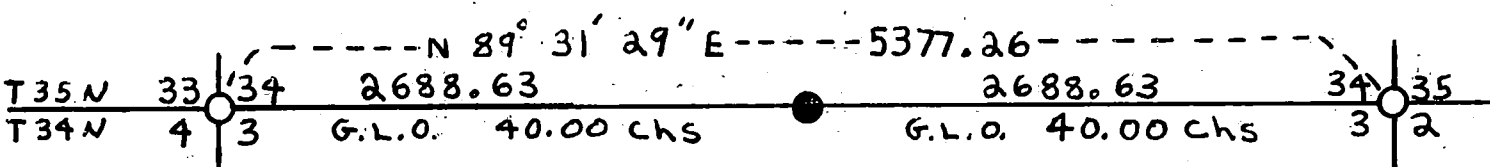

Affix Land Surveyor Seal

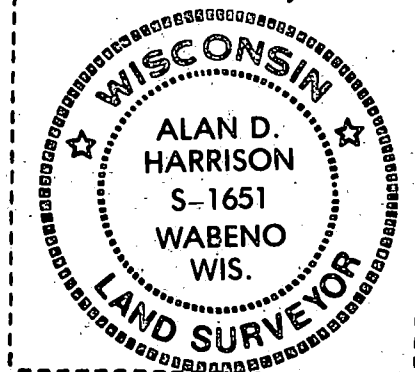

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 2, 3, 34, and 35, T.34-35N., R.16E.

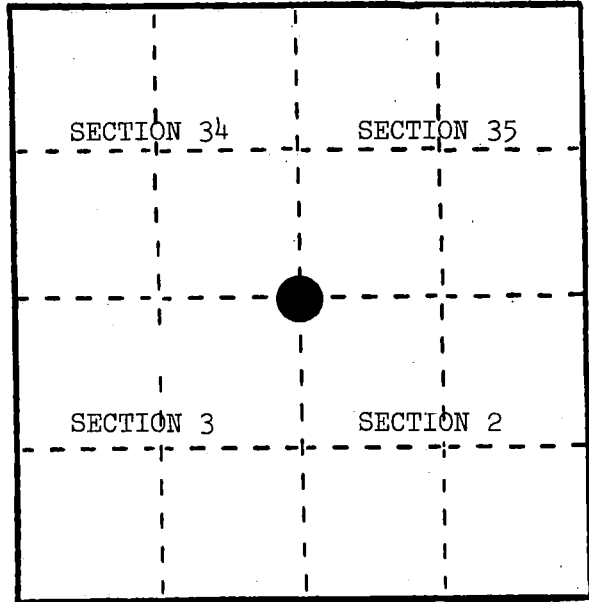

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Tamarack, 12", N.20°W., 8 links; Tamarack, 12", N.15°E., 9 links; Tamarack, 13", S.20°E., 30 links; Tamarack, 11", S.15°W., 5 links.


March 8, 1935, L. Sobczak found corner consisting of a Spruce tree with a metal tag on it. He did not believe this to be original. No BTs.

October 20, 1983, Alan Harrison found a Spruce snag with location tag, 7' south of squared picket. April 16, 1984, from picket located remains of BTs: Stump remains of Tamarack, N.20°W., 5.3'; No remains, N.15°E., 5.9'; Tamarack stump, S.20°E., 19.2'; Tamarack stump, S.15°W., 3.3'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 60" aluminum monument stamped to identify the corner.
- Tamarack, 13", N.53°E., 41.89'
- Yellow Birch, 10", S.49°E., 11.06'
- Black Spruce, 12", S.87°W., 65.51'
- Black Spruce, 12", N.59°W., 29.60'
- Steel Sign Post, Northwest, 1.4'

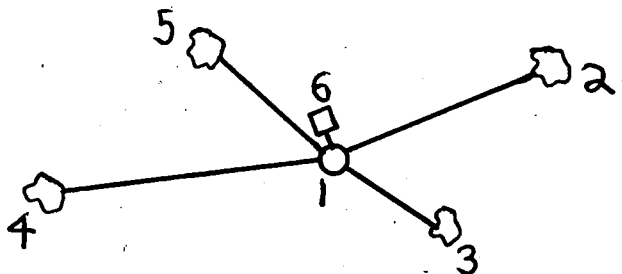

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day

of January A. D., 1985 at

... 10:00 o'clock ... P ... M. and

recorded in Vol. CORNER RESTORATIONS

on page A-17

Paul A. Schenck
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/27/84

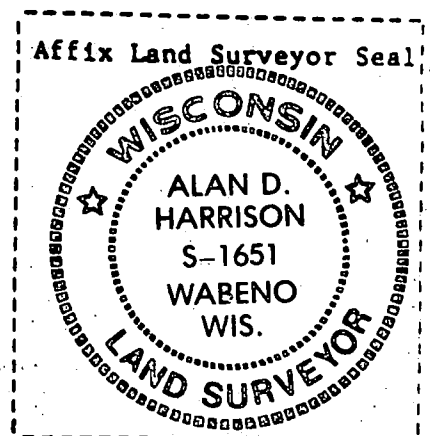

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 10th day of June, 1982, I found evidence of the North Quarter corner of Section 2 Township 34 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis
40.00 chains, set wood post
Cedar, 10", N35°E, 15 lks.
Cedar, 9", S48°W, 11 lks.



Description of corner evidence found:

Cedar stump, S48°W, 11 lks., 7.3 feet
Local Evidence: Old Cedar post lying in swamp and post point
Cedar, 14", with pencil writing in. Overgrowth indicates tree was blazed 70 years ago, or more.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced wood post point with a 2" x 60" aluminum monument with tablet stamped as follows:
T35N, R16E, S35, 1/4, S2, T34N, 1982, RLS-1558
From which the following bear:
Hemlock, 10", S47°E, 13.51 feet
Hemlock, 12", S62°W, 55.34 feet
Cedar, 6", N15°W, 12.95 feet
Steel Sign Post, Northwest, 1.0 feet

DOCUMENT NO.
124232

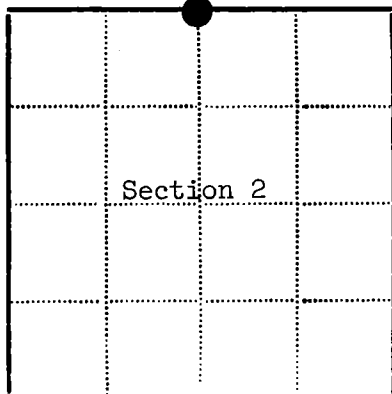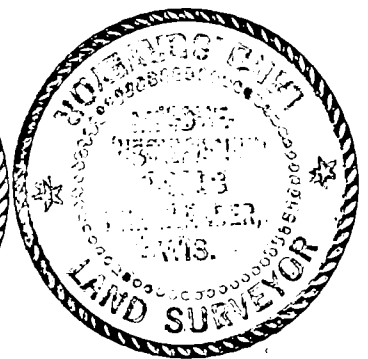

● - Corner monument restored
□ -

Resident witnesses _____

Dated at Rhinelanders Wisconsin, this _____ day of 1983.

Signature *Milo E. Stefan* Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 15th day of September 1983, and was filed in Book No. _____ Page No. _____ of County Records.

Signature *Eugene Stegany* Title Register of Deeds

Township 34 North, Range 16 East, Section 2, Index No. A-19, Page No. 12

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 1, 2, 35, and 36,
T.34-35N., R.16E.

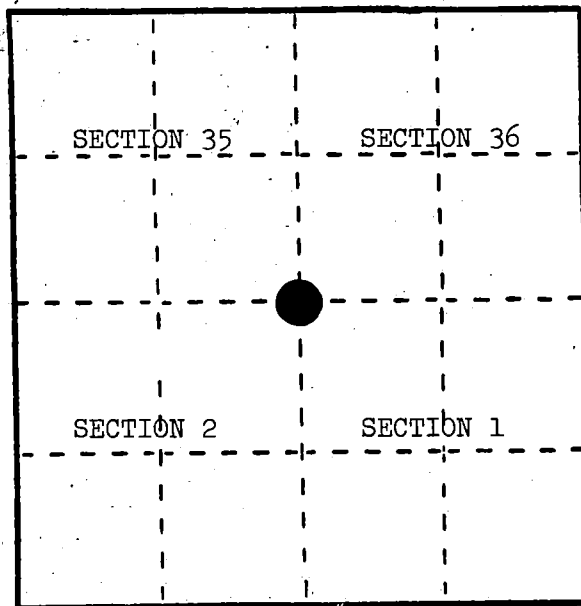

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Sugar, 11", N.67°W., 39 links; Linn, 14", N.72°E., 49 links; Sugar, 12", S.72°E., 82 links; Sugar, 14", S.50°W., 15 links. March 11, 1935, L. Sobczak found corner consisting of a blazed Maple in good condition. He did not believe it to be original. No BTs.

April 19, 1984, Alan Harrison set proportionate position. Found no evidence of corner position. Set corner at proportionate position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 8", N.5°E., 24.56'
3. White Birch, 8", S.62°E., 16.61'
4. Sugar, 9", S.11°W., 8.25'
5. Basswood, 12", S.78°W., 1.88'
6. Steel Sign Post, Northwest, 2.0'

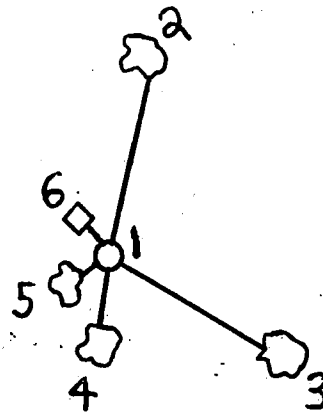

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of... January... A.D., 1985 at
... 2:00 o'clock... P.M. and

recorded in Vol. CORNER RESTORATIONS

on page... 21...
Paul Ascham
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate.

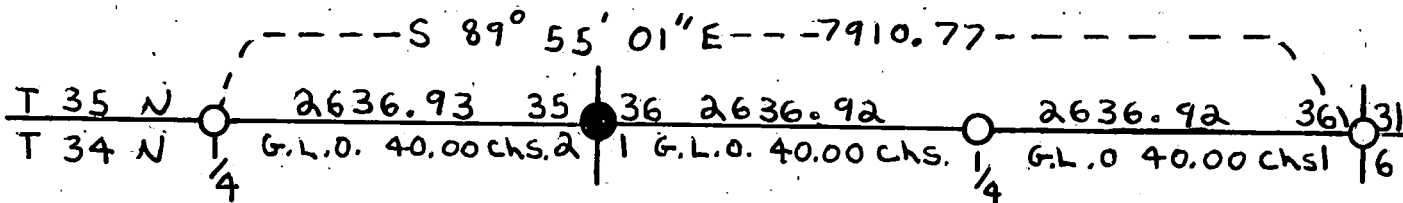

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

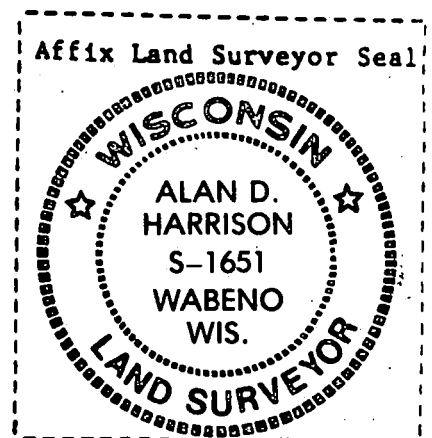


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 1 and 36,
T.34-35N., R.16E.

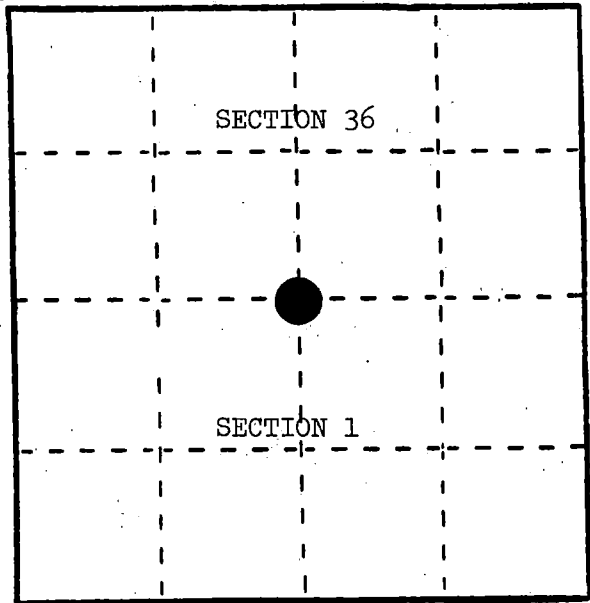

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Beech, 14", N.5°W., 49 links; Beech, 16", S.33°E., 46 links.

April 19, 1984, Alan Harrison set proportionate position. Searched area, found 3 blazed trees 20' south of position. No evidence of corner here. Set corner proportionately.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify corner.
- Sugar, 14", N.21°E., 26.25'
- Yellow Birch, 5", S.28°E., 20.35'
- Beech, 13", N.15°W., 14.26'
- Steel Sign Post, Southwest, 1.5'

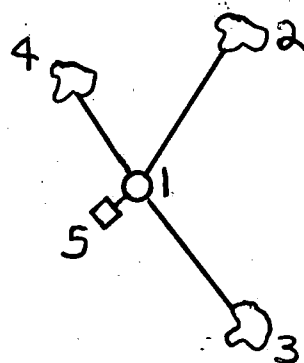

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of... January... A.D., 1985

... 2:00 o'clock... P... M. and

recorded in Vol. CORNER RESTORATION

on page 133

Paul Aschauer
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

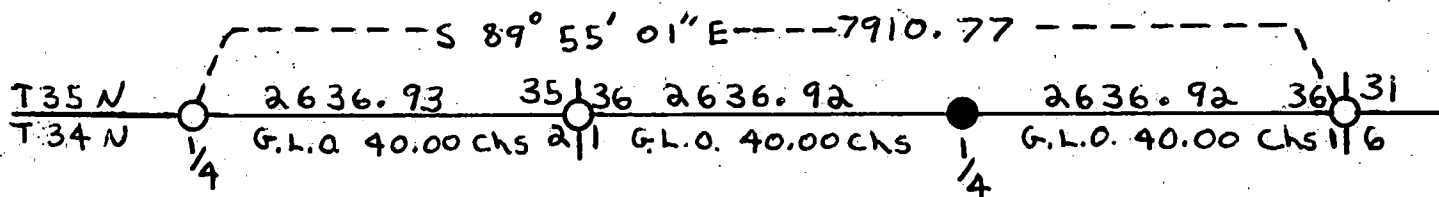

Affix Land Surveyor Seal



(1) I, Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 1, 6, 31, and 36,
T.34-35N., R.16-17E.

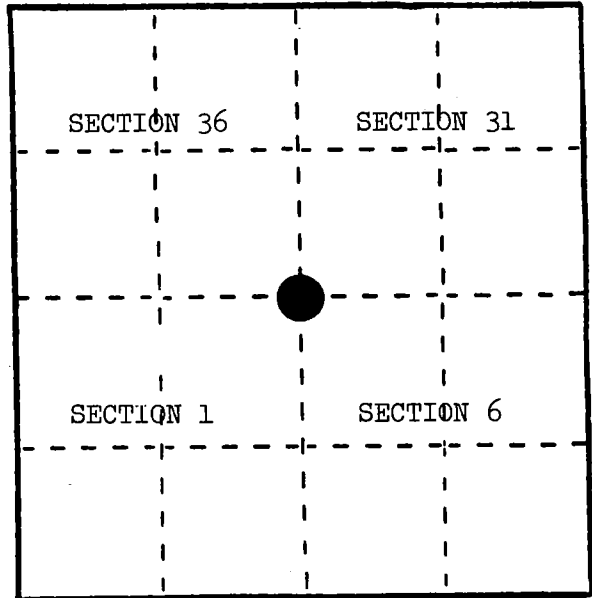

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set post for Township corner.


In 1935, Marinette County resurvey, by Frank Gould, set a 4" iron pipe with brass cap.

June 30, 1981, Milo Stefan found County monument, as set by Gould.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 4" x 36" iron pipe with tablet stamped to identify the corner.
- Sugar, 6", N.51°E., 18.81'
- Sugar, 7", S.65°E., 25.50'
- Sugar, 10", S.24°E., 31.35'
- Basswood, 10", N.13°W., 18.94'
- Steel Sign Post, South, 2.2'

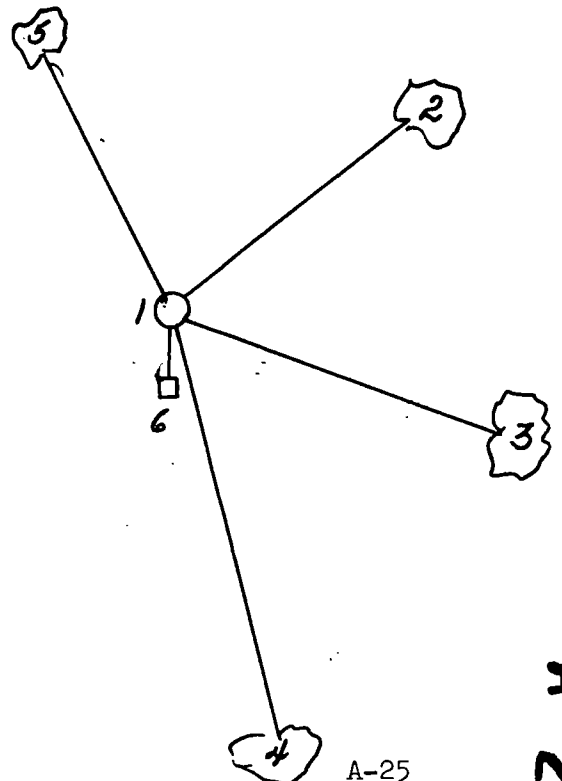

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day
of January, A.D., 1985

at 2:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATION

on page 25

Paul E. Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 1 and 6, T.34N., R.15-16E.

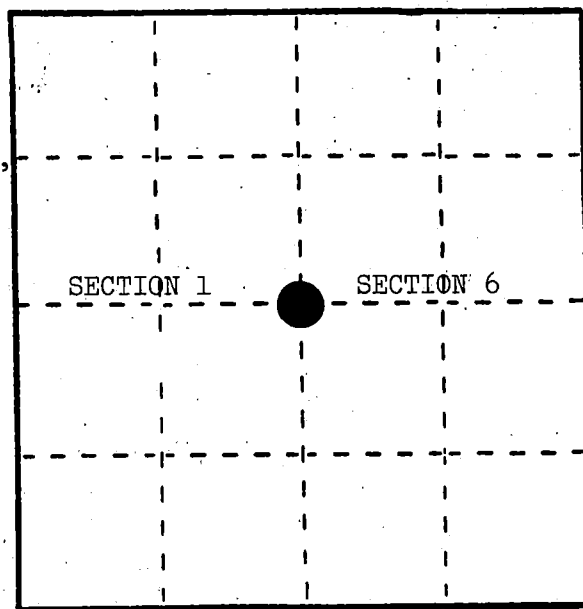

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set post with following BTs: Cedar, 12", N.80°W., 8 links; Cedar, 14", S.32°E., 19 links.


October 17, 1934, Stabo and Savee found stake in center of road; Yellow Birch BT, 12", SW $\frac{1}{2}$ chain, (not original); location poster of 4" Aspen, 1 $\frac{1}{2}$ chains north of corner.

September 22, 1983, Milo Stefan found base of Cedar post on west side of road and Yellow Birch stump, SW $\frac{1}{2}$ chain from road center. From new BT and 874 post, we restored corner position in Lindsey Road.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. "x" on large rock 8" below road surface.
2. Reference corner (2" x 36" monument) stamped to identify corner, S.36°E., 27.51'
3. Black Spruce, 8", N.50°E., 27.54'
4. Black Ash, 5", N.87°W., 23.63'
5. Red Maple, 5", N.28°W., 78.47'

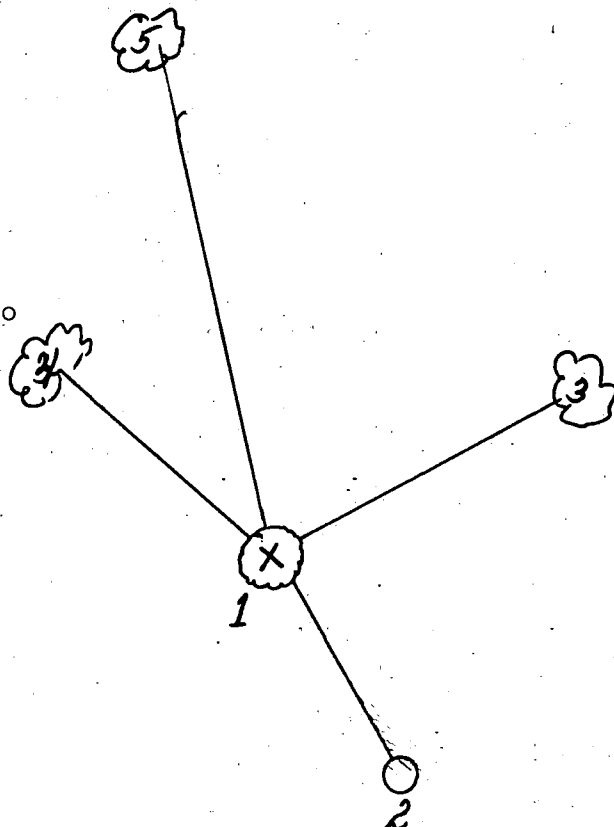

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of January, A.D., 1985

at 2:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATIONS

on page 1

Paul Aschenbrenner
REGISTER

C-1

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 26 day of July, 1973, I found evidence of the east quarter corner of section 6 Township 34 north, Range 16 east, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1858 by James McBride 38.10 chains South corrected between sections 5 and 6 set post.
 Tam. 7 inches, bears S78°E 21 lks.
 W. Pine 8 inches, bears N71°W 13 lks.



Description of corner evidence found:

1. Old post point
2. W. Pine snag scribed, bears N71W 13 lks.
3. Tamarack stump scribed, bears S78E 21 lks.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced old post point with 2 inch inside diameter galvanized pipe 5 feet long filled with concrete with a brass cap marked T34N, R16E, 1/4, S6, S5, 1974, S-802

From which the following new bearing trees bear
 Cedar 5 inches bears S21°E 11.68 ft.
 Cedar 12 inches bears N31°W 11.30 ft.
 Steel post 1.0 N. E.

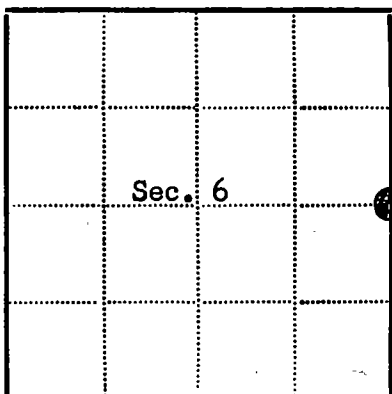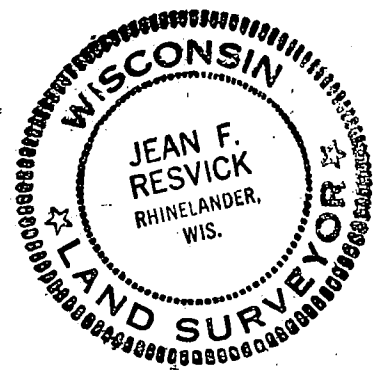

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 21 day of Feb. 1974.

Signature Jean F. Resvick Title Land Surveyor
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT No. 105089

Office of Register of Deeds County of FOREST

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 1974, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutz Title Register of Deeds

Township 34 North, Range 16 East, Section 6, Index No. C-5, Page No. _____

H3416 06 2000

C 5


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**I N S T R U C T I O N S :**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 4 and 5,
T.34N., R.16E.

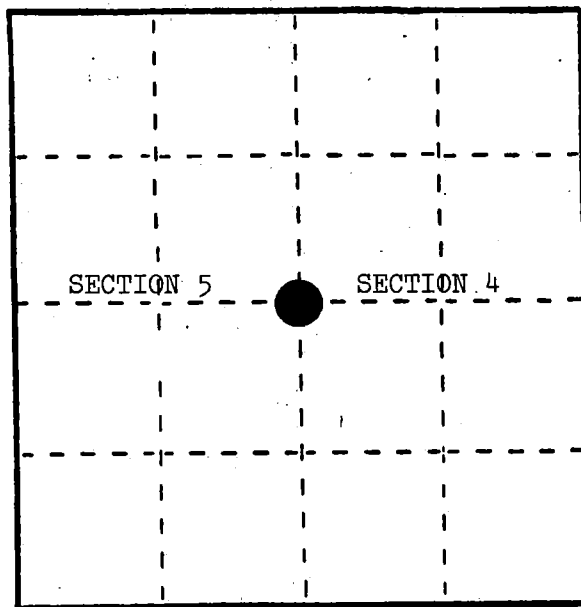

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Basswood, 11", West, 8 links; Sugar, 13", N.49°E., 11 links.

May 2, 1984, Alan Harrison found remains of Cedar post. Pulled from post hole and found Basswood clump, West, 5.28'; Stump hole of Sugar, N.49°E., 7.5'. Set corner from post hole and stumps.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Steel Sign Post, Northwest, 1.35'
3. Iron Pipe, 1", N.35°E., 3.48'
4. Iron Pipe, 1", S.61°E., 4.26'
5. Iron Pipe, 1/2", S.30°W., 3.24'

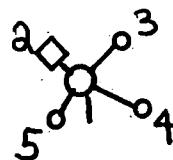

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of January A.D., 1985 at
... 2:00 o'clock... P..... M. and

recorded in Vol. CORNER RESTORATIONS

on page C-9

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated corner.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

11/27/84

Date

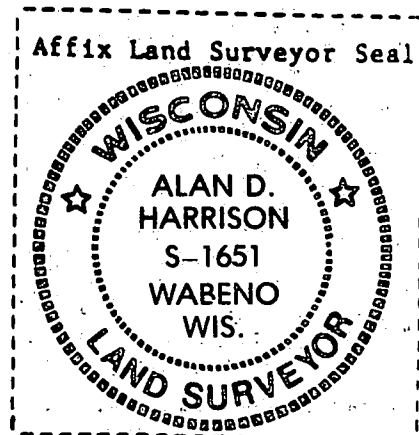

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 3 and 4,
T.34N., R.16E.

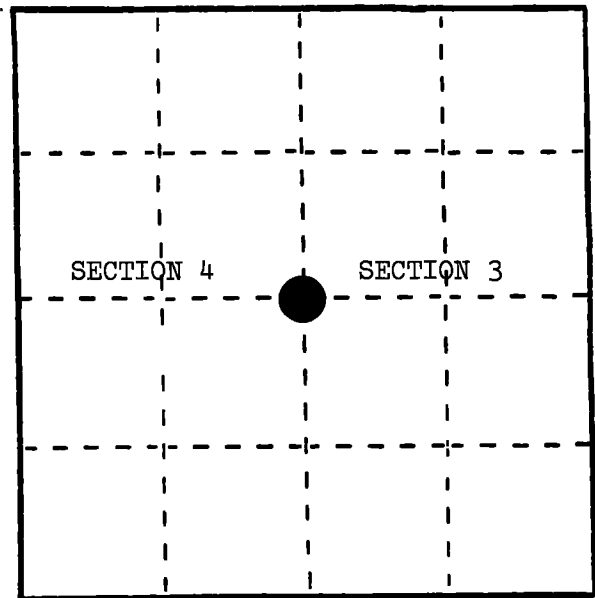

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Spruce, 12", N.26°E., 20 links; Spruce, 12", S.40°W., 14 links.


September 11, 1973, Stefan and Tallier found 15" Spruce stump with $\frac{1}{4}$ scribing visible on face. Distance chained from good section corner-south. Set steel sign post at bearing and distance from BT found.

May 2, 1984, Alan Harrison found corner as described, no other evidence found.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 60" aluminum monument stamped to identify the corner.
- Cedar, 8", N.68°E., 29.54'
- Cedar, 8", S.20°E., 27.10'
- Cedar, 6", N.87°W., 20.51'
- Steel Sign Post, North, 0.9'
- Steel Sign Post, South, 1.4'

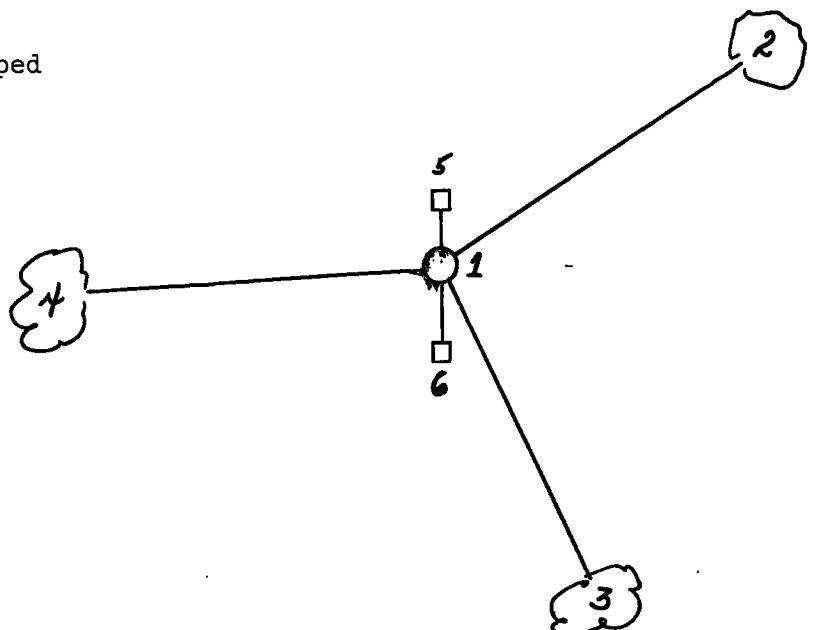

REGISTER'S OFFICE)
Forest County, Wis.)
Received for record this 23rd day
of January, A.D., 1985 at
... 2:00 o'clock... P...M. and
recorded in Vol. CARNER... RESTORATIONS
on page 6-13...
Paul A. Schenck
REGISTER

43416012000

C-13

C 13

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date

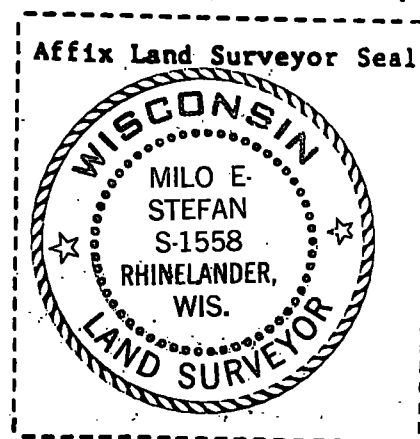


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 2 and 3, T.34N., R.16E.

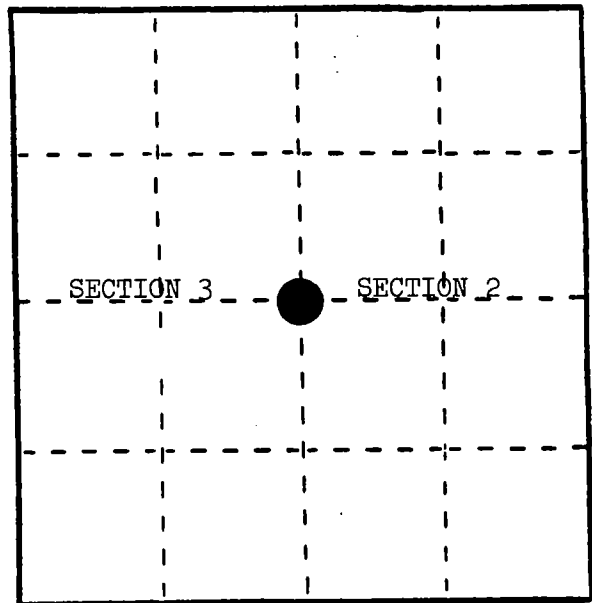

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Fir, 8", N.78°E., 4 links; Hemlock, 8", S.53°W., 20 links.

June 13, 1984, Alan Harrison set proportionate position. Conducted search, found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Red Maple Clump (2), 10", N.31°E., 14.89'
- Cherry, 5", S.13°W., 57.02'
- Basswood, 8", N.55°W., 34.19'
- Steel Sign Post, East, 1.10'

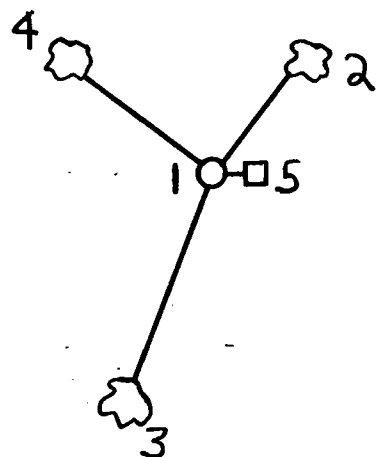

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day
of January, A.D., 1985

at 2:00 o'clock P. M. and

recorded in Vol. CORNER RESTORATIONS

on page 17
Paul Aschauer
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate between section corners $\frac{1}{2}$ mile north and south.

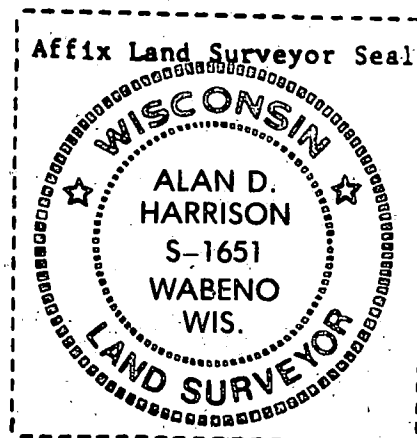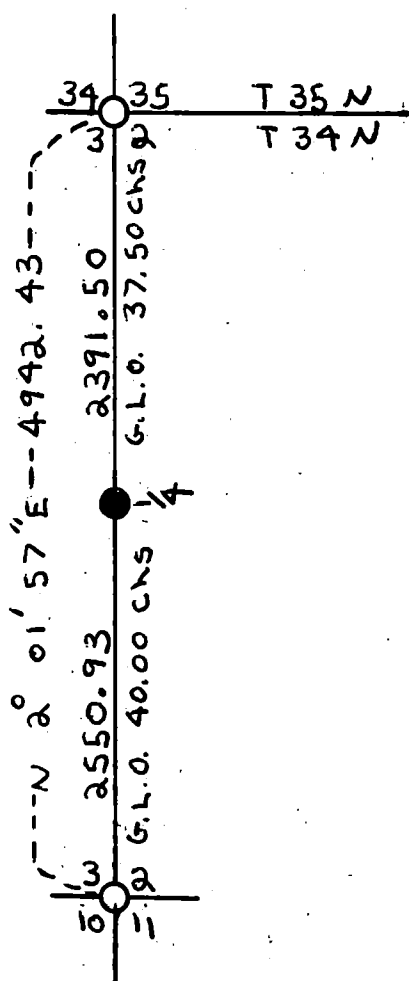

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

11/27/84

Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 1 and 2, T.34N., R.16E.

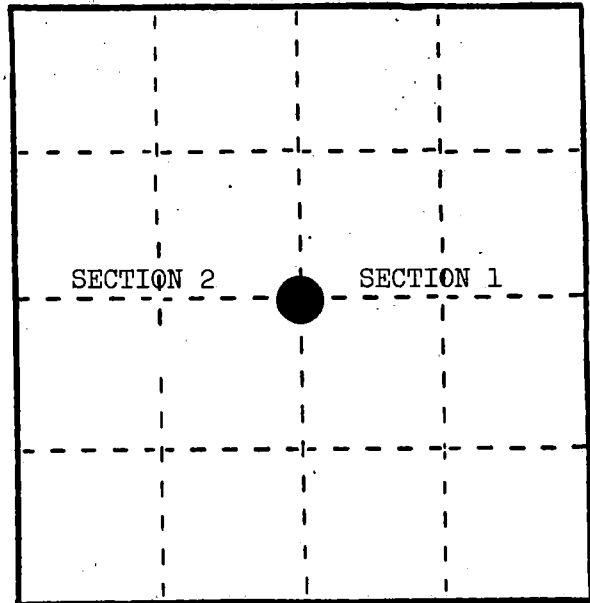

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Beech, 10", N.72°E., 20 links; Sugar, 20", S.87°W., 19 links.

June 19, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 11", N.80°E., 3.75'
3. Sugar, 10", S.30°W., 32.17'
4. Sugar, 11", N.48°W., 28.10'
5. Steel Sign Post, South, 1.29'

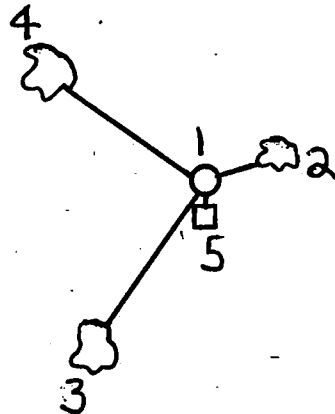

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day
of January, 1985, at
2:00 P.M. and

recorded in Vol. CORNER RESTORATIONS

on pages 21-22
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


Yes.

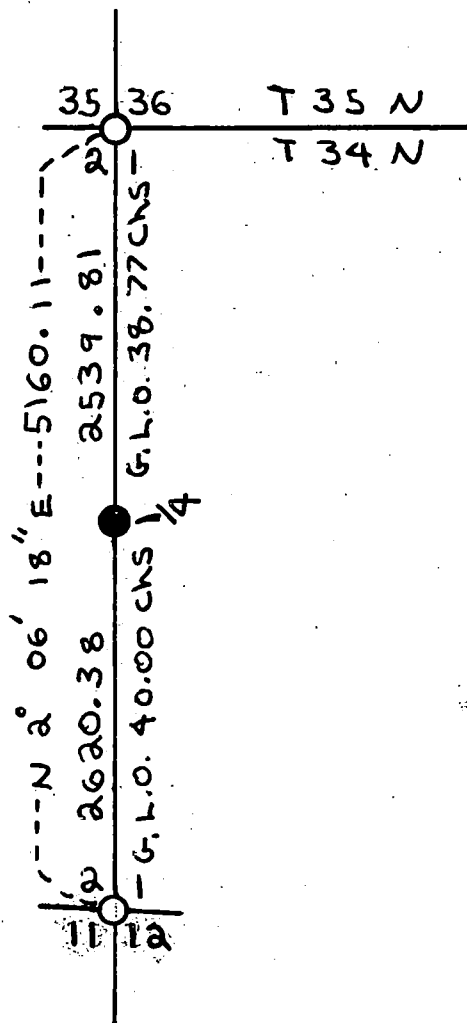

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

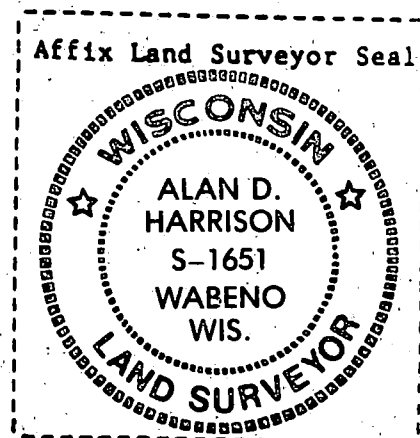

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter corner to Sections 1 and 6,
T.34N., R.16-17E., Forest and
Marinette Counties, Wisconsin.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 18th day


of DECEMBER A.D., 1982 at

11:00 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page C-25

Paul Hechschimmer
Register of Deeds

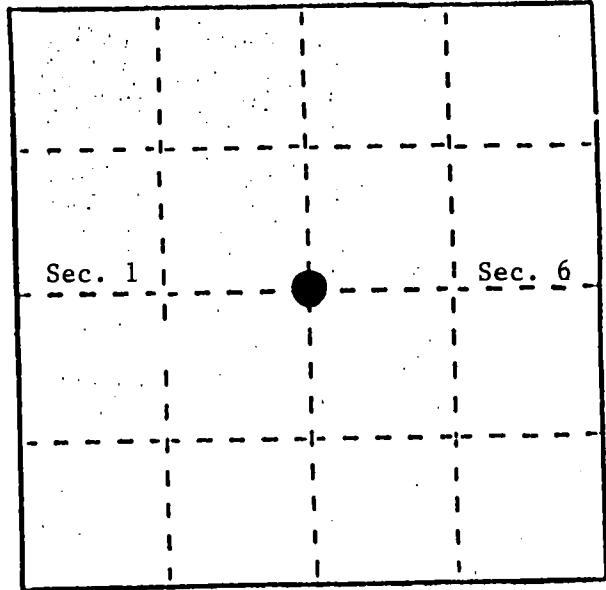

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839 T. Sprague set quarter post and made the following B.T.'s: Hemlock, 12", S.62°W., 23 links (15.18 feet); Hemlock, 12", N.30°W., 25 links (16.50 feet).

In 1935 Marinette County Surveyor F. P. Gould set a four inch iron post with brass cap for corner by proportion.


In 1975 J. Resvick found corner by Gould and made the following B.T.'s: W. Spruce, 7", N.81°W., 13.57 feet; W. Spruce, 7", N.04°W., 2.91 feet.

In 1989 Alan Harrison found corner by Gould and B.T.'s by Resvick. B.T. N.04°W. was cut down on property line. Made two new B.T.'s.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 4" Marinette County Monument stamped to identify corner location.
2. Balsam, 7", S.40°W., 37.33 feet (new).
3. W. Spruce, 9", N.81°W., 13.57 feet.
4. W. Spruce, 6", N.09°W., 24.86 feet (new).
5. Steel sign post, South, 1.82 feet.

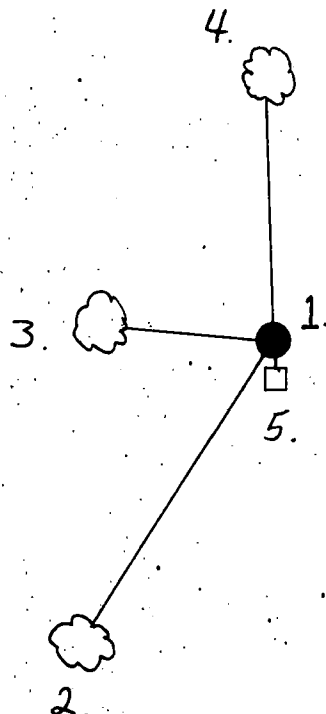

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

U.S.A.

MARINETTE COUNTY


LANDS

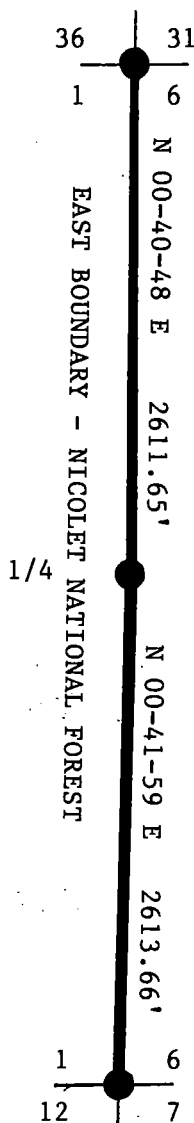

U.S.A.

PRIVATE LANDS

— = MARKED BOUNDARY LINE OF
U.S. GOVERNMENT LANDS

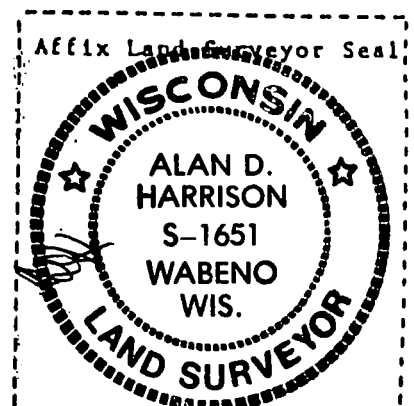

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards
Acting District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 20th day of February, 19 75,
I found evidence of the east quarter corner of Section 1
Township 34 North, Range 16 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Surveyed in 1839 by Thomas Sprague
40 chains north between Sections 1 and 6 set post
Hemlock 12, S62W, 23 lks
Hemlock 12, N30W, 25 lks
Resurvey in 1935 by Marinette County Surveyors F. P. Gould and B. F. Hammes
Set a 4" iron post for the 1/4 corner to sections 1 and 6. Corner established by
measurement.

Description of corner evidence found:

Found 4" diameter pipe set by F. P. Gould and B. F. Hammes with a brass cap stamped:
MARINETTE CO - SURVEY,
T34N, R16E, 1, 1/4, 6, T34N, R17E

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:
W. Spruce 7 inch diameter, bears N81W 13.57 feet
W. Spruce 7 inch diameter, bears N4W 2.91 feet
Nailed sign on Plantation Post 2 feet SW of the monument

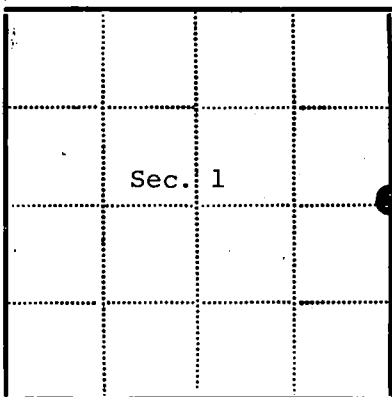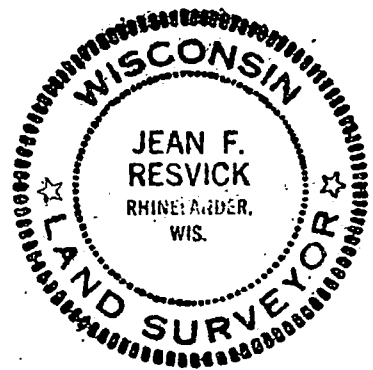

- - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 20 day of March,
19 75.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 Document Number 106865

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
on the 31st day of March, 19 75, and was filed in Book
No. Restorations Page No. C-25 of County Records.

Signature Eugene Statym Title Register of Deeds

Township 34 North, Range 16 East, Section 1, Index No. C-25, Page No. 25

434116012000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 1, 6, 7, and 12,
T.34N., R.15-16E.

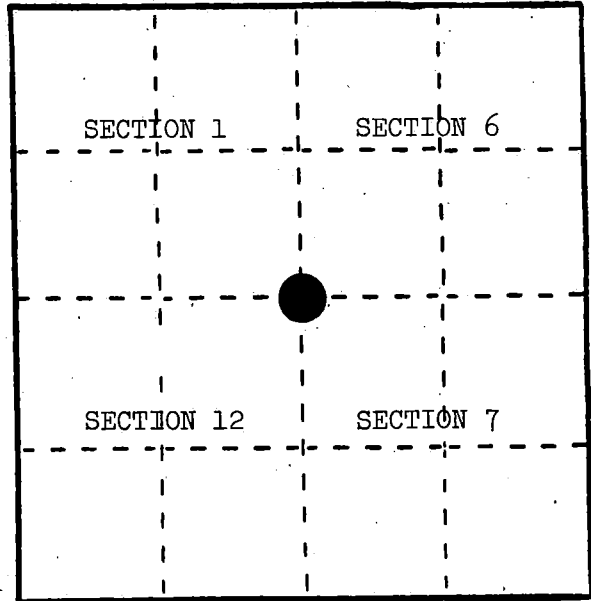

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set section post with the following BTs: Sugar, 14", N.54°E., 49 links; Sugar, 12", S.25°E., 26 links; Ironwood, 10", S.34°W., 16 links; Hemlock, 12", N.53°W., 13 links


October 17, 1934, Stabo and Savee--corner in center of road. Found BT, Maple, 11", N.80°E., 1/2 chain. Location poster on 11" Maple, corner bears S.80°E., 1/2 chain.

September 22, 1983, Milo Stefan found location poster on 6" x 5' black and white Cedar post on east side of road. Blazed line west.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 5", N.38°E., 54.83'
- Sugar, 8", S.61°E., 34.86'
- Basswood, 9", S.27°W., 40.42'
- Sugar, 12", N.61°W., 34.01'
- Steel Sign Post, West, 9.5'

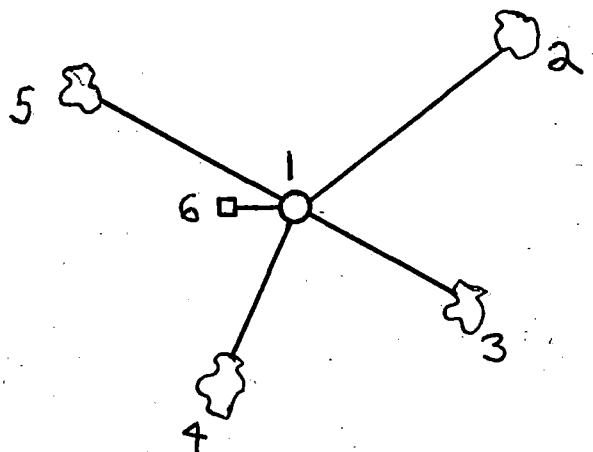

REGISTER'S OFFICE
Forest County, Wis.

Received for record this... 23rd day
of January... A.D., 1985 at
... 2:00 o'clock... P.M. and

recorded in Vol. CORNER RESTORATIONS

on page 5-1
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or; (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal



(i) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 6 and 7, T.34N., R.16E.

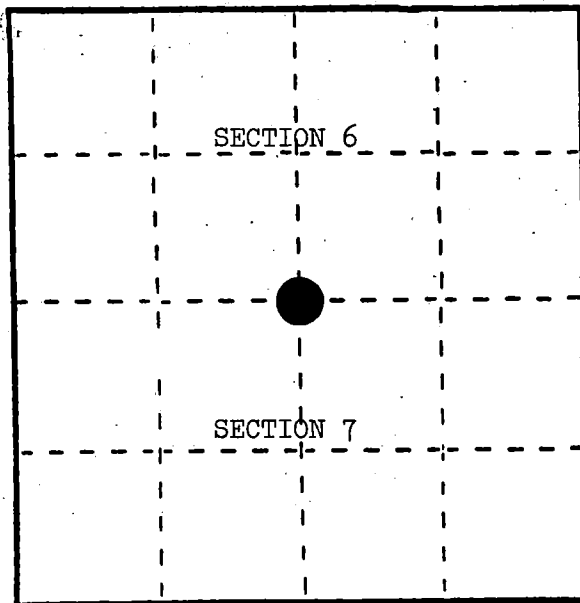

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Hemlock, 12", N.18°E., 41 links; Birch, 12", S.33°W., 15 links.

February 21, 1984, Alan Harrison found 1/2" iron pipe. From pipe, S.33°W., 10', stump depression. Accepted as corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Aspen, 4", S.44°E., 21.54'
3. Aspen, 3", S.45°W., 10.25'
4. Elm, 6", N.3°W., 57.59'
5. Steel Sign Post, North, 1.5'

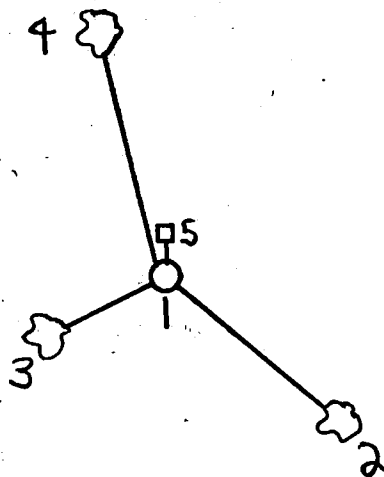

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day

of January A.D., 1985 at

.....2:00 o'clock.....P.....M. and

recorded in Vol. CORNER RESTORATIONS

on page F-3

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal

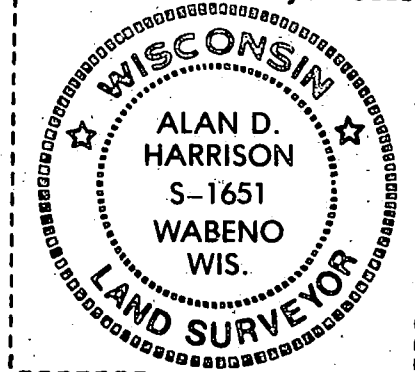

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 18 day of September, 19 73, I found evidence of the South East Section corner of Section 6 Township 34 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Survey in 1858 by James McBride 80.00 chains North between sections 5 and 8, set post Cedar, 10 inches, bears N44°E 21 lks.
 B. Ash, 12 inches, bears S26°E 32 lks.
 Cedar 12 inches, bears S75°W 30 lks.
 Cedar 10 inches, bears N17°W 35 lks.

Description of corner evidence found:

1. Remains of wood post
2. Remains of Cedar stump, bears N44°E 21 lks.
3. Black Ash stump, bears S26°E 32 lks.
4. Cedar snag bears S75°W 3 lks.
5. Remains of Cedar stump bears N17°W 35 lks.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced wood post with 2 inch inside diameter galvanized pipe, 3 ft. long filled with concrete with a brass cap marked: T34N, R16E S6, S5, S7, S8, 1974 S-802
 From which the following new bearing trees bear:
 Cedar 8 inches bears S60°E 15.74 ft.
 Cedar 5 inches bears S40°W 26.99 ft.
 Steel post N.E. 1.0 ft.

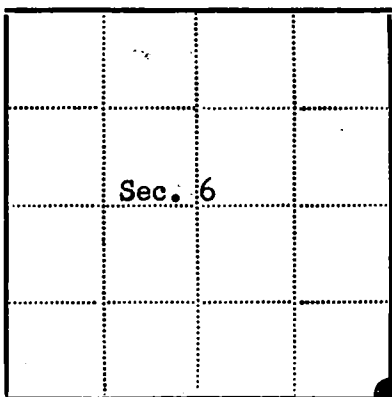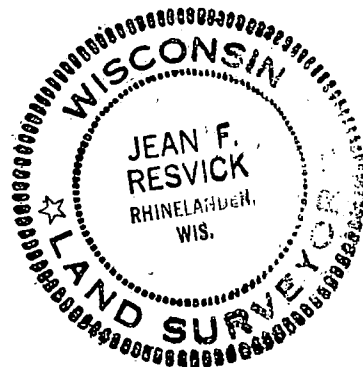

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 21 day of Feb. 19 74.

Signature Jean F. Resvick Title Land Surveyor
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT No. 105090

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 19 74, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Batzner Title Register of Deeds

Township 34 North, Range 16 East, Section 6, Index No. E-5, Page No. _____

43416040000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 5 and 8, T.34N., R.16E.

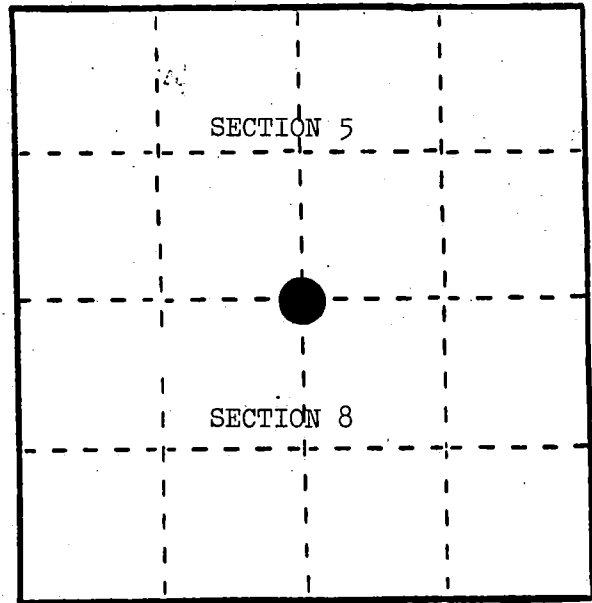

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 10", N.36°E., 24 links; Hemlock, 20", S.45°W., 34 links.

June 14, 1984, Alan Harrison found 12"-15" Sugar stump, pulled S.36°W., 15.84', and found post hole. From there, S.45°W., 22.44', to center of large Hemlock stump remains. Accepted as original.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 6", S.70°E., 48.07'
3. Sugar, 5", S.78°W., 8.80'
4. Sugar, 8", N.35°W., 40.50'
5. Steel Sign Post, Northeast, 1.22'

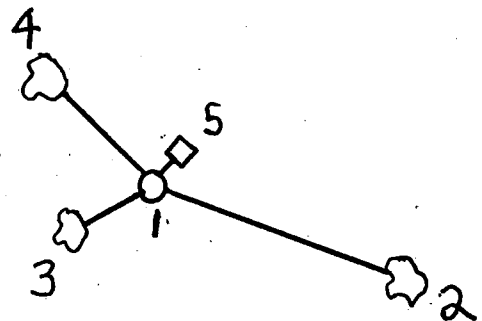

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of January... A.D., 1985 at
... 2:00 o'clock... P... M. and

recorded in Vol. CORNER RESTORATIONS

on page F-7

Paul A. Schreiner
REGISTER

434116050020

E-7

E 7

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

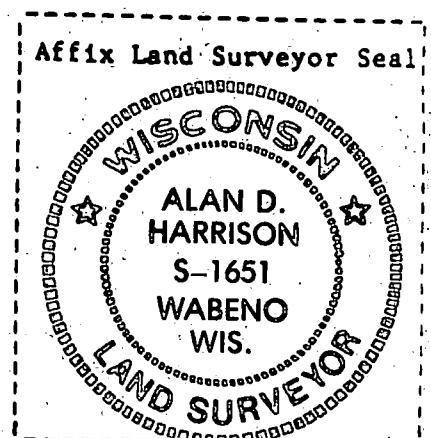


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 4, 5, 8, and 9, T.34N., R.16E.

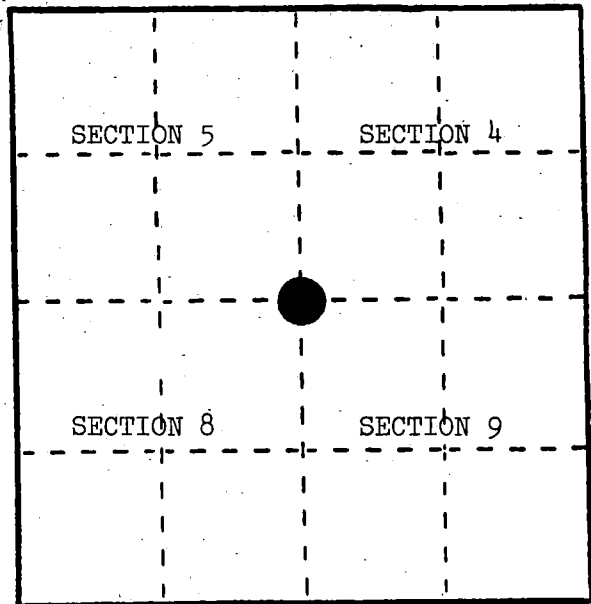

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Tamarack, 12", N.4°W., 17 links; Tamarack, 8", N.50°E., 28 links; Tamarack, 12", S.39°E., 16 links; Tamarack, 12", S.66°W., 35 links.

September 10, 1973, Stefan and Tallier found point of rotted off post; Forest Service location poster on west face of 10" Balsam, East, 31 links; 9" Tamarack stump, N.50°E., 28 links; 12"-14" Tamarack stump, S.39°E., 16 links; 3 Spruce growing on mound that could be stump mound, S.66°W., 35 links; stump remains, N.4°W., 17 links. Accepted as original corner.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. Black Spruce, 10", N.33°E., 41.98'
3. Tamarack, 5", S.1°E., 29.98'
4. Black Spruce, 6", S.31°W., 14.15'
5. Hemlock, 15", N.53°W., 43.76'
6. Steel Sign Post, West, 1.3'

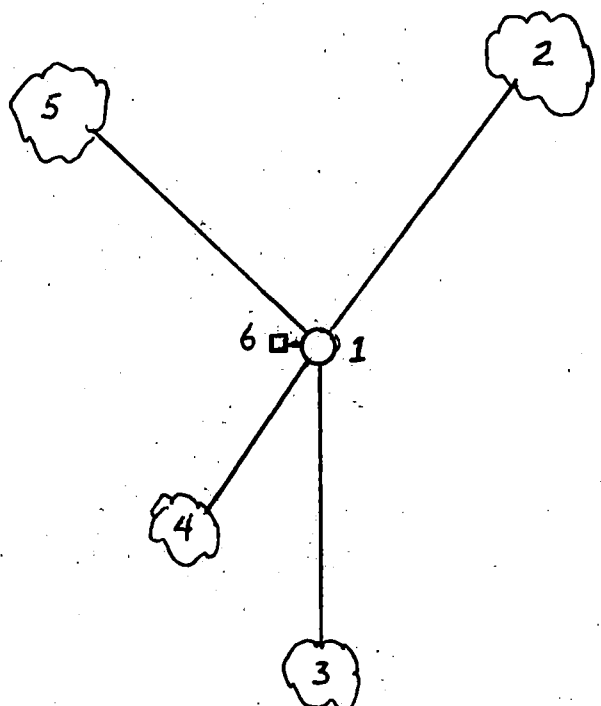

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of... January ... A.D., 1985 at

... 2:00 o'clock... P. ... M. and

recorded in Vol. CORNER RESTORATIONS

on page 9

Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

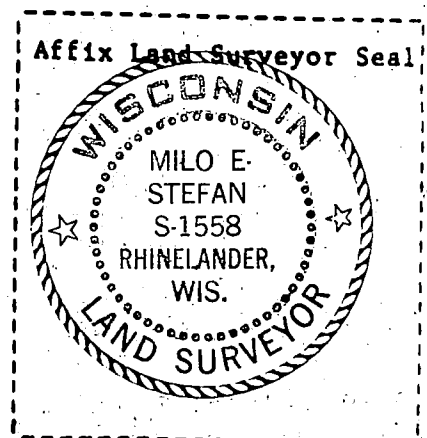


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 4 and 9, T.34N., R.16E.

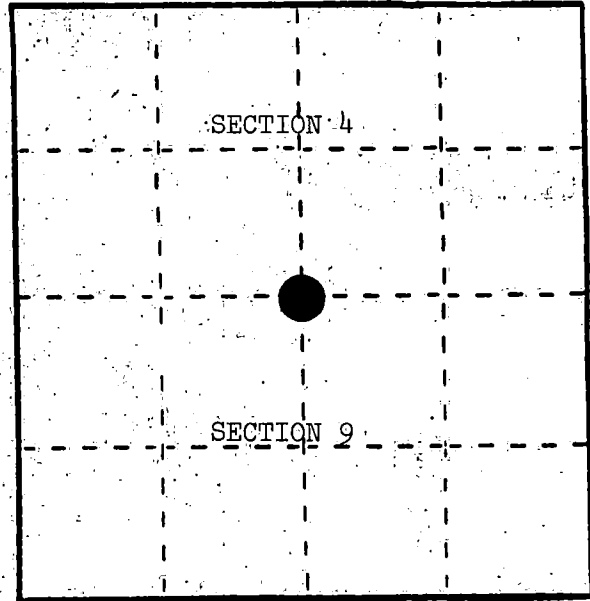

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed:


In 1858, James McBride set wood post with the following BTs: Sugar, 12", N.72°W., 16 links; Elm, 14", S.10°E., 25 links.

June 14, 1984, Alan Harrison set proportionate position from traverse. Found no evidence of corner. Position falls in Aspen clearcut.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Steel Sign Post, North, 1.18'
3. Steel Sign Post, West, 1.00'
4. Iron Pipe, 1", East, 2.41'
5. Iron Pipe, 1", South, 2.66'

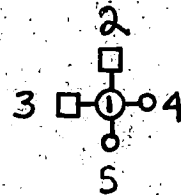

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day

of January, A.D., 1985 at

2:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATIONS

on page E-11

Paul Ackerman
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Single proportionate measure between section corners east and west one-half mile.

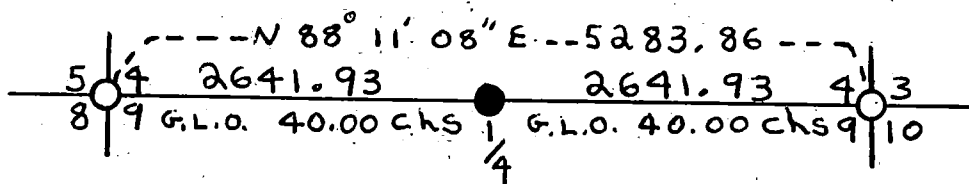

Affix Land Surveyor Seal

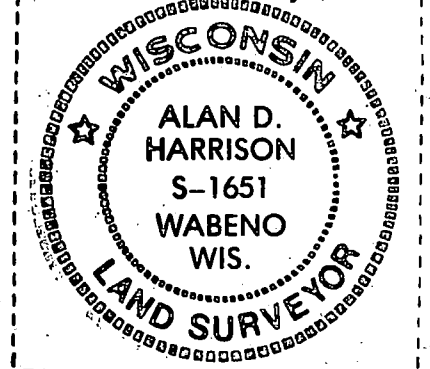

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 17th day of October, 19 73, I found evidence of the south west section corner of section 3 Township 34 north, Range 16 east, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in 1858
 North between sections 9 and 10. 80.0 chains set post
 Corner to Sections 3, 4, 9 and 10
 Cedar, 12, N35W, 15 lks.
 Hemlock, 12, N48E, 23 lks.
 Cedar, 10, S39W, 5 lks.
 Cedar, 8, S50E, 23 lks.

Description of corner evidence found:



Old post point
 Cedar snag, 14", S39°W, 5 lks., scribed
 Fallen cedar snag, S46°E, 23 lks., scribed
 Hemlock stump, N48°E, 23 lks.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post point with a 2 in. inside diam., galvanized pipe, 5 feet long, filled with concrete, with a brass cap marked: T34N, R16E, S3, S4, S9, S10, 1974, S-802

From which the following new bearing trees bear:

Balsam, 6 in., N37°E, 3.94 ft.
 Balsam, 5 in., S67°E, 8.80 ft.
 Cedar, 4 in., N77°W, 8.20 ft.
 Steel post, north, 1.5 ft.

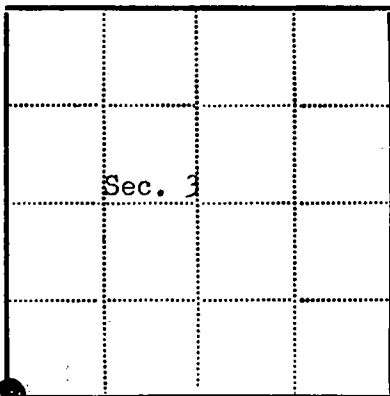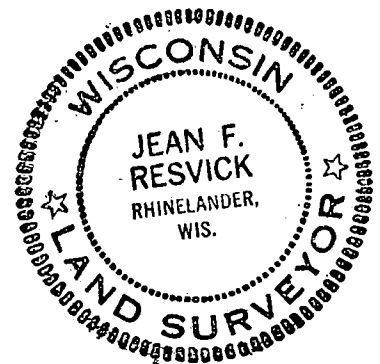

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 21 day of Feb. 19 74.

Signature Jean F. Resvick Title Land Surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 105091

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 19 74, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 34 north, Range 16 east, Section 3, Index No. E-13, Page No. _____

434116 040000

E 13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 3 and 10, T.34N., R.16E.

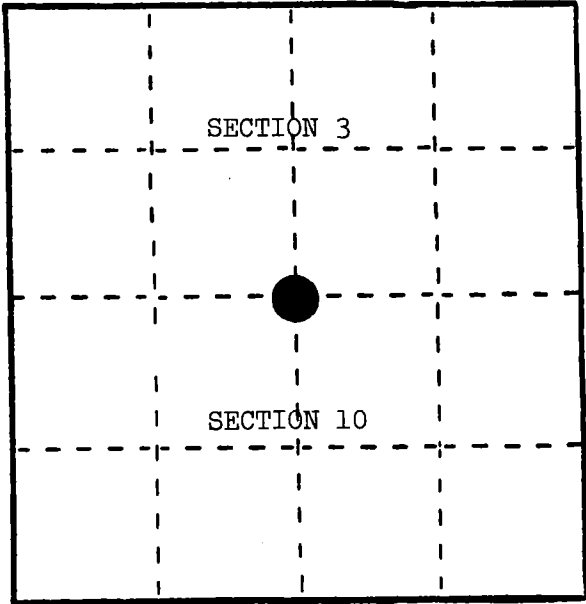

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Elm, 10", N.28°E., 36 links; Elm, 6", S.28°W., 15 links.


In 1974, Tom Tallier found corner of old fence line running north and west. Found no bearing trees.

June 12, 1984, Alan Harrison searched area around fence corner and an area N.13°E., 235.01', where proportionate position is. Fence corner has fences running west, N.12°E. Found no evidence of corner.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 12", N.12°E., 14.58'
3. Basswood, 5", S.36°E., 32.90'
4. Sugar, 6", S.72°W., 35.59'
5. Steel Sign Post, South, 1.65'

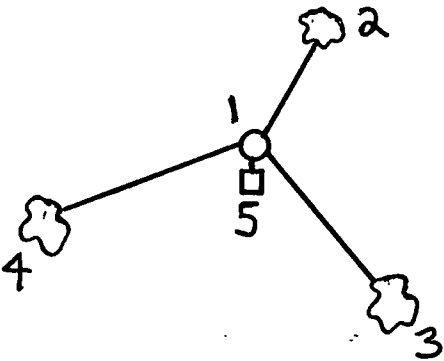

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 23rd day
of January A.D., 1985 at
2:00 o'clock P.M. and
recorded in Vol. CORNER RESTORATIONS
on page E-15
Paul H. Schumacher
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate measure midpoint and on line between section corners $\frac{1}{2}$ mile east and west.

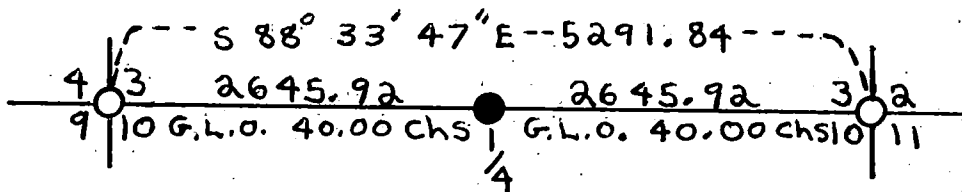

Affix Land Surveyor Seal

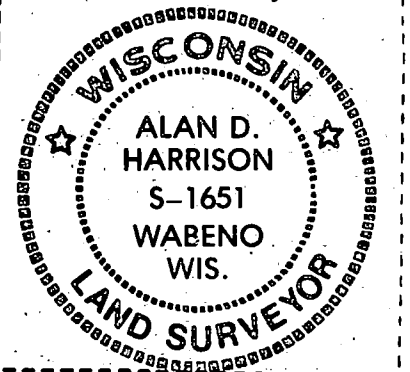

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 2, 3, 10, and 11,
T.34N., R.16E.

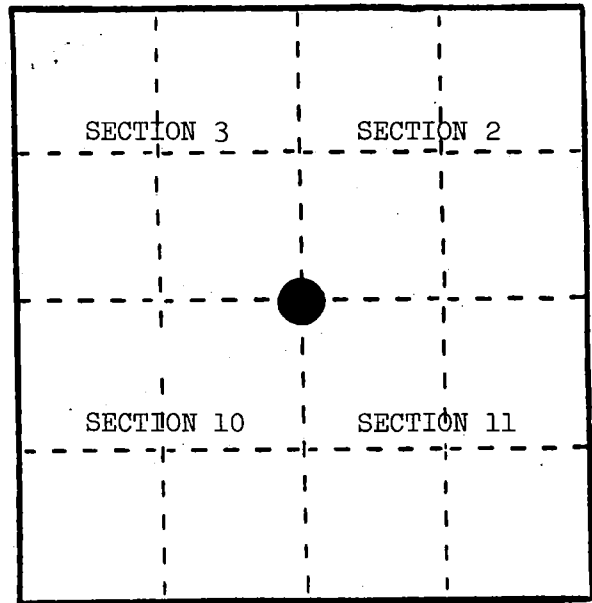

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wooden post with the following BTs: Hemlock, 12", N.36°W., 63 links; Sugar, 10", N.28°E., 27 links; Hemlock, 14", S.6°E., 28 links; Hemlock, 16", S.28°W., 48 links.


December 21, 1933, Griepentroe found iron pipe 2' above ground in a mound of stone.

September 26, 1983, Milo Stefan found 1 1/4" iron pipe; stump hole, S.28°W., 32.0'; beaver blazes around corner area.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 8", N.44°E., 52.40'
3. Sugar, 6", S.79°E., 11.47'
4. Sugar, 5", S.82°W., 27.80'
5. Sugar, 8", N.30°W., 36.24'
6. Steel Sign Post, East, 1.2'

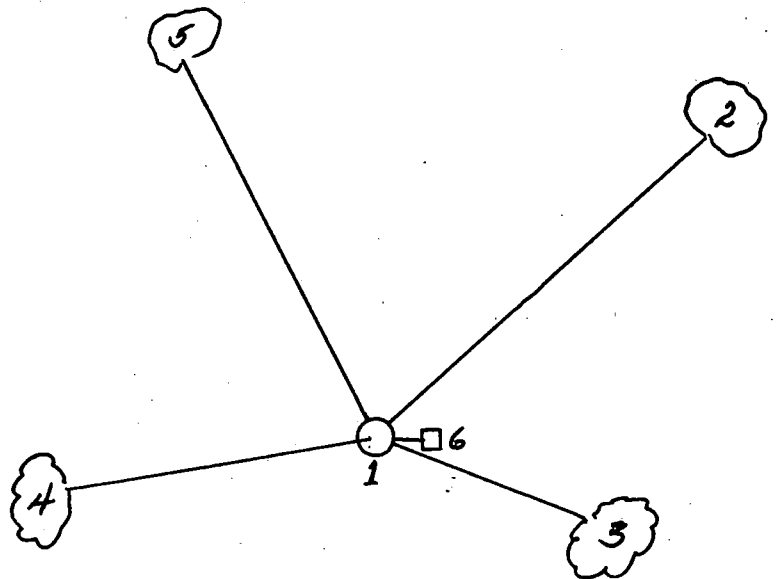

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day

of January... A. D., 1985 at

... 2:00 o'clock... P. ... M. and

recorded in Vol. CORNER RESTORATIONS

on page E-17

Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) 1. Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11 / 15 / 84
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 2 and 11, T.34N., R.16E.

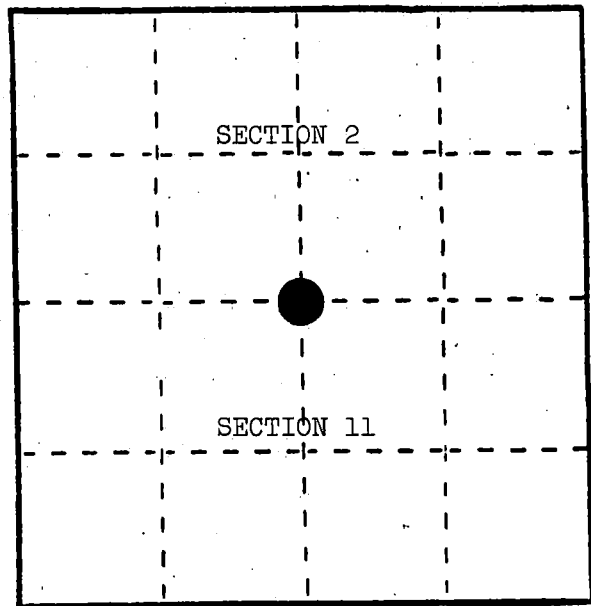

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following BTs: Hemlock, 14", N.7°E., 19 links; Hemlock, 14", S.44°W., 27 links.


January 15, 1935, C. J. Priegel found a fence post and Forest Service poster along Truck Trail #344.

September 22, 1983, Milo Stefan found a post that has been used for quarter corner for years. Distance west to section corner fits well. Accepted as the quarter corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 7", S.53°E., 38.50'
3. Sugar, 6", N.64°W., 30.34'
4. White Spruce, 6", N.11°E., 31.75'
5. Steel Sign Post, South, 1.1'

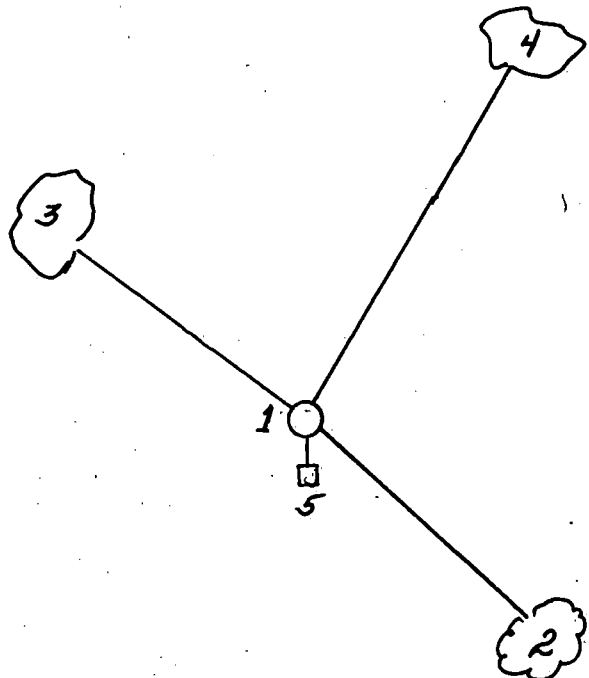

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day
of January A.D., 1985 at

.... 2:00 o'clock.... P......M. and

recorded in Vol. CORNER RESTORATIONS

on page 5-19

Paul Achenbrenner
REGISTER

43416020020

E-19

E 19

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date



Document Number

189327

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page E-21
Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
ELM 10" N36°W 16 LINKS
SUGAR MAPLE 14" N80°E 41 LINKS
SUGAR MAPLE 10" S45°E 29 LINKS
SUGAR MAPLE 16" S25°W 6 LINKS

1984 - ALAN HARRISON, SURVEYOR, S-1651, SET PROPORTIONATE POSITION, IT FALLS 60' INSIDE CLEARCUT.
FOUND NO EVIDENCE OF CORNER. SET A 2" X 60" ALUMINUM MONUMENT.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE S63°E 84.83 FEET
SUGAR MAPLE S04°W 99.06 FEET
ASPEN N55°W 6.89 FEET
STEEL POST NORTHEAST 0.89 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 3-1/2" STAMPED ALUMINUM CAP.

FOUND THE FOLLOWING WITNESSES:


MAPLE 12" S60°E 84.67 FEET - SET D.H. NAIL IN TREE.
MAPLE 30" S06°W 98.29 FEET - SET D.H. NAIL IN TREE.
ASPEN STUMP N58°W 7 FEET

SET THE FOLLOWING WITNESSES:


MAPLE 5" N43°W 26.05 FEET - SET D.H. NAIL IN TREE.
MAPLE 3" N61°E 21.23 FEET - SET D.H. NAIL IN TREE.
STEEL SIGN N44°E 0.95 FEET

ALL TREES HAVE STUMP AND CHEST BLAZES.

THE NORTHWEST
CORNER OF SECTION 12,
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

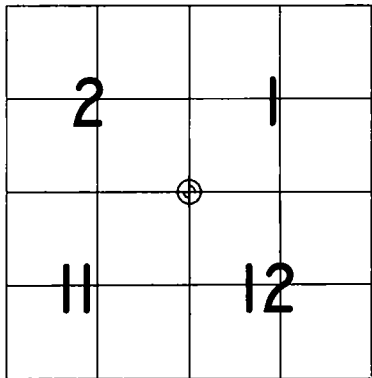

⊕ = LOCATION OF CORNER

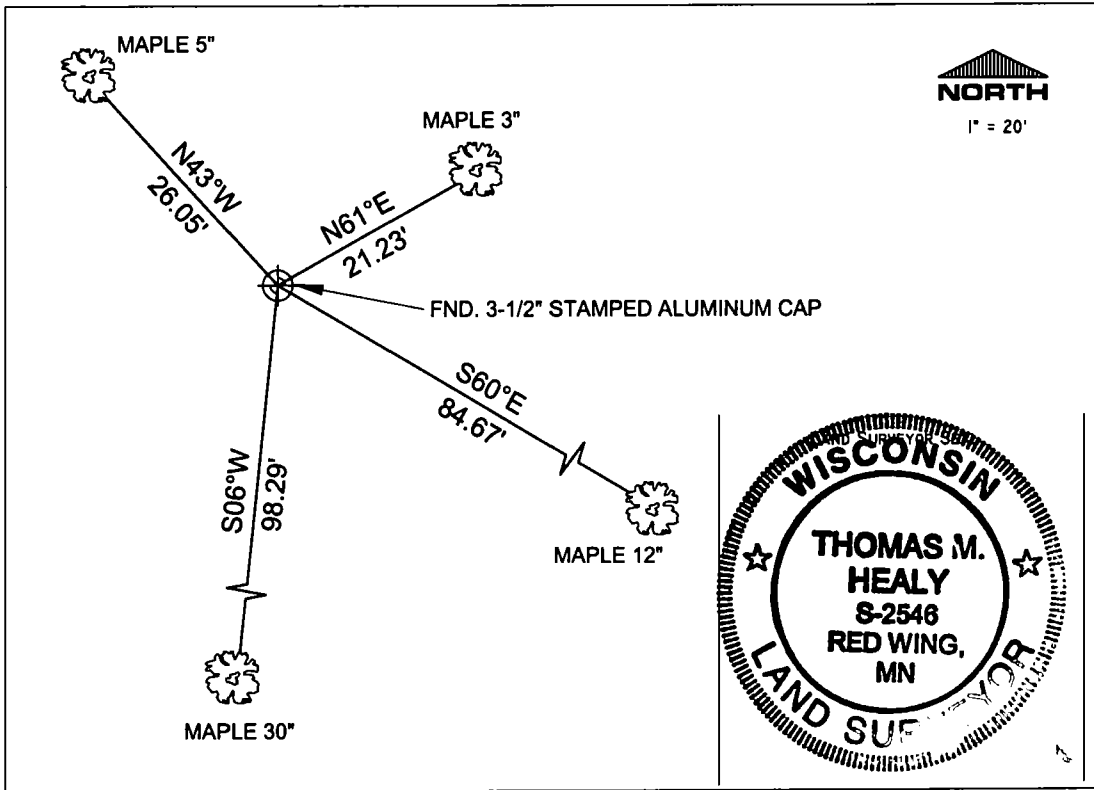

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Thomas M. Healy 11-17-05
SIGNATURE DATE

INDEX No. E-21

43416020000


E-21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section corner to Sections 1, 2, 11, and 12,
 T.34N., R.16E.

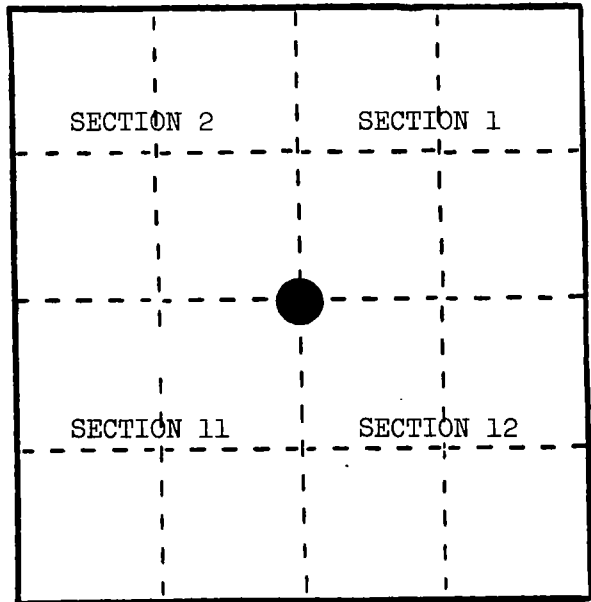


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Elm, 10", N.36°W., 16 links; Sugar, 14", N.60°E., 41 links; Sugar, 10", S.45°E., 29 links; Sugar, 16", S.25°W., 6 links.
 July 16, 1984, Alan Harrison set proportionate position. It falls 60' inside clearcut.
 No evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, S.63°E., 84.83'
- Sugar, S.4°W., 99.06'
- Aspen, N.55°W., 6.89'
- Steel Sign Post, Northeast, 0.89'

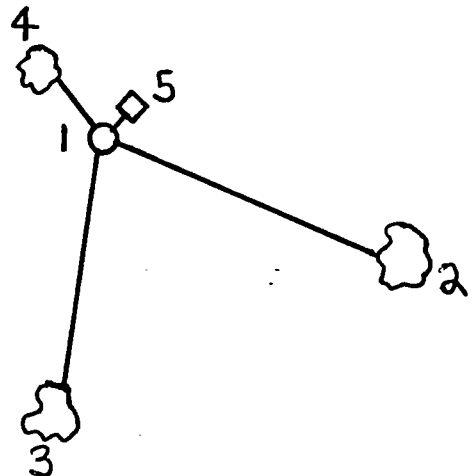

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this... 23rd day
 of January... A.D., 1985 at
 ... 2:00 o'clock... P.M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 5-21
Paul A. Schenck
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

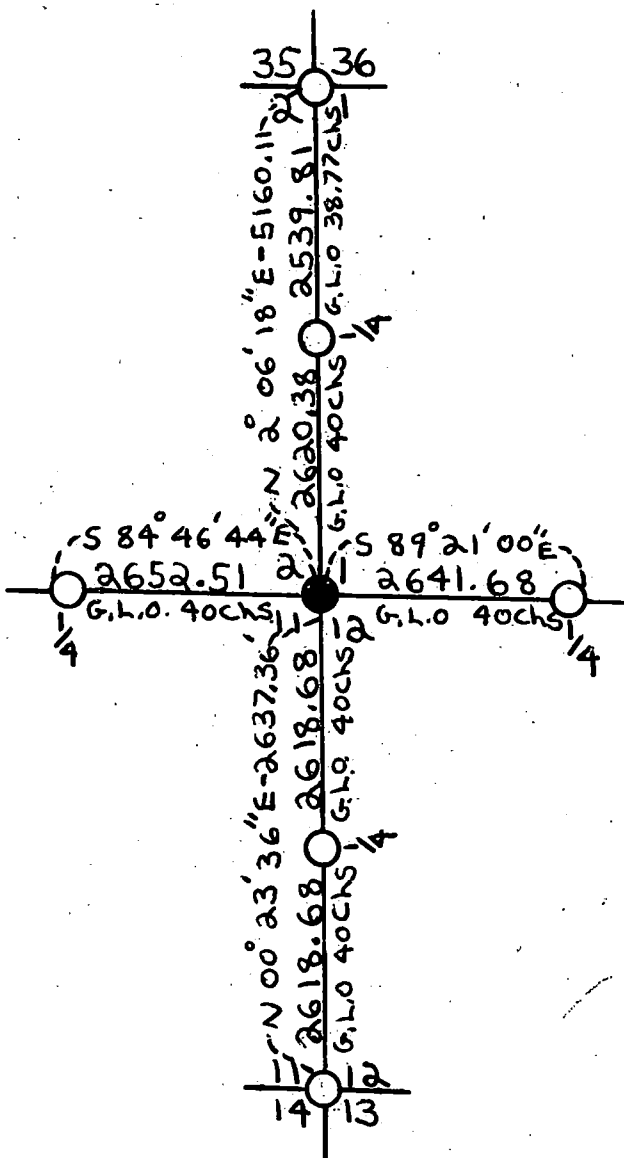

Affix Land Surveyor Seal

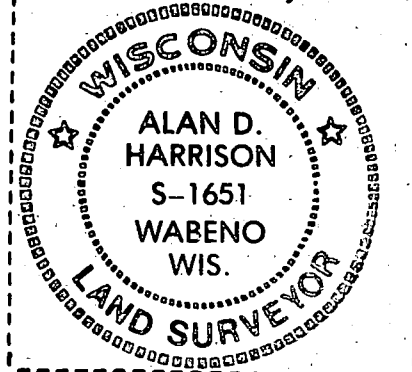

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/27/84

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I Jean F. Resvick, do hereby certify that on the 18 day of September, 1973, I found evidence of the South Quarter corner of Section 1 Township 34 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1858 by James McBride 40.00 chains west corrected between sections 1 and 12 set post

W. Pine 36 Inches, bears N12E, 306 lks.

W. Pine 15 Inches, bears S3E 309 lks.

Description of corner evidence found:

1. Post with Forest Service poster
2. W. Pine stump, bears N12E 306 lks.
3. W. Pine stump, bears S3E, 309 lks.

Description of monument and accessories I established to perpetuate the location of this corner:



Replaced post with a 2 inch inside diameter galvanized pipe 5 feet long filled with concrete with a brass cap marked: T34N, R16E, 1/4, S1, S12, 1974, S-802.

From which the following new bearing trees bear

Tamarack 7 inches bears N58 E 31.33 lks.

Tamarack 6 inches bears N30°W 11.40 lks.

Steel Post N.W. 0.5 feet

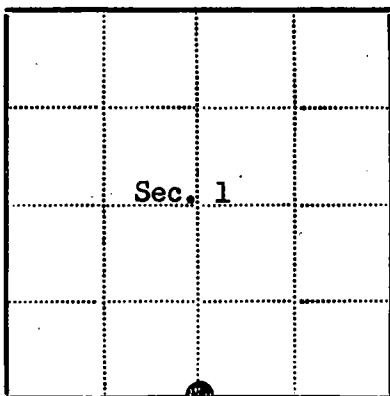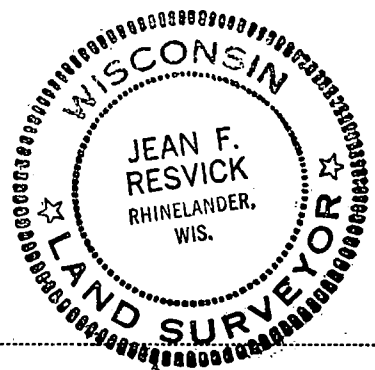

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 21 day of Feb. 1974.....

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT Number 105092

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 1974, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stitzing Title Register of Deeds

Township 34 North, Range 16 East, Section 1, Index No. E-23, Page No. _____

43416010020


E 23

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Section corner to Sections 1, 6, 7, and 12, T.34N., R.16-17E.

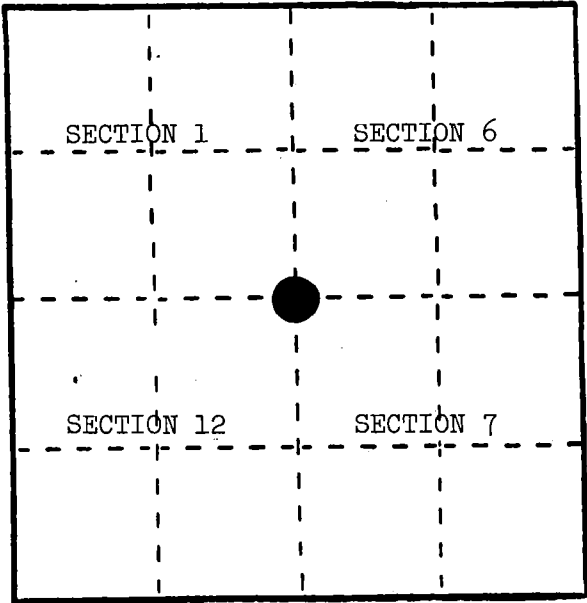

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1839, Tom Sprague set post 40.00 chains, with the following BTs: Black Ash, 10" S.36°W., 25 links; Fir, 10", N.62°W., 11 links.

In 1935, Marinette County resurvey of range line by Frank Gould--set 4" iron pipe.

July 7, 1981, Alan Harrison found 4" x 36" iron pipe lying in the mud. Pipe was stood up in place.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 4" x 36" iron pipe with tablet stamped to identify the corner.
 - Black Ash, 4", N.28°E., 11.53'
 - Black Ash, 5", S.59°E., 8.28'
 - Black Ash, 5", S.5°W., 16.70'
 - Cedar, 9", N.51°W., 24.36'
 - Steel Sign Post, West, 0.10'

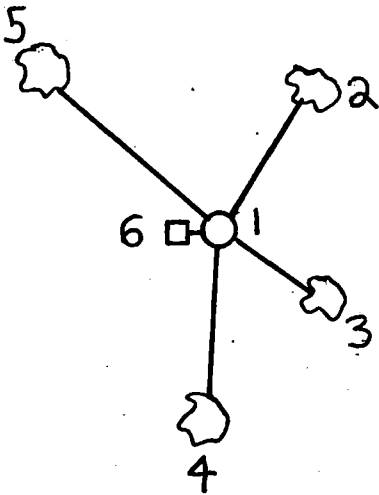

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this...23rd day
of January...A.D., 1985
...2:00...o'clock...P.....M. and
recorded in Vol. 100, P. 25
on page 5. 25
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal

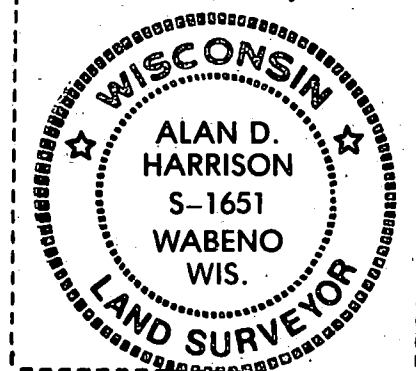

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 7 and 12,
T.34N., R.15E.

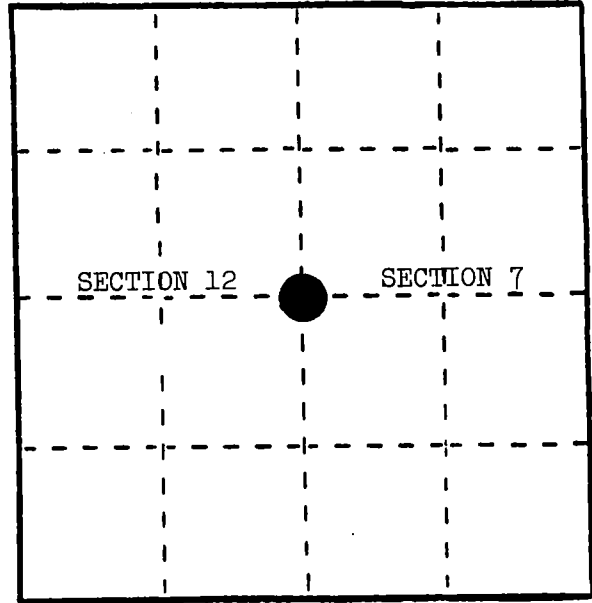

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set wood post with the following BTs: Hemlock, 9", S.25°W., 15 links; Sugar, 20", N.63°E., 24 links.

November 8, 1922, Nathan Smith subdivided Section 12, T.34N., R.15E. and called original corner.


October 17, 1934, Stabo and Savee found a stake 3" below road surface; also, Hemlock stump, 10", S.50°W., 33'. Metal location poster on 9" fence post east of corner ½ chain.

June 25, 1984, Alan Harrison searched area, found no evidence of original corner. Set corner by retracement of N. Smith's 1922 survey of Section 12 from W ¼ through C ¼ through CE 1/16 to E ¼.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner--4" below surface.
2. Power Pole #3416-7L27, N.89°E., 22.39'
3. Red Pine, 6", S.35°W., 71.92'
4. Red Pine, 8", N.48°W., 51.85'
5. Steel Sign Post, West, 15.51'

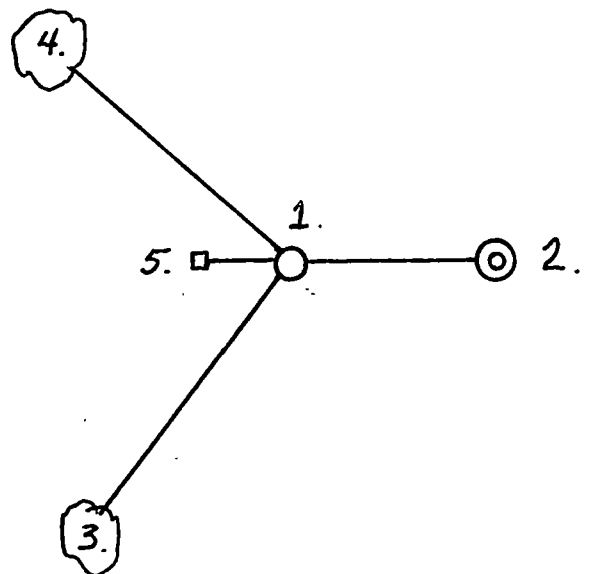

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day
of January, A.D., 1985

at 2:00 o'clock P. M. and

recorded in Vol. CORNER RESTORATIONS

on page 9
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

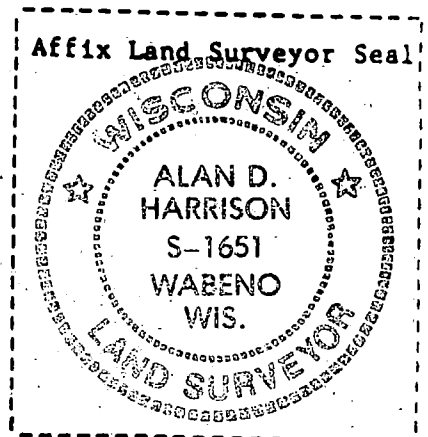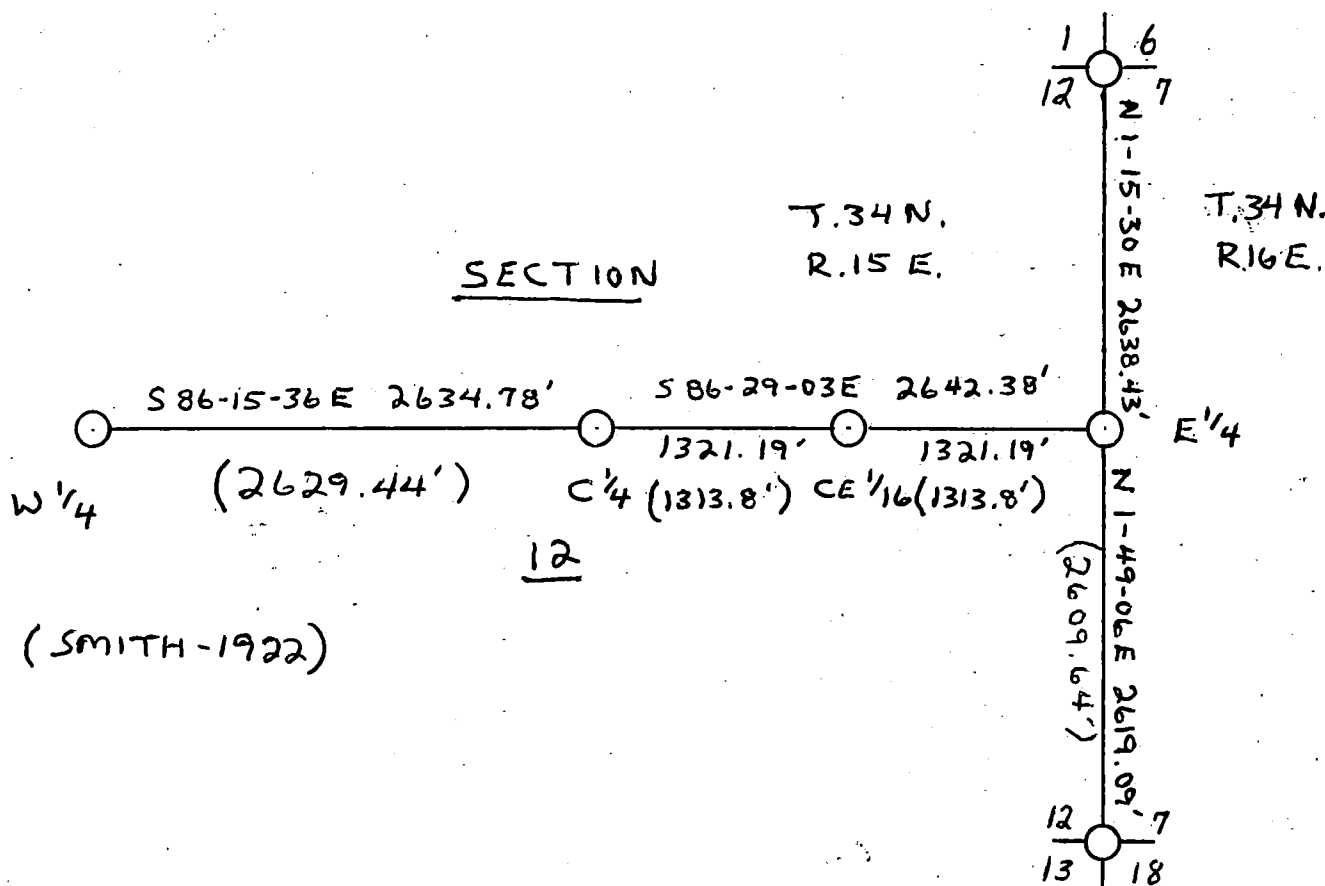

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/28/84

Signature


Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner to Sections 7 and 8, T.34N., R.16E.

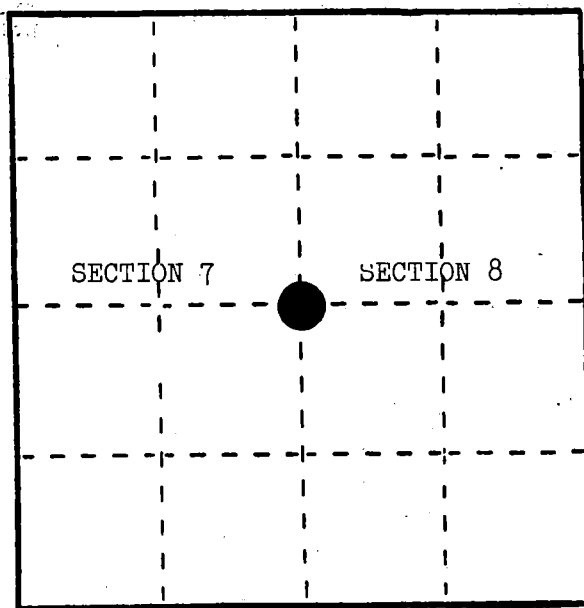

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Birch, 6", S.76°W., 24 links; Birch, 6", N.71°E., 27 links.


Connor Co. has notes (Kolbe) on corner. They call for 2" iron pipe and wood post.

April 2, 1984, Alan Harrison found iron pipe and wood post, distance to swamp north fits. Accepted this as best evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 11", N.47°E., 27.32'
- Sugar, 8", S.54°E., 68.62'
- Yellow Birch, 9", N.22°W., 54.51'
- Steel Sign Post, Northwest, 1.5'

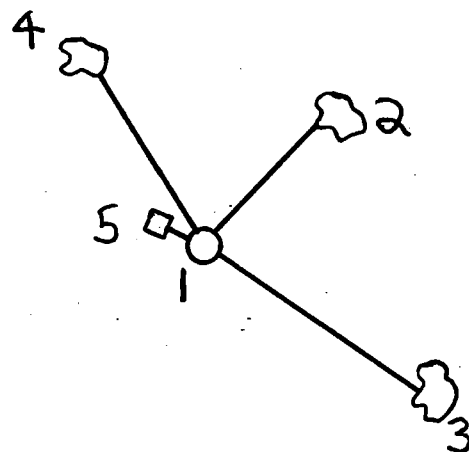

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this... 23rd day
 of... January... A.D., 1985
 at... 2:00 o'clock... P. M. and

recorded in Vol. CORNER RESTORATIONS

on page 45

Paul Aschenbrenner
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

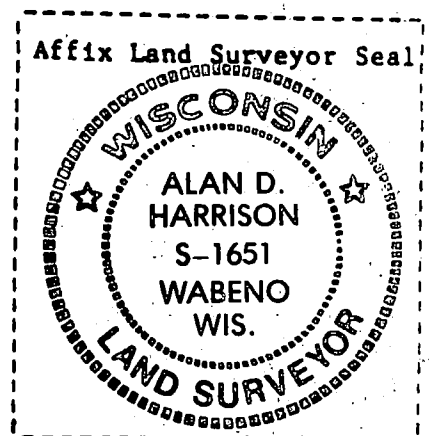


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Quarter corner to Sections 8 and 9, T.34N., R.16E.

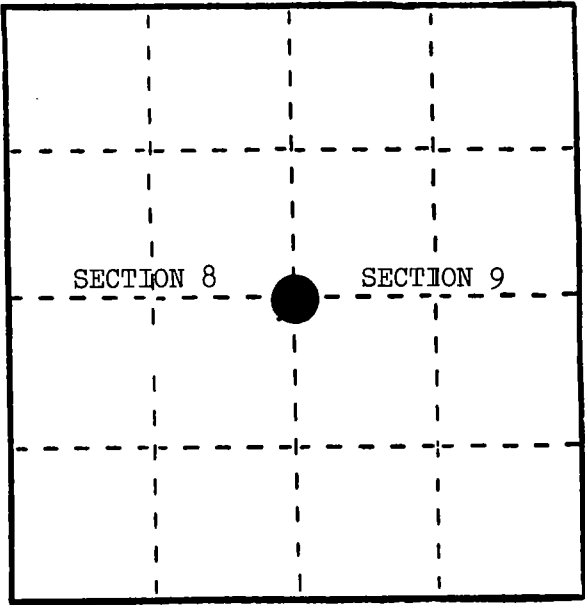

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Hemlock, 12", S.31°W., 10 links; Hemlock, 10", N.19°E., 11 links.

January 9, 1935, L. Sobezak found iron pipe 12" high, location poster on post from which corner bears east, 1.0'


1966, Kolbe found iron pipe lying on ground.

May 9, 1984, Alan Harrison found plantation post with iron pipe lying on ground. Scraped area and found metal location tag 3' west of post. Found Cedar (axe marked) wood just south of post. Area has been furrowed. Plantation post is best evidence, with support of tag and Cedar remains.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. White Spruce, 4", N.45°E., 12.88'
3. Rock Elm, 5", S.58°E., 20.21'
4. White Spruce, 4", S.43°W., 12.34'
5. Steel Sign Post, Northwest, 1.3'

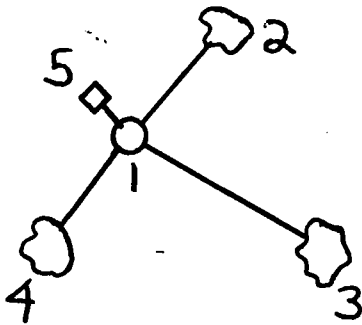

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this... 23rd day
of January... A. D., 1985 at
... 2:00 o'clock... P... M. and
recorded in Vol. CORNER RESTORATIONS
on page 9-9
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

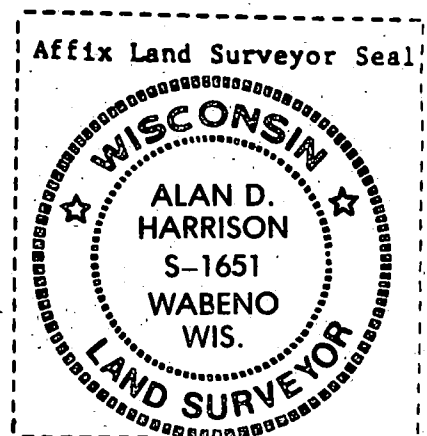

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 9 and 10,
T.34N., R.16E.

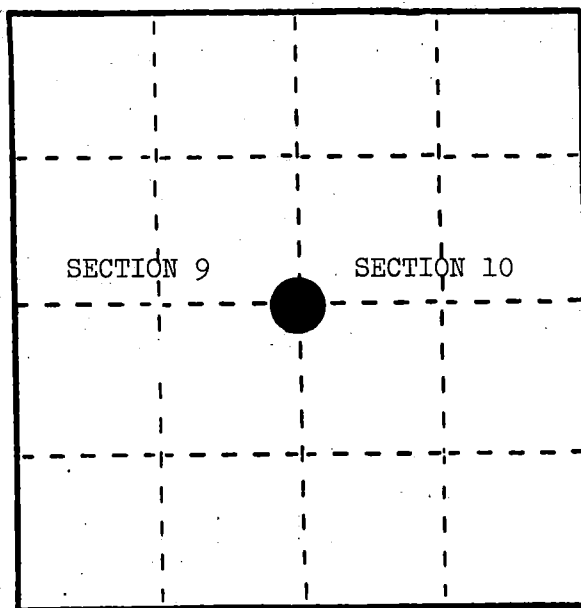

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Hemlock, 12", S.76°E., 15 links; Hemlock, 16", S.51°W., 15 links.

June 20, 1984, Alan Harrison found post hole and two Hemlock stumps that bear from corner position S.76°E., 9.90', 14" stump; S.51°W., 9.90', 18" stump. Fits with lake call. Accepted this as original corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north:

- 2" x 36" aluminum monument stamped to identify the corner.
- Red Maple, 4", N.12°E., 30.47'
- Red Maple, 5", S.61°E., 23.93'
- Red Maple, 6", N.62°W., 29.96'
- Steel Sign Post, Southwest, 1.2'

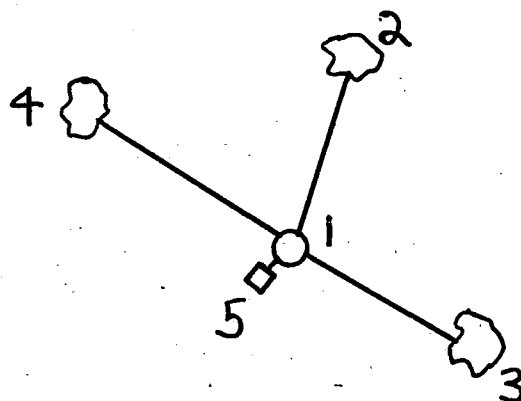

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 23rd day

of January 1985 at

9:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATIONS

on page 13

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

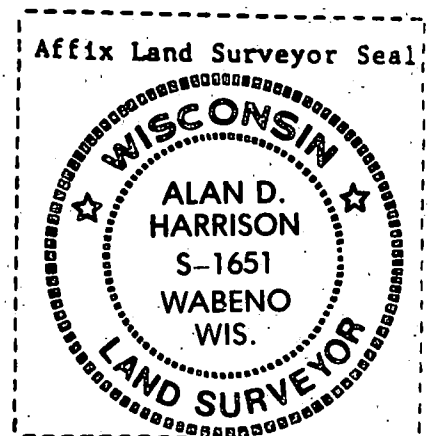


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS :**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 10 and 11, T.34N., R.16E.

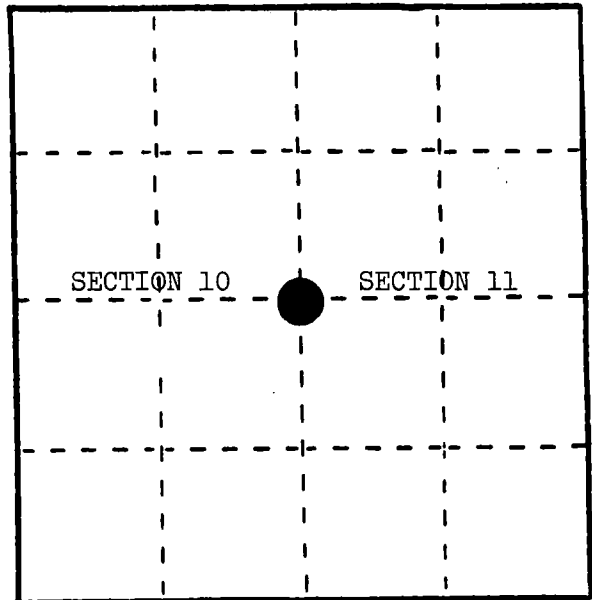

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Sugar, 10", N.83°W., 17 links; Hemlock, 20", N.31°E., 15 links.


July, 1935, road survey found Cedar post and rock mound.

August 17, 1983, Alan Harrison found wood post and iron pipe in rock mound, location tag on post dated 11-13-77.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 7", N.60°E., 20.33'
3. Yellow Birch, 5", S.54°W., 26.46'
4. Sugar, 9", N.4°W., 41.77'
5. Steel Sign Post, Southeast, 1.2'

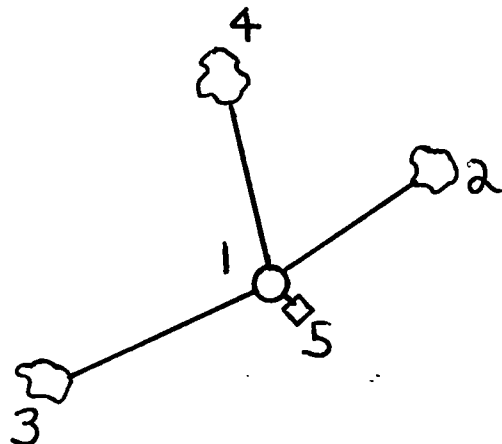

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this... 23rd day

of... January... A.D., 1985 at

... 2:00 o'clock... M. and

recorded in Vol. CORNER RESTORATIONS

on page 17

Paul A. Schrammer
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

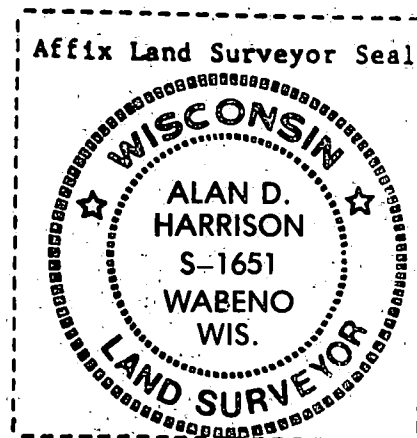

Document Number

189328

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P. M. and recorded
in Vol. Corner Restoration
page G-21

Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
TAMARACK 14" N20°W 15 LINKS
CEDAR 8" S22°E 8 LINKS

1984 - ALAN HARRISON, SURVEYOR, S-1651, SET PROPORTIONATE POSITION, THEN PULLED SOUTH FROM CREEK. THIS POSITION FELL 15' WEST OF PROPORTIONATE POSITION. FOUND NO EVIDENCE OF CORNER. SET A 2" X 60" ALUMINUM MONUMENT STAMPED TO IDENTIFY THE CORNER.

SET THE FOLLOWING WITNESSES:
CEDAR 5" S79°E 48.27 FEET
CEDAR 6" S55°W 16.24 FEET
CEDAR 11" N27°W 57.82 FEET
STEEL POST SOUTH 1.15 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 2" PIPE UP 3' WITH 3.5" ALUMINUM CAP STAMPED 1984 RLS-1651.


FOUND THE FOLLOWING WITNESSES:

CEDAR 5" S70°E 48.50 FEET - SET NAIL IN TREE
CEDAR 8" S59°W 16.24 FEET - SET NAIL IN TREE
CEDAR 11" N25°W 57.67 FEET - SET NAIL IN TREE
STEEL SIGN SOUTH 1.15 FEET


SET THE FOLLOWING WITNESSES:

CEDAR 7" S19°E 55.33 FEET - SET NAIL IN TREE

THE WEST 1/4
CORNER OF SECTION 12,
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

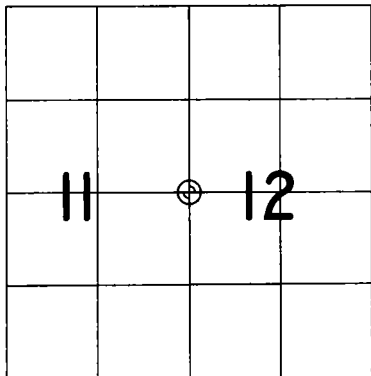

⊕ = LOCATION OF CORNER

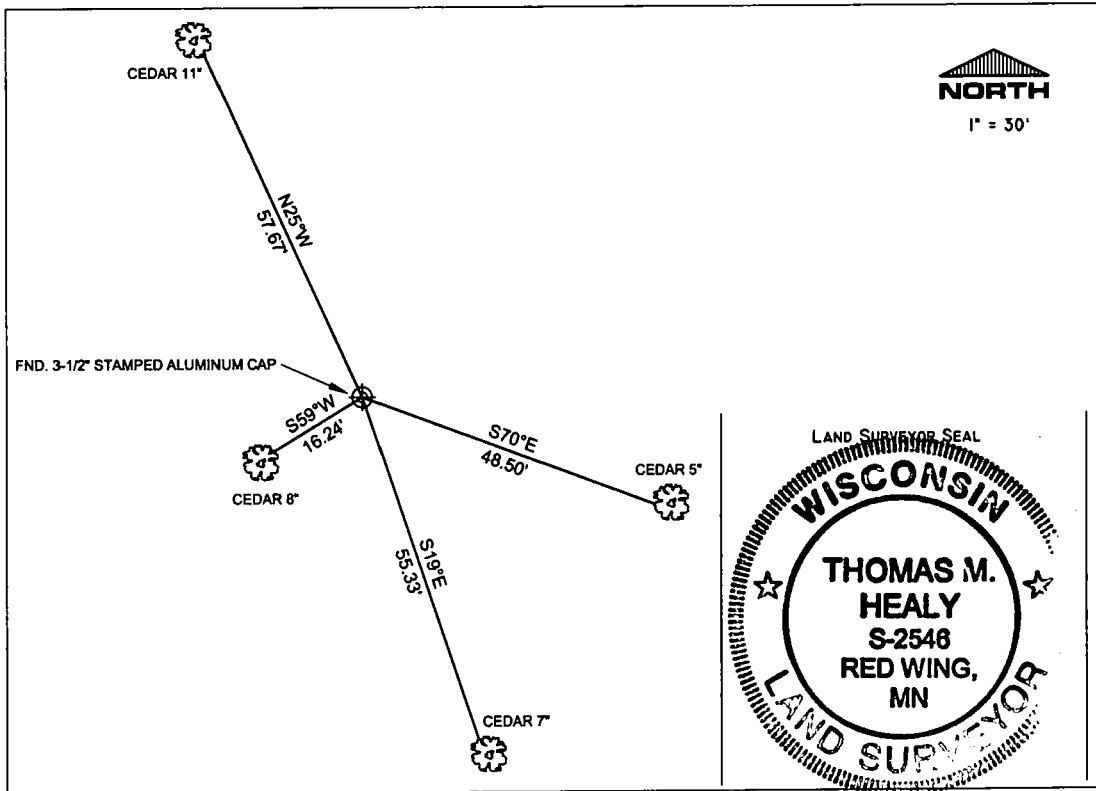

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. G-21

SIGNATURE

DATE

43416112000

G-21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 11 and 12,
T.34N., R.16E.

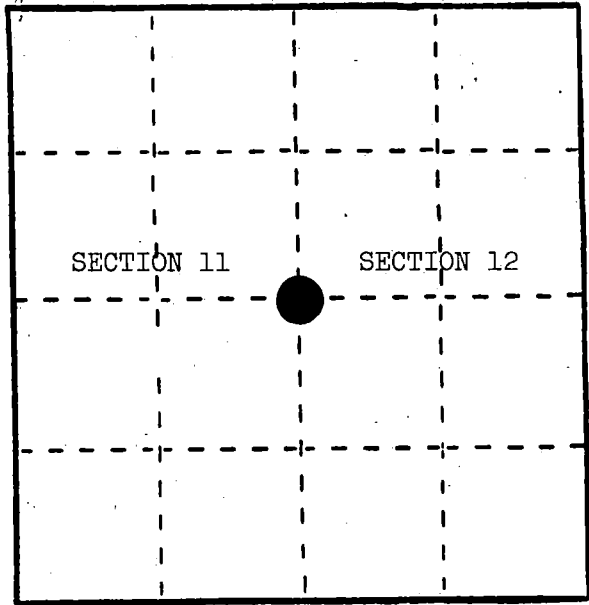

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Tamarack, 14", N.20°W., 15 links; Cedar, 8", S.22°E., 8 links.

June 18, 1984, Alan Harrison set proportionate position, then pulled south from crrek. This position fell 15' west of proportionate position. Found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. Cedar, 5", S.79°E., 48.27'
3. Cedar, 6", S.55°W., 16.24'
4. Cedar, 11", N.27°W., 57.82'
5. Steel Sign Post, South, 1.15'

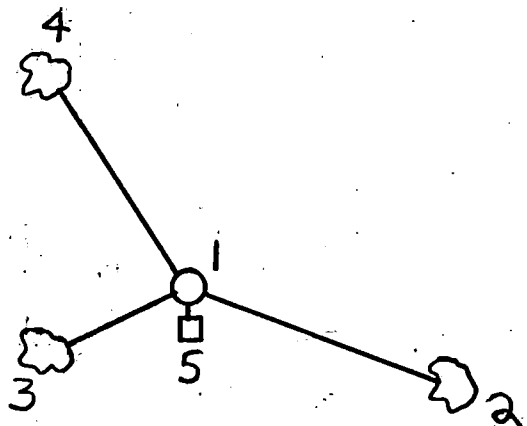

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of January, 1985, at
2:00 o'clock, P.M. and

recorded in Vol. 100, Page 100, of the
on page 100 of the

Paul McChesney
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


(9&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

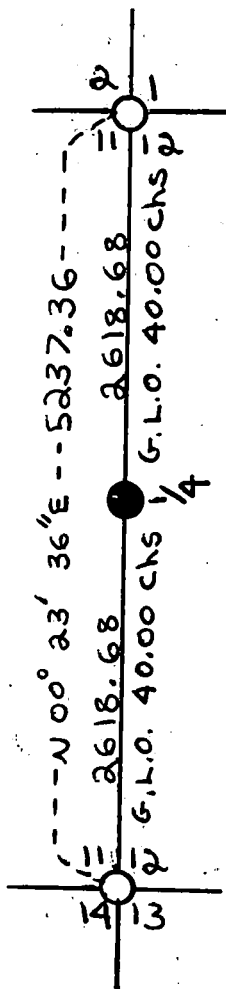

() Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature Alan S. Harrison Date 11/27/84

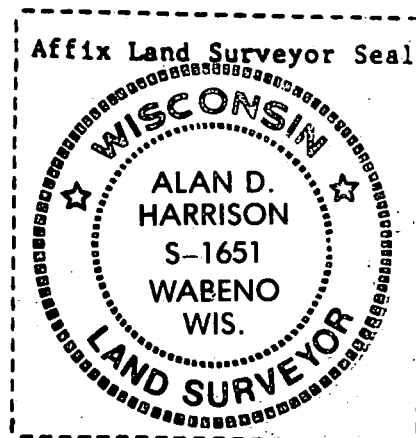


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 12 and 7, T.34N., R.16E.

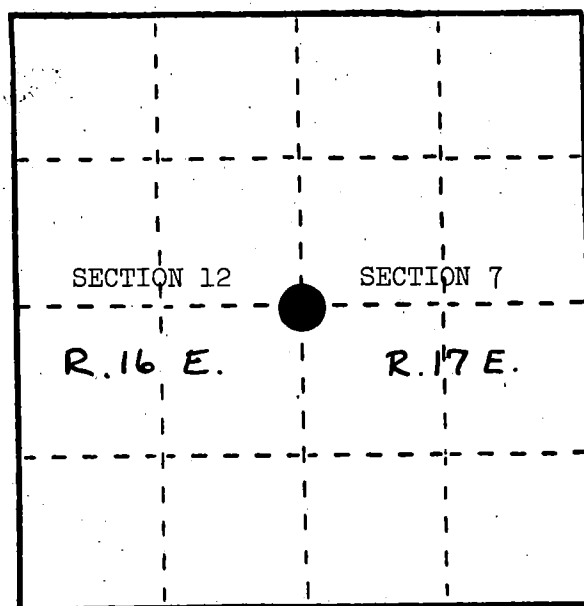

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Fir, 10", S.41°W., 45 links; Hemlock, 10", N.45°W., 51 links.


In 1935, Marinette County resurvey of range line by Frank Gould--set a 4" steel pipe with brass cap.

July 7, 1981, Alan Harrison found 4" x 36" iron pipe with brass cap marked Marinette County Survey-1935.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 4" x 36" iron pipe stamped to identify the corner.
2. Black Ash, 3", East, 21.36'
3. Red Maple, 4", S.75°W., 34.66'
4. Red Maple, 6", N.39°W., 51.64'
5. Steel Sign Post, South, 0.18'

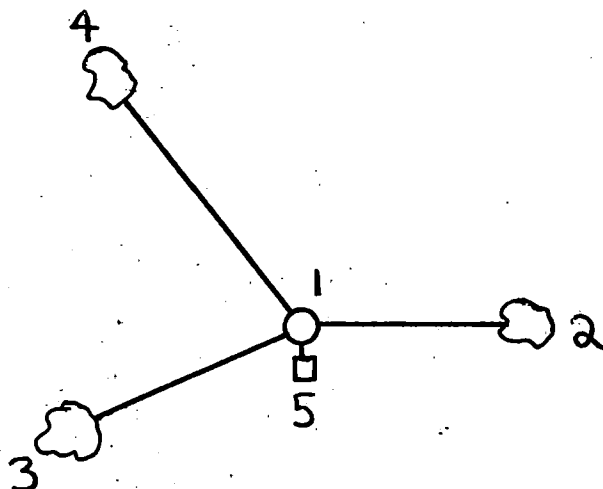

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day

of... January ... A. D., 1985 at

... 2:00 ... o'clock ... P ... M. and

recorded in Vol. CORNER RESTORATIONS

on page 6-25

Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

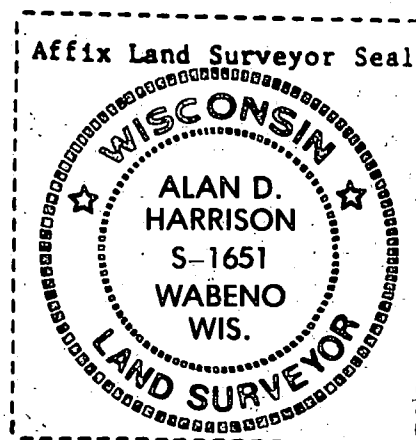

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

North Meander Corner of Otter Lake, T.34N., R.16E.

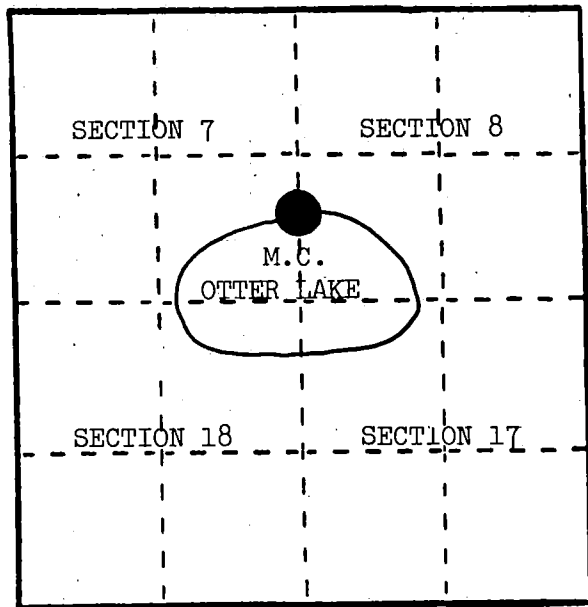

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Cedar, 8"; N.6°W., 4.65 chains; White Pine, 2", N.11°E., 4.68 chains.

October 2, 1983, Milo Stefan found White Pine stump with M.C. scribed in stump blaze; also, north-south blazed line.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 120" aluminum monument stamped to identify the corner.
2. Cedar, 14", N.10°E., 124.31'
3. White Birch, 8", N.31°E., 263.80'
4. Tamarack, 8", East, 41.81'
5. Steel Sign Post, Northwest, 1.2'

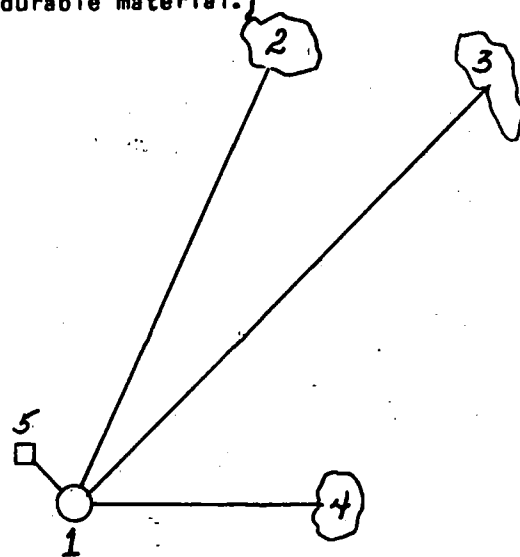

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of January, A.D., 1985

at 2:00 o'clock P.M. and

recorded in Vol. CORNER RESTORATIONS
on page 5

Paul E. Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 7, 12, 13, and 18,
T.34N., R.16E.

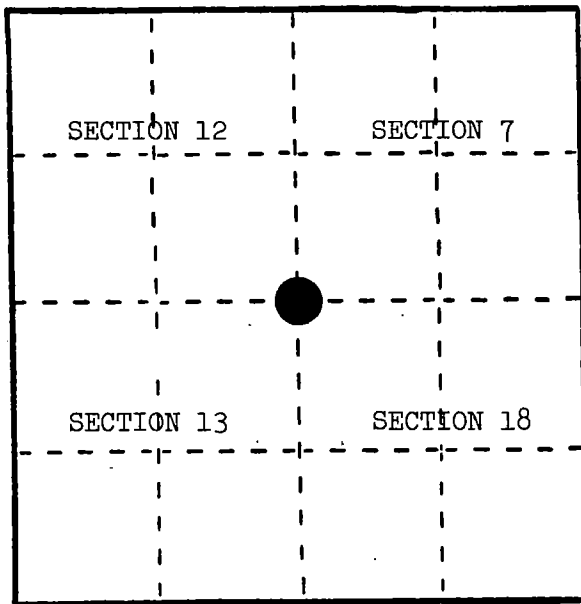

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post from which the following bear: Tamarack, 5", N.64°W., 21 links; Tamarack, 8", N.60°E., 31 links; Tamarack, 6", S.88°E., 24 links.


N. H. Smith--54.55 chains west from N₁ of Section 18 fell 165.75 links north of post. Original BTs okay, marked new BTs as follows: Tamarack, 8", S.1°E., 53 links; Tamarack, 10", S.46°E., 65 links.

September 27, 1979, Milo Stefan found railroad spike in road. At S.1°E., 53 links, Tamarack stump; at 54.5 chains, east, fence north with location poster. Accepted this position as the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A railroad spike in the road for the corner.
2. Reference corner (2" x 36" aluminum monument), N.61°E., 51.32'
3. Red Maple clump, 5", S.79°E., 178.72'
4. Reference corner (2" x 36" aluminum monument), S.61°W., 52.90'
5. Power Pole #3416-12R6, N.47°W., 41.37'

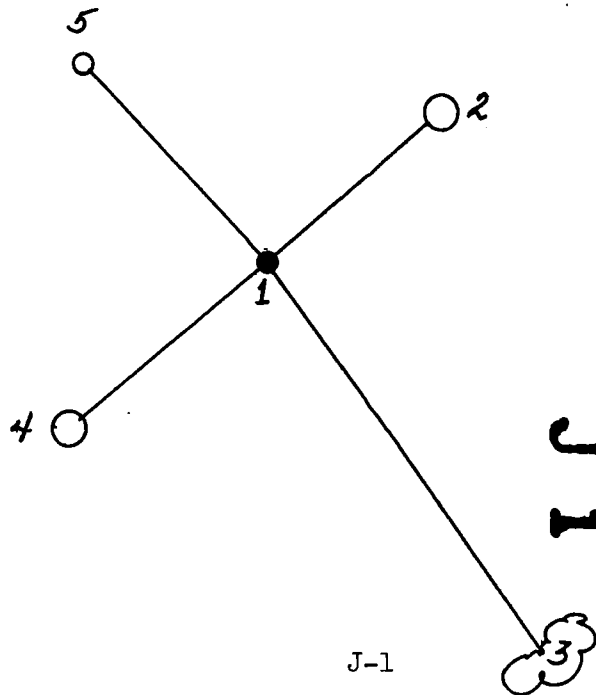

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this.....day

of.....A. D., 19.....at

.....o'clock.....A.....M. and

recorded in Vol.....

on page.....

.....
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/15/84
Date

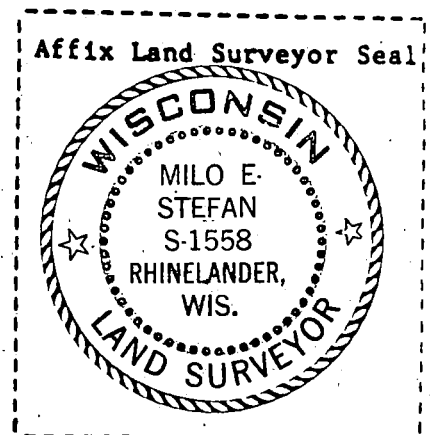

Document Number
209974


REGISTER'S OFFICE
Forest County, Wis.
Received for record this 17th day
of September A.D., 2012 at
9:12 o'clock A.M. and recorded
in Vol. CORNER REDEMPTION
page 1-2
Christy M. Miller, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD
FOREST COUNTY, WISCONSIN

IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A)-(I)

LOCATION: CHAPTER A-E 7.08 (3): (A)
SECTION 7 TOWNSHIP 34 NORTH RANGE 16 EAST
TYPE OF MONUMENT: MAG NAIL OVER 3/4in. REBAR
WITH ALUMINUM CAP

HORIZONTAL DATUM: NAD 83(2007) GRID
FOREST COUNTY COORDINATES
NORTHING: 521207.926
EASTING: 927869.716

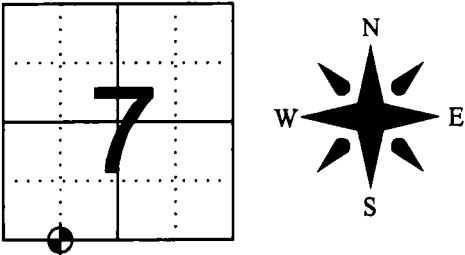


RECOVERY PROCEDURES: CHAPTER A-E 7.08 (3): (B), (F), (G), (H)

7 JUNE 2012: FOUND RAILROAD SPIKE, LOCATION FIT BEARINGS AND DISTANCES SHOWN ON
PLAT OF SURVEY BY RLS 1259 DATED 1986. RECORDED LOCATION IN PREPARATION OF CTH
"C" RESURFACE PROJECT

30 JULY 2012: SET 3/4in. X 24in. REBAR 1.50lbs/ft. WITH ALUMINUM CAP IN ROAD BASE,
THEN SET A MAG NAIL OVER THE REBAR IN THE BITUMINOUS ROADWAY AFTER COMPLETION
OF CTH "C" RESURFACE PROJECT

PLAN VIEW: CHAPTER A-E 7.08 (3): (C), (D), (E),

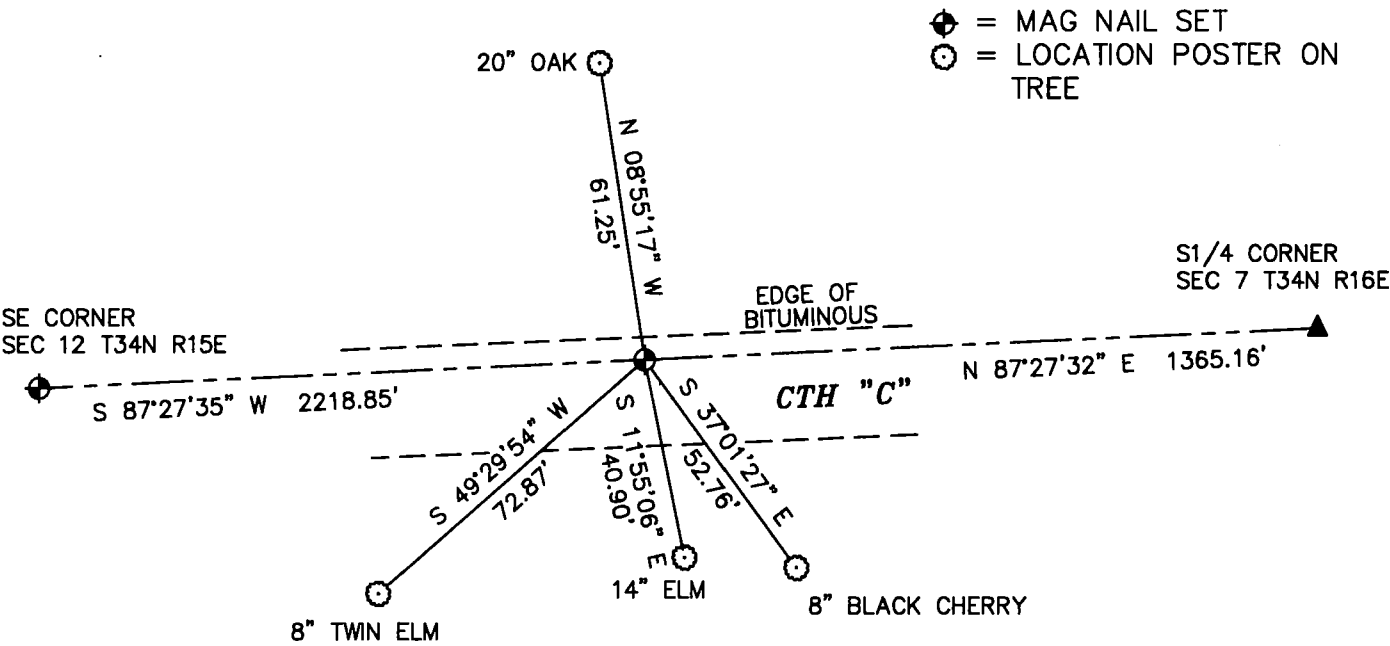

SURVEYOR'S CERTIFICATE: CHAPTER 7.08 (3): (I)

THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND
SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF.



Darren B. Krzanowski
DARREN B. KRZANOWSKI
WISCONSIN LAND SURVEYOR S-2663
DATED THIS 2nd DAY OF AUGUST 2012

Document Number
209973

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 17th day
of September A.D., 2012 at
9:00 o'clock A.M. and recorded
in Vol. 10012-2000000000
page 53
Cathy McSweeney
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD
FOREST COUNTY, WISCONSIN


CORNER NO. 43416070020

IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A)-(I)

LOCATION: CHAPTER A-E 7.08 (3): (A)
SECTION 7 TOWNSHIP 34 NORTH RANGE 16 EAST

TYPE OF CORNER: SOUTH 1/4 CORNER
TYPE OF MONUMENT: 3/4in. REBAR/ALUMINUM CAP


FOREST COUNTY COORDINATES
NORTHING: 521268.453
EASTING: 929233.530

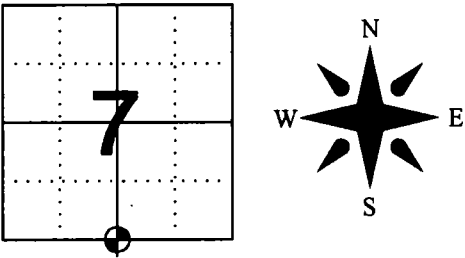

RECOVERY PROCEDURES: CHAPTER A-E 7.08 (3): (B), (F), (G), (H)
1858 ORIGINAL SURVEY BY McBRIDE, B.T.S HEMLOCK 12" N 6° E 46 LKS, BIRCH 16" S 23° W 41 LKS.
1983 HARRISON RLS NO. S-1651 SET 2" DIA. ALUMINIM MONUMENT B.T.S RED MAPLE 7" S 22° E
60.57', BASSWOOD 6" S 54° W 87.54', WITNESS STEEL SIGN POST NE 13.80' REFERENCE CENTER
COUNTY "C" SOUTH 23.78'
1993 DOBBRATZ, RLS NO. S-973, FOUND MONUMENT, STEEL SIGN POST AND B.T.S, POWER POLE IS
GONE. B.T. BASSWOOD 6" BEARING IS WRONG.

7 JUN 2012: FOUND CALLED FOR ALUMINUM MONUMENT IN GOOD CONDITION PRIOR TO CTH "C"
RESURFACE PROJECT.
30 JULY 2012: SET 3/4in. X 24in. REBAR WITH ALUMINUM CAP OVER ALUMINUM MONUMENT AFTER
COMPLETION OF RESURFACE PROJECT

PLAN VIEW: CHAPTER A-E 7.08 (3): (C), (D), (E),

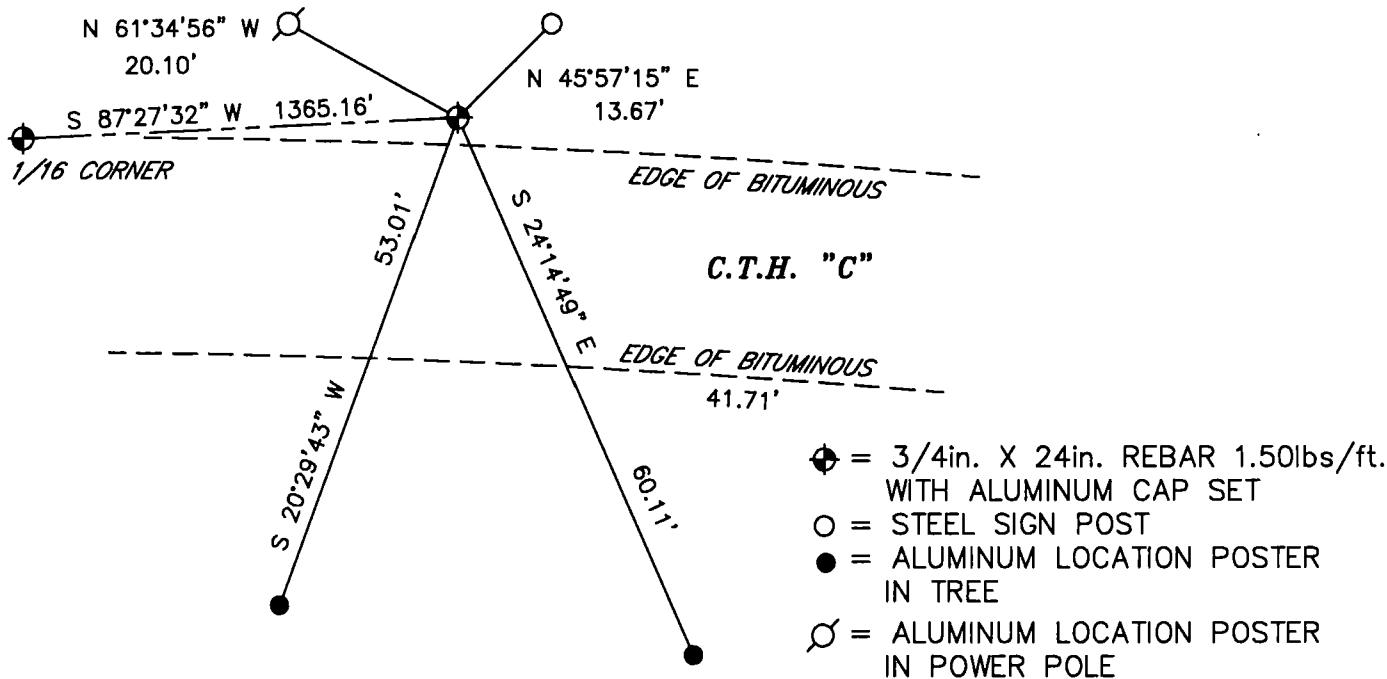

SURVEYOR'S CERTIFICATE: CHAPTER 7.08 (3): (I)

THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND
SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF.



Darren B. Krzanowski
DARREN B. KRZANOWSKI
WISCONSIN LAND SURVEYOR S-2663
DATED THIS 1ST DAY OF AUGUST 2012

43416070020


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTH $\frac{1}{4}$ CORNER OF SECTION 7, TWP. 34 N.,
 R. 16 E.

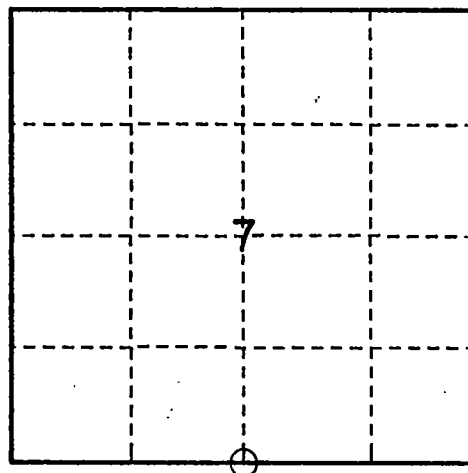

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, B.Ts - HEMLOCK 12" N.6°E. 46 LKS.,
 BIRCH 16" S.23°W. 41 LKS.

1983 - HARRISON R.L.S. NO.S-1651 SET 2" DIA. ALUMINUM MONUMENT, B.Ts
 RED MAPLE 7" S.22°E. 60.57FT., BASSWOOD 6" S.54°W. 87.54FT., WITNESS -
 STEEL SIGN POST NE 13.80FT., REFERENCE CENTER COUNTY "C" SOUTH 13.90FT.
 WITNESS POWER POLE NO. 3416-7L10 N.5°W. 23.78FT.


1993 - DOBBRATZ, R.L.S. NO.S-973, FOUND MONUMENT, STEEL SIGN POST AND
 B.Ts., POWER POLE IS GONE. B.T. BASSWOOD 6" BEARING IS WRONG.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS AND REFERENCE


1. STEEL SIGN POST NE 13.80FT. (EXISTING)
2. B.T. RED MAPLE 8" S.22°E. 60.57FT. (EXISTING)
3. CENTERLINE CTY. "C" SOUTH 13.90FT.
4. B.T. BASSWOOD 6" S.45°W. 87.54FT. (EXISTING)
5. POWER POLE # 34167R4 N.57°W. 47.35FT. (NEW)
6. 2" DIA. ALUMINUM MONUMENT (FOUND)

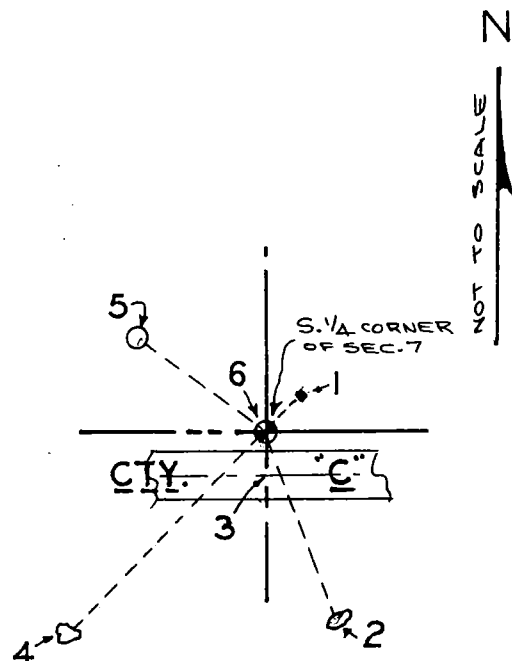

43416070020

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.
- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
- (2)
- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

REGISTER'S OFFICE
FOREST COUNTY, WIS.

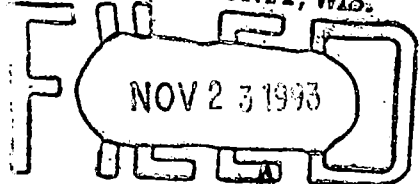

At 9:00 AM.
Paul [Signature] Register of Deeds

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

7/31/93

Date

CERTIFICATE READY FOR FILING:

Ralph [Signature] 11-5-93
Acting District Ranger

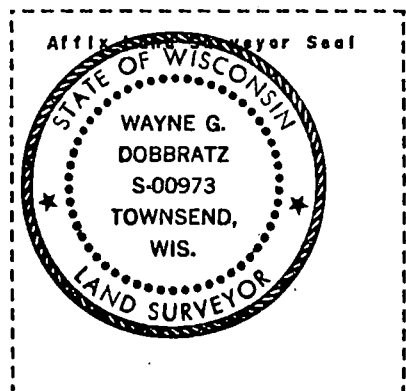

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 7 and 18,
T.34N., R.16E.

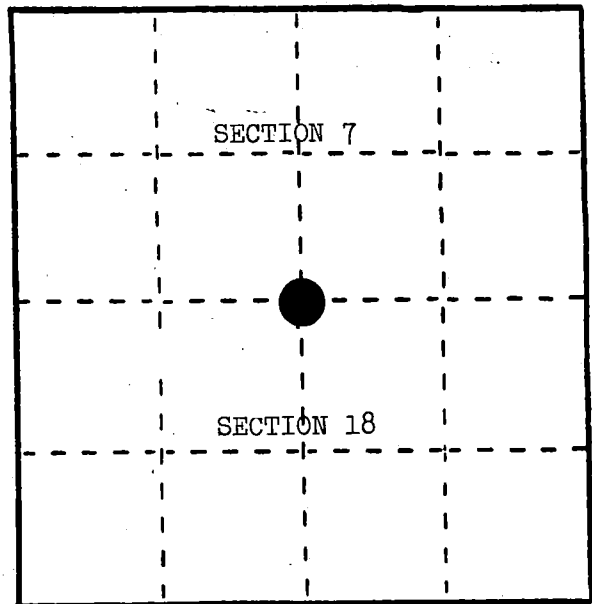

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post 52.51 chains with the following BTs: Hemlock, 12", N.6°E., 46 links; Birch, 16", S.23°W., 41 links.

December 5, 1983, Alan Harrison set point at end of N-S fence line and intersection of Highway "C". Corner set $1\frac{1}{2}$ rods south of fence corner with location tag. Resident witness, Mr. Stubbs, said corner was in old road bed of County "J" south of fence corner. Nathan Smith's survey of 1916 fits this location well.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Red Maple, 7", S.22°E., 60.57'
3. Basswood, 6", S.54°W., 87.54'
4. Power Pole #3416-7L10, N.5°W., 23.78'
5. Steel Sign Post, Northeast, 13.8'
6. Center County "C", South, 13.9'

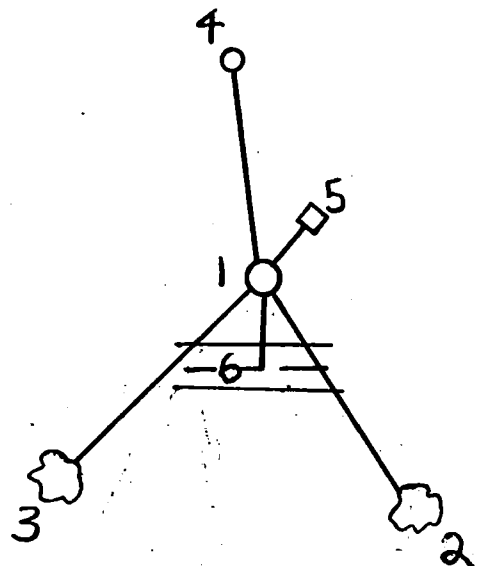

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 14th day
of January, 1985 at
10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 3
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.


○ = Corner monument restored.

Meander corner between Sections 7 and 18,
T.34N., R.16E. on west shore of Otter Lake.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 21st day
of October A.D., 1985 at
10:00 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page J-4,5

Paul Aschenbrenner
Register of Deeds

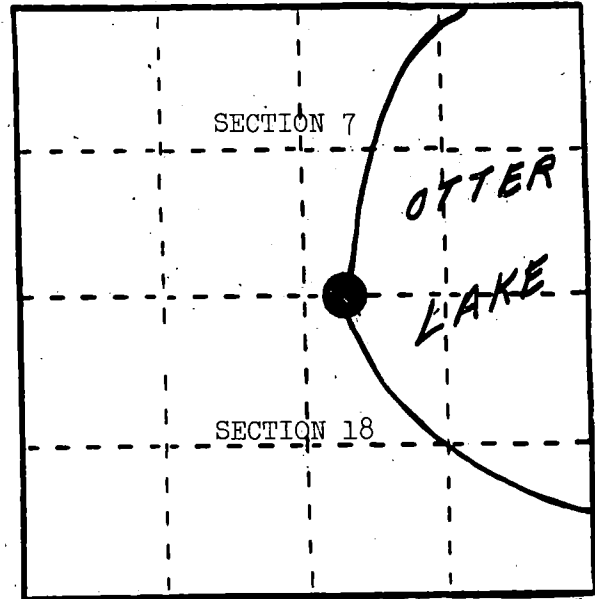

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Tamarack, 8", N.3°W., 43 links; Tamarack, 8", S.76°W., 60 links.

In 1984, Alan Harrison found no evidence of original corner or accessories. Restored corner by single proportion between north quarter corners of Sections 17 and 18.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 120" aluminum monument stamped to identify the corner.
2. Tamarack, 6", S.16°W., 16.29 feet
3. B. Spruce, 5", S.88°W., 5.24 feet
4. Tamarack, 2", N.8°W., 19.21 feet
5. Steel Sign Post, East, 1.50 feet

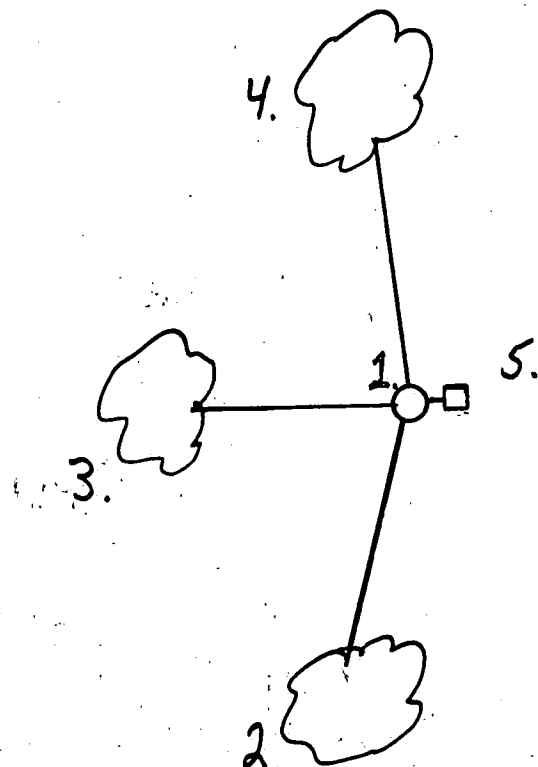

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


- (g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

10/15/85
Date

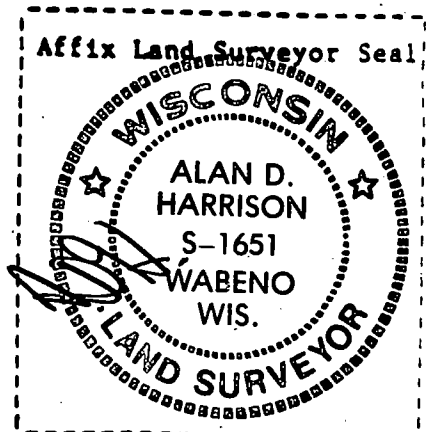

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

South meander corner to Sections 17 and 18,
T.34N., R.16E.

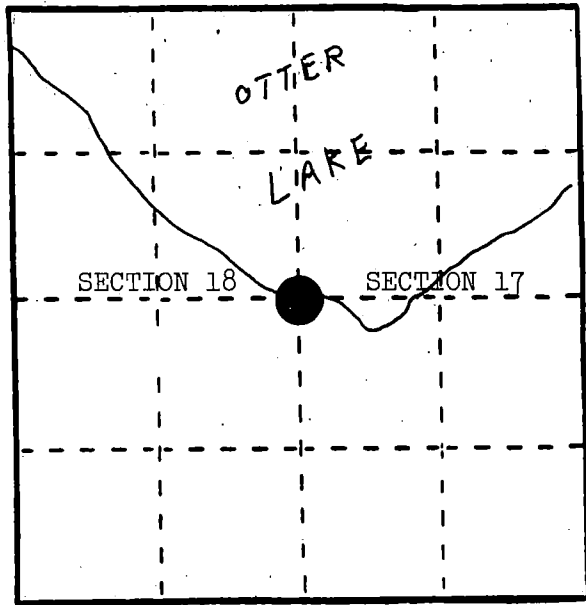

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set meander post at 65.20 chains with the following BTs: Tamarack, 6", S.9°W., 63 links; Tamarack, 6", S.22°E., 63 links.

In 1983, Paul Smith, R.L.S., said iron pipe was at M.C. and original Tamarack still there. He used this for subdivision in Section 17.


December 30, 1983, Milo Stefan and Alan Harrison found iron pipe, but no stump remains-- tied pipe to survey.

July 23, 1984, Alan Harrison found no evidence of original corner. Distance to north M.C. is very close to original distance. Accepted this as best corner location evidence.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. Cedar, 6", S.43°E., 48.38'
3. Cedar, 6", S.21°W., 31.40'
4. Cedar, 10", N.64°W., 39.65'
5. Steel Sign Post, Northeast, 1.28'

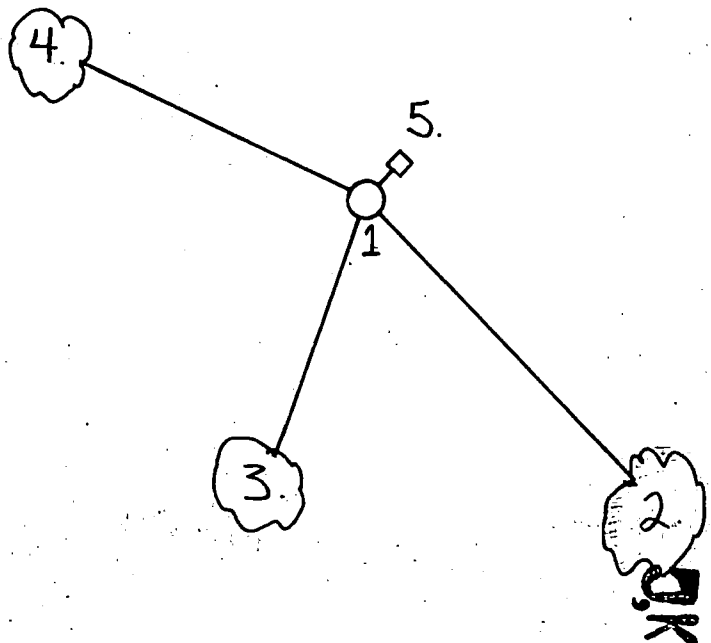

REGISTER'S OFFICE)
Forest County, Wis.

Received for record this... day
of... January... A.D., 1985 at
... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATION
on page J.K.5

Paul Aschenbrenner
REGISTER

J,K-5

43416182000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/13/84
Date

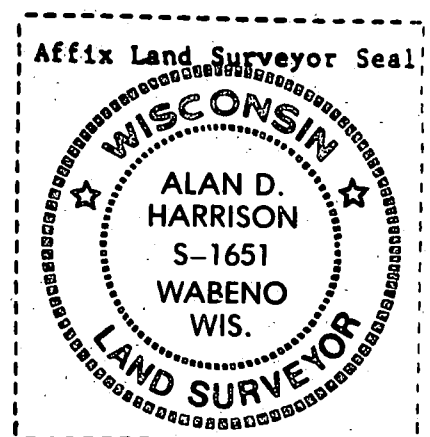


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 8 and 17, T.34N., R.16E.

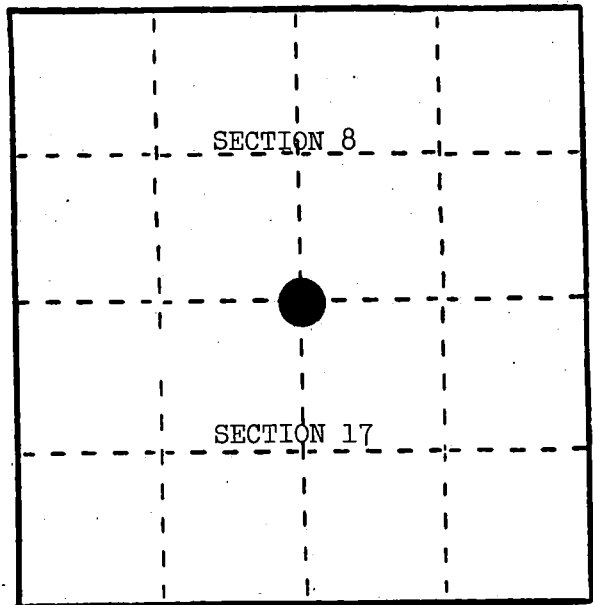

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Hemlock, 8", N.42°W., 17 links; Hemlock, 8", S.11°W., 23 links.

December 8, 1983, Stefan and Harrison found 1½" iron rod. Pulled S.11°W., 15.2', stump hole; pulled N.42°W., 11.2', Basswood clump growing. Iron rod is same type as found at J-11.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 7", N.29°E., 10.85'
3. Sugar, 5", S.29°W., 16.83'
4. Sugar, 6", S.11°E., 22.59'
5. Steel Sign Post, West, 1.5'

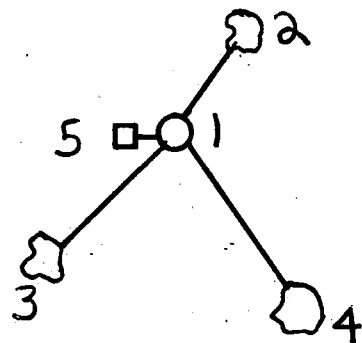

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24th day
of January, A.D., 1985 at
...10:30 o'clock... A...M. and
recorded in Vol. CORNER RESTORATIONS
on page 7

Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

Affix Land Surveyor Seal



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 8, 9, 16, and 17,
T.34N., R.16E.

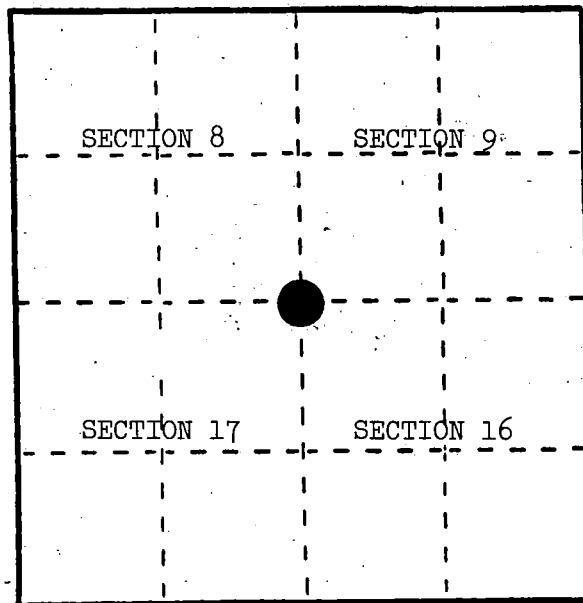

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Hemlock, 12", N.20°W., 24 links; Cedar, 8", N.22°E., 20 links; Hemlock, 12", S.39°E., 18 links; Cedar, 8", S.52°W., 15 links.

December, 1935, road survey found fence corner, iron peg, and Forest Service poster. Fence runs south and west.


March 29, 1968, Resvick found fence post with Forest Service poster on it. From post, Cedar stump, S.52°W., 9.90'. October 25, 1968, Resvick--Hemlock stump mound bears S.39°E., 13.5'

April 19, 1984, Alan Harrison found corner, as described above, plus N.20°W., 15.8', remains of Hemlock stump. Accepted as the original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Balsam, 6", N.50°E., 34.82'
- Aspen, 10", S.41°E., 28.32'
- Rock Elm, 4", S.85°W., 51.94'
- Rock Elm, 6", N.22°W., 42.95'
- Steel Sign Post, Southwest, 0.9'

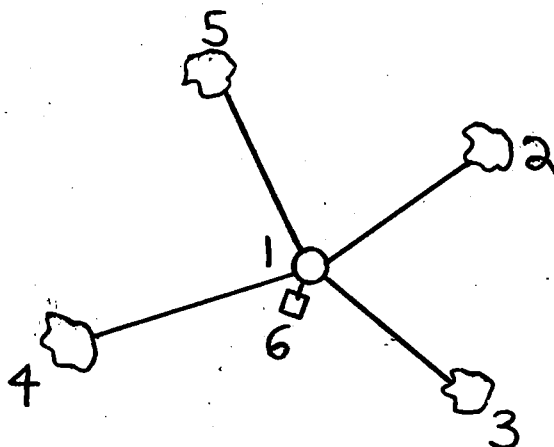

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24th day
of January, 1985, at
10:30 o'clock A.M. and

recorded in Vol. CABNER..RESTORATIONS

on page 79
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

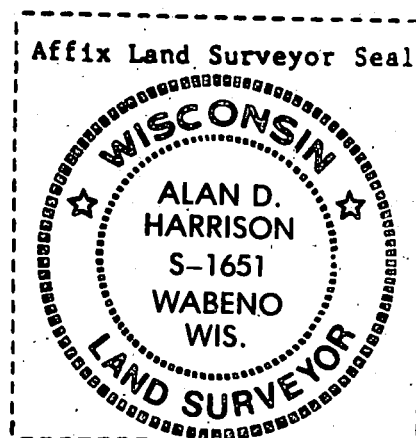


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 9 and 16, T.34N., R.16E.

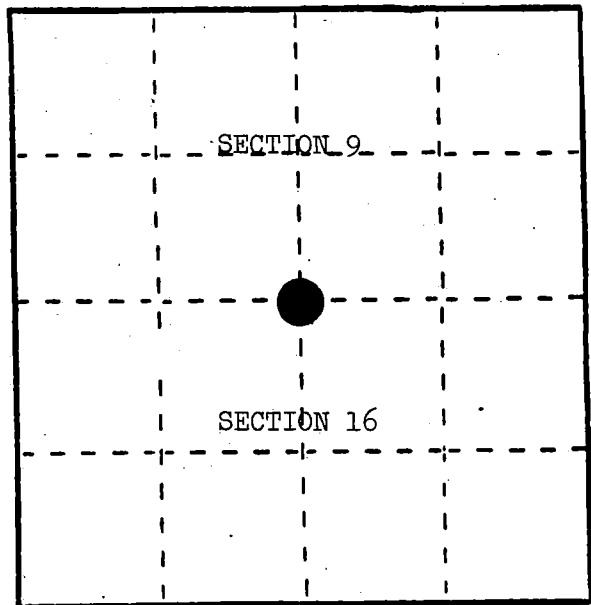

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Sugar, 11", S.13°E., 29 links; Ironwood, 6", N.2°W., 25 links.


January 3, 1984, Bob Dangremond (874), found a squared wood post at fence corner and location poster on south side of 6" fence post at corner.

October 6, 1983, Milo Stefan found fence corner with Forest Service poster (down and rusted badly), fence found west; 1" x 24" iron pipe at base of fence post; new post, rotted off and in crotch of Black Cherry clump; stump hole, S.13°E., 19.1'; stump hole, N.2°W., 16.5'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Aspen, 7", N.33°E., 23.61'
- Triple Basswood, 11", S.73°E., 94.00'
- Black Cherry, 4", S.62°W., 33.73'
- Steel Sign Post, North, 1.5'

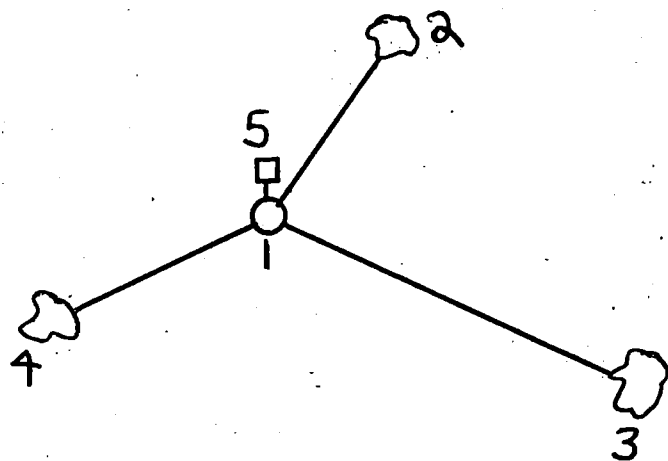

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this 24th day

of January 25, 1985 A.D., at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 11

Paul A. H. ...
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to 9, 10, 15, and 16, T.34N., R.16E.

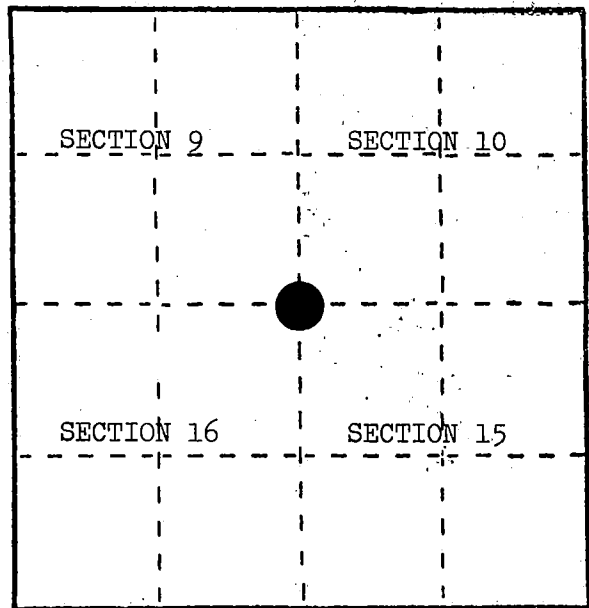

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Sugar, 12", N.15°W., 31 links; Sugar, 12", N.34°E., 7 links; Hemlock, 16", S.35°E., 17 links; Linn, 14", S.28°W., 33 links.

December 18, 1934, Bob Dangremond found an iron pipe 14" high.


March 29, 1968, Resvick found 1" iron pipe painted orange--on top of small knoll.

November 14, 1983, Milo Stefan found Cedar post, fallen, point is very plain; remains of root pattern from a 16"-20" Hemlock stump, S.35°E., 11.2'; stump hole, N.34°E., 4.6', no trace of pipe found by Resvick or Dangremond. Accepted as the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 5", S.72°E., 26.14'
3. Basswood, 10", S.15°E., 121.69'
4. Rock Elm, 4", S.53°W., 33.26'
5. Sugar, 6", N.03°W., 66.97'
6. Steel Sign Post, South, 1.10'

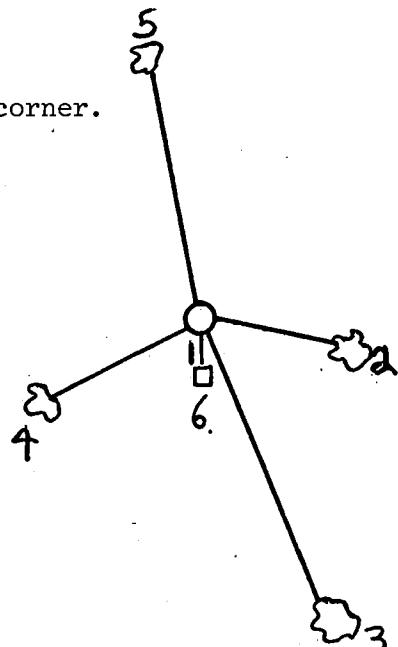

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of January... A.D., 1985 at

... 10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 13

Paul A. Schumacher
REGISTER

J-13

43416090000

J 13

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal



(i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Milo E. Stefan

11/30/84


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 10 and 15,
T.34N., R.16E.

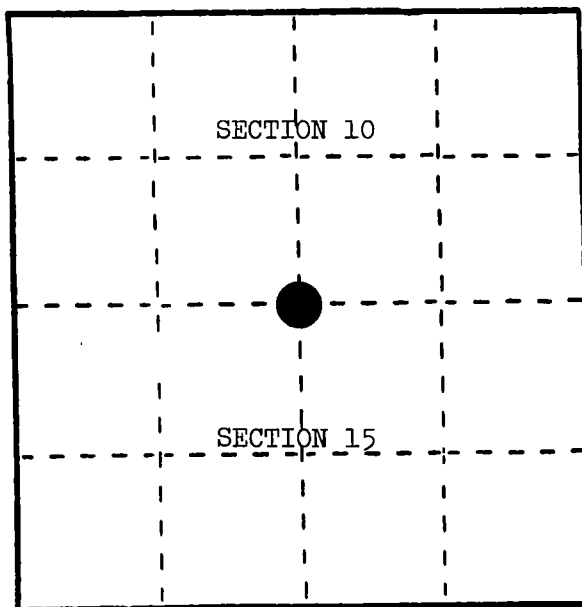

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: White Pine, 14", N.48°E., 13 links; White Pine, 12", N.39°W., 23 links.

August 18, 1983, Milo Stefan found post point--6" diameter and 12" long; White Pine stump rotted to ground level, N.48°E., 8.58'; White Pine stump rotted, N.39°W., 15.2'; creek, west, and swamp call, east, fit well. Accepted as corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Basswood, 10", N.39°E., 52.29'
3. White Birch, 12", N.11°W., 83.93'
4. White Pine Stump, 30", N.8°E., 25.64'
5. Steel Sign Post, West, 1.3'
6. Steel Sign Post, South, 1.3'

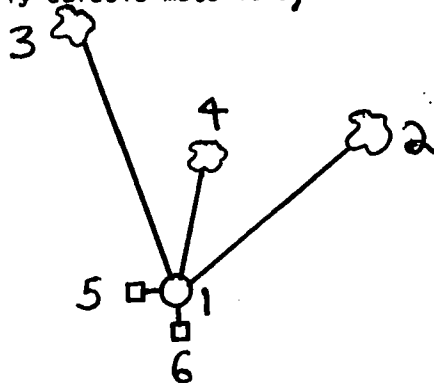

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day
of January A.D., 1985 at
..... o'clock... A..... M. and

recorded in Vol. CORNER RESTORATIONS
on page 15

Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section Corner to Sections 10, 11, 14 & 15;
 T.34N., R.16E., 4th P.M.

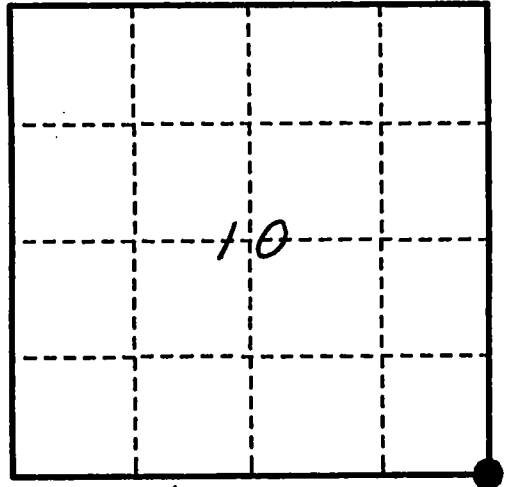

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found aluminum monument, sign post and two BTs in good condition. Aspen and 5" Tamarack dead and down. This corner was restored by myself in 1983.


We made two new BTs:

Black Spruce, 6", S.15°E., 123.04'
 White Pine, 6", S.3°W., 139.59'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" Aluminum monument.
- Black Spruce, 6", S.15°E., 123.04'.
- White Pine, 6", S.3°W., 139.59'.
- Tamarack, 14", S.38°W., 44.44'.
- White Spruce, 7", N.86°W., 36.73'.
- Steel sign post, Northwest, .70'.

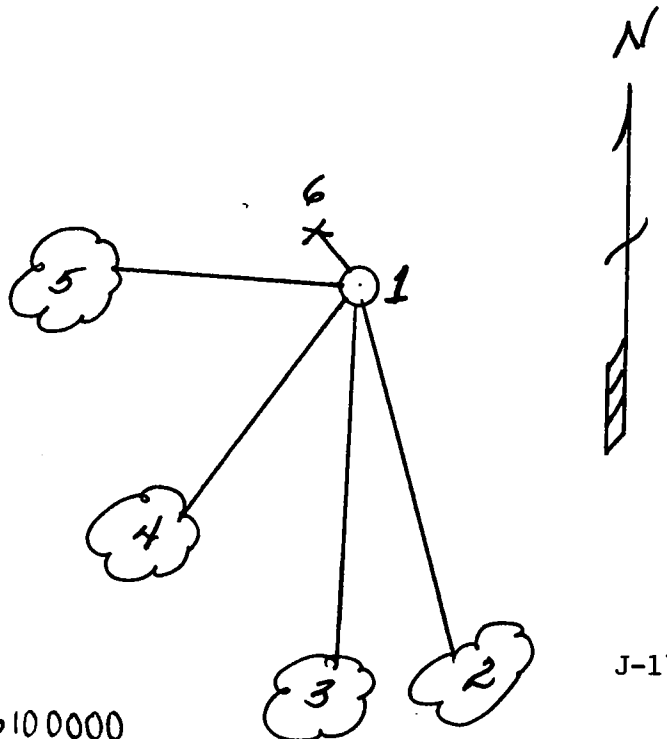

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 9th day
 of March, A.D., 1983 at
2:15 o'clock P.M. and recorded
 in Vol. 34-16 Corner Restoration
 page J-17
Shel Chitto, Deputy
 Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992
Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 10, 11, 14, and 15,
T.34N., R.16E.

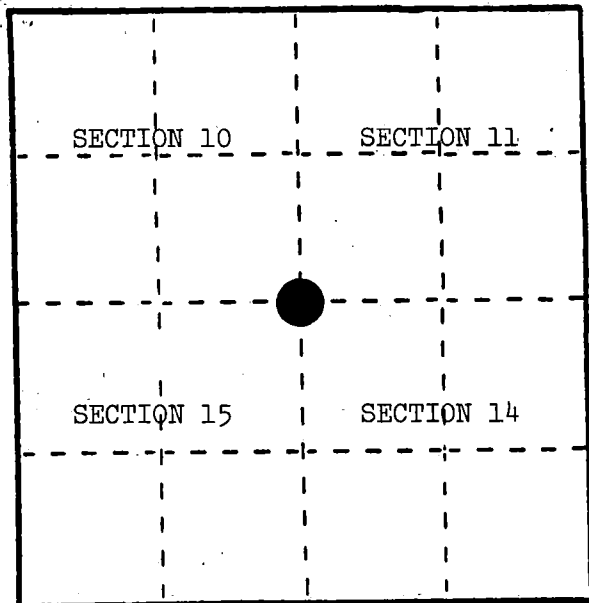

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Tamarack, 14", N.20°W., 57 links; Tamarack, 12", N.29°E., 20 links; Black Ash, 12", S.44°E., 30 links; Birch, 16", S.11°W., 17 links.

January 11, 1935, C. J. Priegal--Truck Trail #344 found a fence line and Forest Service poster.

January, 1984, Milo Stefan, Bay Shore Farm Road runs north and south from section corner. Found no evidence of fence line or corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

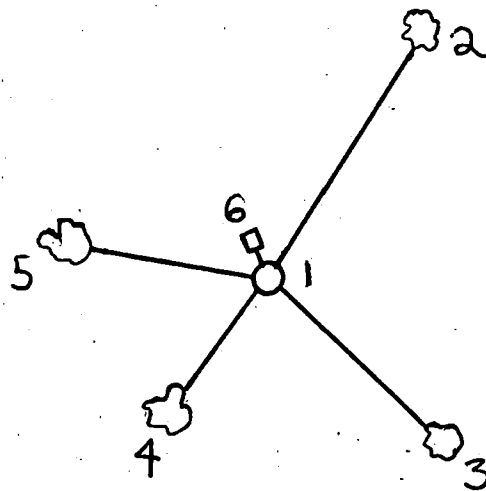

1. A 2" x 36" aluminum monument stamped to identify the corner.
2. Tamarack, 5", N.25°E., 88.68'
3. Aspen, 6", S.39°E., 68.32'
4. Tamarack, 14", S.38°W., 44.44'
5. White Spruce, 7", N.86°W., 36.73'
6. Steel Sign Post, Northwest, 0.7'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of... January... A.D., 1985

... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS

on page J-17...
Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

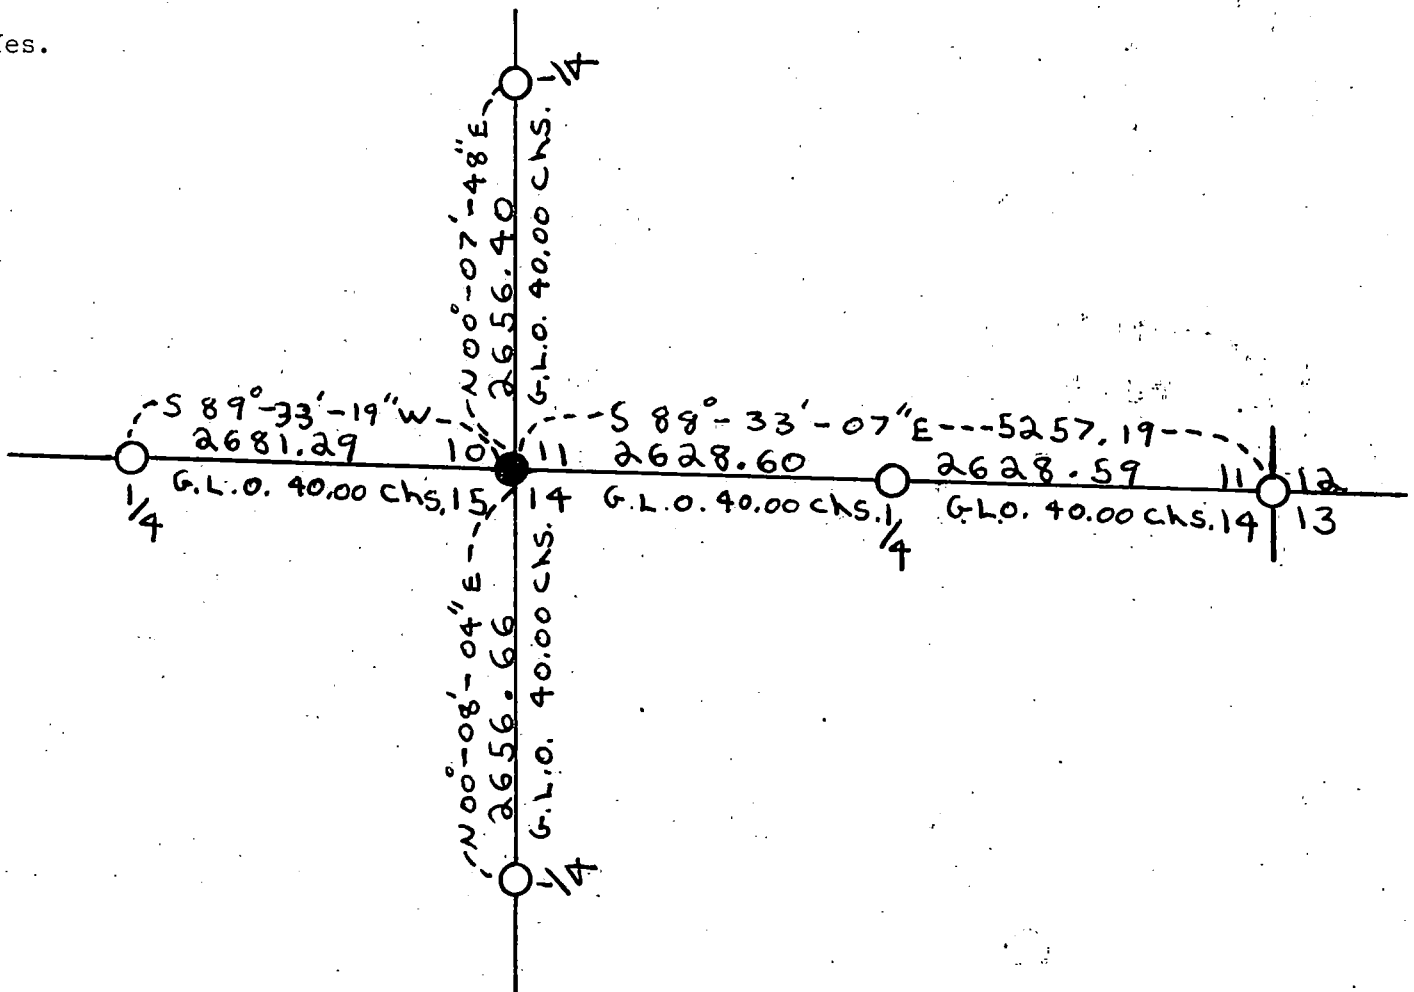

Affix Land Surveyor Seal



- (i) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Milo E. Stefan

11/30/84

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner between Sections 11 & 14;
T.34N., R.16E., 4th P.M.

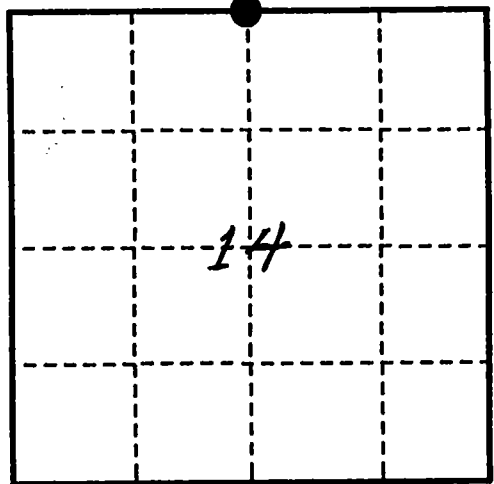

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Found 2 1/2" aluminum monument with sign post and two BTs in good condition. We made one new BT: Balsam Fir, 5", N.76°E., 21.29'

This corner was restored by myself in 1983.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" x 30" Aluminum monument.
2. Balsam Fir, 5", N.76°E., 21.29'.
3. Black Cherry (dead), 5", N.25°E., 45.01'.
4. Aspen, 7", S.47°E., 27.23'.
5. Spruce, 6", N.53°W., 55.44'.
6. Steel sign post, East, 2.10'.

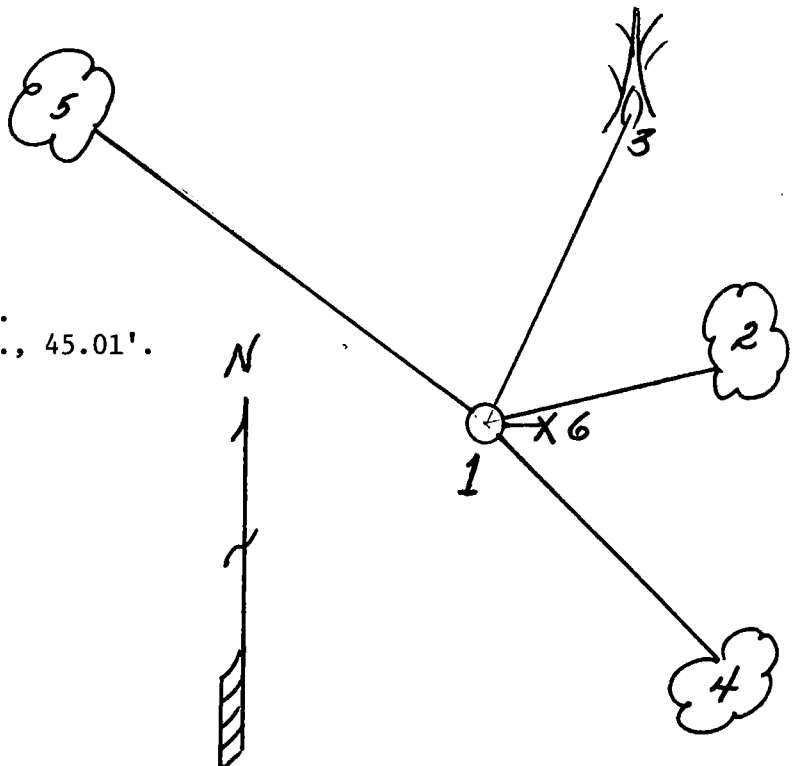

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 9th day
of March A.D., 1993 at

2:15 o'clock P.M. and recorded
in Vol. 34 of Corner Restorations
page 1-19

Shat Chitt Deputy
Register of Deeds

- (a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan

Signature

November 20, 1992

Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 11 and 14, T.34N., R.16E.

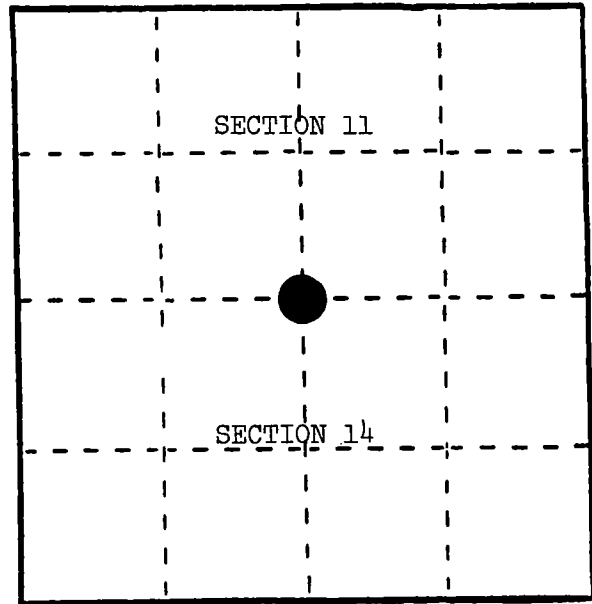

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Birch, 14", S.61°W., 18 links; Sugar, 12", N.2°W., 20 links.

March, 1984, Alan Harrison set proportionate position---searched area, found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Black Cherry, 5", N.25°E., 45.01'
- Aspen, 7", S.47°E., 27.23'
- White Spruce, 6", N.53°W., 55.44'
- Steel Sign Post, East, 2.1'

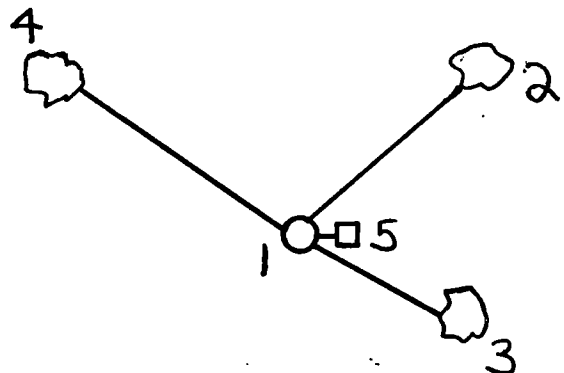

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this 24th day
 of January A. D., 1985 at
10:30 o'clock A. M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 19
Paul Aschenbrenner
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

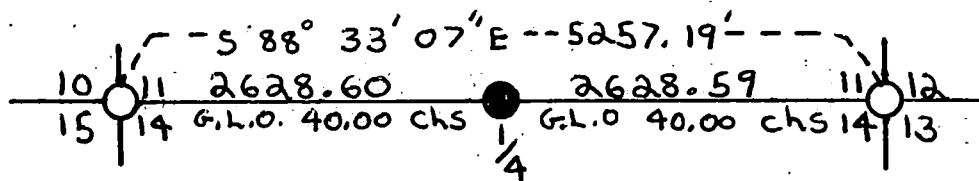

Affix Land Surveyor Seal



(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 11, 12, 13 and 14, T.34N., R.16E., Forest County, Wisconsin.

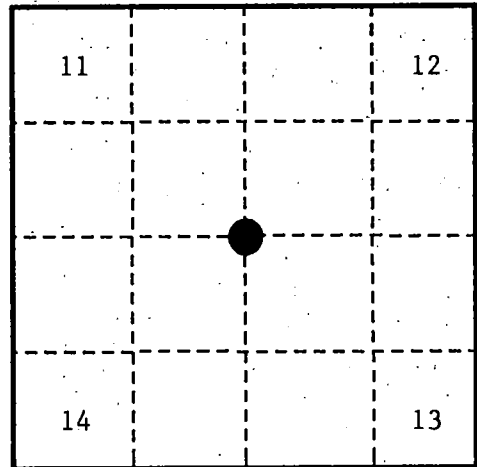

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1885, James McBride set a wood post with the following B.T.'s: Hemlock, 24", N.54W., 45 links (29.70 feet); Hemlock, 10", N.83E., 25 links (16.50 feet); Birch, 16", S.06E., 21 links (13.86 feet); Hemlock, 14", S.64W., 9 links (5.94 feet).

In 1834, Leonard Sobzak (C.C.C.) found cedar post and placed a metal location poster on the same.


In 1979, Jean Resvick (R.L.S.) found the cedar post with the Forest Service Location poster, Hemlock stumps at N.54W., 45 links (29.70 feet), and S.64W., 9 links (5.94 feet). Accepted as best evidence of corner. Set 2" monument with brass cap stamped to identify the corner and the following B.T.'s: Yellow Birch, 4", N.82E., 21.57 feet; Maple, 10", S.03E., 30.12 feet; Balsam, 16", N.49W., 40.38 feet.

In 1990, Alan Harrison (R.L.S.) found monument and B.T.'s and added a new B.T. and Steel Sign Post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" Iron pipe with stamped brass cap to identify the corner.
2. White Birch, 5", S.82W., 20.46 feet (new).
3. Yellow Birch, 4", N.82E., 21.59 feet.
4. Maple, 10", S.03E., 30.12 feet.
5. Balsam, 16", N.49W., 40.38 feet.
6. Steel Sign Post, West, 0.51 feet.

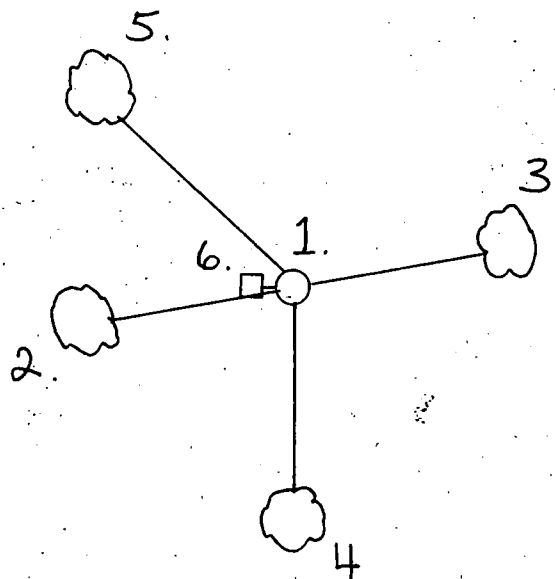

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 19th day
of SEPTEMBER A.D., 1990 at
3:15 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page 21.

Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner, as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)
a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

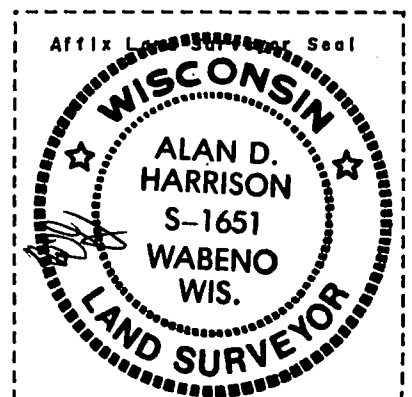

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 11, 12, 13 & 14;
T.34N., R.16E., 4th P.M.

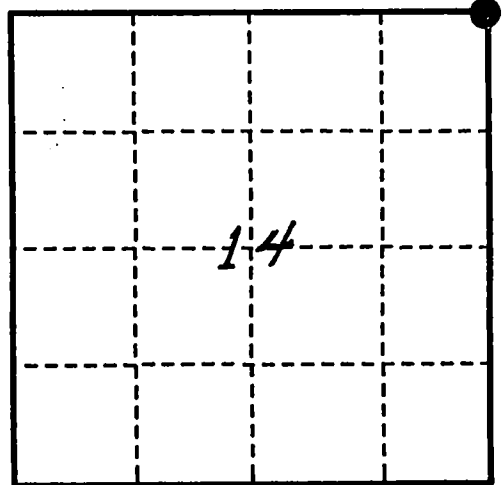

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found monument, sign post and two BTs by Resvick in good condition. Balsam BT in poor condition and nearly dead. Another BT, not of record, is present: White Birch, 6", S.86°W., 20.47'.


We made one new BT: Black Cherry, 8", N.43°W., 29.84'

This corner was restored by Resvick in 1979.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" Iron pipe with brass cap.
2. White Birch, 4", N.82°E., 21.57'.
3. Red Maple, 10", S.3°E., 30.12'.
4. White Birch, 6", S.86°W., 20.47'.
5. Balsam Fir (dead), 16", N.49°W., 40.38'.
6. Black Cherry, 8", N.43°W., 29.84'.
7. Steel sign post, Northwest, .5'.

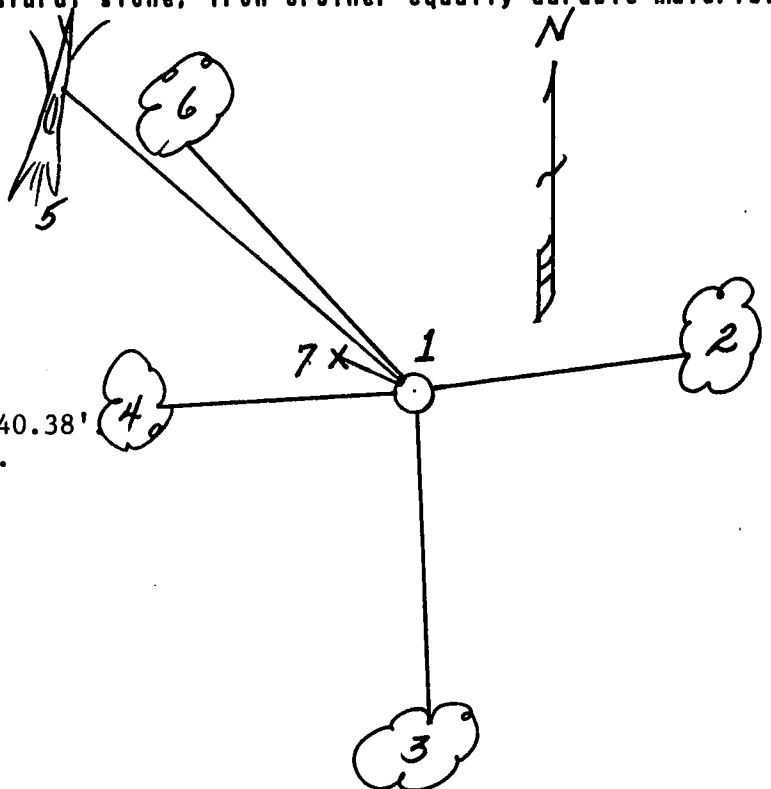

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 9th day
of March, A.D., 1993 at
9:15 o'clock A.M. and recorded
in Vol. 34 to Corner Restorations
page 5-21

Dea Chitta Deputy
Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.



Milo E. Stefan
Signature

November 20, 1992
Date

CERTIFICATE READY FOR FILING:

Dele R. Covey
Acting District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 14 day of September, 1979, I found evidence of the Northeast Section corner of Section 14 Township 34 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in 1858
80.00 chains north between Sections 13 and 14, set post
Hemlock 24, N54W, 45 links
Hemlock 10, N83E, 25 links
Birch 16, S6E, 21 links
Hemlock 14, S64W, 9 links
South, 11 chains enter cedar swamp
North, 22 chains enter cedar swamp

Description of corner evidence found:



Cedar post with location poster
Possible hemlock stump at N54W, 45 links
Possible hemlock stump at S64W, 9 links
Plantation post SE of post dated 1938
South 11 chains enter cedar swamp
North 22 chains enter swamp
Small swamp just north of corner
Post was in place in 1934

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post with 2 inch inside diameter, galvanized iron pipe,
3 feet long, filled with concrete, with brass cap stamped
T34N, R16E, S11, S12, S14, S13, 1979, S-802

Blazed and scribed the following new bearing trees

Yellow Birch 4, bears N82E, 21.57 feet
Maple 10, bears S3E, 30.12 feet
Balsam 16, bears N49W, 40.38 feet
Set steel sign post northwest, 0.5 foot

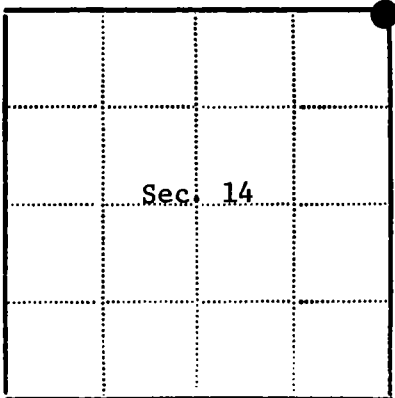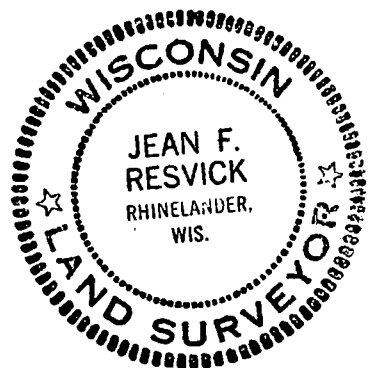

● - Corner monument restored
□ -

Resident witnesses

Dated at Rhinelander Wisconsin, this 25 day of September 1979.

Signature *Jean F. Resvick* Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NO. 118066

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 9th day of June 1980, and was filed in Book No. Page No. of County Records.

Signature *Sharon Mueller* Title Deputy

Township 34 North, Range 16 East, Section 14, Index No. J-21, Page No.

43416110000

521


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 12 and 13, T.34N., R.16E.

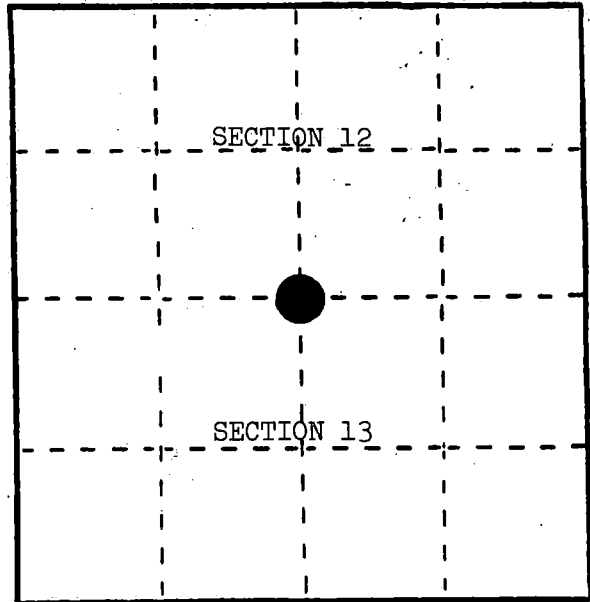

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set quarter section post with the following BTs: Birch, 16", S.16°E., 28 links; Birch, 14", N.54°W., 13 links.

July 6, 1982, Milo Stefan searched area and found no evidence of the corner. Placed a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. White Spruce, 6", N.44°E., 7.96'
2. Red Maple, 6", S.20°E., 12.90'
3. Basswood, 6", S.47°W., 8.36'
4. Steel Sign Post, West, 1.5'
5. 2" x 36" aluminum monument stamped to identify the corner.

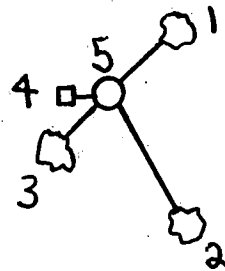

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day
of January, 1982 at
... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS
on page 23


Paul A. Schenker
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Lost corner proportionate methods. Single proportionate measure between the northwest and the northeast section corners of Section 13.

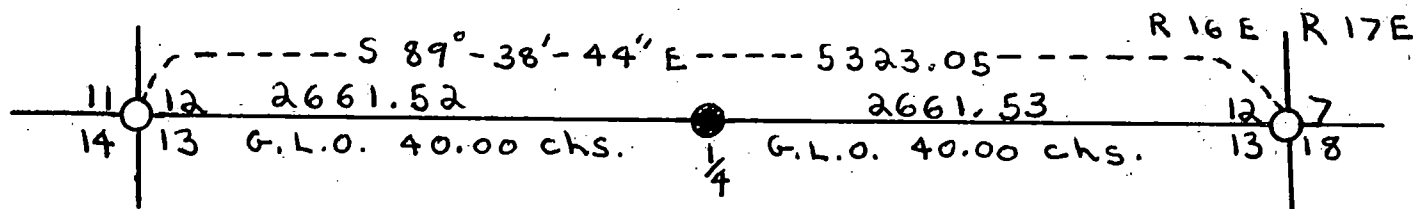

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.



Milo E. Stefan
Signature

11/30/84
Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I Jean F. Resvick, do hereby certify that on the 2nd day of May, 19 76,
 I found evidence of the Northeast Section corner of Section 13
 Township 34 North, Range 16 East, Fourth Principal Meridian, as described
 hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
 petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed by T. Sprague in November 1839
 Surveyed in 1935 by F.P. Gould and B.F. Hammes
 Set a 4" iron post for the corner of Sections 7, 12, 13 and 18
 with a brass cap stamped: Marinette Co. - Survey, T34N, R16E,
 T34N, R17E, 7, 12, 13, 18.

Description of corner evidence found:

Monument as described above and in place

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:
 W. Spruce, 8", N50°W, 7.81 feet
 W. Spruce, 8", S59°W, 5.81 feet
 Set a steel sign post SE of the monument, 0.50 feet

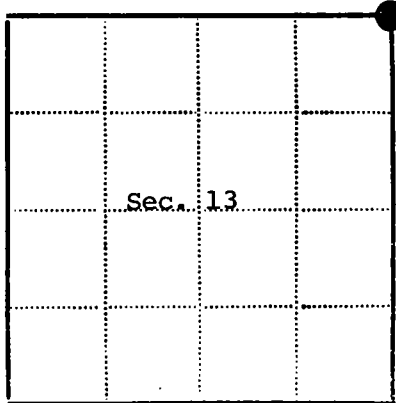

● - Corner monument restored

□ -

Resident witnesses

Dated at Rhineland Wisconsin, this 15 day of May,
 19 76.

Signature Jean F. Resvick Title Land Surveyor
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT NUMBER

109578Office of Register of Deeds County of FOREST

I hereby certify that the within instrument was filed in this office for record
 on the 2nd day of July, 19 76, and was filed in Book
 No. _____ Page No. _____ of County Records.

Signature Eugene Staty Title Register of Deeds

Township 34 North, Range 16 East Section 13 Index No. J-25, Page No. _____

4341612 0000

25


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ● = Corner monument restored.

Section Corner to Sections 7, 12, 13 and 18, T.34N., R.16 and 17E., Forest and Marinette Counties, Wisconsin.

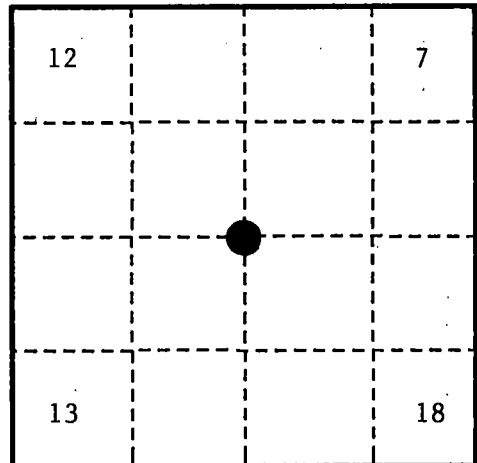

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set a wood post with the following B.T.'s: Elm, 12", S.35°W., 29 links (19.14 feet); Birch, 12", N.40°W., 21 links (13.86 feet).

In 1935, F. P. Gould, Deputy Surveyor, Marinette County set 4" pipe with a stamped brass cap to identify the corner.


In 1976, William Cochrane (R.L.S.) found monument in place. Set the following B.T.'s: White Spruce, 8", N.50°W., 7.81 feet; White Spruce, 8", S.59°W., 5.81 feet; Steel Sign Post, Southeast, 0.50 feet.

In 1990, Alan Harrison (R.L.S.) found monument in place, added new B.T.'s.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County Monument with stamped brass cap to identify the corner.
2. Aspen, 8", N.49°E., 17.61 feet.
3. Black Cherry, 7", S.38°E., 40.37 feet (new).
4. White Spruce, 8", N.50°W., 7.81 feet. (new).
5. White Spruce, 8", S.59°W., 5.81 feet.
6. Steel Sign Post, Southwest, 0.50 feet.

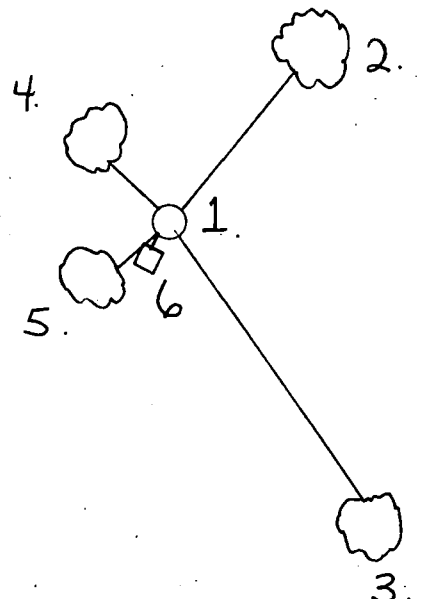

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 19th day
 of SEPTEMBER A.D., 1990 at
3:15 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 page J-25
Paul Hechendorfer
 Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

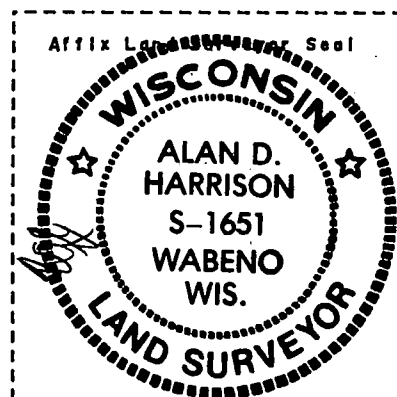

Alan D. Harrison 8/1/90
Signature Date

CERTIFICATE READY FOR FILING:

Deer S. Stage
District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTH MEANDER CORNER TO SECTIONS 17 AND 18,
 TWP. 34 N., R.16E.

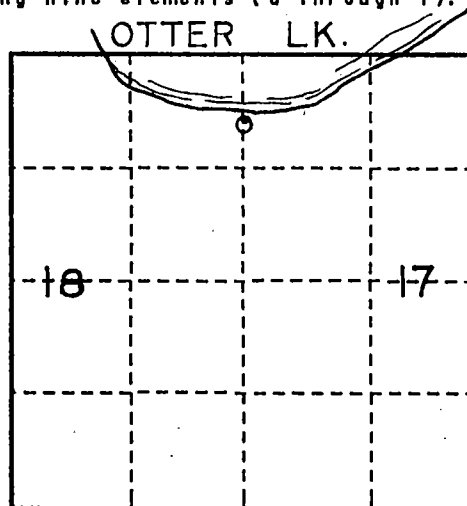

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


1858 - ORIGINAL SURVEY BY McBRIDE, SET MEANDER POST, B.Ts - TAMARACK 6" S.9°W. 63 LKS., TAMARACK 6" S.22°E. 63 LKS.
 1983 - SMITH R.L.S., SAID IRON PIPE WAS AT M.C., ORIGINAL TAMARACK STILL THERE, HE USED THIS FOR SUBDN. OF SEC. 17.
 1983 - STEFAN R.L.S. NO. S-1558 AND HARRISON R.L.S. NO. S-1651 FOUND IRON PIPE BUT NO STUMP REMAINS, TIED PIPE TO SURVEY
 1983 - HARRISON R.L.S. NO. S-1651 SET 2' DIA. AT M.C., B.Ts - CEDAR 6" S.43°E. 48.38FT., CEDAR 6" S.21°W. 31.40FT., CEDAR 10" N.64°W. 39.65FT.
 WITNESS - STEEL SIGN POST NE 1.28FT.
 1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST AND B.Ts EXCEPT B.T. CEDAR 10" N.64°W. 39.65FT. IS DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. STEEL SIGN POST NE 1.28FT. (EXISTING)
2. B.T. CEDAR 8" S.43°E. 48.55FT. (EXISTING)
3. B.T. CEDAR 8" S.21°W. 31.35FT. (EXISTING)
4. B.T. CEDAR 7" S.80°W. 31.70FT. (NEW)
5. 2" DIA. ALUMINUM MONUMENT AT M.C. CORNER (EXISTING)

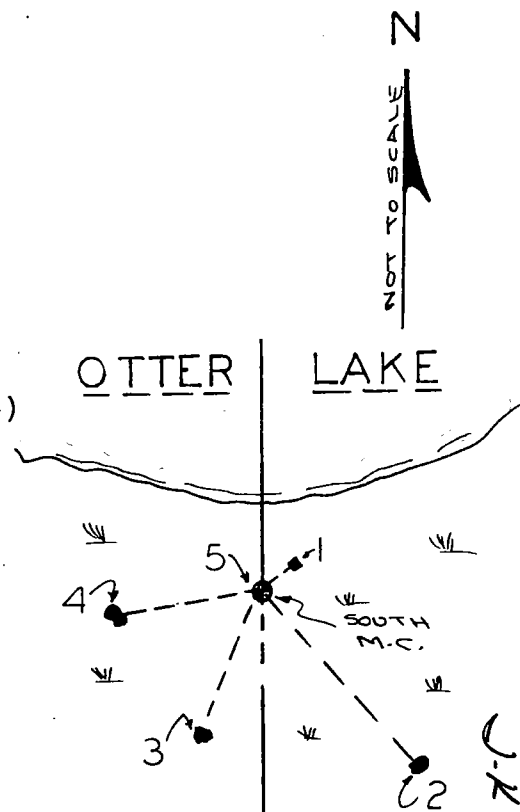



4341618 3420

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

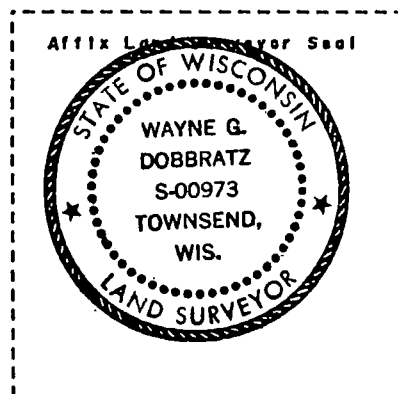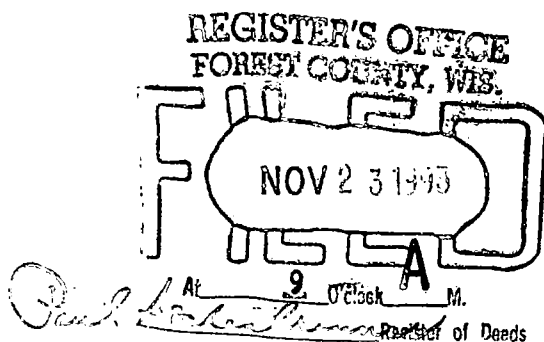

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

8/9/93

Date

CERTIFICATE READY FOR FILING:

Ralph Allen 11-5-93
Acting District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

WEST $\frac{1}{4}$ CORNER OF SECTION 18, TWP. 34 N., R. 16 E.

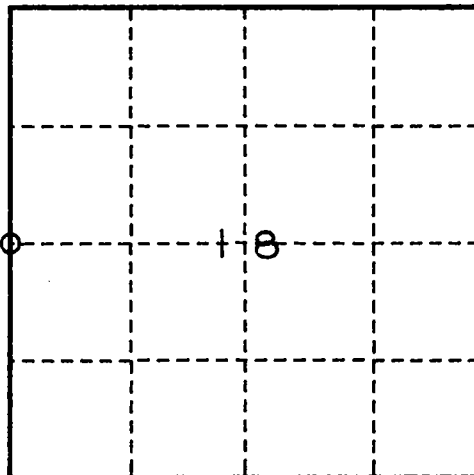

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


1858 - ORIGINAL SURVEY BY McBRIDE, SET WOOD POST - B.Ts- HEMLOCK 16" N.40°W. 35 LKS., YELLOW BIRCH 12" S.38°E. 27 LKS.
1933 - KOLBE FOUND WOOD STAKE, B.T. 9" 6 YDS. WEST.
1984 - HARRISON R.L.S. NO. S-1651, SET 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER, B.Ts -WHITE SPRUCE 4" N.77°E. 11.66FT., HEMLOCK 14" S.28°W. 24.50FT., YELLOW BIRCH 6" N.49°W. 27.69FT., WITNESS - STEEL SIGN POST EAST 0.80FT.
1993 - DOBBRATZ R.L.S. NO.S-973, FOUND MONUMENT, SIGN POST AND B.Ts. HEMLOCK B.T. IS DOWN,

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. YELLOW BIRCH 7" N.49°W. 27.80FT. (EXISTING)
2. 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER (EXISTING)
3. B.T. WHITE SPRUCE 6" N.77°E. 11.66FT. (EXISTING)
4. STEEL SIGN POST EAST 0.80FT. (EXISTING)
5. B.T. YELLOW BIRCH 8" S.54°W. 27.60FT. (NEW)

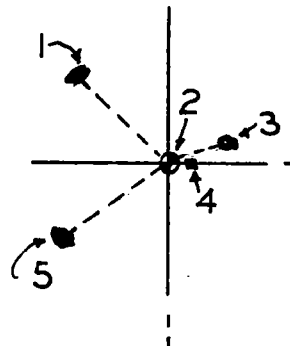


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

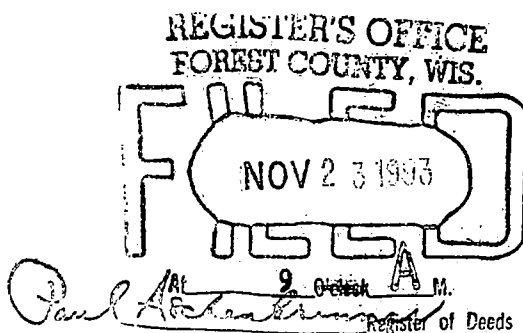

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

9/4/93

Date

CERTIFICATE READY FOR FILING:

Ralph C. Bell 71-5-93
Acting District Ranger

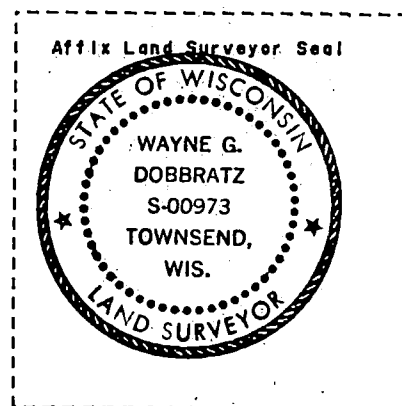

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 13 and 18, T.34N., R.16E.

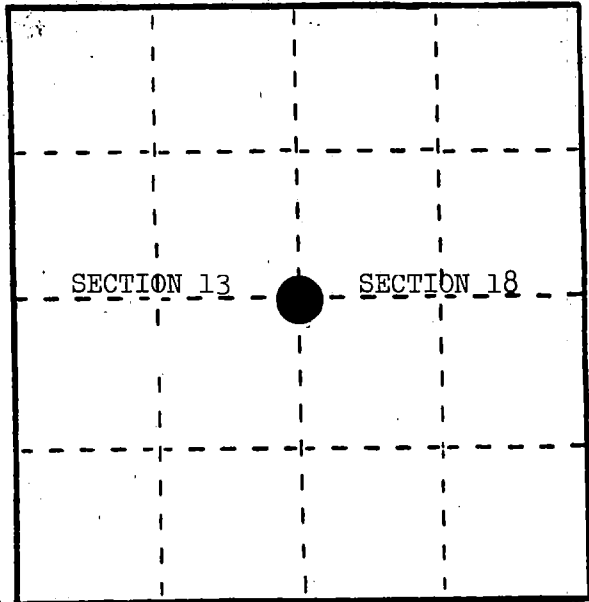

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Hemlock, 16", N.40°W., 35 links; Yellow Birch, 12", S.38°E., 27 links. North, 8.5 chains, enter swamp.


December 20, 1933, Kolbe found Elm stake with a BT, 9", 6 yards west.

May 23, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner position. Found Hemlock line tree south; it aligns with swamp calls. Set corner by G.L.O. distance from line tree and swamp call.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- White Spruce, 4", N.77°E., 11.66'
- Hemlock, 14", S.28°W., 24.50'
- Yellow Birch, 6", N.49°W., 27.69'
- Steel Sign Post, East, 0.8'

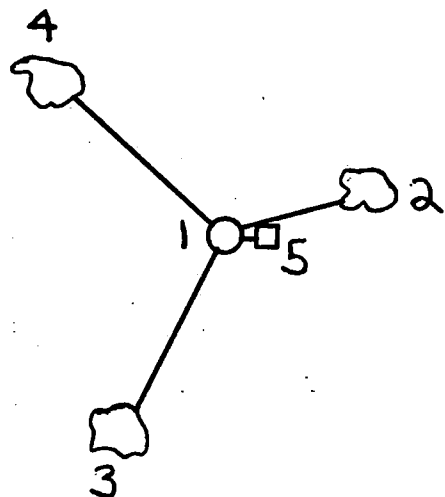

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of January... A.D., 1985 at

10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page... 1...

Paul A. Schrammer
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

Date

11/27/84

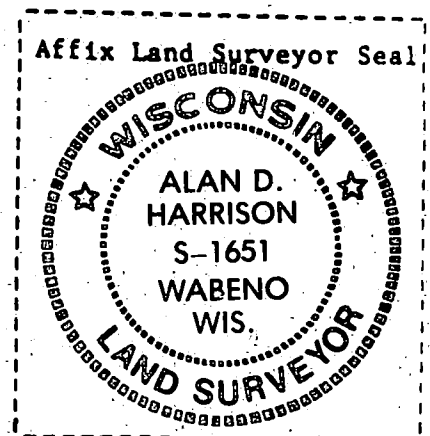

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 17 and 18, T.34N., R.16E.

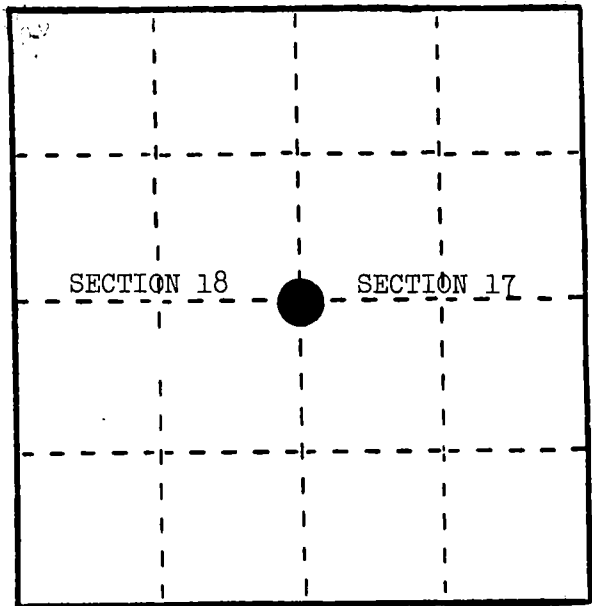

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Birch, 20", S.59°E., 29 links; Hemlock, 8", N.55°W., 19 links.

February 15, 1984, Stefan and Harrison found a 2" x 24" iron pipe flush with the ground; Southeast BT in road clearing; Hemlock root system, N.55°W., 12.5'. Accepted as the corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 5", S.84°E., 31.53'
- Sugar, 5", S.42°W., 35.61'
- Sugar, 5", N.71°W., 50.81'
- Steel Sign Post, South, 1.9'

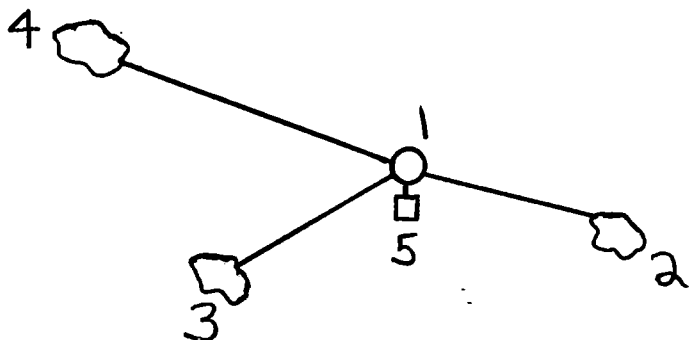

REGISTER'S OFFICE }
rest County, Wis.

Received for record this 24th day
January A.D., 1985 at
10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 5
Paul Aschenberger
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

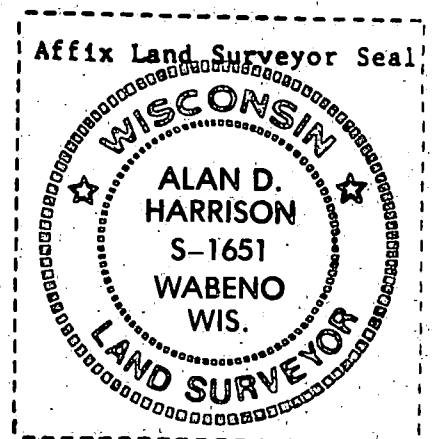

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 16 and 17, T.34N., R.16E.

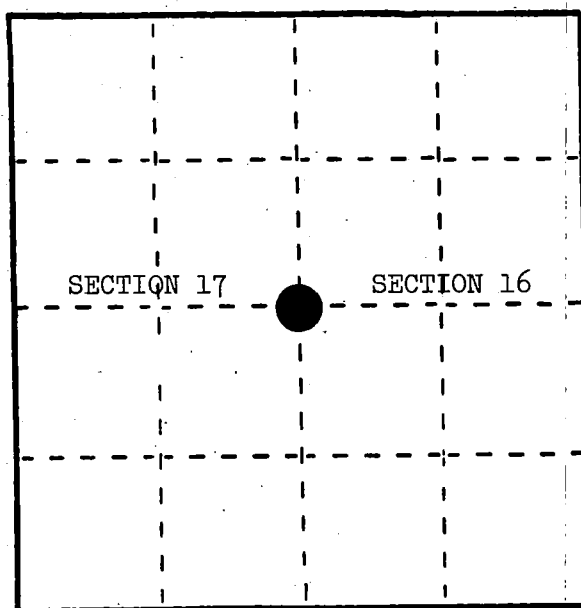

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Sugar, 12", N.61°E., 50 links; Hemlock, 16", N.66°W., 32 links.


April 10, 1935, C. J. Priegal - Otter Lake Truck Trail #346, found a fence corner and Forest Service poster.

November 14, 1983, Stefan and Harrison found a 2" iron pipe, north, 25' from location post along Highway "C", 2" iron pipe, south, 70' on south side of Hwy. "C", north pipe is in center of old road. Paul Smith said he dug up old pipe from roadbed and placed it above, as to be visible--monumented same.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 14", N.49°E., 76.75'
3. Tamarack, 6", S.1°W., 123.64'
4. Power Pole #3416-16L15, N.16°W., 26.52'
5. Steel Sign Post, West, 1.1'

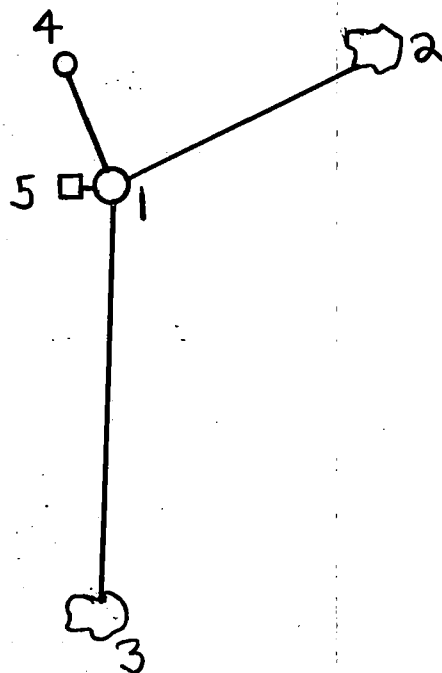

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of... January... A. D., 1985 at

... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATION

on page 9

Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/27/84

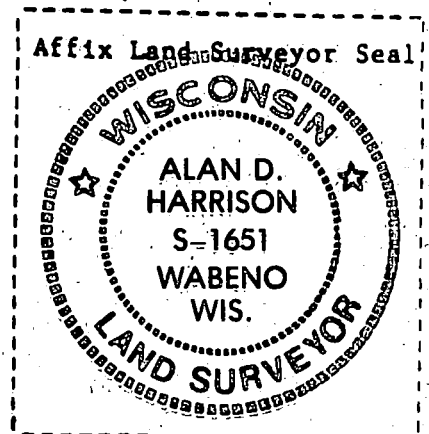


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i):

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 15 and 16, T.34N., R.16E.

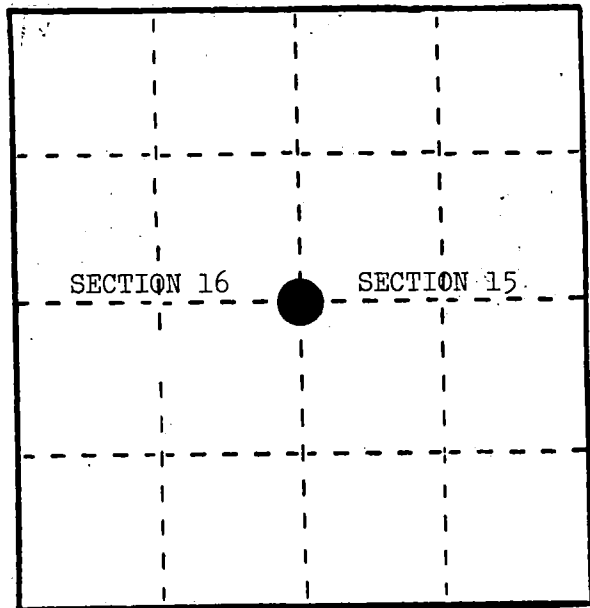


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Fir, 12", N.55°E., 22 links; Fir, 12", S.39°W., 24 links.

November 16, 1983, Alan Harrison found squared wood post lying on ground and post point. From post point, S.39°W., 15.8', conifer stump--south, 33' on edge of beaver flowage close to swamp call. Accepted as corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

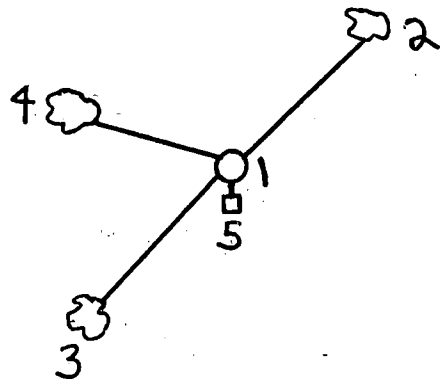

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Black Cherry, 7", N.23°E., 47.86'
3. Double Spruce, 4", S.28°W., 54.94'
4. Black Cherry, 7", N.70°W., 22.17'
5. Steel Sign Post, South, 2.1'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of... January... A.D., 1985 at

... 10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 13

Paul Aschmussen
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(i) 1. Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/27/84

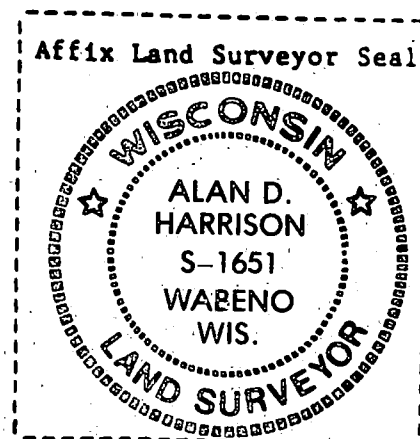


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter Corner to Sections 14 & 15,
 T.34N., R.16E., 4th P.M.

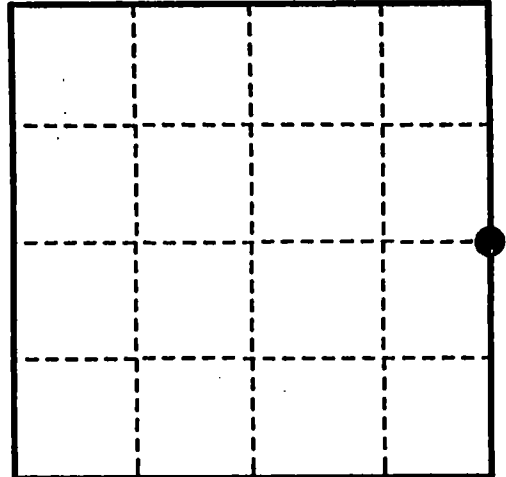

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Found W.C. Monument 19.48' East of corner under road bed. (Did not dig out.) Two BTs in good condition; Aspen dead. Made new BT: Aspen, 6", N.70°E., 34.45'.

This corner was restored by myself in 1983.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" Aluminum monument.
2. W.C., East, 19.48'.
3. Aspen, 6", N.70°E., 34.45'.
4. Aspen (dead), 7", N.64°E., 54.11'.
5. Black Cherry, 6", S.54°E., 36.17'.
6. Tamarack, 3", S.24°W., 104.44'.
7. Steel sign post, East, 20.00'.

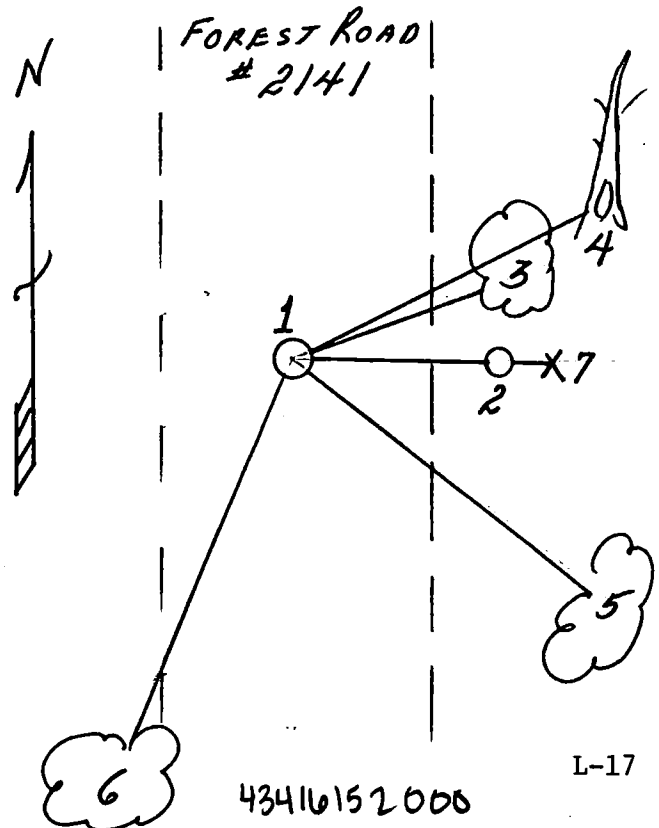

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 9th day
 of March A.D., 1993 at
9:15 o'clock A.M. and recorded
 in Vol. 346 Cases Restoration
 page 1-17
Dea. Chittos Deputy
 Register of Deeds

L-17

L-17

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

- (1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992
Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Quarter corner to Sections 14 and 15, T.34N., R.16E., Forest County, Wisconsin.

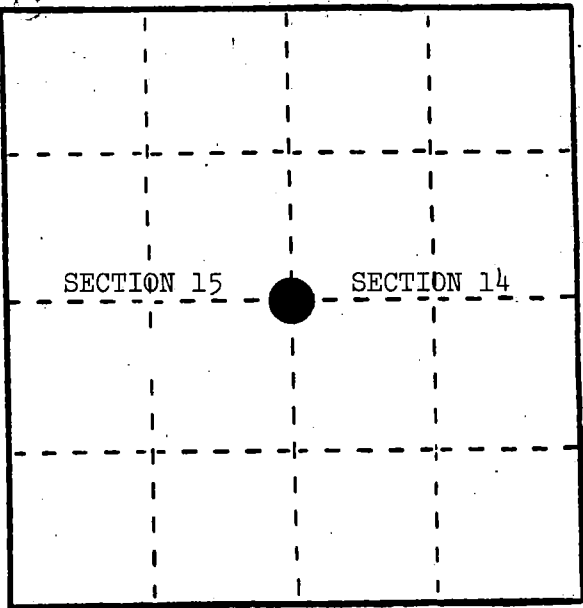

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post and the following BTs: Hemlock, 12", S.37°W., 24 links; Hemlock, 10", S.73°E., 26 links.

On February 15, 1935, Truck Trail #344 found fence corner and location poster.

September 29, 1983, corner position was restored in centerline of Bay Shore Farm Road and fence line, west, as called for on Truck Trail #344 survey. Placed a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
1. Aspen, 7", N.64°E., 54.11'
 2. Black Cherry, 6", S.54°E., 36.17'
 3. Tamarack, 3", S.24°W., 104.44'
 4. Steel Sign Post, West, 20.0'
 5. 2" x 36" aluminum monument stamped to identify the corner.

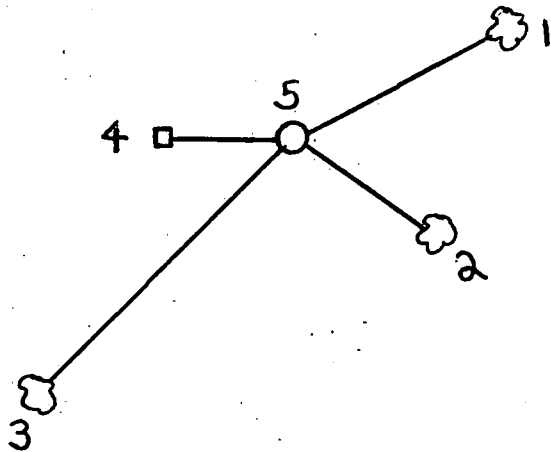

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 24th day
of January, A. D., 1985 at
... 10:30 o'clock... A... M. and
recorded in Vol. CORNER RESTORATIONS
on page 17
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 13 and 14, T.34N., R.16E., Forest County, Wisconsin.

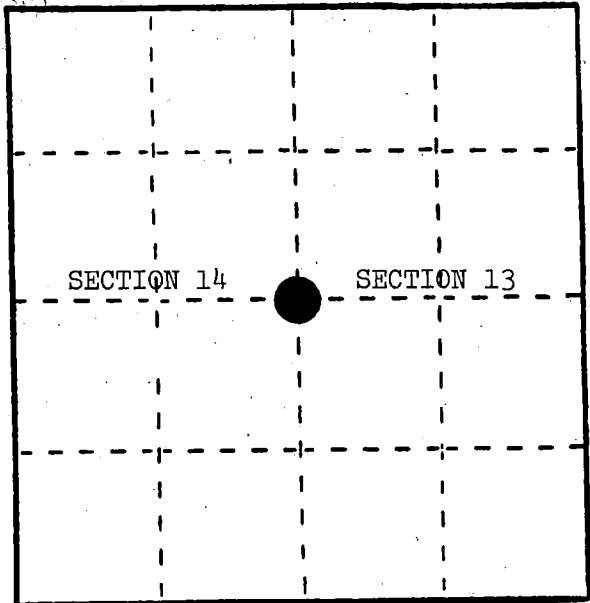

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post and the following BTs: Elm, 16", S.62°E., 19 links; Sugar, 16", S.56°W., 22 links.

September 17, 1981, found north-south fence. Placed a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Basswood, 5", S.02°E., 16.26'
2. Basswood, 8", S.42°W., 39.71'
3. Basswood, 8", N.66°W., 33.98'
4. Steel Sign Post, North, 4.03'
5. 2" x 36" aluminum monument stamped to identify the corner.

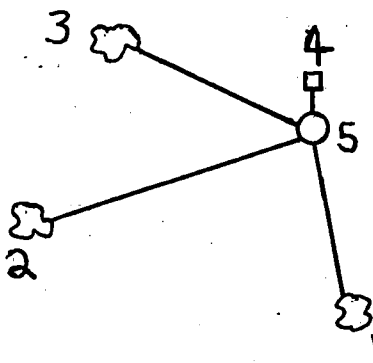

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 24th day
of January A. D., 1985
at 10:30 o'clock A. M. and

recorded in Vol. CORNER RESTORATIONS
on page 21

Deul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

This corner was restored by single proportionate measure between the northeast and southeast section corners of Section 14.

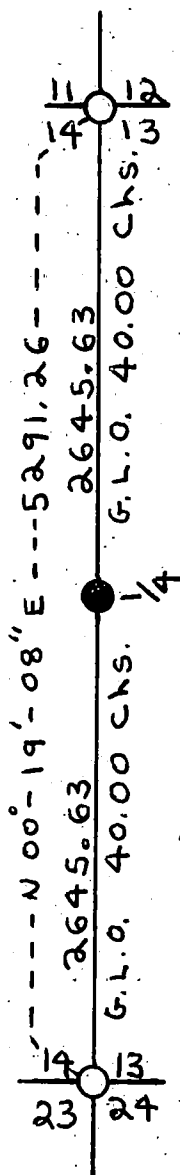

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

140453


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ● = Corner monument restored.

Quarter Corner to Sections 13 and 18,
 T.34N., R.16 and 17E., Forest and
 Marinette County, Wisconsin.

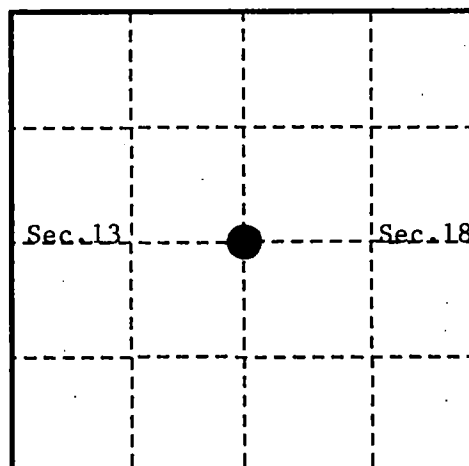

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set a wood post with the following B.T.'s: Sugar, 10", S.39W., 15 links (9.90 feet); Hemlock, 13", N.44W., 15 links (9.90 feet).

In 1933, Robert Colbe (C.C.C.) found Elm stake.

In 1935, F.P. Gould, Deputy Surveyor, Marinette County, set 4" pipe with a stamped brass cap to identify the corner.


In 1976, William Cochrane (R.L.S.) found monument in place. Set the following B.T.'s: Basswood, 4", N.44W., 22.12 feet; Maple, 12", S.62W., 34.14 feet; Steel Sign Post, Southeast, 0.50 feet.

In 1990, Alan Harrison (R.L.S.) found monument in place and added new B.T.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County Monument with stamped brass cap to identify the corner.
2. Hemlock, 24", N.80E., 47.94 feet (new).
3. Basswood, 4", N.44W., 22.12 feet.
4. Maple, 12", S.62W., 34.14 feet.
5. Steel Sign Post, Southeast, 0.50 feet.

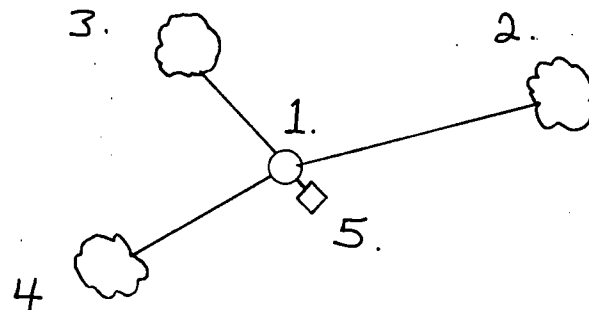

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 19th day
 of SEPTEMBER A.D., 1990 at
3:15 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 page L-25
Paul Hachenbrenner
 Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

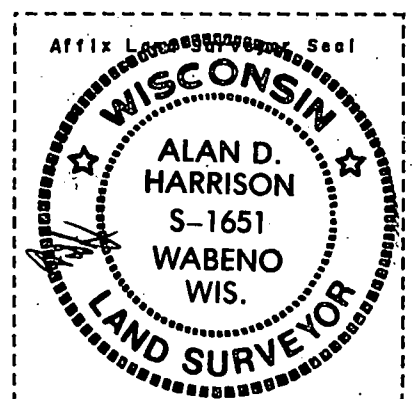

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 2nd day of May, 1975, I found evidence of the East Quarter corner of Section 13 Township 34 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by T. Sprague in November 1839
Surveyed in 1935 by F.P. Gould and B.F. Hammes
Set a 4" iron post for the quarter corner between Sections 13 and 18, with a brass cap stamped: Marinette Co. - Survey, T34N, R16E, T34N, R17E, 1/4, 13, 18



Description of corner evidence found:

Monument as described above and in place.

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:

Basswood, 4", N44°W, 22.12 feet
Maple, 12", S62°W, 34.14 feet
Set a steel sign post SE of the monument, 0.50 feet

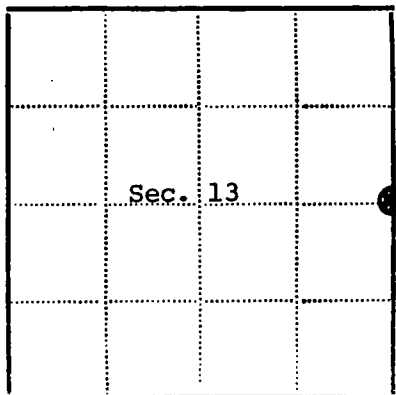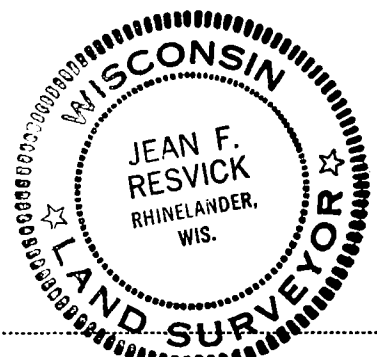

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 15 day of June 1976...

Signature *Jean F. Resvick* Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 109579

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of July 1976, and was filed in Book No. Page No. of County Records.

Signature *Eugene Staszny* Title Register of Deeds

Township 34 North, Range 16 East, Section 13, Index No. L-25, Page No.


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 13, 18, 19, and 24,
T.34N., R.15-16E.

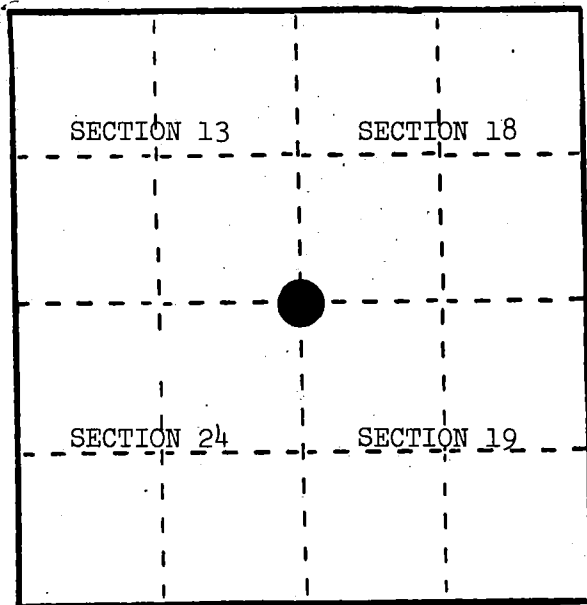

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Yellow Birch, 18", S.47°W., 29 links; Yellow Birch, 11", N.57°W., 40 links; Sugar, 13", N.40°E., 30 links; Sugar, 10", S.20°E., 17 links.

May 23, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner. From Hemlock line tree, north, set corner position on line between Hemlock and section corner 2 miles, south, and holding G.L.O. distances from Hemlock through swamp calls to corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Yellow Birch, 15", N.30°E., 2.80'
3. Yellow Birch, 14", S.16°E., 20.71'
4. Sugar, 12", S.75°W., 21.69'
5. Hemlock, 13", N.52°W., 22.43'
6. Steel Sign Post, South, 2.30'

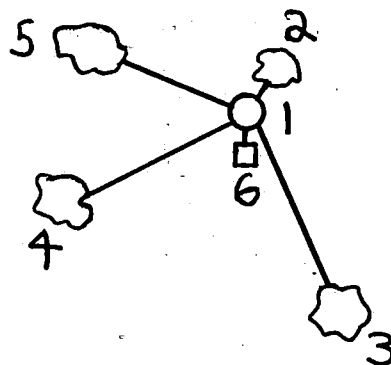

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day
of January, 1985 A.D., at
...10:30 o'clock...A...M. and

recorded in Vol. CORNER RESTORATIONS
on page N-1

Paul Aschenbrenner
REGISTER

N-1

43415130000

N1

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTH $\frac{1}{4}$ CORNER OF SECTION 18,
 TWP.34 N., R.16 E.

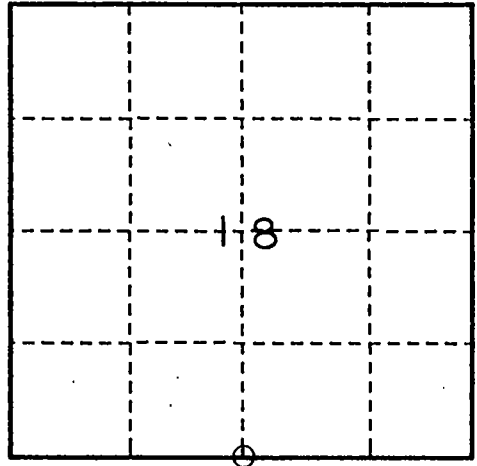

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, B.Ts SUGAR 10" S.27° E. 22 LKS.,
 HEMLOCK 36" N.82° W. 26 LKS.

1984 - HARRISON R.L.S. NO.S-1651 SET 2" DIA. ALUMINUM MONUMENT, B.Ts
 SUGAR 4" N.55° E. 49.60FT., SUGAR 8" S.89° W. 44.24FT., SUGAR 6" N. 14° W.
 70.81FT. WITNESS - STEEL SIGN POST SE 1.40FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST AND
 2 B.Ts, SUGAR 6" N.14° W. 70.81 IS DEAD.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. SUGAR 7" N.55° E. 49.60FT. (EXISTING)
2. STEEL SIGN POST SE 1.40FT. (EXISTING)
3. B.T. ASPEN 8" S.5° E. 36.92FT. (NEW)
4. SUGAR 12" S.89° W. 44.39FT. (EXISTING)
5. 2" DIA. ALUMINUM MONUMENT (EXISTING)

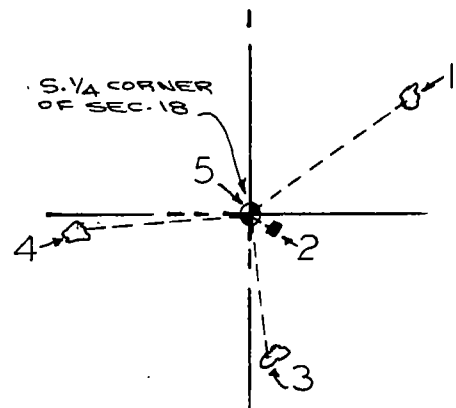

NOT TO SCALE



N-E

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

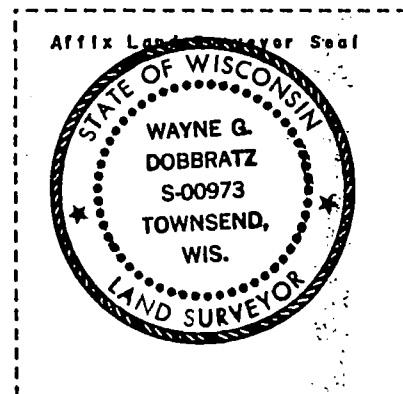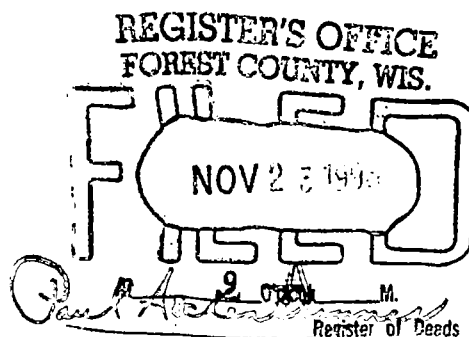

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Ralph A. Wells 11-5-93
Acting District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 18 and 19, T.34N., R.16E.

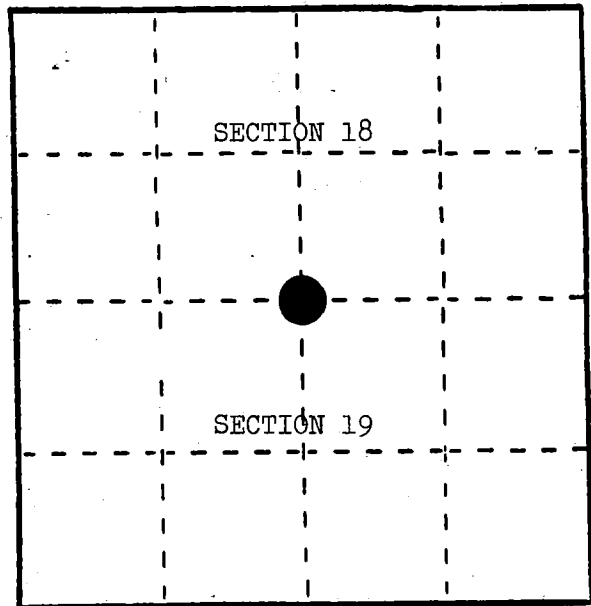

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 10", S.27°E., 22 links; Hemlock, 36", N.82°W., 26 links.

July 17, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" aluminum monument stamped to identify the corner.
- Sugar, 4", N.55°E., 49.60'
- Sugar, 8", S.89°W., 44.24'
- Sugar, 6", N.14°W., 70.81'
- Steel Sign Post, Southeast, 1.40'

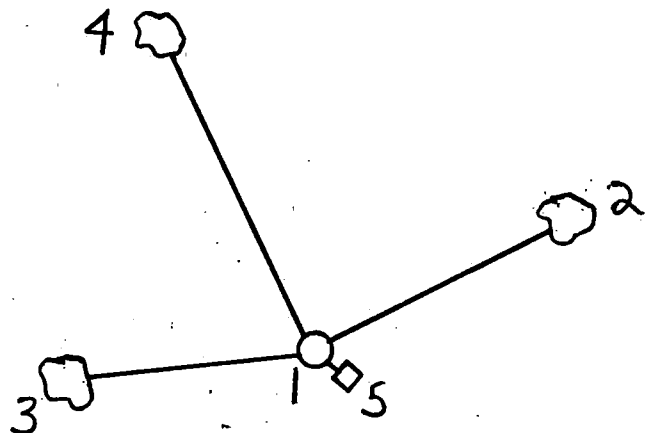

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day
of January, 1985 A.D., at
...10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page A-3

Paul Aschenbrenner
REGISTER

43416180020

N-3.

N3

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

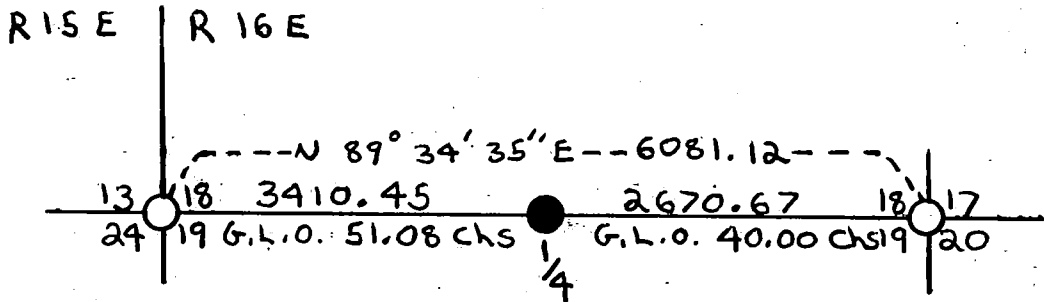

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

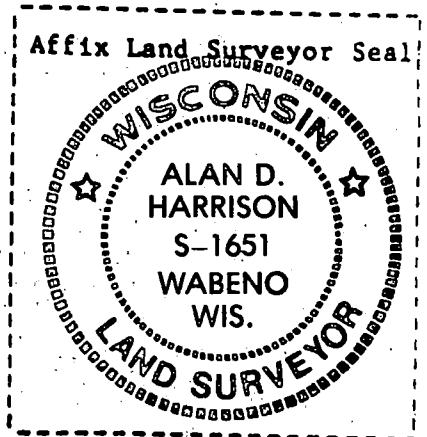

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


I N S T R U C T I O N S :

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 17, 18, 19, and 20,
T.34N., R.16E.

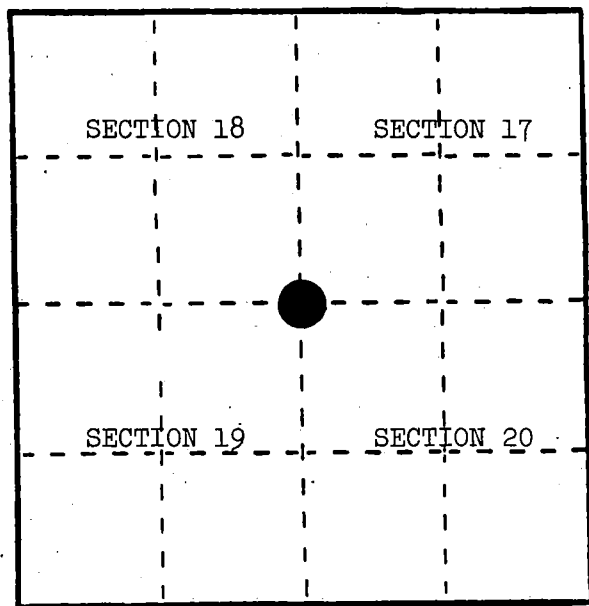

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, James McBride set wood post with the following BTs: Hemlock, 24", N.46°E., 30 links; Hemlock, 12", S.53°E., 35 links; Birch, 12", S.31°W., 4 links; Sugar, 12", N.65°W., 7 links.


December, 1935, road survey found squared Cedar post 3' high and Forest Service poster.

July 10, 1984, Alan Harrison found wood post lying down with location poster. From post point, 19.8', N.46°E., large turned-out Hemlock; S.53°E., 23.1', Hemlock stump remains; S.31°W., 2.6', no remains; N.65°W., 4.6', no remains. Accepted as original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Red Maple, 7", N.64°E., 62.42'
3. White Birch, 3", S.13°E., 61.97'
4. Black Cherry, 6", S.33°W., 26.81'
5. Aspen, 12", N.62°W., 76.88'
6. Steel Sign Post, North, 1.31'

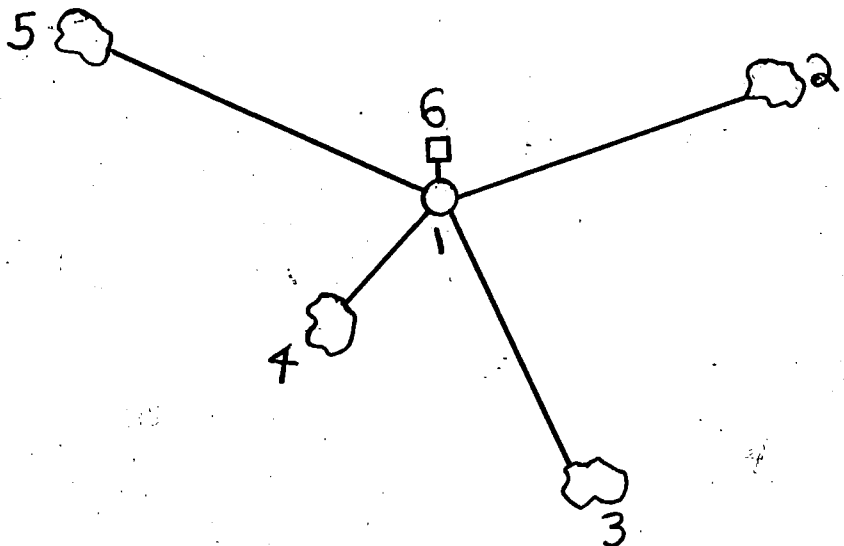

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of... January... A.D., 1985
at... 10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page 15

Paul Ashenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(1) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/27/84

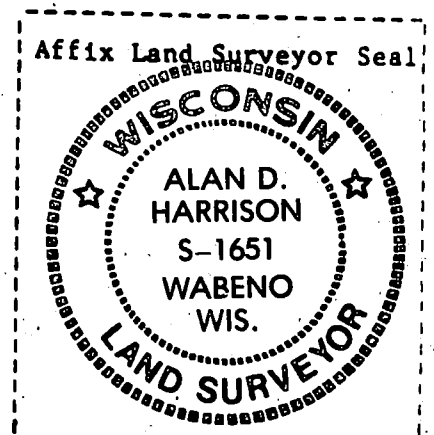


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- O** = Corner monument restored.

Quarter corner to Sections 17 and 20, T.34N., R.16E.

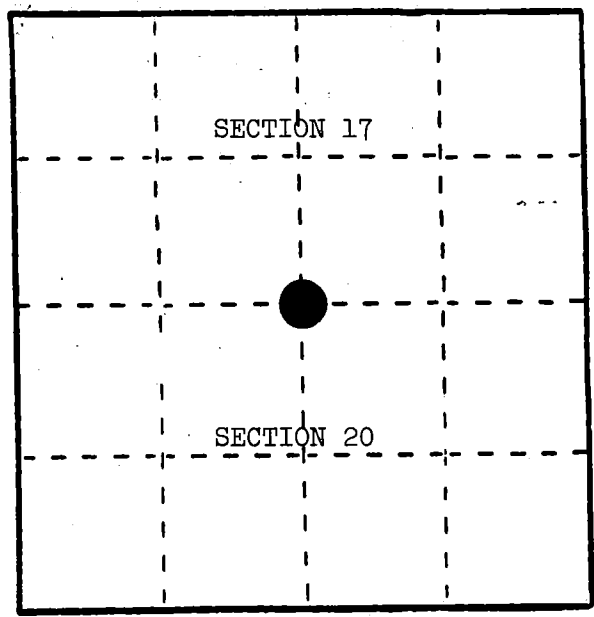

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Hemlock, 8", N.45°E., 20 links; Sugar, 8", S.10°W., 18 links.


1920, N. H. Smith subdivided Section 17.

July 12, 1984, Alan Harrison found squared wood post 20' south of proportionate position, post was charred. No original remains. No record of Smith's BTs. Accepted as best evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Basswood, 12", S.12°E., 24.83'
3. Basswood, 8", S.28°W., 60.34'
4. Sugar, 14", N.13°W., 17.03'
5. Steel Sign Post, Northeast, 1.70'

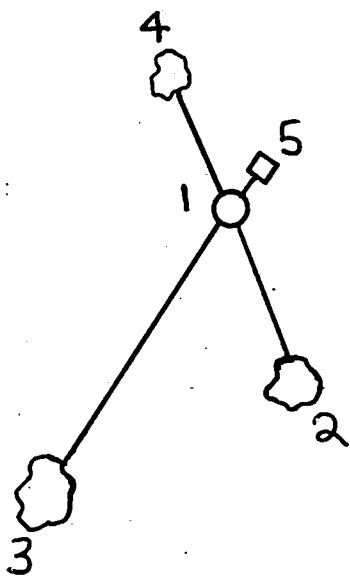

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this... 24th day
of January A. D., 1985 at
... 10:30 o'clock... A M. and
recorded in Vol. CORNER RESTORATIONS
on page 1.....
Paul Achenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

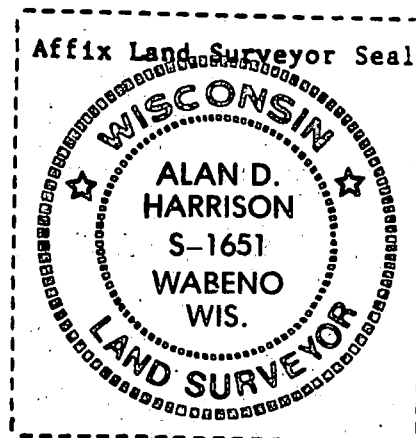

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS :

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 16, 17, 20, and 21,
T.34N., R.16E.

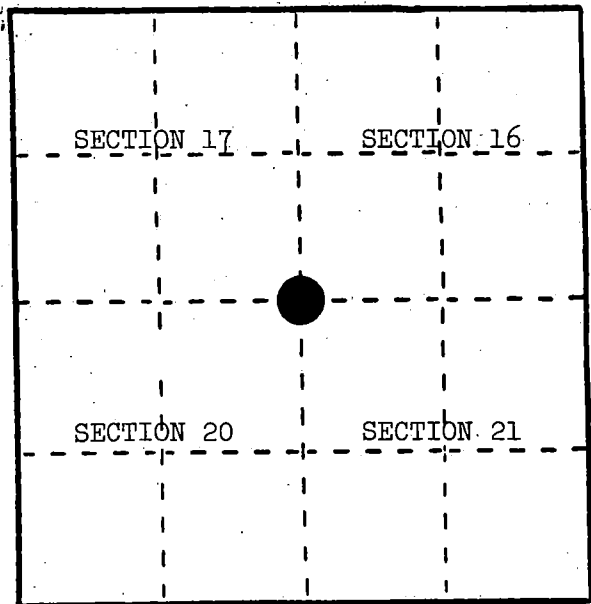

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Hemlock, 14", N.32°E., 33 links; Birch, 6", S.29°E., 31 links; Birch, 10", S.84°W., 26 links; Ironwood, 7", N.46°W., 82 links.


January 30, 1959, Nels Sandberg found a 4" x 4" x 36" Cedar post.

November 15, 1983, Milo Stefan found a 4" x 4" Cedar post rotted off at ground line, point in place. Stump hole, N.32°E., 22'. Survey distances north and east look good. Accepted post as original corner location and replaced it with a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. White Elm, 7", N.39°E., 42.30'
2. Basswood, 6", S.04°W, 61.03'
3. Sugar Maple, 7", S.64°W., 75.56'
4. Black Cherry, 5", N.07°W., 19.14'
5. Steel Sign Post, Southwest, 1.20'
6. 2" x 36" aluminum monument stamped to identify the corner.

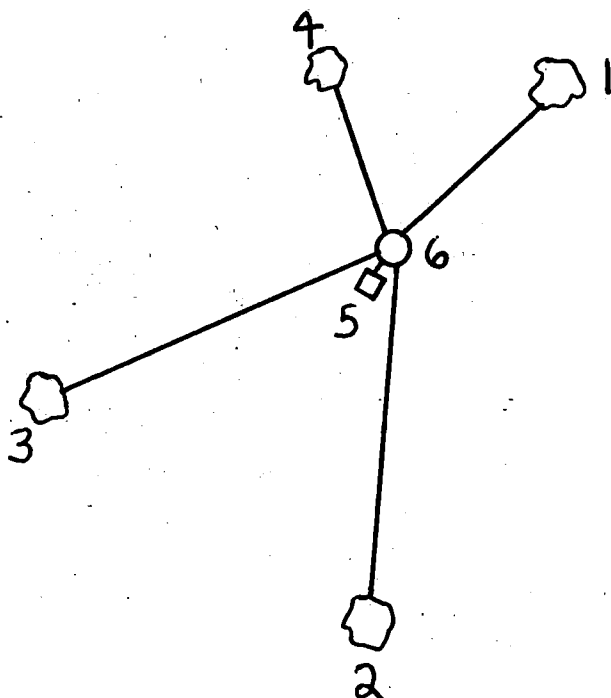

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of... January... A.D., 1985

... 10:30 o'clock... A.M. and

recorded in Vol. **CORNER RESTORATIONS**

on page... N-9...
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 16 and 21, T.34N., R.16E.

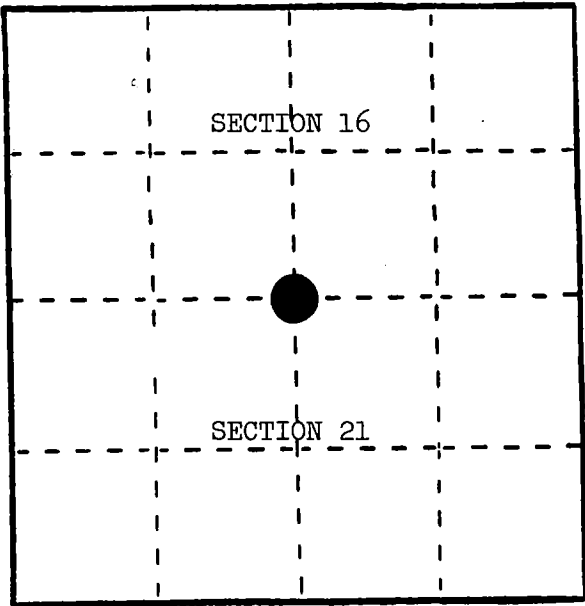

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 8", S.40°W., 30 links; Sugar, 24", N.8°W., 4 links.

November 30, 1983, Alan Harrison found 1½" iron pipe under power line and in clearing. Distances east and west to section corners fit very close to original.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Basswood, 4", N.37°E., 45.26'
3. Power Pole #3416-21W1, S.53°E., 48.92'
4. Jack Pine, 13", N.83°W., 100.30'
5. Steel Sign Post, West, 1.90'

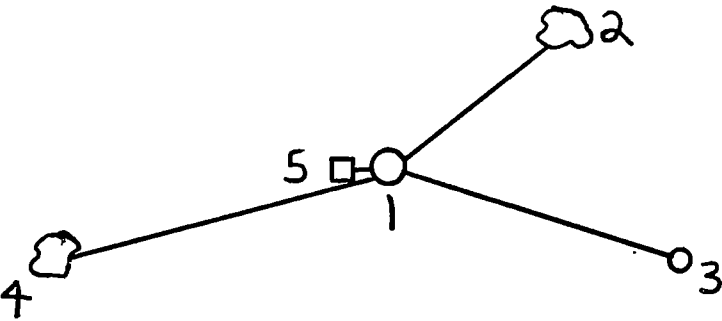

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 24th day
of January, 1985, at
10:30 o'clock, A.M. and
recorded in Vol. CORNER RESTORATIONS
on page N-11
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

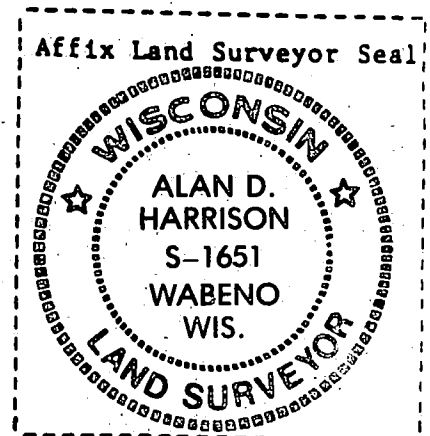


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section Corner to Sections 15, 16, 21 & 22,
 T.34N., R.16E., 4th P.M.

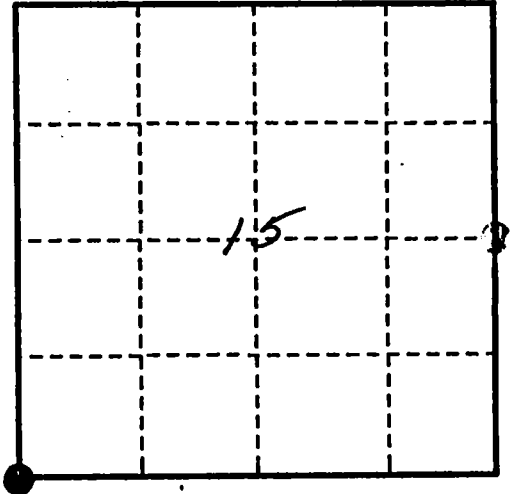

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found aluminum monument, three BTs and steel sign post in good condition. Tamarack BT - dead.


Made one new BT: Black Ash, 6", N.33°E., 112.98'

This corner was restored by Harrison in 1983.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" Aluminum monument.
2. Black Ash, 6", N.33°E., 112.98'.
3. Cedar, 11", S.82°E., 80.58'.
4. Cedar, 5", S.24°E., 44.97'.
5. Balsam Fir, 7"; S.79°W., 17.91'.
6. Tamarack, 3", N.14°W., 82.02'.
7. Steel sign post, Northeast, 1.20'.

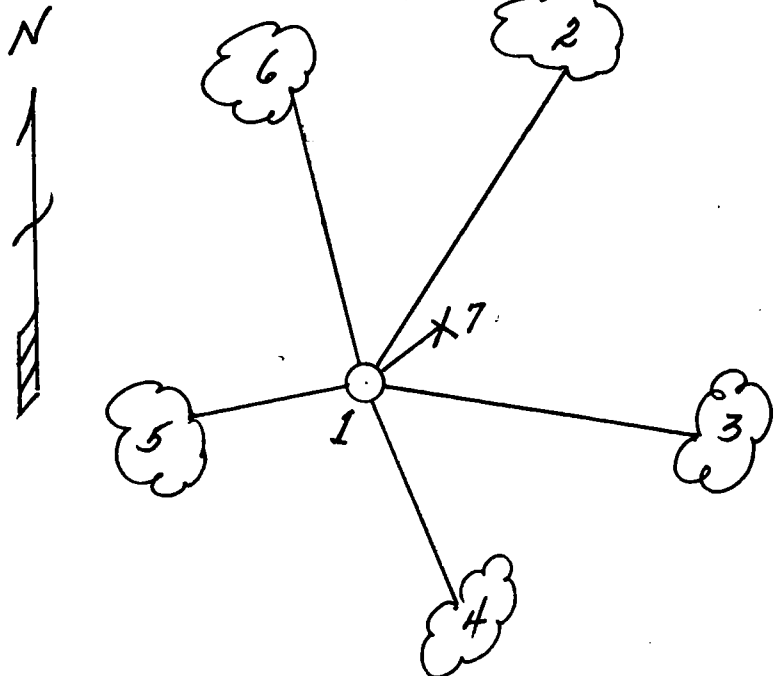

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 9th day
 of March, A.D., 1993 at
9:15 o'clock A.M. and recorded
 in Vol. 34-16 Corner Restorations
 page N-13

Sean Chittie, Deputy
 Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992
Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 15, 16, 21, and 22, T.34N., R.16E., Forest County, Wisconsin.

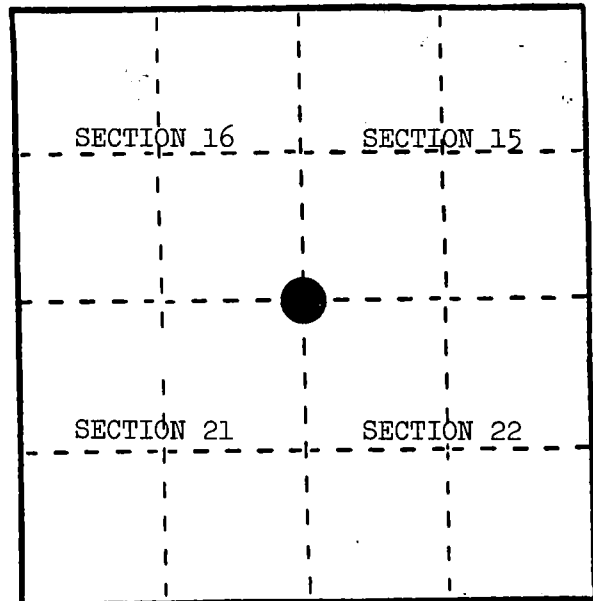

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post 80.00 chains, with the following BTs: Tamarack, 10", N.57°W., 5 links; Cedar, 6", N.53°E., 14 links; Birch, 12", S.9°E., 18 links; Cedar, 7", S.73°E., 24 links.


1930s CCC Era - Route Survey #341 called corner south of centerline 25.0'.

In 1983, Milo Stefan found black and white corner post and original Cedar stump, S.73°W., 15.8'. Set a 2" x 36" aluminum monument stamped at corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Cedar, 11", S.82°E., 80.58'
2. Cedar, 5", S.24°E., 44.97'
3. Balsam, 7", S.79°W., 17.91'
4. Tamarack, 3", N.14°W., 82.02'
5. Steel Sign Post, Northeast, 1.2'
6. 2" x 36" aluminum monument stamped to identify the corner.

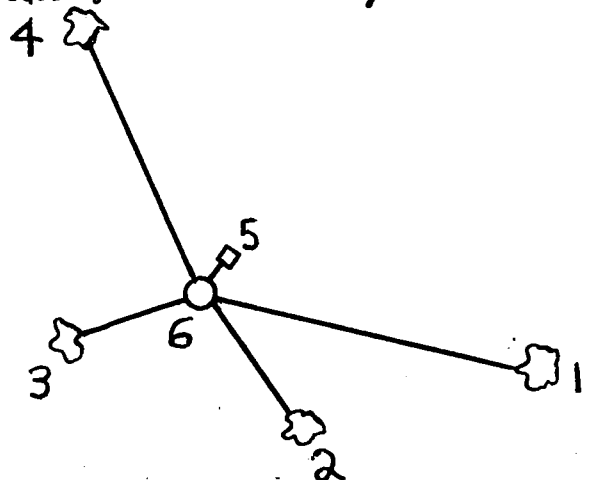

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 24th day

of January 1985 A.D., at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page N-13

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal



Document Number
209976


REGISTER'S OFFICE
Forest County, Wis.
Received for record this 17th day
of September A.D., 2012 at
9:10 o'clock A.M. and recorded
in Vol. OWNER RESOLUTION
page 16-15
Christy McSweeney Dwyer
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD
FOREST COUNTY, WISCONSIN

CORNER NO. N15


IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A)-(I)

LOCATION: CHAPTER A-E 7.08 (3): (A)
SECTION 15 TOWNSHIP 34 NORTH, RANGE 16 EAST
TYPE OF CORNER: SOUTH QUARTER CORNER
TYPE OF MONUMENT: MAG NAIL OVER 3/4in. REBAR
WITH ALUMINUM CAP
HORIZONTAL DATUM: NAD 83(2007) GRID
FOREST COUNTY COORDINATES
NORTHING: 515982.737
EASTING: 944907.092

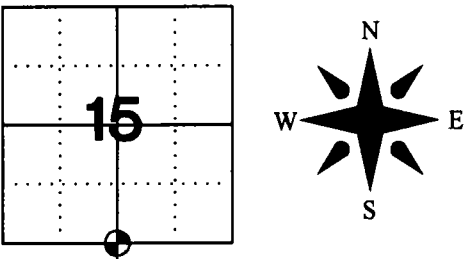

RECOVERY PROCEDURES: CHAPTER A-E 7.08 (3): (B), (F), (G), (H)
1858, JAMES McBRIDE SET POST 40.00 CHAINS, WITH THE FOLLOWING BTS: BIRCH 6" S 74° E 32 LINKS; SUGAR 12" N 63° E 25 LINKS
DECEMBER 1934 PRIEGEL TRUCK ROUTE #341 SURVEY CALLED CORNER IN CENTERLINE OF COUNTY HIGHWAY "C" WITH FENCE NORTH
SEPTEMBER 29 1983, MILO STEFAN FOUND THIS POSITION TO FIT WITHIN 1' OF MIDPOINT EAST AND WEST, AND PLACED A RAILROAD SPIKE IN CENTERLINE OF HIGHWAY.
7 JUNE 2012; PRIOR TO HIGHWAY "C" RESURFACE PROJECT FOUND NO MONUMENT AT CORNER
30 JULY 2012: SET 3/4in. X 24in. REBAR 1.50lbs/ft. WITH ALUMINUM CAP BELOW BITUMINOUS USING WITNESS MONUMENT AND SECTION CORNERS FROM SURVEY BY RLS 1651 DATED 1984
SET MAG NAIL OVER 3/4in. REBAR AFTER COMPLETION OF ROAD WORK

PLAN VIEW: CHAPTER A-E 7.08 (3): (C), (D), (E).

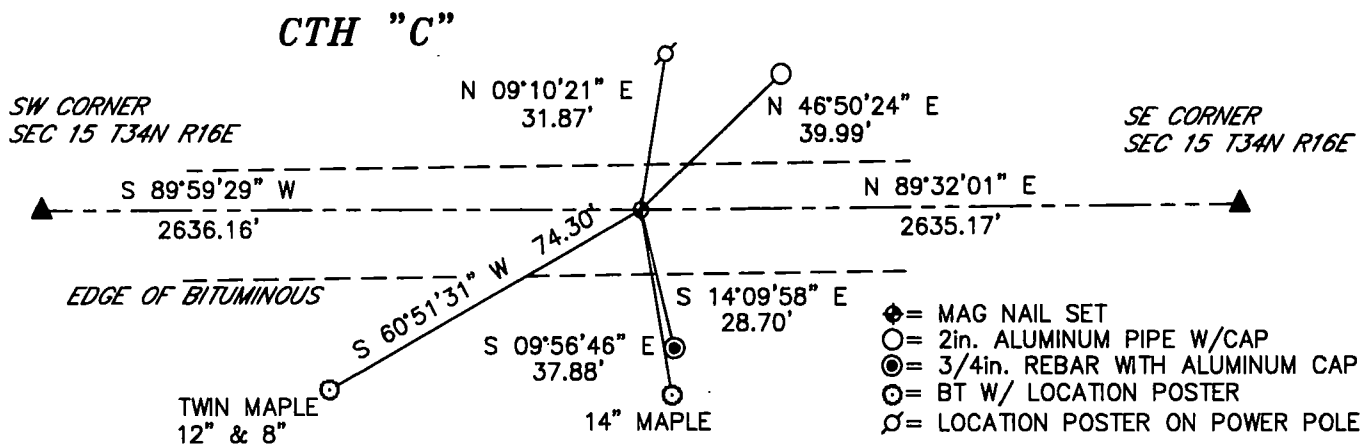

SURVEYOR'S CERTIFICATE:

CHAPTER 7.08 (3): (I)
THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.



Darren B. Krzanowski
DARREN B. KRZANOWSKI
WISCONSIN LAND SURVEYOR S-2663
DATED THIS 2ND DAY OF AUGUST 2012

43416 160020

N15


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 15 and 22, T.34N., R.16E., Forest County, Wisconsin.

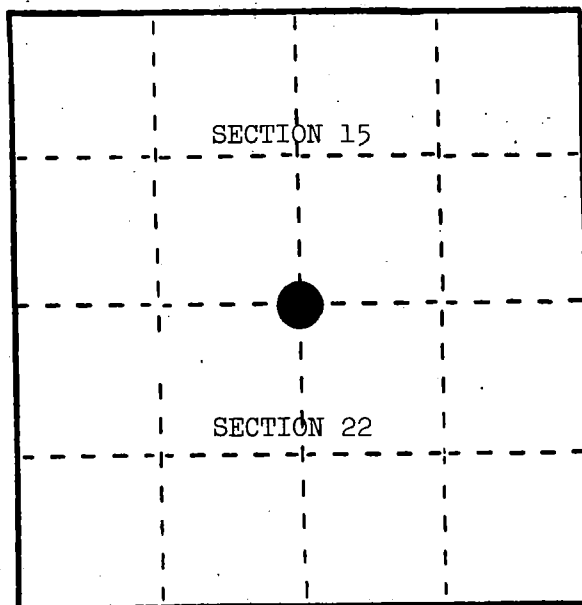

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post 40.00 chains, with the following BTs: Birch, 6", S.74°E., 32 links; Sugar, 12", N.63°E., 25 links.

December, 1934, Priegel Truck Route #341 survey called corner in centerline of County Highway "C" with fence north.

September 29, 1983, Milo Stefan found this position to fit within 1' of midpoint east and west, and placed a railroad spike in centerline of said highway.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

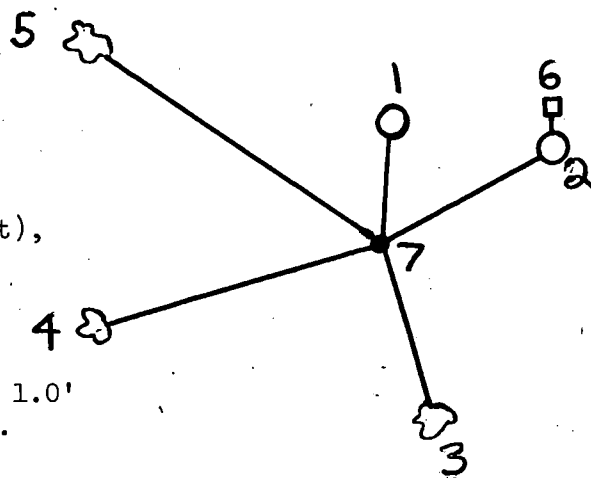

1. Power Pole #3416-15R15, N.5°E., 29.51'
2. Reference Corner (2" x 36" aluminum monument), N.51°E., 39.98'
3. Sugar Maple, 10", S.8°E., 37.62'
4. Sugar Maple, 8", S.64°W., 75.13'
5. Sugar Maple, 6", N.46°W., 84.08'
6. Steel Sign Post, North of Reference Corner, 1.0'
7. Railroad spike marking the corner locations.

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day
of... A.D., 19... at
... o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS
on page N-15

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Milo E. Stefan

- (i) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

11/30/84

Affix Land Surveyor Seal



Document Number
209975


REGISTER'S OFFICE
Forest County, Wis.
Received for record this 17th day
of September A.D., 2012 at
9:00 o'clock A.M. and recorded
in Vol. 146850
page N-17
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD
FOREST COUNTY, WISCONSIN

N-17


IN ACCORDANCE WITH WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08 (3) (A)-(I)

LOCATION: CHAPTER A-E 7.08 (3): (A)
SECTION 15 TOWNSHIP 34 NORTH RANGE 16 EAST
TYPE OF MONUMENT: MAG NAIL OVER 3/4in. REBAR
WITH ALUMINUM CAP
HORIZONTAL DATUM: NAD 83(2007) GRID
FOREST COUNTY COORDINATES
NORTHING: 516004.190
EASTING: 947542.174

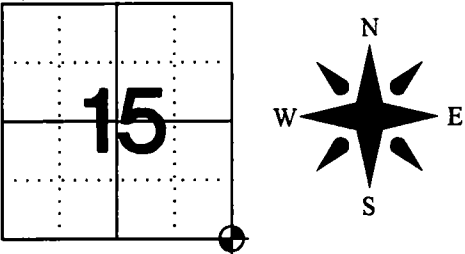

RECOVERY PROCEDURES: CHAPTER A-E 7.08 (3): (B), (F), (G), (H)
20 NOV 1992: MONUMENT RECORD BY RLS 1558 (DOCUMENT #146850, VOL. 34-16 N-17) CALLS FOR A RAILROAD SPIKE AT CORNER
7 JUNE 2012: FOUND CALLED FOR RAILROAD SPIKE UNDER FIRST LIFT OF BITUMINOUS AND RECORDED LOCATION PRIOR TO CTH "C" RESURFACE PROJECT
30 JULY 2012: SET 3/4in. X 24in. REBAR 1.50lbs/ft. WITH ALUMINUM CAP IN ROAD BASE AND THEN SET A MAG NAIL IN BITUMINOUS OVER REBAR AFTER COMPLETION OF CTH "C" RESURFACE PROJECT

PLAN VIEW: CHAPTER A-E 7.08 (3): (C), (D), (E).

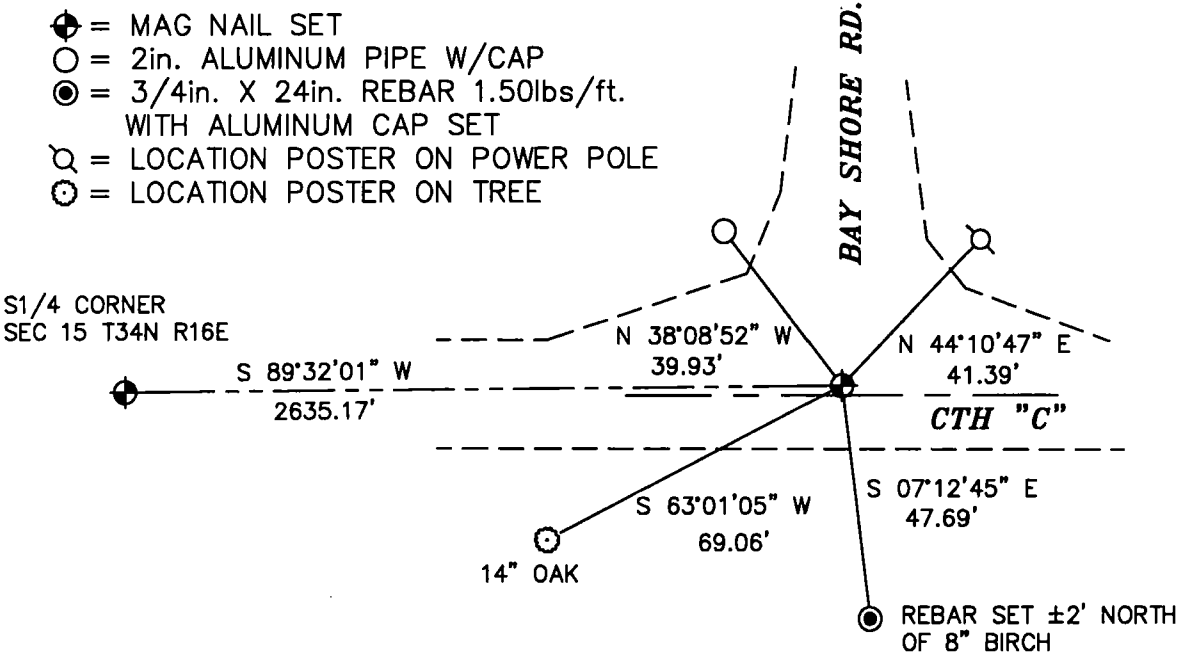

SURVEYOR'S CERTIFICATE:

CHAPTER 7.08 (3): (I)
THE UNDERSIGNED HEREBY CERTIFIES THAT THE U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.



[Signature]
DARREN B. KRZANOWSKI
WISCONSIN LAND SURVEYOR S-2663
DATED THIS 2ND DAY OF AUGUST 2012

212


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 14, 15, 22 & 23;
 T.34N., R.16E., 4th P.M.

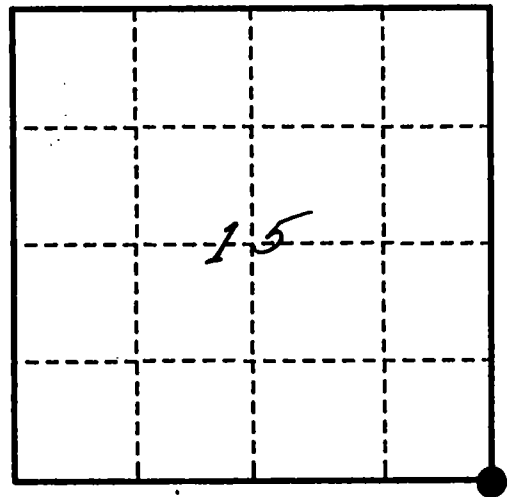

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Found railroad spike set for corner in 1983 and reference corner, with Aspen BT in good condition. Black Cherry BT down and dead. Power Pole looks new, lots of fresh earth work near pole, could be WPS or telephone line being buried.

We made one new BT: Black Cherry, 6", S.69°W., 126.95'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad spike.
2. Ref. Cor. 2" Aluminum Monument N.35°W., 39.87'/Steel sign post, 1.0' North.
3. Aspen, 6", S.52°E., 86.78'.
4. Black Cherry (dead & down), 6", S.38°W., 124.30'.
5. Black Cherry, 6", S.69°W., 126.95'.
6. U.S.G.S. Bench Mark, S.01°W., 52.44'.
7. Power Pole, N.54°E., 43.29'.

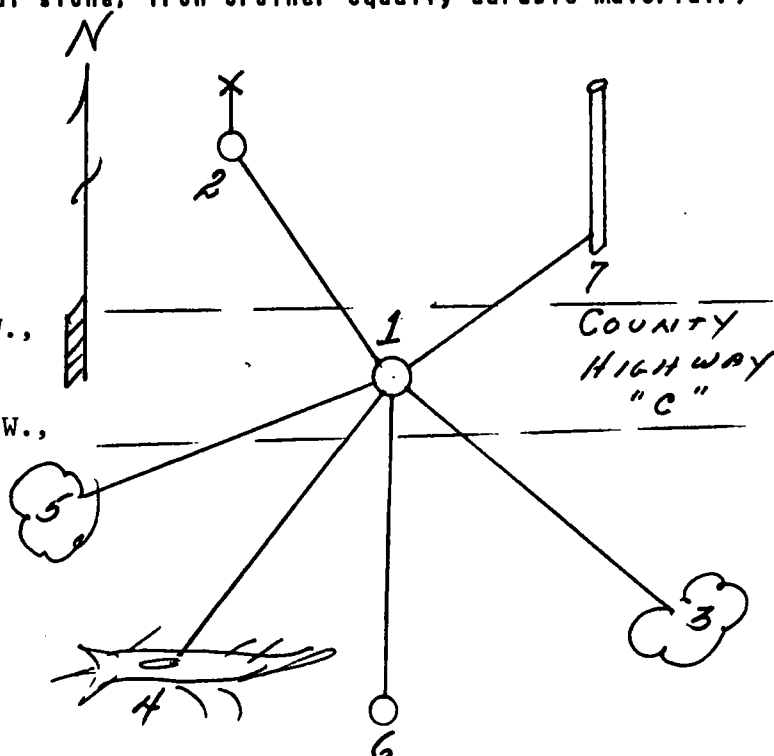

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 9th day
 of March A.D. 1993 at
9:15 o'clock A. M. and recorded
 in Vol. 34-16 Corner Restorations
 page 11-17
Paul Chittick Deputy
 Register of Deeds

4341615 0000

N-17

L1-N

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992

Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 14, 15, 22, and 23, T.34N., R.16E., Forest County, Wisconsin.

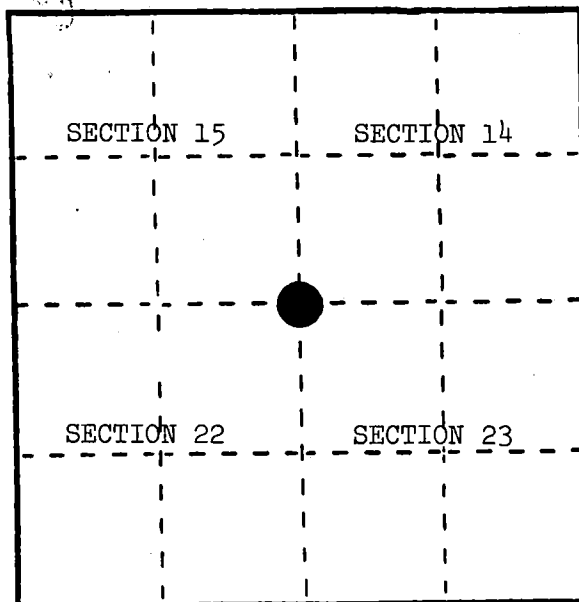

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post at 80.00 chains, with the following BTs: Hemlock, 30", N.63°E., 62 links; Birch, 14", S.48°E., 28 links; Sugar, 30", S.59°W., 46 links; Birch, 7", N.72°W., 29 links.

October 25, 1983, corner position restored at the intersection of the centerlines of County Trunk "C" and Bay Shore Farm Road--marked by a railroad spike.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Power Pole #3416-14L9, N.54°E., 43.29'
2. Aspen, 6", S.52°E., 86.78'
3. USGS Benchmark #17 W.R.M., S.01°W., 52.44'
4. Reference Corner (2" x 36" aluminum monument), N.35°W., 39.87'
5. Black Cherry, 6", S.38°W., 124.30'
6. Steel Sign Post, North of Reference Monument, 1.0'
7. Railroad spike marking corner location.

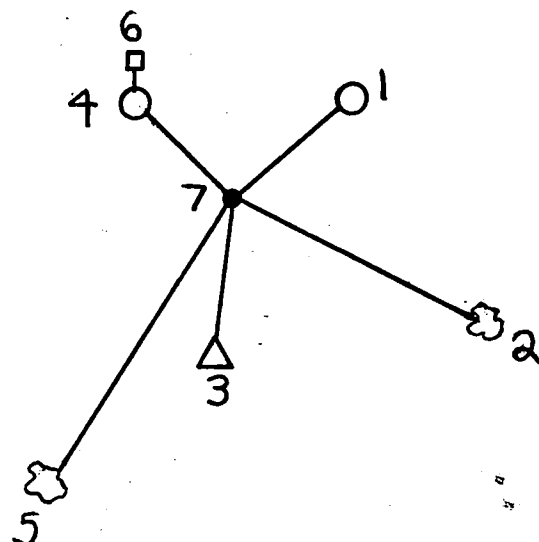

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day

of January A.D., 1985 at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page N-17

Paul A. Schenckner
REGISTER

43416150000

N-17

N17

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 14 and 23, T.34N., R.16E., Forest County, Wisconsin.

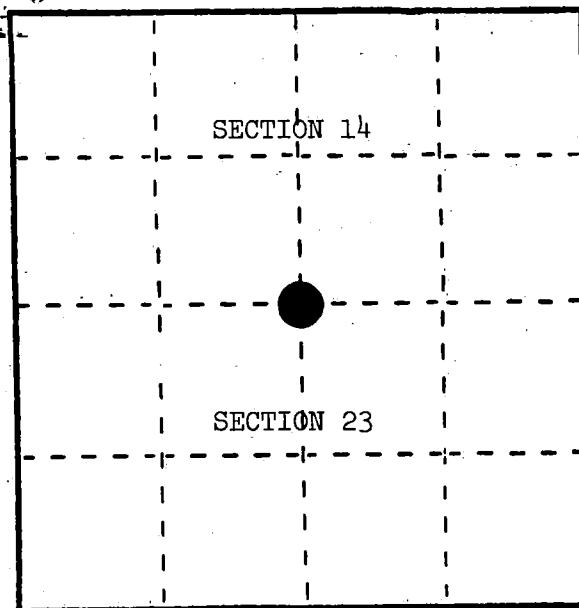

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post 40.00 chains, with the following BTs: Sugar, 12", N.23°E., 19 links; Sugar, 16", S.43°W., 16 links.

August 16, 1983, corner position found marked by a fallen post with post hole, supported by stump holes northeast and southwest at position of original bearing tree calls. Plantation post and camera point post near this corner. Placed a 2" x 36" aluminum monument in post hole.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Black Spruce, 6", S.54°E., 10.74'
2. White Spruce, 8", S.48°W., 6.81'
3. Red Pine, 13", N.58°W., 5.69'
4. Steel Sign Post, East, 1.4'
5. 2" x 36" aluminum monument stamped to identify the corner.

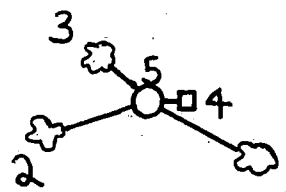

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 24th day

of January 1985 at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 19

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) 1. Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 22 day of October, 1980
I found evidence of the Southeast corner of Section 14
Township 34 North, Range 16 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in August 1858.
Set a wood post.
Spruce, 6", N23°E, 24 links
Spruce, 6", S43°E, 10 links
Cedar, 10", S43°W, 21 links
Cedar, 12", N32°W, 20 links.

Description of corner evidence found:


Posts points and 1½" iron pipe, 36" long, with point
No BT'S recovered
Swamp calls north and west fit well.

Description of monument and accessories I established to perpetuate the location of this corner:

At corner position set a 2 inch by 5 foot aluminum pipe with cap stamped:
T34N, R16E, S13, S14, S23, S24, 1980, R.L.S.-1558.

From which the following bear:
Tamarack, 10", N73°E, 42.84 feet
Cedar, 6", S55°E, 14.78 feet
Tamarack, 8", S25°W, 17.39 feet
Cedar, 10", N62°W, 29.77 feet

DOCUMENT NO.
119863

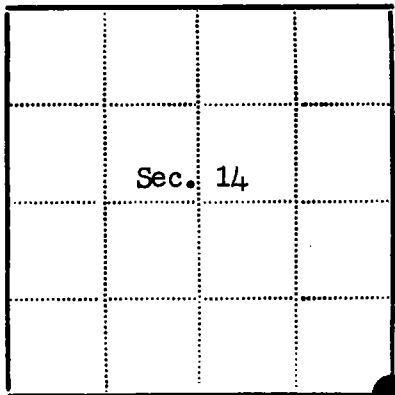

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 4 day of November
1980...

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)
S-1558
Surveyors Registration No.....

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
on the 2nd day of June, 1981, and was filed in Book
No..... Page No..... of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 34N, Range 16E, Section 14, Index No. N-21, Page No.....

43416140000

N21

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P. M. and recorded
in Vol. Corner Restoration
page N-23
Kay Swanson, Deputy
Register of Deeds

Document Number
189317

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 10" N07°W 7 LINKS
HEMLOCK 10" S37°E 9 LINKS

1981 - MILO STEFAN, SURVEYOR, S-1558, FOUND A 7/8" STEEL ROD 2' LONG WITH A 90° BEND ON THE END 2" LONG. 4-SIDED BLAZED 3" SUGAR, N30°W, APPROXIMATELY 30' FROM IRON. STUMP HOLES AT S37°E - 6', AND N07°W - 5' FROM IRON BAR. REPLACED IRON ROD WITH A 2" X 36" ALUMINUM PIPE.

1984 - MILO STEFAN, SURVEYOR, S-1558, PERPETUATED A FOUND LOCATION WITH A 2" X 36" ALUMINUM PIPE STAMPED TO IDENTIFY THE CORNER WITH THE FOLLOWING WITNESSES:

SUGAR MAPLE 5" N05°E 19.82 FEET
BASSWOOD 7" S19°E 13.49 FEET
SUGAR MAPLE 7" S29°W 31.18 FEET
STEEL SIGN WEST 1.6 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 3" STAMPED ALUMINUM CAP.

FOUND THE FOLLOWING WITNESSES:


BASSWOOD 8" S15°E 13.36 FEET - SET D.H. NAIL IN TREE.
MAPLE 10" N11°E 19.95 FEET - FOUND SINGLE HEADED NAIL IN TREE.
MAPLE 10" S38°W 31.16 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


BASSWOOD 7" N64°E 10.23 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST AND STUMP BLAZES.

THE NORTH 1/4
CORNER OF SECTION 24
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

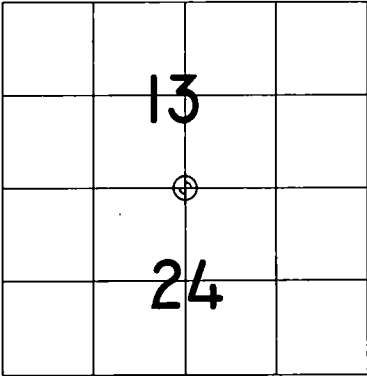

⊕ = LOCATION OF CORNER

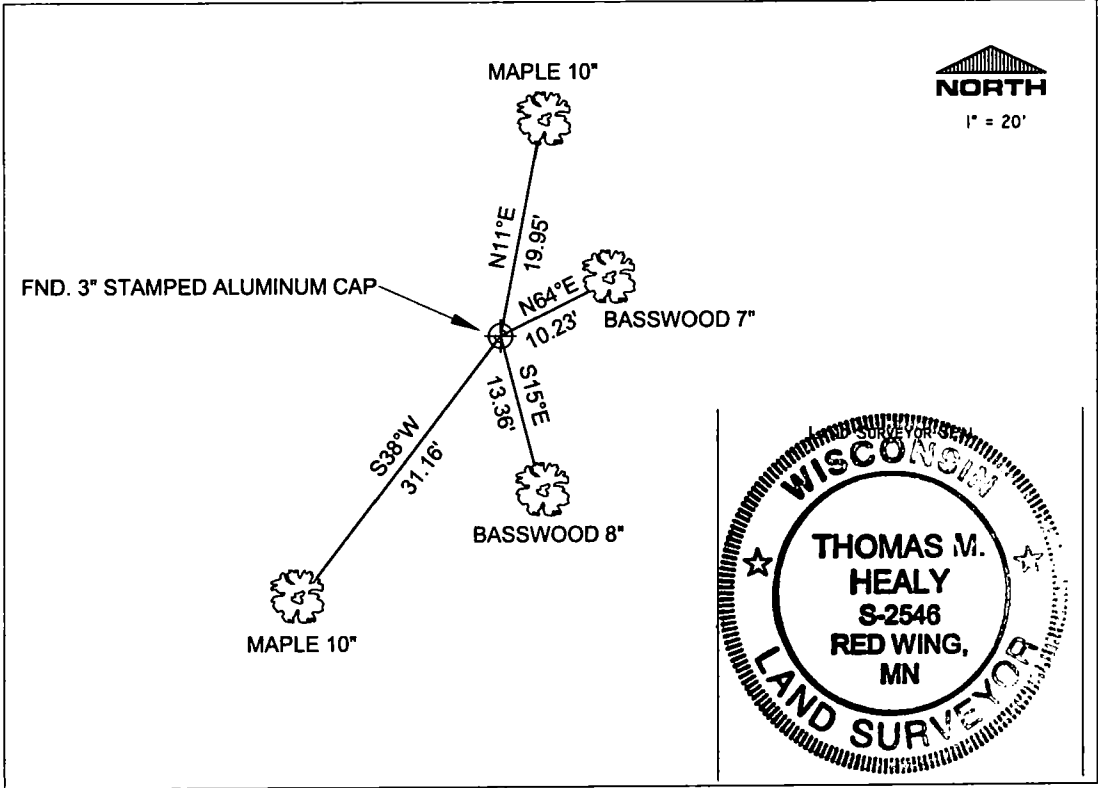

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. N-23

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

4341613 0020

N-23


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 13 and 24, T.34N., R.16E.

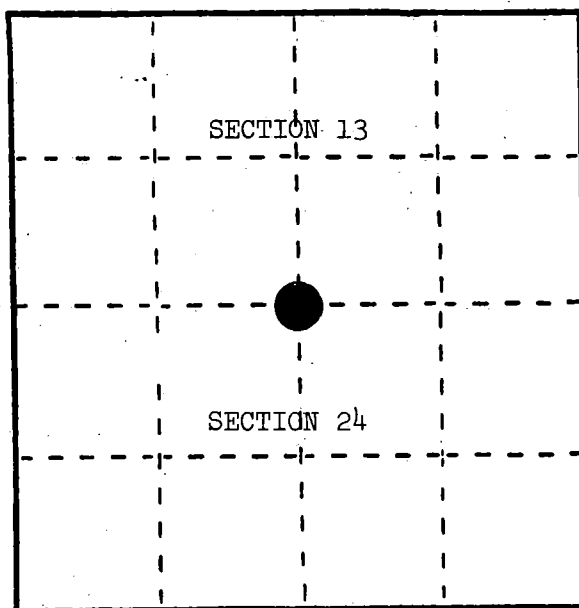

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set quarter section post with the following BTs: Hemlock, 10", S.37°E., 9 links; Sugar, 10", N.07°W., 7 links.

July 8, 1981, Milo Stefan found a 7/8" steel rod 2' long with 90° bend on end 2" long; 4-sided blazed 3" Sugar, N.30°W., approximately 30' from iron; stump holes at S.37°E., 6' and N.7°W., 5' from iron bar. Replaced iron rod with a 2" x 36" aluminum pipe.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north:

1. Sugar, 5", N.05°E., 19.82'
2. Basswood, 7", S.19°E., 13.49'
3. Sugar, 7", S.29°W., 31.18'
4. Steel Sign Post, West, 1.6'
5. 2" x 36" aluminum pipe stamped to identify the corner.

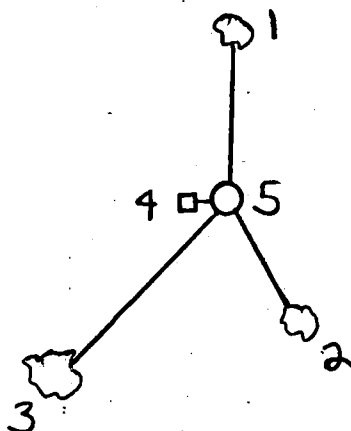

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24th day

of January A.D., 1985 at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 23

Paul Archambault
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

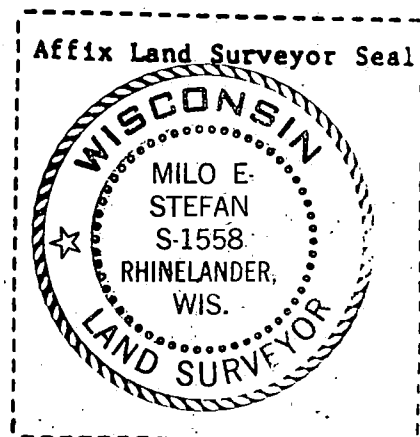

Document Number

189303

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P. M. and recorded
in Vol. Corner Restoration
page N 24/25
Kay Swanson Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES McBRIDE, SURVEYOR, SET POST AT MEANDER CORNER 15.53 CHAINS WEST OF NE CORNER OF SECTION

SET THE FOLLOWING WITNESSES:

HEMLOCK 14" N43°E 9 LINKS
HEMLOCK 18" S54°E 16 LINKS

1986 - KIM H. PRITZLAFF, SURVEYOR S-1259, PLAT OF SURVEY, FOUND CORNER POSITION MARKED WITH 1.5" IRON PIPE AND ACCEPTED BY FOREST SERVICE
AS MEANDER CORNER PERPETUATION

CORNER WAS: (CHECK ALL THAT APPLY)

- ☒ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☐ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)
DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


1.5" IRON PIPE NOT FOUND. SET A 3/4" REBAR WITH A 3" ALUMINUM CAP AT RECORD POSITION ACCORDING TO 1986 U.S. FOREST SERVICE SURVEY BY KIM H. PRITZLAFF, RLS NO. 1259.

SET THE FOLLOWING WITNESSES:


HEMLOCK 8" N04°E 5.00 FEET - SET D.H. NAIL IN TREE.
HEMLOCK 8" S55°E 18.16 FEET - SET D.H. NAIL IN TREE.
HEMLOCK 10" S15°W 3.25 FEET - SET D.H. NAIL IN TREE.
HEMLOCK 8" N55°W 9.70 FEET - SET D.H. NAIL IN TREE.
SIGN S30°E 1.40 FEET
WATER'S EDGE EAST 20 FEET

ALL TREES HAVE CHEST AND STUMP BLAZES.

THE NORTH LINE M.C.
OF SECTION 24,
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

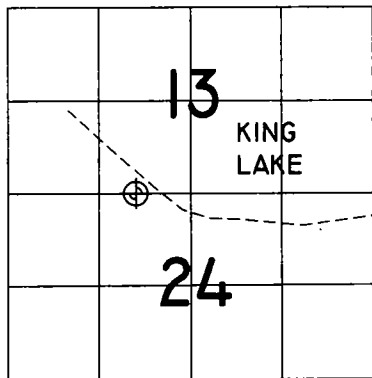

⊕ = LOCATION OF CORNER

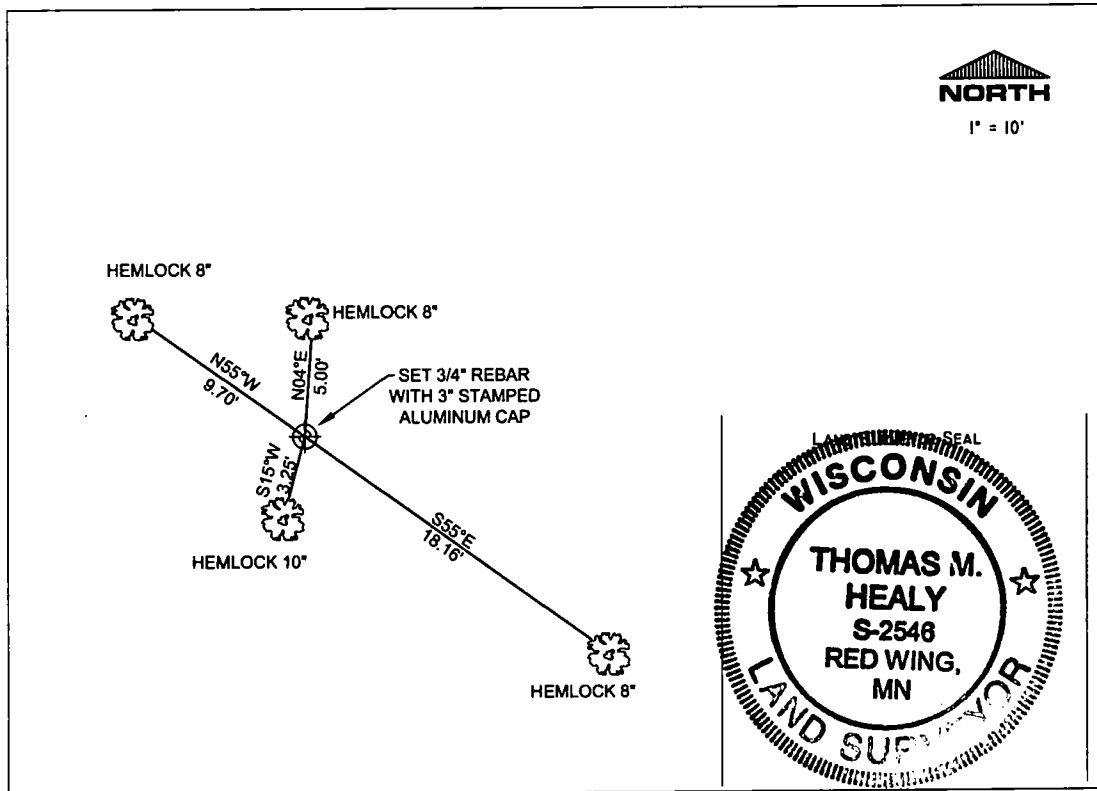

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

TH M Healy 11-17-05
SIGNATURE DATE

INDEX No. M.C - N 24/25

4341613 0026

N 24-25

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page N/O 25
Kay Swanson, Deputy
Register of Deeds

Document Number
189315

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
CEDAR 12" SOUTH 35 LINKS

1935 - C.J. PRIEGEL - TRUCK TRAIL #342, M.C. APPROXIMATELY S26°W, 830' TO TWO 12" X 20' CULVERTS, ROAD INTERSECTION.

1983 - LANDOWNER TOOK MILO STEFAN TO CORNER WHICH CONSISTS OF 1.5" IRON PIPE, AN OLD POST POINT, AND A WOODEN PICKET NEXT TO IT.

1984 - ALAN D. HARRISON, SURVEYOR, S-1651, FOUND A PERPETUATED LOCATION.

SET THE FOLLOWING WITNESSES:
YELLOW BIRCH 6" N40°E 16.60 FEET
SUGAR MAPLE 12" S45°W 45.64 FEET
HEMLOCK 12" N65°W 25.63 FEET
STEEL SIGN NORTH 1.3 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED TO REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 2" PIPE W/3" ALUMINUM CAP STAMPED R.L.S. 1651.

FOUND THE FOLLOWING WITNESSES:


YELLOW BIRCH 8" N36°E 16.52 FEET - FOUND SINGLE HEADED NAIL IN TREE.
MAPLE 16" S45°W 45.64 FEET - SET D.H. NAIL IN TREE.
HEMLOCK 22" N68°W 26.08 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


BEECH 10" S25°W 27.40 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST AND STUMP BLAZES.
ALL FOUND BT'S HAVE ALUMINUM BEARING TAG.

THE EAST LINE M.C.
OF SECTION 24,
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

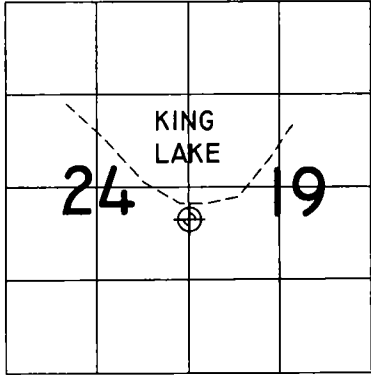

⊕ = LOCATION OF CORNER

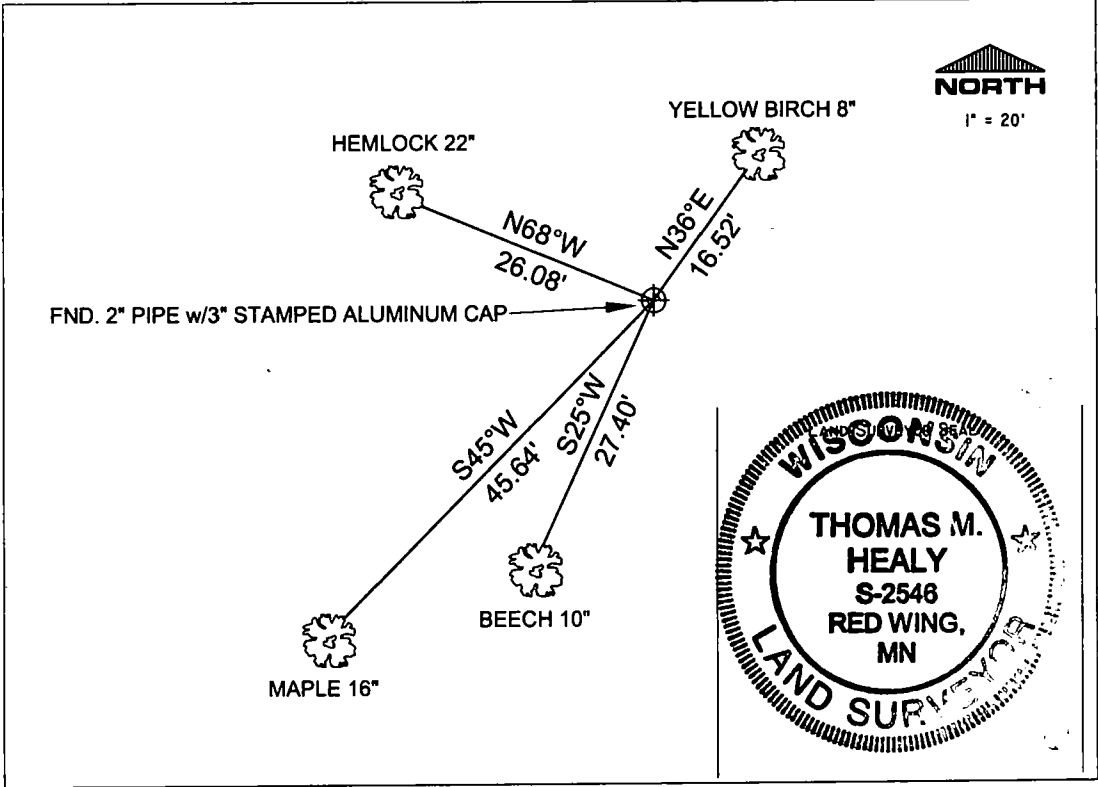

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. M.C - N/O 25

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

43416241620

N/O - 25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

North Meander Corner on King's Lake, T.34N., R.16E.

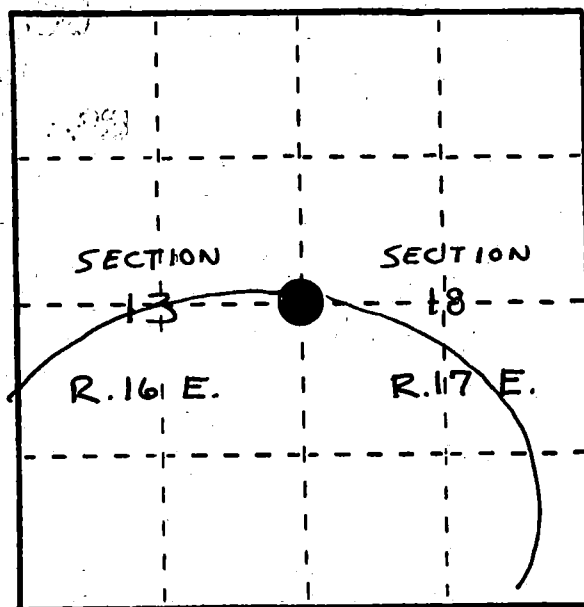

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set meander corner, which consists of an 18" Hemlock tree.

February 21, 1984, Alan Harrison found an iron pipe, as when surveyed by Forest Service in Section 13.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. White Birch, 18", N.17°E., 56.12'
3. Sugar, 8", S.62°E., 31.12'
4. Sugar, 9", N.46°W., 5.26'
5. Steel Sign Post, North, 3.6'

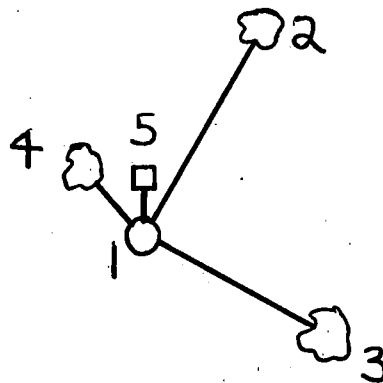

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of January... A. D., 1985
at 10:30 o'clock... A. M. and

recorded in Vol. CORNER RESTORATIONS
on page N-25

Paul Hechendorfer
REGISTER

43416132000

M,N-25

N25

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

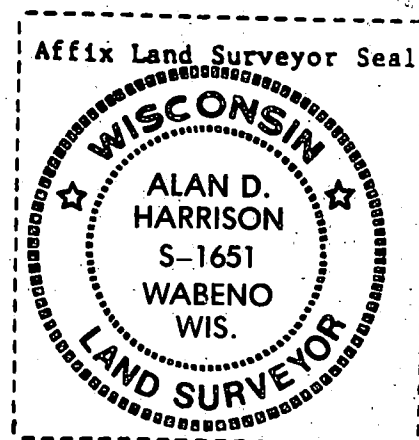


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

South Meander Corner, King Lake, Sections 19 and 24, T.34N., R.16E.

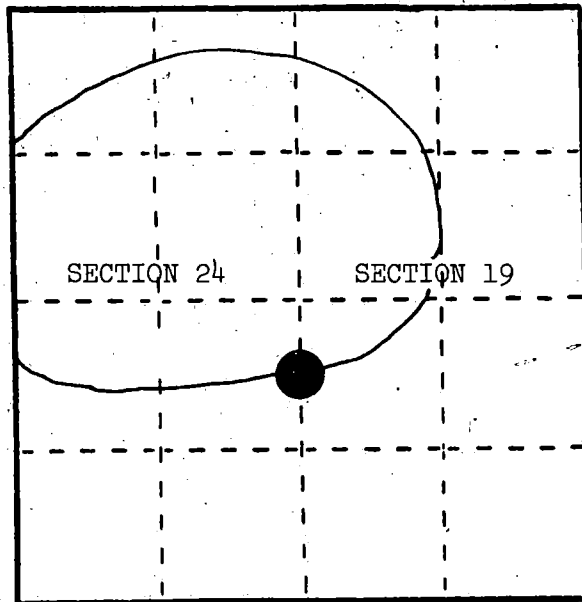

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BT: Cedar, 12", south, 35 links.


1935, C. J. Priegel - Truck Trail #342, M.C. approximately S.26°W., 830' to two 12" x 20' culverts, road intersection.

September 29, 1983, landowner took Milo Stefan to corner which consists of 1½" iron pipe, an old post point, and a wooden picket next to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Yellow Birch, 6", N.40°E., 16.60'
3. Sugar, 12", S.45°W., 45.64'
4. Hemlock, 12", N.65°W., 25.63'
5. Steel Sign Post, North, 1.3'

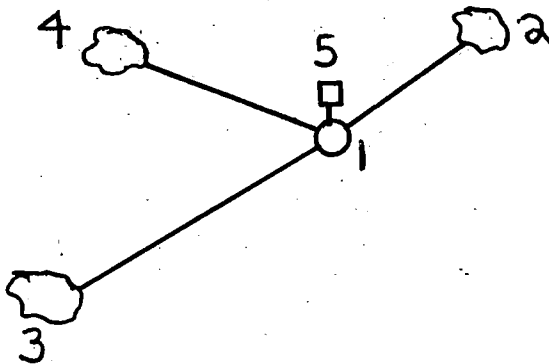

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day

of... January... A.D., 1985

... 10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 1, 0-25
Paul Aschenbrenner
REGISTER

N,0-25

43416241500

N,025

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date

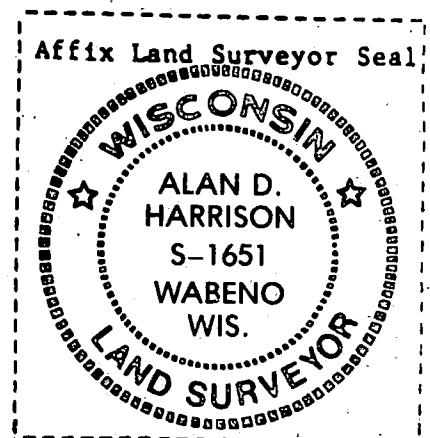


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

WEST $\frac{1}{4}$ CORNER OF SECTION 19, TWP. 34 N.,
R.16 E.

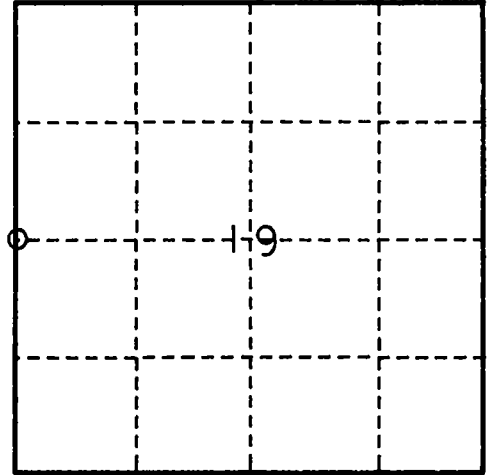

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - ORIGINAL SURVEY BY CURTIS, SET WOOD POST, B.Ts - SUGAR 12" S.11° E. 6 LKS., SUGAR 30" N.46° W. 5 LKS.

1984 - STEFAN R.L.S. NO. S-1558 SET 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER, B.Ts - SUGAR 5" NORTH 28.97FT., SUGAR 8" S.26° E. 50.72FT., SUGAR 8" N.49° W. 26.77FT., WITNESS- STEEL SIGN POST NORTH 1.80FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, B.Ts AND WITNESS. B.T SUGAR 5" NORTH 28.97FT. IS DOWN, TIE TO STEEL SIGN POST IS 2.40FT. NOT 1.80FT. FOUND B.T. NOT LISTED ON LAND SURVEY MONUMENT RECORD LISTED AS NO. 3 BELOW.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

- 1.-B.T. SUGAR 8" N.49° W. 26.95FT. (EXISTING)
2. STEEL SIGN POST NORTH 2.40FT. (EXISTING)
- 3.-B.T. SUGAR 7" N.10° E. 24.72FT. (EXISTING)
- 4.-2" DIA. ALUMINUM MONUMENT AT CORNER (EXISTING)
- 5.-B.T. SUGAR 12" S.26° E. 50.53FT. (EXISTING)

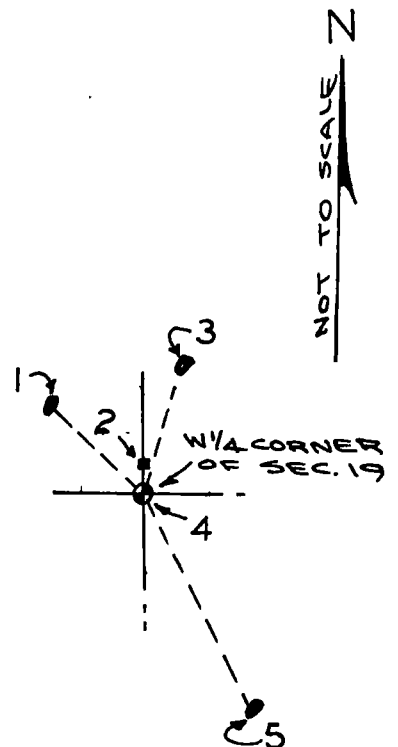


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

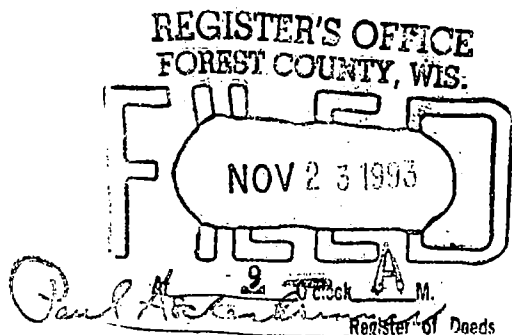

(1) I, WAYNE G. DOBBRATZ
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

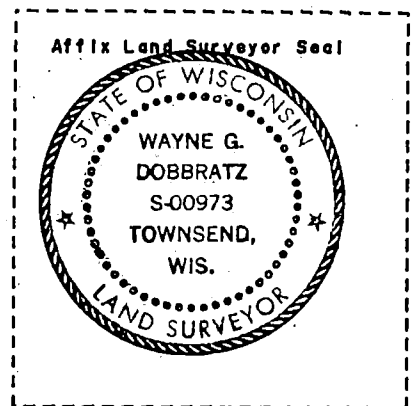

Wayne G. Dobbratz 9/4/93
Signature Date

CERTIFICATE READY FOR FILING:


Ralph ... 11-5-93
Acting District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 19 and 24, T.34N., R.15-16E.

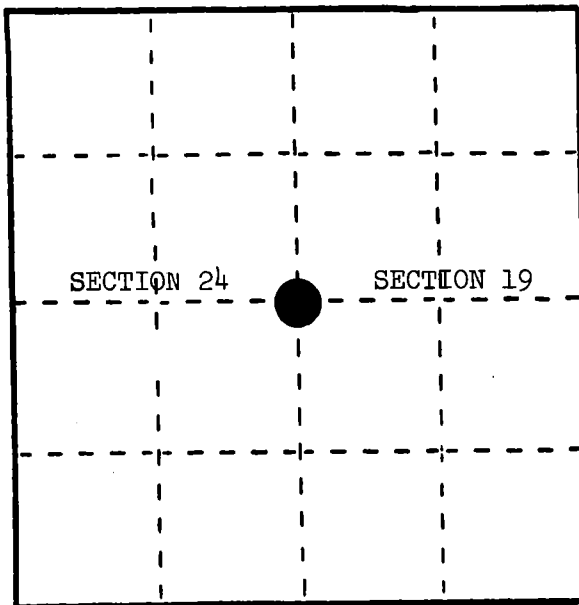

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Sugar, 12", S.11°E., 6 links; Sugar, 30", N.46°W., 5 links.

May 31, 1984, Milo Stefan set proportionate position. Searched area, found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 5", North, 28.97'
- Sugar, 8", S.26°E., 50.72'
- Sugar, 8", N.49°W., 26.77'
- Steel Sign Post, North, 1.80'

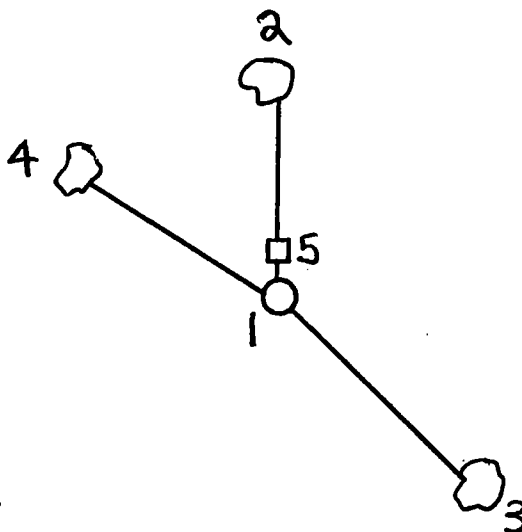

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this... day
 of... A. D., 19... at
 ... o'clock... A. M. and

recorded in Vol. **CORNER RESTORATIONS**

on page **P-1**
 Paul Aschenbrenner
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

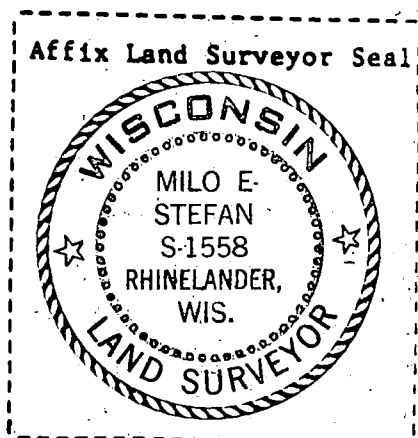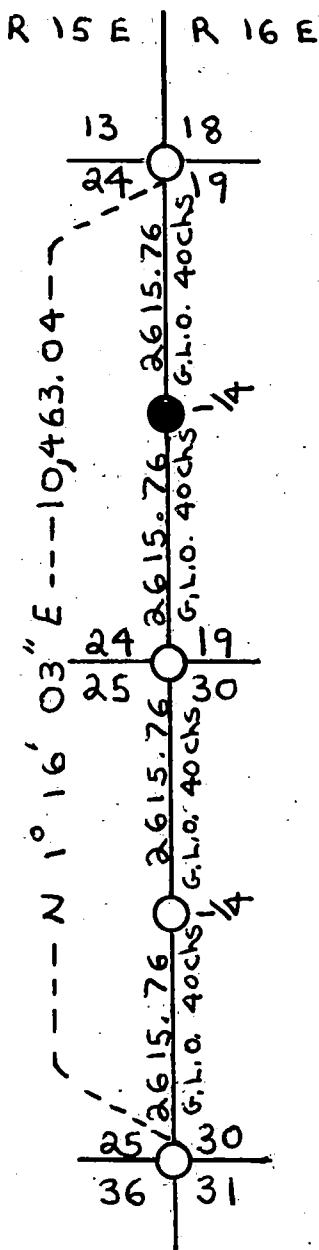

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 19 and 20, T.34N., R.16E.

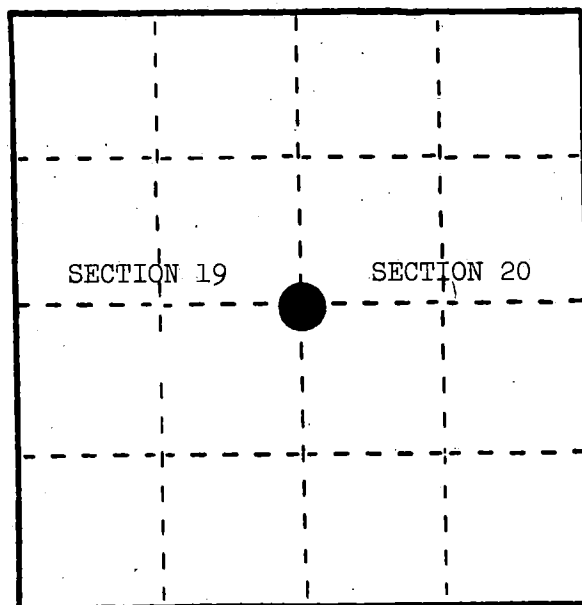


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set wood post with the following BTs: Birch, 8", S.27°E., 23 links; Hemlock, 6", S.14°W., 4 links.

July 10, 1984, Alan Harrison set proportionate position. Searched area, found Hemlock root remains; then, pulled N.14°E., 2.6', and found remains of post point--from post point, S.27°E., 15.2', stump hole of 8" - 10" tree.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

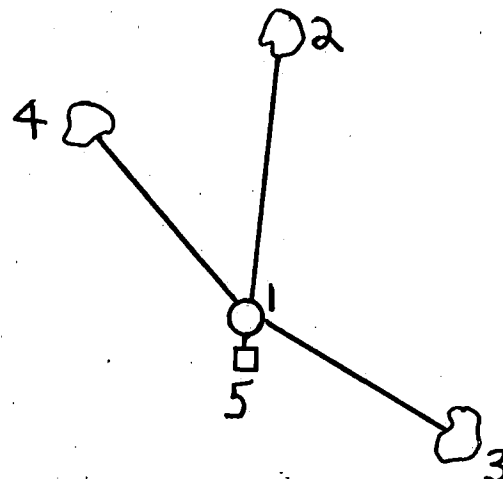

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 8", N.3°E., 53.85'
- Black Cherry, 5", S.70°E., 28.67'
- Black Cherry, 5", N.33°W., 21.90'
- Steel Sign Post, South, 1.42'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of January... A.D., 1985 at

... 10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page P-5
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

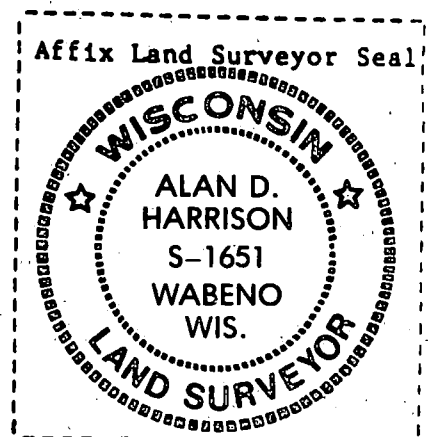

11/27/84


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

EAST $\frac{1}{4}$ CORNER OF SECTION 20, TWP. 34 N.,
 R. 16 EAST.

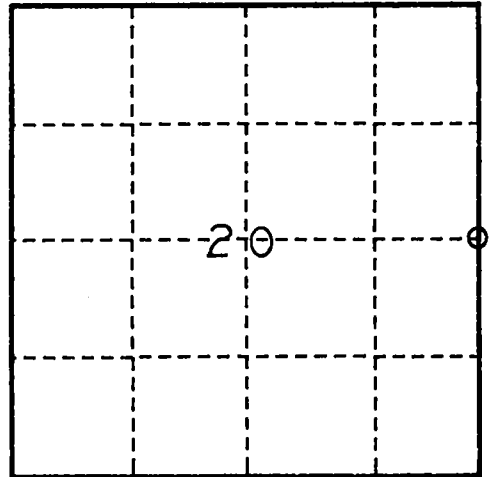

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET WOOD POST, B.Ts - BEECH
 20" S.81° E. 8 LKS., BEECH 18" N.48° W. 32 LKS.

1959 - SANDBERG FOUND 4" X 4" CEDAR POST

1984 - HARRISON R.L.S. NO. S-1651, SET 2" DIA. ALUMINUM MONUMENT AT
 CORNER, B.Ts - SUGAR 6" S.19° E. 29.59FT., SUGAR 7" S.36° W. 21.62FT.,
 SUGAR 6" N.29° W. 25.29FT., WITNESS - STEEL SIGN POST NE 1.93FT.


1993 - DOBBRATZ R.L.S. NO. S-973 FOUND MONUMENT, STEEL SIGN POST
 AND B.Ts. TIES TO B.Ts AND WITNESS DIFFER WITH LAND SURVEY MONUMENT
 RECORD.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. SUGAR 7" N.29° W. 26.00FT. (EXISTING)
2. B.T. SUGAR 7" S.19° E. 28.80FT. (EXISTING)
3. B.T. SUGAR 8" S.36° W. 21.08FT. (EXISTING)
4. 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER (EXISTING)
5. STEEL SIGN POST NORTH 1.37FT. (EXISTING)

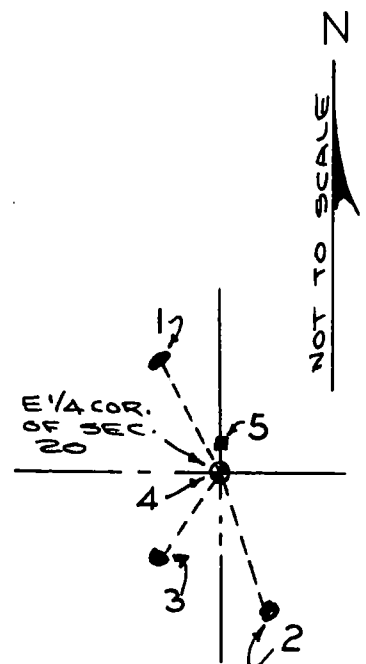


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

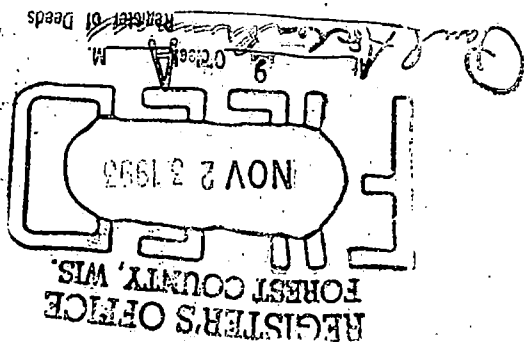

(1) I, WAYNE G. DOBBRATZ
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

9/4/93

Date

CERTIFICATE READY FOR FILING:

Ralph Cella 11-5-93
Acting District Ranger

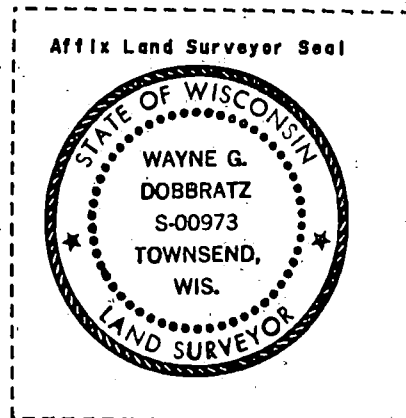


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 20 and 21, T.34N., R.16E.

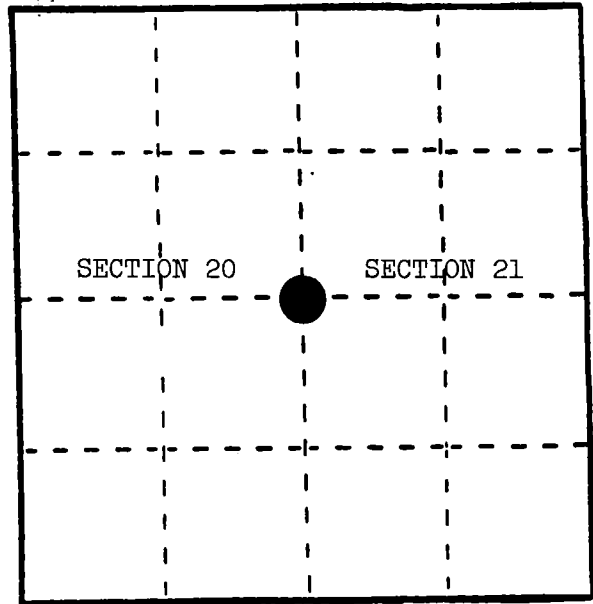

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Beech, 20", S.81°E., 8 links; Beech, 18", N.48°W., 32 links.


January 30, 1959, Nels Sandberg found 4" x 4" x 36" Cedar post.

August 22, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; in a mound of stone.
2. Sugar, 6", S.19°E., 29.59'
3. Sugar, 7", S.36°W., 21.62'
4. Sugar, 6", N.29°W., 25.29'
5. Steel Sign Post, Northeast, 1.93'

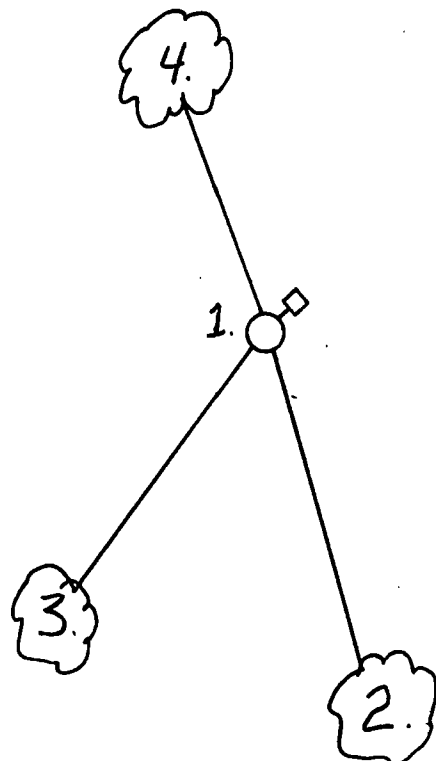

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this 24th day
 of January, 1985, at
 10:30 o'clock A.M. and
 recorded in Vol. CORNER RESTORATIONS
 on page P-9
 Paul A. Ashenbrenner
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

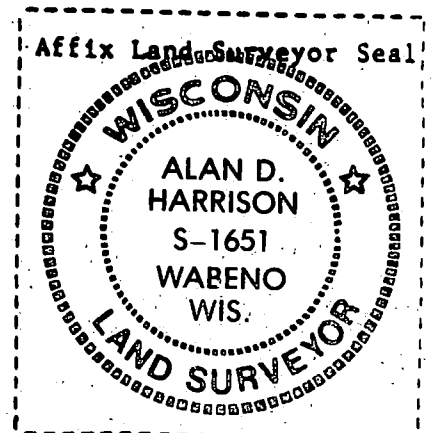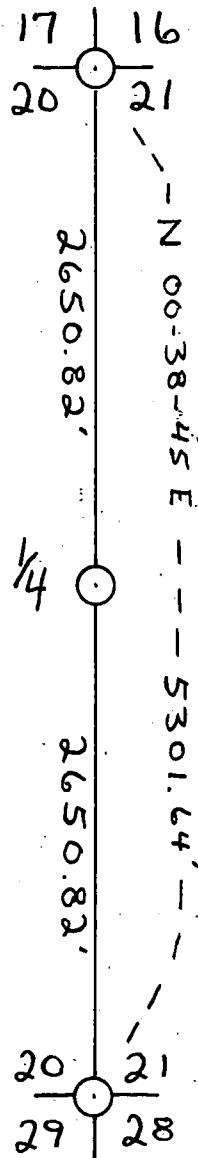

(i) 1. Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date

Document Number

189314

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55'clock P.M. and recorded
in Vol. Corner Restoration
page P-13
Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
BIRCH 8" N65°E 28 LINKS
HEMLOCK 12" S58°W 26 LINKS

1933 - RAYMOND LEIGH, FOUND AN 8" X 8" CEDAR POST AND A 2" IRON PIPE, 6" HIGH.

1984 - ALAN HARRISON, SURVEYOR, S-1651, SEARCHED AREA, FOUND A 2" IRON PIPE ALONGSIDE A ROCK PILE WITH POST HOLE ON CENTER. NO TRACE OF BT'S. SWAMP CALL FITS WELL. SET A 2" X 30" ALUMINUM MONUMENT IN A MOUND OF STONES.

SET THE FOLLOWING WITNESSES:
ASPEN 6" N47°E 12.64 FEET
BLACK CHERRY 5" S18°W 46.60 FEET
BLACK CHERRY 8" N31°W 22.66 FEET
STEEL SIGN POST EAST 1.44 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 2-1/2" STAMPED ALUMINUM MONUMENT.

FOUND THE FOLLOWING WITNESSES:


ASPEN 11" N44°E 12.64 FEET - SET A D.H. NAIL IN NW FACE OF TREE.
BLACK CHERRY 8" S14°W 46.75 FEET - FOUND NAIL IN EAST FACE OF TREE.
BLACK CHERRY 10" N30°W 22.67 FEET - FOUND NAIL IN SOUTH FACE OF TREE.
SIGN EAST 1.44 FEET

SET THE FOLLOWING WITNESSES:


ASPEN 12" S41°E 16.08 FEET - SET D.H. NAIL IN NORTH FACE OF TREE.

ALL TREES HAVE CHEST & STUMP BLAZES. FOUND BT'S HAVE TAGS.

THE WEST 1/4
CORNER OF SECTION 22
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

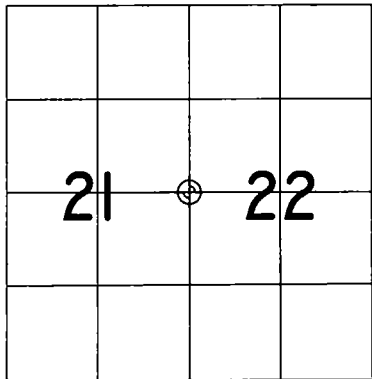

⊕ = LOCATION OF CORNER

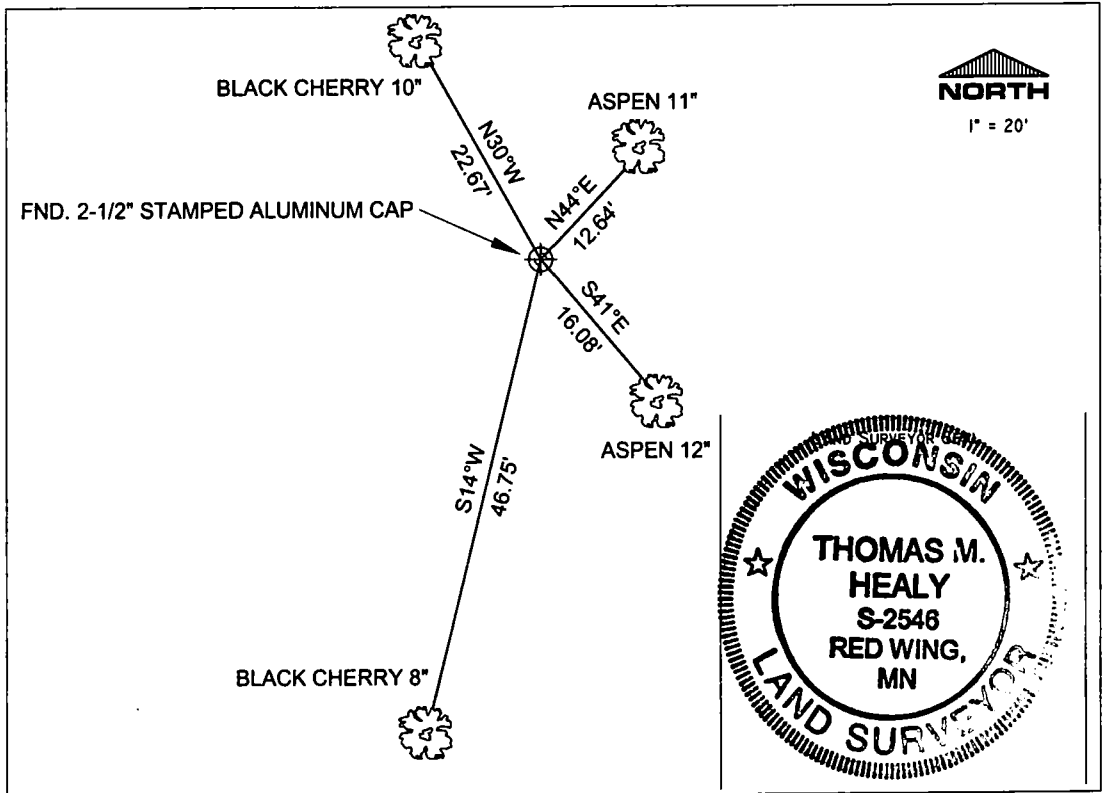

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

INDEX No. P-13

43416212000

P-13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 21 and 22, T.34N., R.16E.

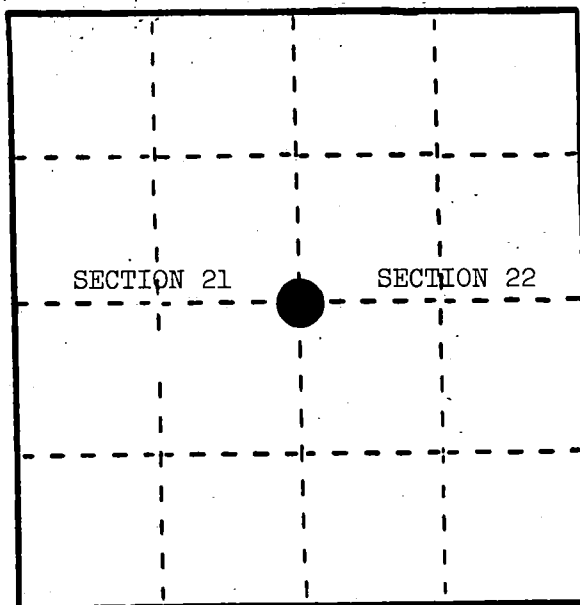

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Birch, 8", N.65°E., 28 links; Hemlock, 12", S.58°W., 26 links. 3.0 chains south, enter Cedar swamp east-west.


December 21, 1933, Raymond Leigh found 8" x 8" Cedar post and a 2" iron pipe, 6" high.

June 14, 1984, Alan Harrison searched area, found 2" iron pipe alongside rock pile with post hole in center. No trace of BTs. Swamp call fits well.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; in a mound of stone.
2. Aspen, 6", N.47°E., 12.64'
3. Black Cherry, 5", S.18°W., 46.60'
4. Black Cherry, 8", N.31°W., 22.66'
5. Steel Sign Post, East, 1.44'

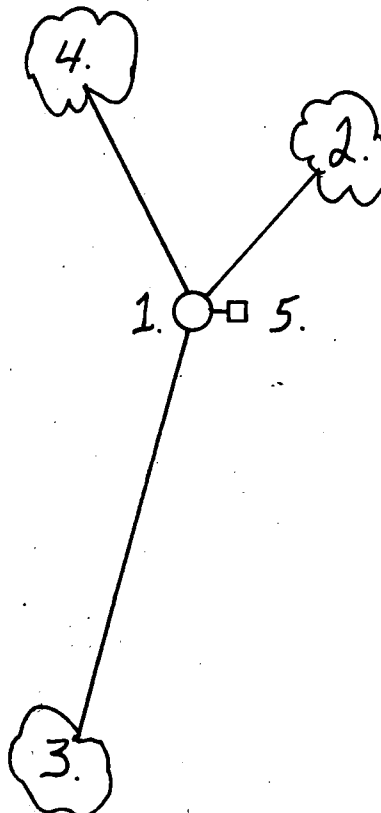

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 24th day

of January, 1985 at

10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page P-13
Paul Ascherbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(i) Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

12/10/84

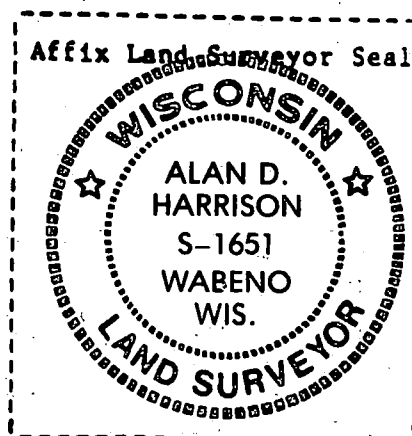


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

WEST $\frac{1}{4}$ CORNER OF SECTION 23, TWP. 34 N.,
 R. 16 E.

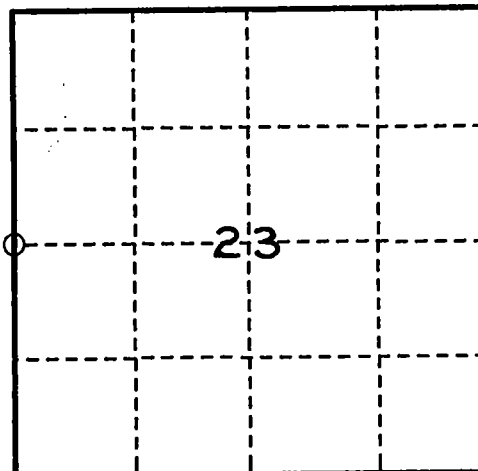

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET $\frac{1}{4}$ CORNER, B.Ts - TAMARACK 5" N.74°E. 116 LKS., TAMARACK 5" S.67 W. 18 LKS.

1984 - HARRISON R.L.S. NO. S-1651 SET 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER, B.Ts TAMARACK 7" N.74°E. 76.53FT., BLACK SPRUCE 6" S.46°W. 13.50FT., BLACK SPRUCE 5" N.8°W. 23.57FT. WITNESS - STEEL SIGN POST NW 1.30FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST AND B.Ts EXCEPT B.T. BLACK SPRUCE 5" N.8°W. IS DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. TAMARACK 7" N.74°E. 76.53FT. (EXISTING)
2. 2" DIA. ALUMINUM MONUMENT (EXISTING)
3. B.T. BLACK SPRUCE 6" S.46°W. 13.50FT. (EXISTING)
4. B.T. BLACK SPRUCE 5" N.80°W. 24.14FT. (NEW)
5. STEEL SIGN POST NW 1.30FT. (EXISTING)

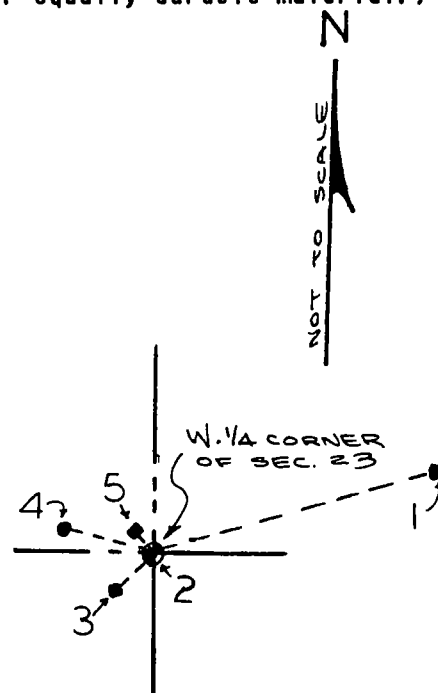


(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

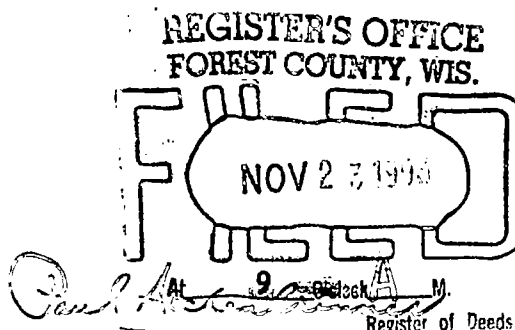

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

8/7/93

Date

CERTIFICATE READY FOR FILING:

Ralph A. Wells 11-5-93
Acting District Ranger

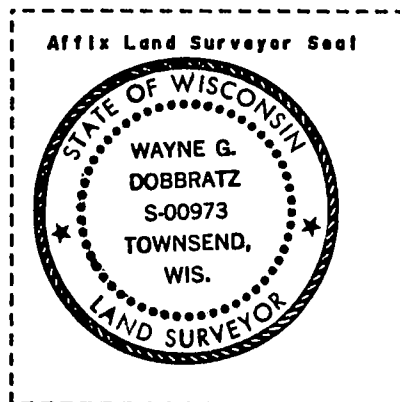

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 22 and 23, T.34N., R.16E.

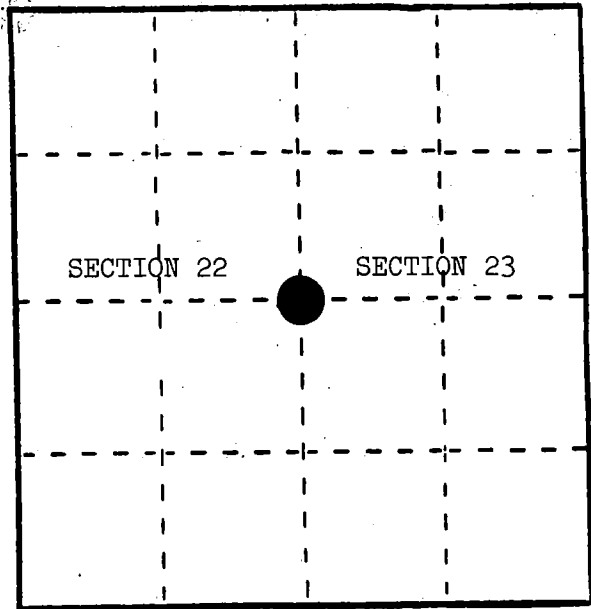

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Tamarack, 5", N.74°E., 116 links; Tamarack, 5", S.67°W., 18 links.

December 6, 1983, Alan Harrison found squared and scribed wood post and point in boggy marsh. At N.74°E., 76.5', 7½" Tamarack--scribing visible. Believed to be original. At N.8°E., 4.4', 4" Black Spruce with blazes D.B.H. and at base. Accepted as original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. Tamarack, 7", N.74°E., 76.53'
3. Black Spruce, 6", S.46°W., 13.50'
4. Black Spruce, 5", N.8°W., 23.57'
5. Steel Sign Post, Northwest, 1.3'

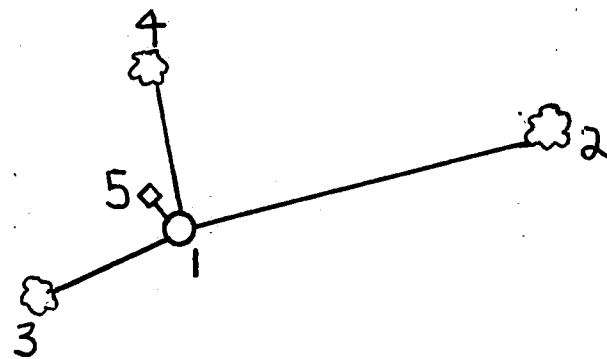

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day
of... A. D., 19... at
... o'clock... M. and

recorded in Vol. CORNER RESTORATIONS
on page...

Paul A. Schenck
Register

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

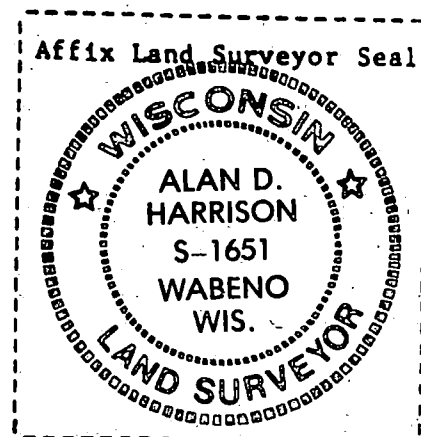


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 23 and 24, T.34N., R.16E.

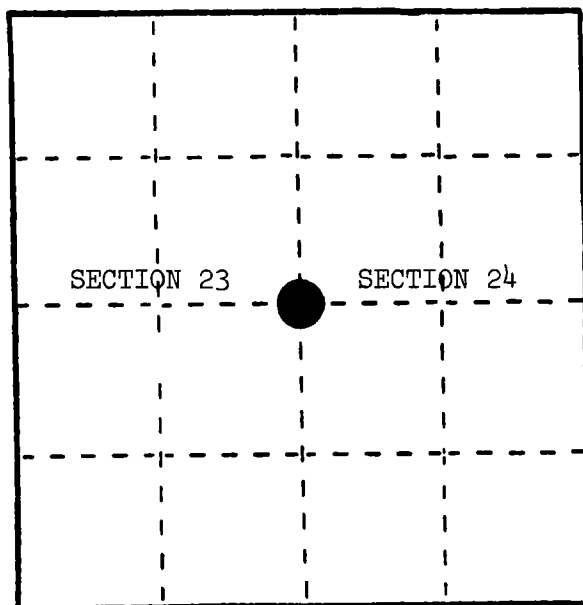

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 6", N.79°E., 5 links; Basswood, 8", N.56°W., 32 links.

December 20, 1933, Raymond Leigh found a 1" iron rod and no BTs--does not believe to be original corner.

July 25, 1984, Alan Harrison searched area and found no evidence of corner. Set proportionate position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

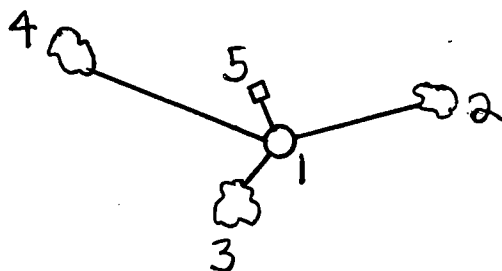

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 5", N.77°E., 13.44'
3. Basswood, 10", S.21°W., 3.05'
4. Sugar, 6", N.60°W., 26.06'
5. Steel Sign Post, Northwest, 2.03'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day

of... January ... A.D., 1985 at

... 10:30 o'clock... A ... M. and

recorded in Vol. CORNER RESTORATIONS

on page P-21
Paul Achenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

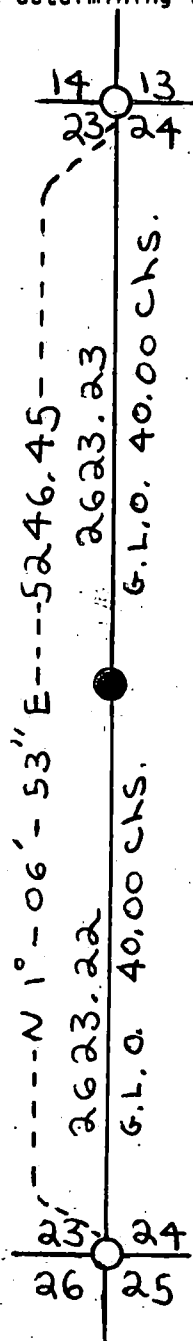


(1) I, Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

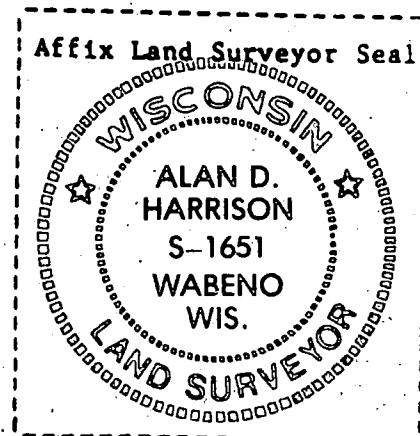

Document Number

189316

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page P-25

Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1839 - TOM SPRAGUE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:

SUGAR MAPLE 12" S01°W 43 LINKS
SUGAR MAPLE 12" N25°W 42 LINKS

1984 - ALAN HARRISON, SURVEYOR, S-1651, FOUND 3" IRON PIPE WITH SCREW ON CAP STAMPED 24 1/4 19, S903, WITH SQUARED ASPEN STAKE LYING ALONGSIDE. DISTANCE FROM M.C. ON SOUTH SIDE OF KING LAKE IS 2637'. B.I.A. FORESTER SET ASPEN STAKE, WHICH WAS MONUMENTED BY S-903. G.L.O. DISTANCE FROM M.C. TO QUARTER CORNER WAS 2485'. SET PROPORTIONAL CORNER AT 2472.91' FROM M.C. AFTER DISCUSSION WITH S-903.

SET THE FOLLOWING WITNESSES:

SUGAR MAPLE 12" N69°E 29.22 FEET
SUGAR MAPLE 5" S42°E 43.75 FEET
SUGAR MAPLE 7" S43°W 50.97 FEET
COUNTY MONUMENT S2°40'E 154.51 FEET
STEEL SIGN SOUTH 2.66 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


FOUND A 3" STAMPED ALUMINUM CAP.

FOUND THE FOLLOWING WITNESSES:


MAPLE 14" N72°E 29.23 FEET - FOUND NAIL IN TREE.
MAPLE 9" S42°E 43.55 FEET - FOUND NAIL IN TREE.
MAPLE 10" S43°W 51.04 FEET - FOUND NAIL IN TREE.
COUNTY MONUMENT S02°E 154.09 FEET
STEEL SIGN SOUTH 2.6 FEET

ALL TREES HAVE CHEST AND STUMP BLAZES AND TAGS.

THE EAST 1/4
CORNER OF SECTION 24
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

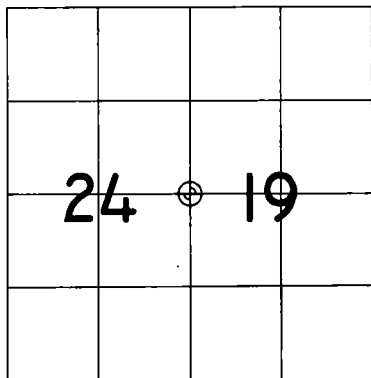

⊕ = LOCATION OF CORNER

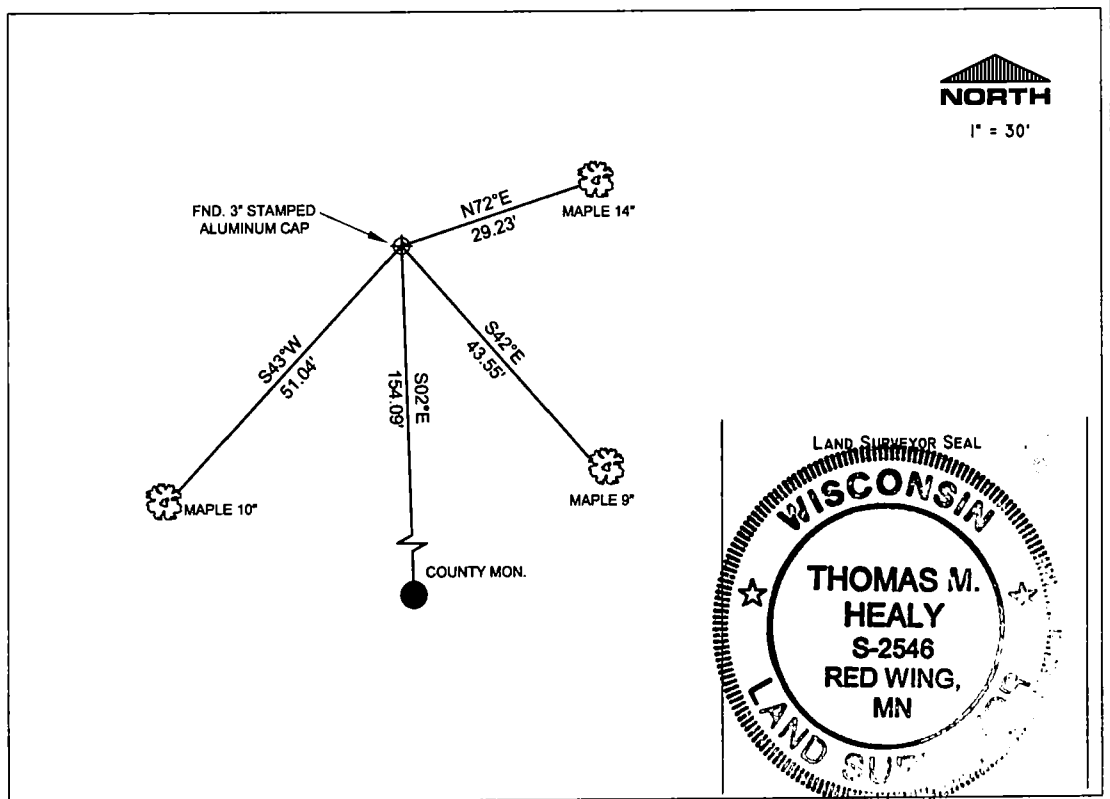

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Thomas M. Healy 11-17-05
SIGNATURE DATE

INDEX No. P-25

43416242000

P-25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 19 and 24, T.34N., R.16-17E.

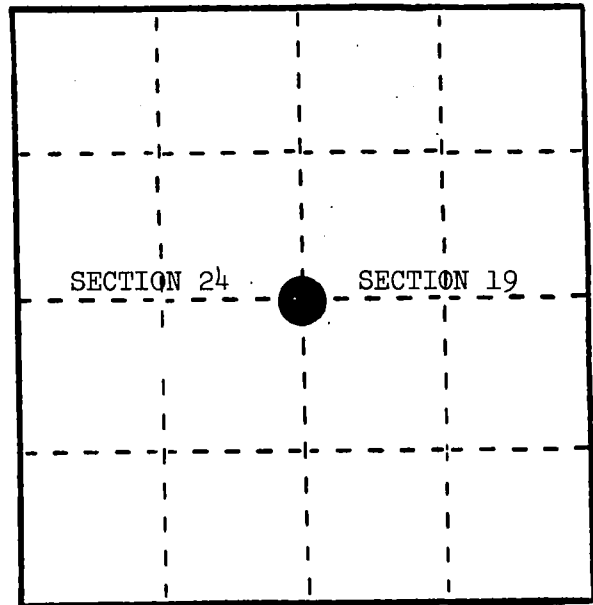

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1839, Tom Sprague set post with the following BTs: Sugar, 12", S.1°W., 43 links; Sugar, 12", N.25°W., 42 links.

June 20, 1984, Alan Harrison found 3" iron pipe with screw-on cap stamped 24 1/4 19, S903, with squared Aspen stake lying alongside. Distance from M.C. on south side of King Lake is 2637'. B.I.A. forester set Aspen stake, which was monumented by S-903. G.L.O. distance from M.C. to quarter corner was 2485'. Set proportional corner at 2472.91' from M.C. after discussion with S-903.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 12", N.69°E., 29.22'
3. Sugar, 5", S.42°E., 43.75'
4. Sugar, 7", S.43°W., 50.97'
5. Steel Sign Post, South, 2.66'
6. County Monument, S.2°40'E., 154.51'

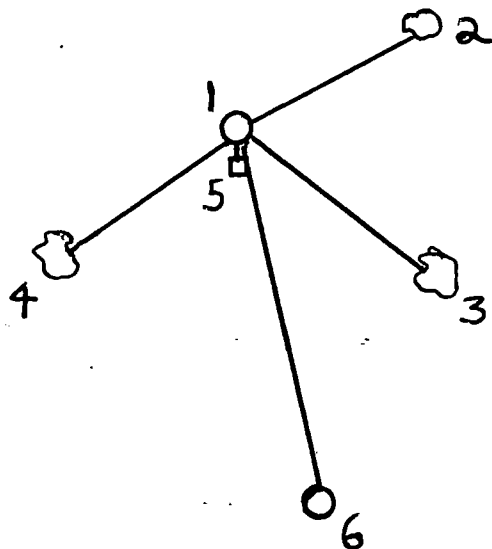

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of January... A.D., 1985 at
... 10:30 o'clock... A.M. and

recorded in Vol. **CORNER RESTORATIONS**
on page **P-25**

Paul E. Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



County monument set at 2637' from M.C. (original G.L.O. 2485').

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

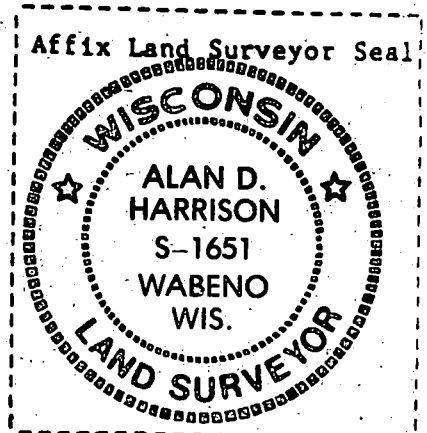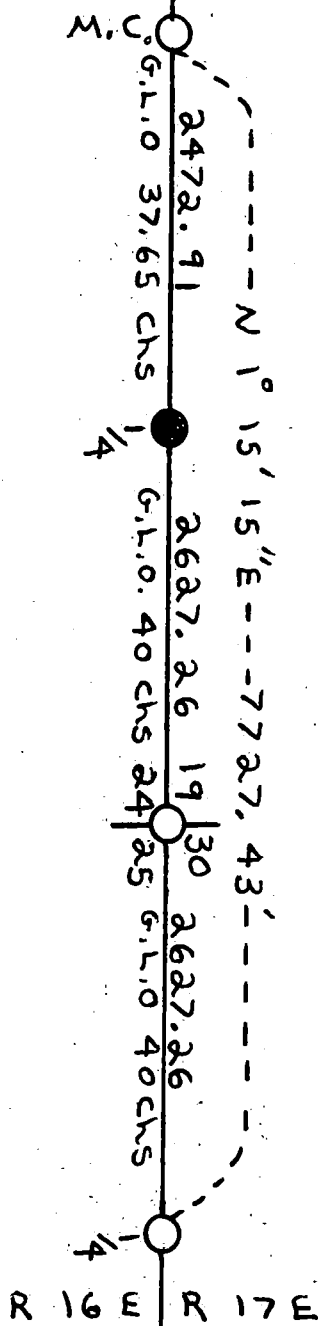

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/27/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 19, TWP. 34 N.,
 R. 16 E.

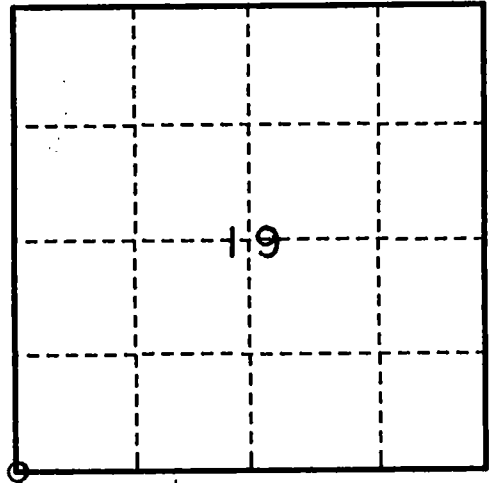

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857- ORIGINAL SURVEY BY McBRIDE, B.Ts. SUGAR 12" N.30°E. 18 LKS.,
 SUGAR 12" S.57°E. 38 LKS., SUGAR 18" S.62°W. 61 LKS., HEMLOCK 18"
 N.68°W. 52 LKS.

1984 -BELLIVEAU SET PROPORTIONATE POSITION

1984 - STEFAN R.L.S. NO.S-1558 PLACED 2" DIA. ALUMINUM MONUMENT AT
 INCORRECT POSITION.

1984 - STEFAN R.L.S. NO.S-1558 SET 2" DIA. ALUMINUM MONUMENT AT CORRECT
 POSITION, NO NEW RESTORATION SHEET PREPARED.


1993 -DOBBRATZ R.L.S. NO. S-973 FOUND MONUMENT AT NEW LOCATION WITH
 B.Ts SCRIBED AND SIGN POST SET.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS AND REFERENCE

1. SUGAR 6" S.24°E. 13.18FT. (EXISTING B.T.)
2. SUGAR 6" S.55°W. 38.12FT. (EXISTING B.T.)
3. STEEL SIGN POST WEST 1.35FT. (EXISTING)
4. SUGAR 5" N.14°W. 47.52FT. (EXISTING B.T.)
5. SUGAR 10" N.34°E. 23.32FT. (EXISTING B.T.)
6. 2" DIA. ALUMINUM MONUMENT (EXISTING)
7. CENTERLINE OF FOREST RD. EAST 28FT.

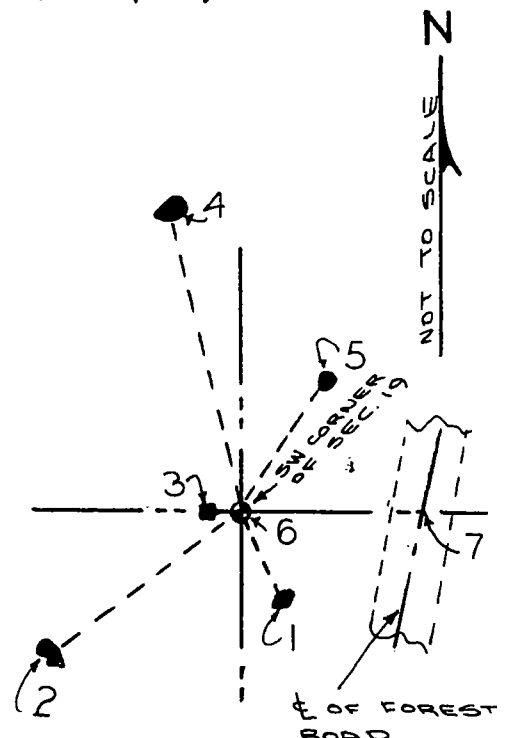


(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

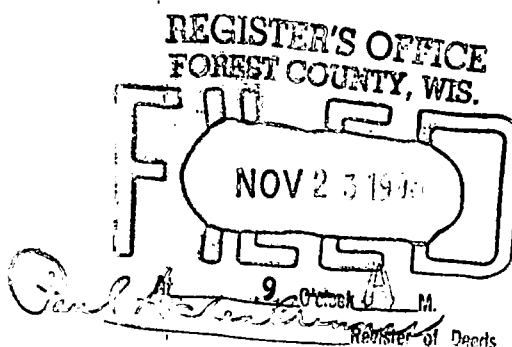

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

8/5/93

Date

CERTIFICATE READY FOR FILING:

Ralph Chella 11-5-93
Acting District Ranger

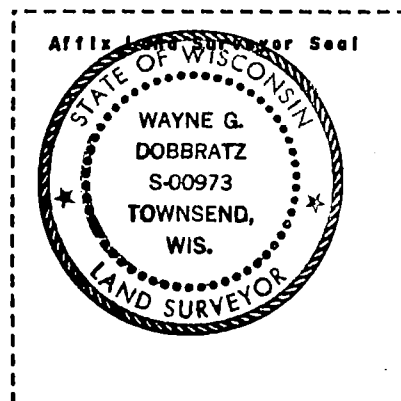


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Corner to Sections 19, 24, 25, and 30, T.34N., R.15-16E.

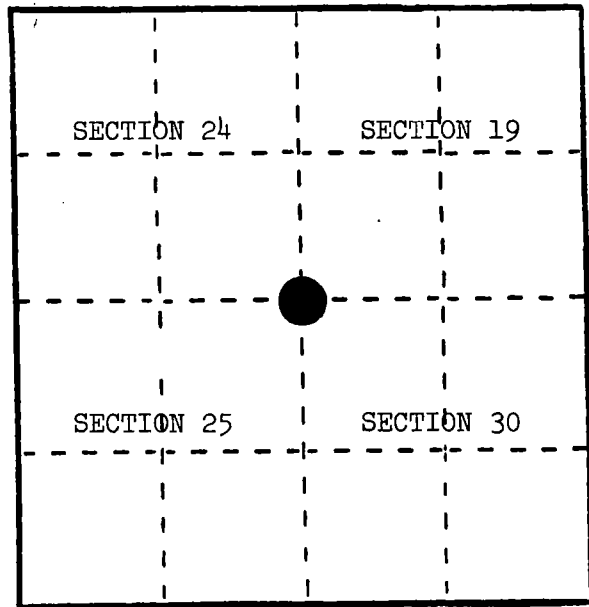


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set section post with the following BTs: Sugar, 12", N.30°E., 18 links; Sugar, 12", S.57°E., 38 links; Sugar, 18", S.62°W., 61 links; Hemlock, 18", N.68°W., 52 links.

May 31, 1984, Richard Belliveau found no evidence of corner position. Set proportionate position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

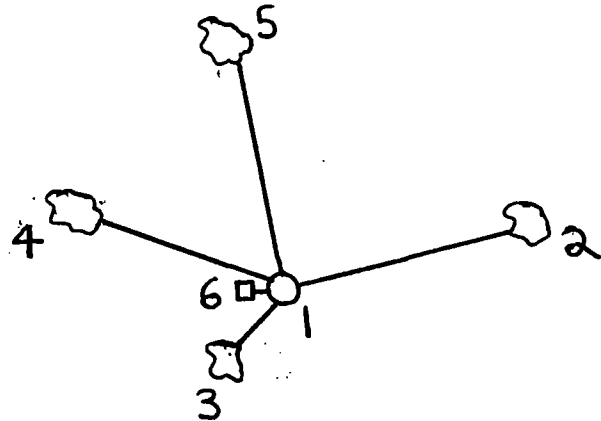

- 2" x 36" aluminum monument stamped to identify the corner.
- Sugar, 12", N.78°E., 25.04'
- Sugar, 7", S.40°W., 7.85'
- Sugar, 10", N.66°W., 29.90'
- Sugar, 10", N.15°W., 28.61'
- Steel Sign Post, West, 1.80'

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24th day
of January, A.D., 1985
at 10:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 1
Paul Aschenbrenner
REGISTER

R-1

43415240000

R
1

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

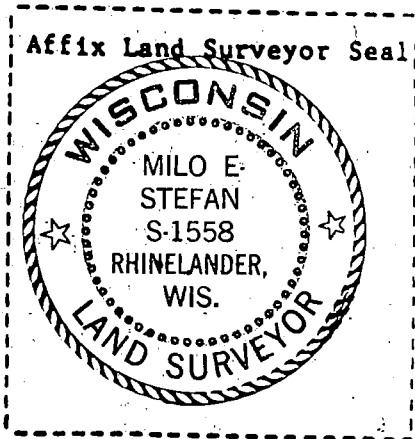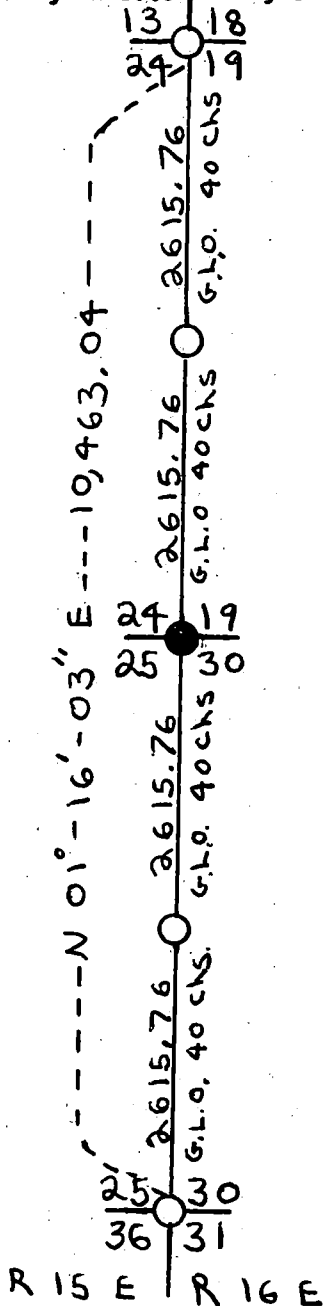

(1) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 19 and 30, T.34N., R.16E.

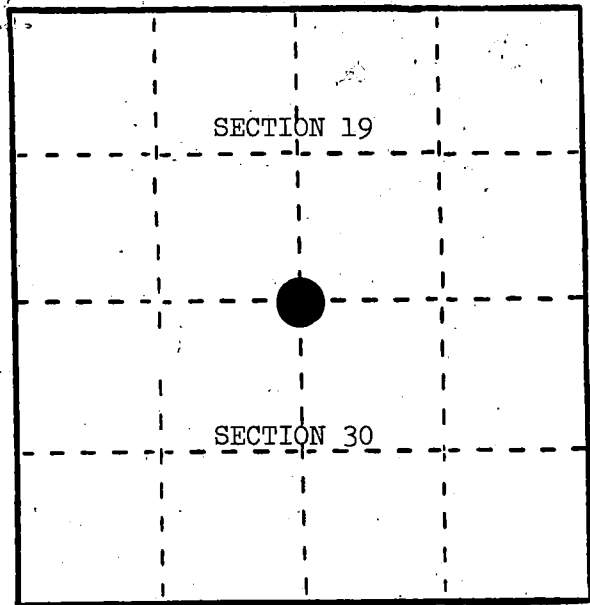

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set quarter post with the following BTs: Hemlock, 10", S.3°E., 35 links; Sugar, 15", N.16°W., 24 links.

July 17, 1984, Alan Harrison found rock mound, Hemlock stump, and stump hole of original BTs.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" aluminum monument stamped to identify the corner.
- Sugar, 8", S.70°E., 32.42'
- Sugar, 6", S.45°W., 34.81'
- Sugar, 8", N.22°W., 6.74'
- Steel Sign Post, East, 2.54'

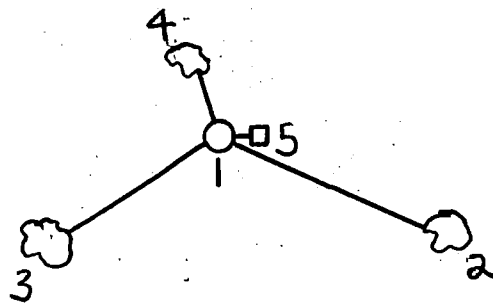

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of January... A.D., 1985 at
10:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page R-3

Paul A. Schreiber
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

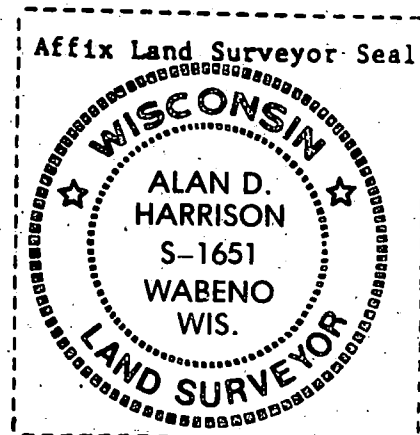


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 20, TWP. 34 N.,
 R.16 E.

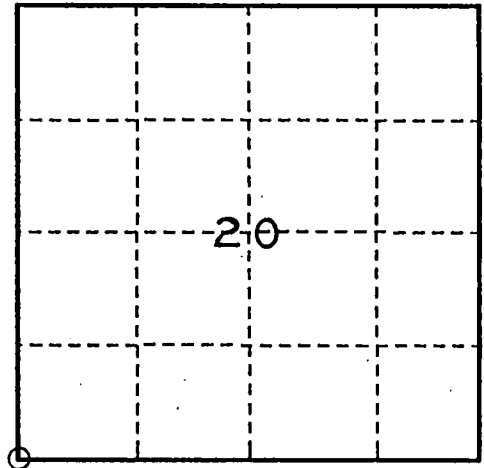

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858- ORIGINAL SURVEY BY McBRIDE, B.Ts. HEMLOCK 10" N.56°E. 48 LKS.,
 HEMLOCK 12" S.57°E. 29 LKS., BIRCH 16" S.37°W. 50 LKS., HEMLOCK 10"
 N.28°W. 38 LKS.

1984- HARRISON R.L.S. NO.S-1651, SET 2" DIA. ALUMINUM MONUMENT, B.Ts
 BLACK CHERRY 8" N.38°E. 65.22, BLACK CHERRY 4" N.81°E. 39.21FT.,
 ASPEN 7" N.24°W. 59.90FT., WITNESS -STEEL SIGN POST WEST 1.13FT.,
 REFERENCE - CENTERLINE OF FR #2349 WEST 42.90FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST,
 AND B.Ts EXCEPT B.T. BLACK CHERRY 8" N.38°E. IS DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)



- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS AND REFERENCE

1. B.T. BLACK CHERRY 4" N.81°E. 39.21FT. (EXISTING)
2. B.T. ASPEN 6" S.12°E. 86.70FT. (NEW)
3. B.T. BLACK CHERRY 6" S.84°W. 91.03FT. (NEW)
4. CENTERLINE FR # 2349 WEST 42.90FT.
5. STEEL SIGN POST WEST 1.13FT. (EXISTING)
6. B.T. ASPEN 8" N.24°W. 59.90FT. (EXISTING)
7. 2" DIA. ALUMINUM MONUMENT (EXISTING)

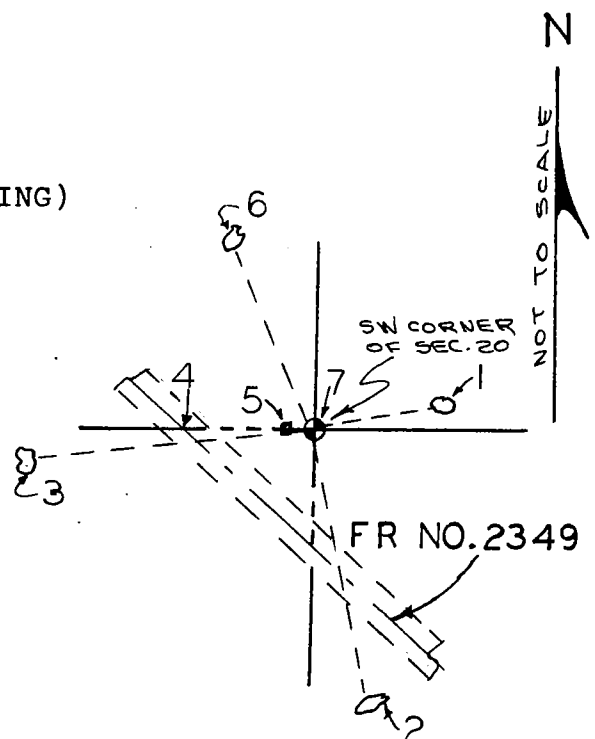

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.
- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
- (2)
- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

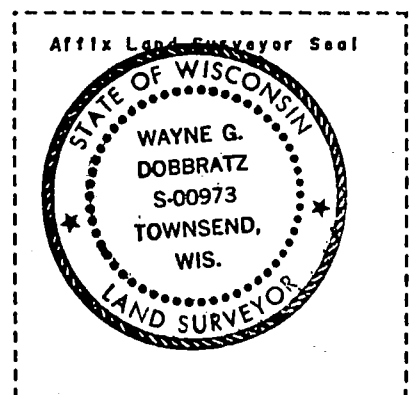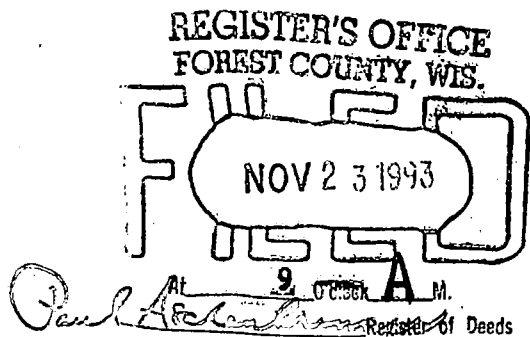

(1) I, WAYNE G. DOBBRATZ
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

7/31/93

Date

CERTIFICATE READY FOR FILING:

Ralph A. Schmitt 11-5-93
Acting District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Corner to Sections 19, 20, 29, and 30, T.34N., R.16E.

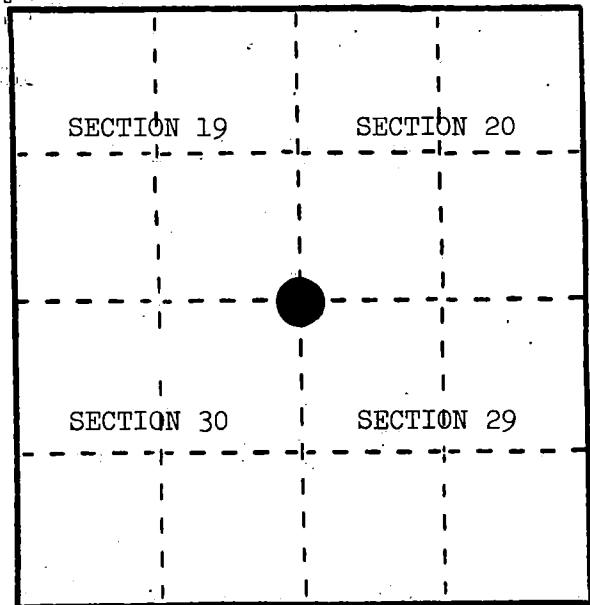


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set section post with the following BTs: Hemlock, 10", N.56°E., 48 links; Hemlock, 12", S.57°E., 29 links; Birch, 16", S.37°W., 50 links; Hemlock, 10", N.28°W., 38 links.

July 12, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner position. Proportionate position falls 40' east of center of Knowles Creek Road. Construction may have destroyed original evidence.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

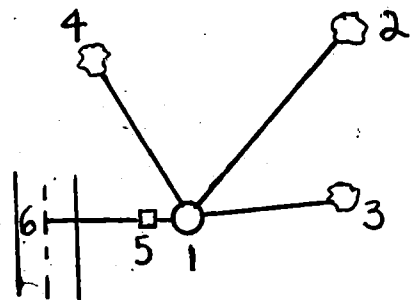

- 2" x 60" aluminum monument stamped to identify the corner.
- Black Cherry, 8", N.38°E., 65.22'
- Black Cherry, 4", N.81°E., 39.21'
- Aspen, 7", N.24°W., 59.90'
- Steel Sign Post, West, 1.13'
- Centerline of FR-2349, West, 42.90'

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 24th day
of... January... A.D., 1985 at
... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS
on page 5

Paul Archambault
REGISTER

43416190000

R-5

R
5

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

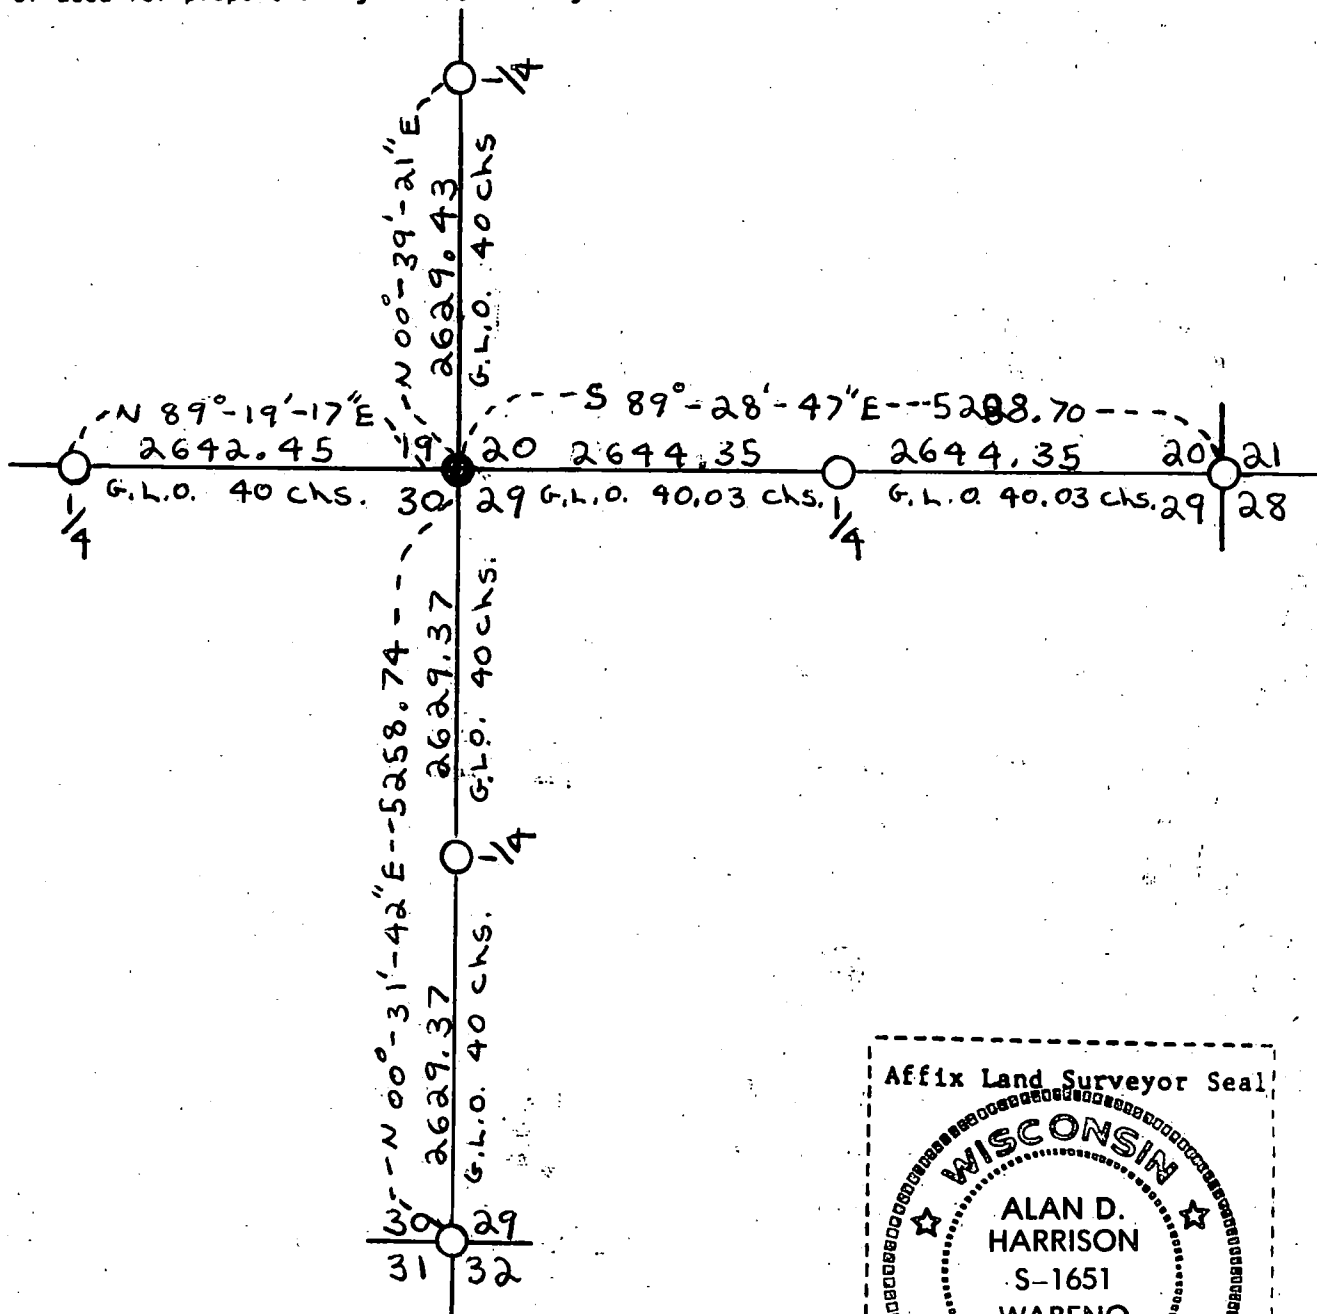

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

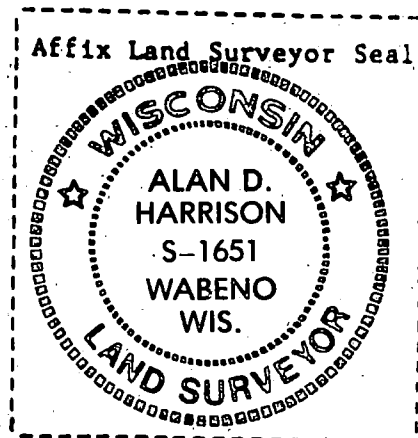

Alan D. Harrison 11/27/84
Signature Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 20 and 29, T.34N., R.16E.

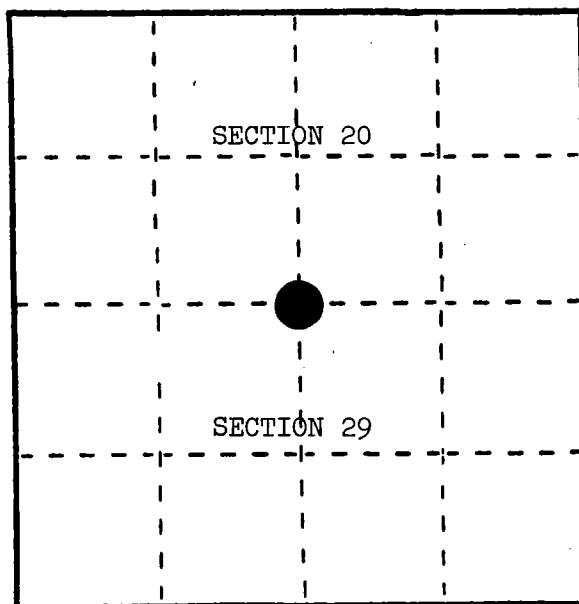

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 8", S.17°E., 9 links; Sugar, 10", N.9°W., 20 links.

July 30, 1984, Alan Harrison set proportionate position--searched area, found no evidence of the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 6", S.56°E., 28.74'
3. Sugar, 8", S.25°W., 49.14'
4. Sugar, 9", N.49°W., 13.74'
5. Steel Sign Post, East, 2.46'

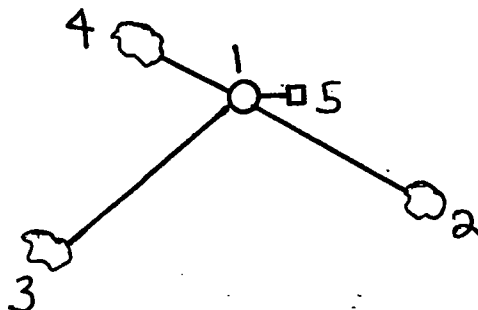

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day

of... January... A. D., 1985 at

... 10:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS

on page R-7
Paul Aschenbrenner
REGISTER

R-7

43416200020

R
7

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

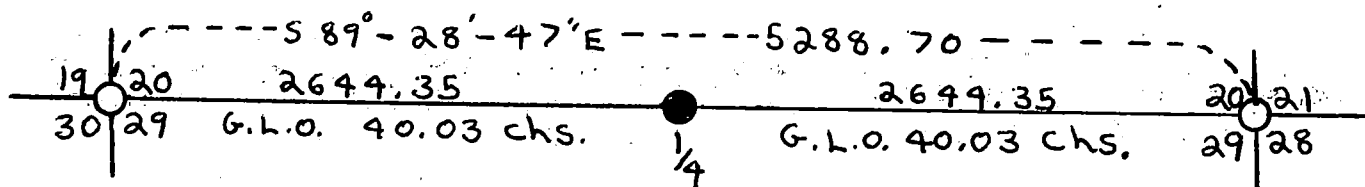

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

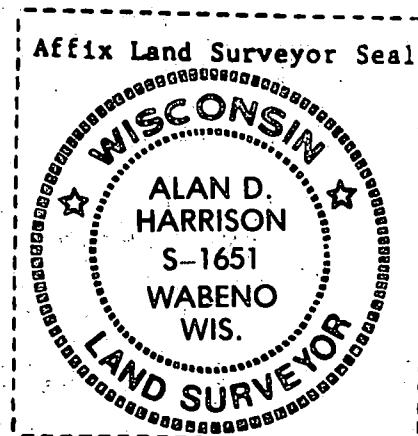

Signature

Date

11/27/84

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 20, 21, 28, and 29,
T.34N., R.16E.

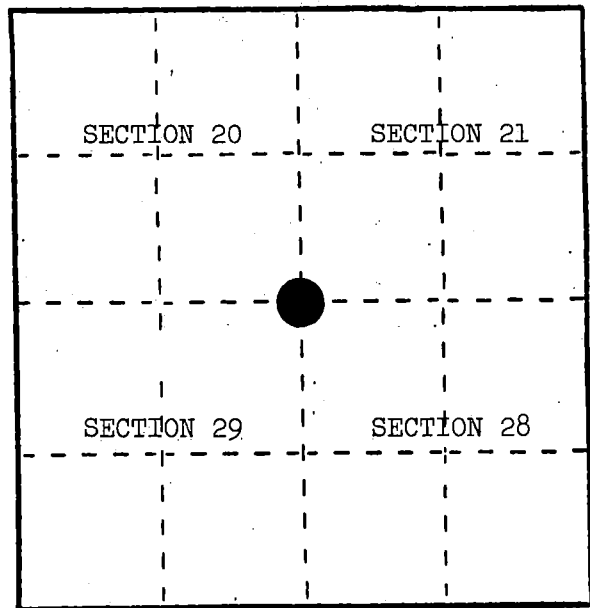

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Sugar, 12", N.23°W., 43 links; Sugar, 12", N.37°E., 36 links; Sugar, 12", S.56°E., 16 links; Sugar, 14", S.61°W., 30 links.

January 9, 1935, Dangremond found wood post in fair condition, 28" above ground. He found no original BTs.


July 30, 1959, Sandberg found a 6" x 6" Hemlock stake--no other evidence of corner. Replaced Hemlock stake with 4" x 4" x 48" Elm post.

July 19, 1984, Alan Harrison found a rock pile with old, rotted Elm post with another Hemlock post remains alongside. At N.37°E., 23.8', stump hole from tree remains. No other evidence of other BTs.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 6", N.34°E., 11.67'
3. Sugar, 6", S.57°E., 19.64'
4. Sugar, 10", S.44°W., 13.28'
5. Sugar, 6", N.49°W., 56.78'
6. Steel Sign Post, S.15°E., 14.86'

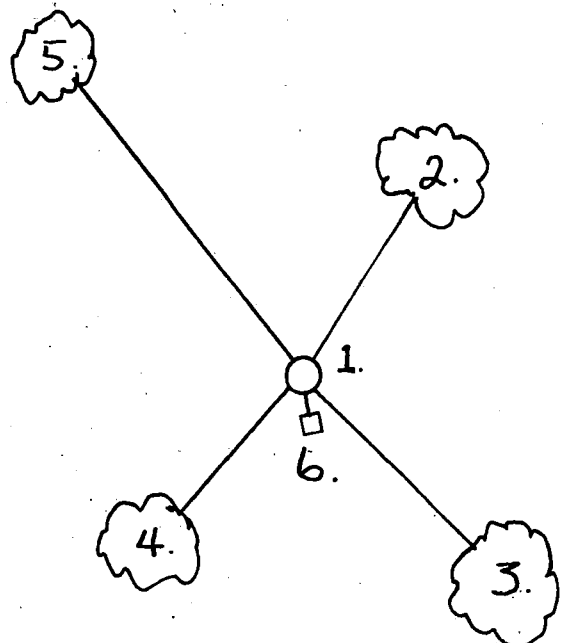

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24th day
of January A.D., 1985

at 10:30 o'clock A.M. and
recorded in Vol. 100

on page 9
Paul A. Schenck
REGISTER

4341620000

R-9

R
9

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/3/84
Date

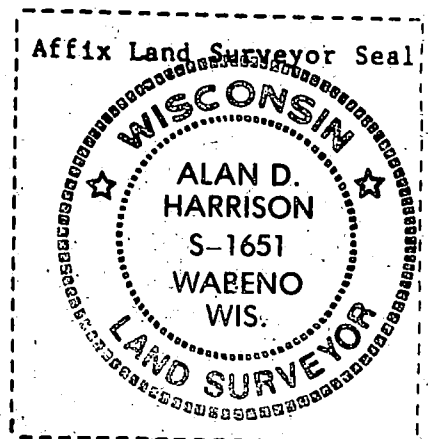


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 21 and 28, T.34N., R.16E.

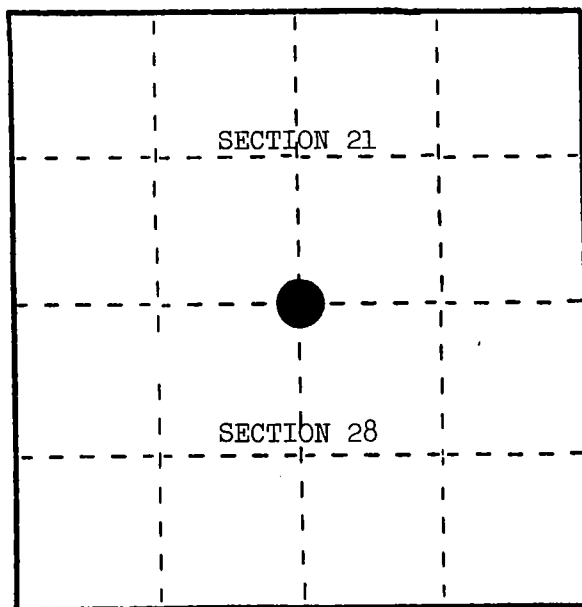

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post at 40.03 chains with the following BTs: Sugar, 12", N.48°W., 2.64'; Hemlock, 12", S.46°E., 12.54'.


In 1962, Connor Company found 5" Cedar post.

July 30, 1984, Alan Harrison searched area and found rotted wood post on the ground--two post holes at base of post. From post N.48°W., 2.64', root holes and at S.46°E., 12.54', root holes of Hemlock.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 8", S.59°E., 54.49'
3. Sugar, 5", S.44°W., 41.56'
4. Sugar, 12", N.45°W., 14.32'
5. Steel Sign Post, Northeast, 1.35'

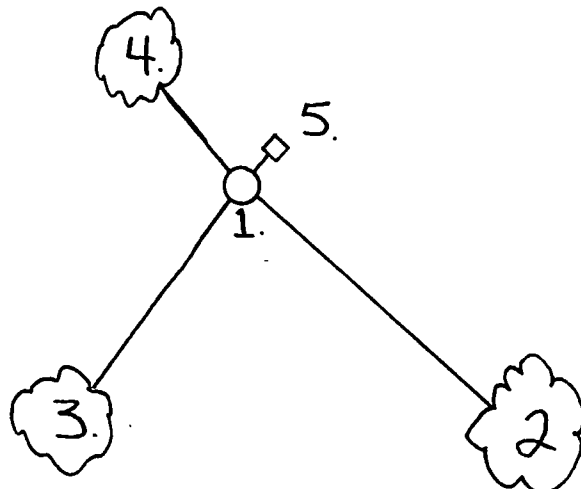

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this... day

of... January... A.D., 1985 at

... 10:30 A.M. and

recorded in Vol... CORNER RESTORATIONS

on page... R-11
... Acchard
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/3/84
Date

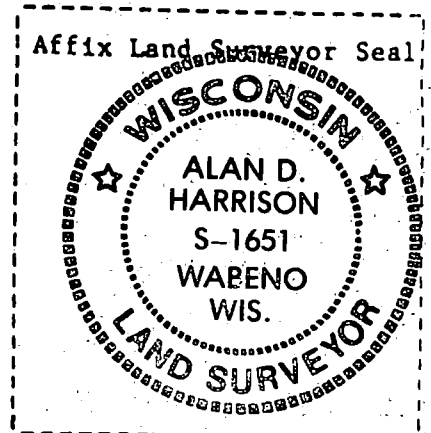


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 22, TWP. 34 N.,
 R.16 E.

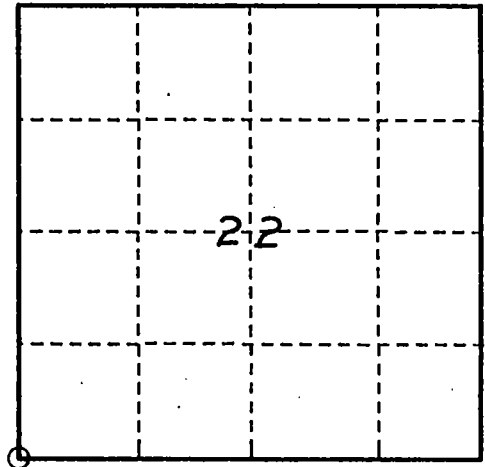

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET SECTION CORNER, B.Ts - SUGAR 8" N.53°W. 25 LKS., HEMLOCK 7" N.12°E. 47 LKS., BIRCH 24" S.53°E. 65 LKS., HEMLOCK 36" S.54°W. 53 LKS.

1984 - HARRISON R.L.S. NO. S-1651 SET 2" DIA. ALUMINUM MONUMENT AT CORNER, STEEL SIGN POST NE 1.24FT., B.Ts - YELLOW BIRCH 9" N.43°E. 13.06FT., SUGAR 9" S.48°E. 30.02FT., YELLOW BIRCH 5" S.17°W. 32.55FT., SUGAR 7" N.48°W. 12.32FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST AND B.Ts EXCEPT YELLOW BIRCH 5" S.17°W. IS DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. YELLOW BIRCH 11" N.43° E. 13.06FT. (EXISTING)
2. STEEL SIGN POST NE 1.24FT. (EXISTING)
3. B.T. SUGAR 11" S.48°E. 29.89 (EXISTING)
4. B.T. YELLOW BIRCH 11" S.4°W. 37.10FT. (NEW)
5. B.T. SUGAR 9" N.48°W. 12.32FT. (EXISTING)
6. 2" DIA. ALUMINUM MONUMENT AT CORNER (EXISTING)

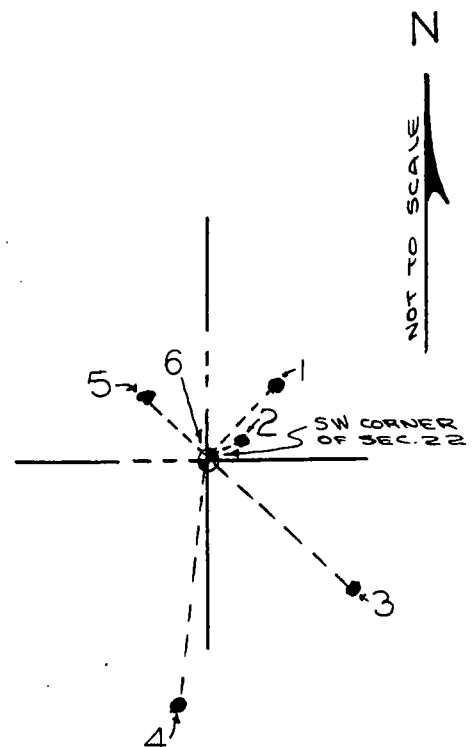


(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

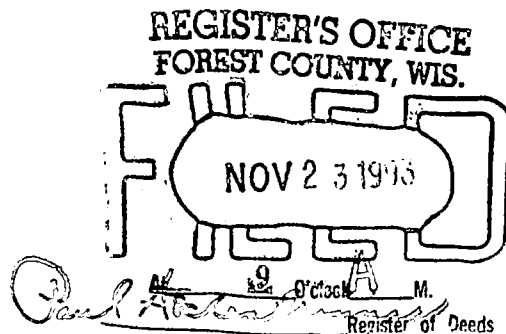

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

8/8/93

Date

CERTIFICATE READY FOR FILING:

Ralph C. Bell 11-5-93
Acting District Ranger

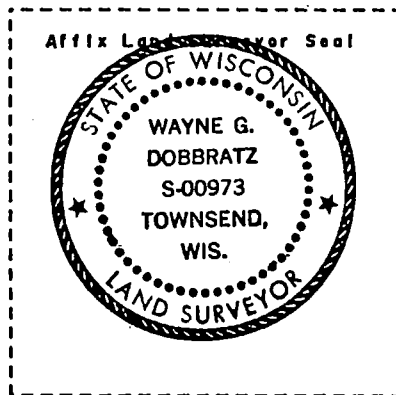

Document Number

189326

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page R-13
Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 8" N53°W 25 LINKS
HEMLOCK 7" N12°E 47 LINKS
BIRCH 24" S53°E 65 LINKS
HEMLOCK 36" S54°W 53 LINKS

1984 - ALAN HARRISON, SURVEYOR, S-1651, SEARCHED AREA AND FOUND NO EVIDENCE OF CORNER POSITION. SET A 2" X 30" ALUMINUM MONUMENT w/STAMPED CAP AT THE PROPORTIONATE POSITION.

SET THE FOLLOWING WITNESSES:
YELLOW BIRCH 9" N43°E 13.06 FEET
SUGAR MAPLE 9" S48°E 30.02 FEET
YELLOW BIRCH 5" S17°W 32.55 FEET
SUGAR MAPLE 7" N48°W 12.32 FEET
STEEL SIGN POST NE 1.24 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND A 2.5" STAMPED ALUMINUM MONUMENT.

FOUND THE FOLLOWING WITNESSES:


YELLOW BIRCH 12" N40°E 13.11 FEET - FOUND NAIL IN WEST FACE OF TREE.
MAPLE 14" S49°E 29.95 FEET - FOUND NAIL IN NORTH FACE OF TREE.
MAPLE 12" N47°W 12.40 FEET - SET D.H. NAIL IN SOUTH FACE OF TREE.

SET THE FOLLOWING WITNESSES:


WHITE BIRCH 12" S03°W 37.24 FEET - SET D.H. NAIL IN WEST FACE OF TREE.

ALL TREES HAVE CHEST & STUMP BLAZES AND TAGS.
STEEL SIGN NORTH.

THE SOUTHWEST
CORNER OF SECTION 22,
T. 34 N., R. 16 E.,
FOREST COUNTY, WISCONSIN

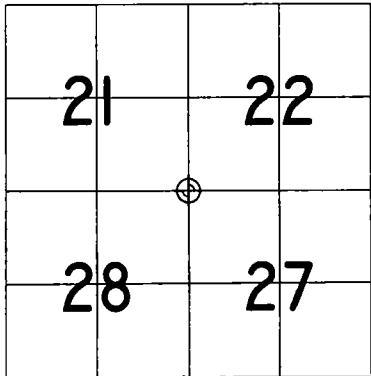

⊕ = LOCATION OF CORNER

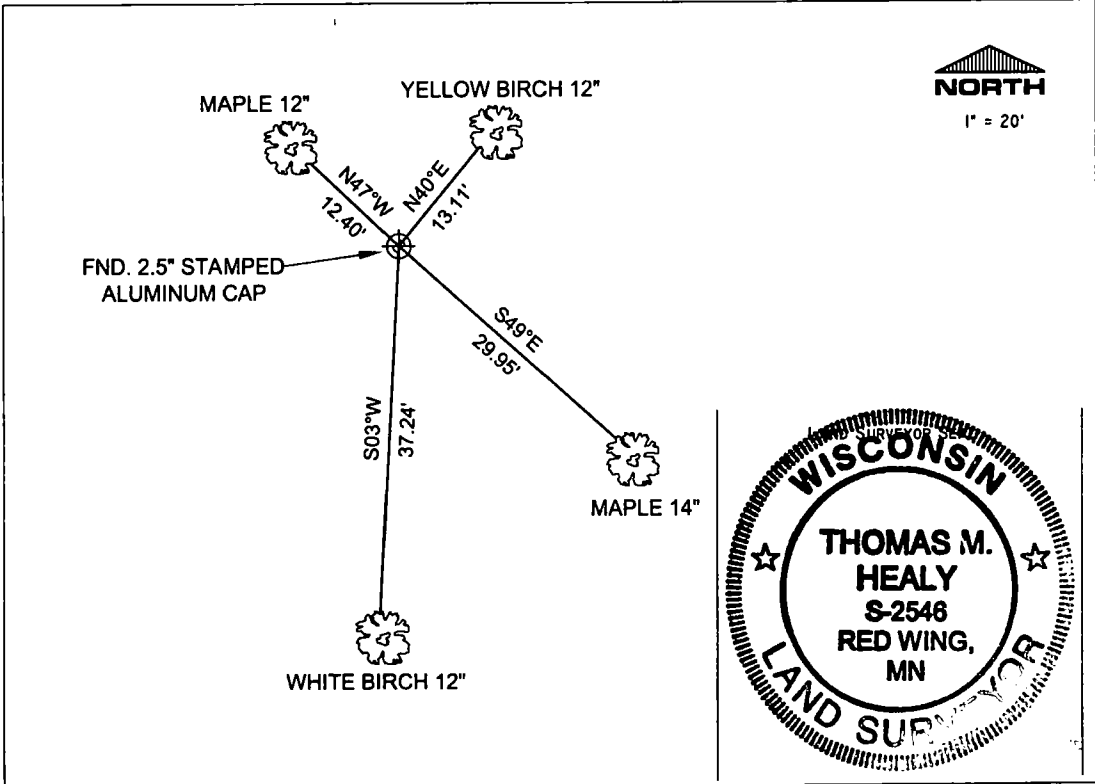

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

THM. Healy 11-8-05
SIGNATURE DATE

INDEX No. R-13

43416210000

R-13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 21, 22, 27, and 28, T.34N., R.16E.

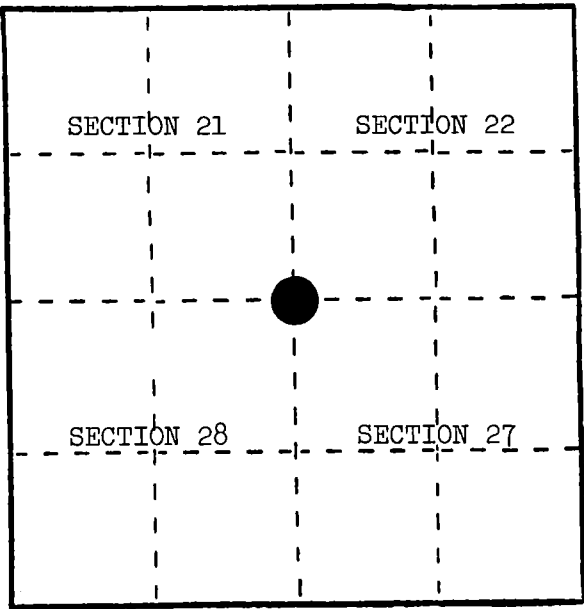

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 8", N.53°W., 25 links; Hemlock, 7", N.12°E., 47 links; Birch, 24", S.53°E., 65 links; Hemlock, 36", S.54°W., 53 links.

August 13, 1984, Alan Harrison set proportionate position and searched area. Found no evidence of corner location.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1. 2" x 30" aluminum monument stamped to identify the corner.
- 2. Yellow Birch, 9", N.43°E., 13.06'
- 3. Sugar, 9", S.48°E., 30.02'
- 4. Yellow Birch, 5", S.17°W., 32.55'
- 5. Sugar, 7", N.48°W., 12.32'
- 6. Steel Sign Post, Northeast, 1.24'

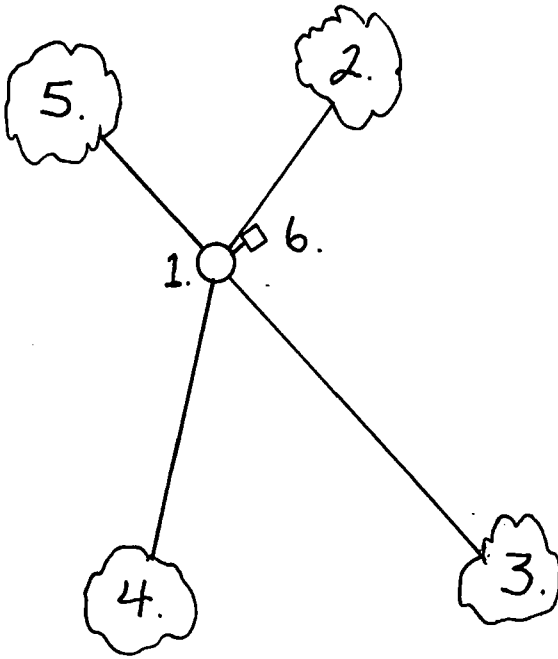

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 24th day
of January, 1985 at
.....A. D., 1985 at
.....10:30 o'clock.....A.....M. and
recorded in Vol. CORNER RESTORATIONS
on page R-13
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

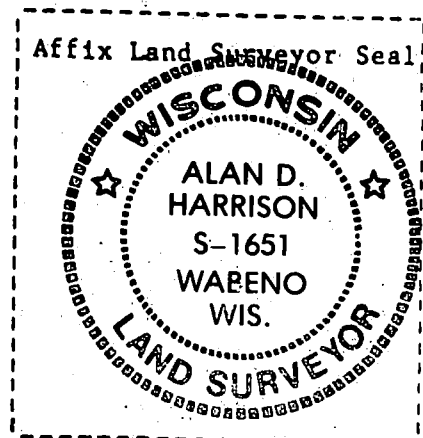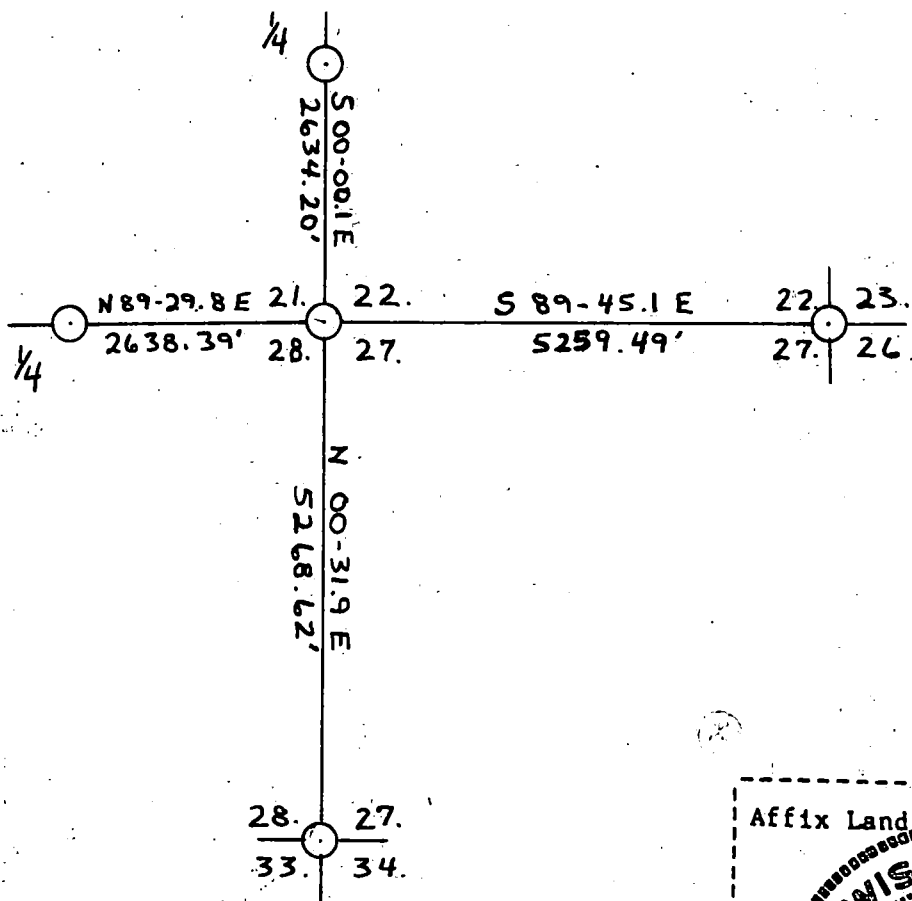

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/3/84
Signature Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 22 and 27, T.34N., R.16E.

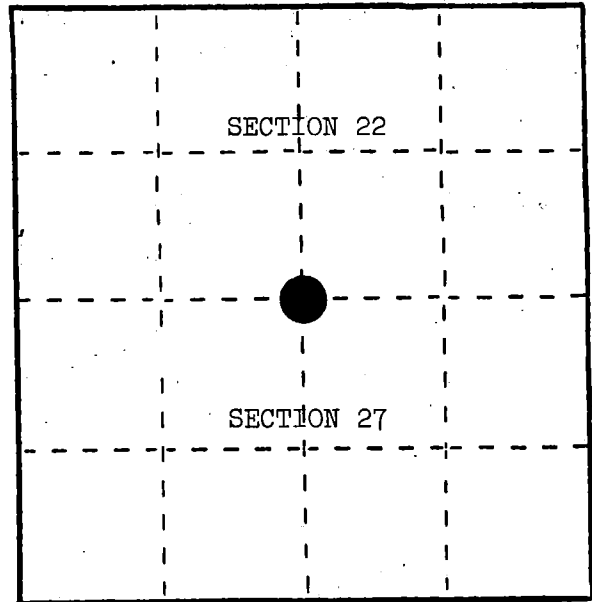

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post 39.90 chains with the following BTs: Hemlock, 14", N.20°W., 31 links; Sugar, 30", S.28°E., 12 links.

August 13, 1984, Alan Harrison set proportionate position. Found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" aluminum monument stamped to identify the corner.
- Sugar, 7", N.36°E., 41.29'
- Sugar, 6", S.20°E., 28.87'
- Basswood, 8", N.75°W., 25.92'
- Steel Sign Post, Northwest, 2.14'

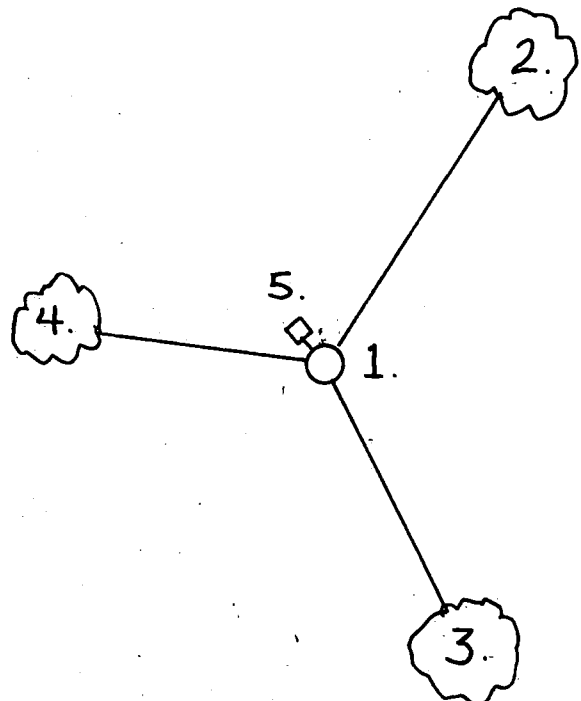

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 24th day
of January, A.D., 1985 at
... 8:30 o'clock... A.... M. and

recorded in Vol. CORNER RESTORATIONS
on page R-15

Paul A. Schumacher
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

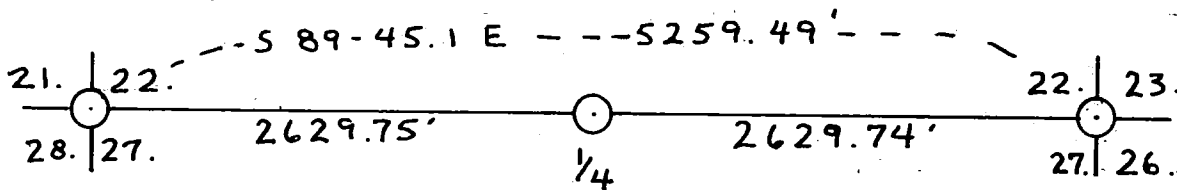

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

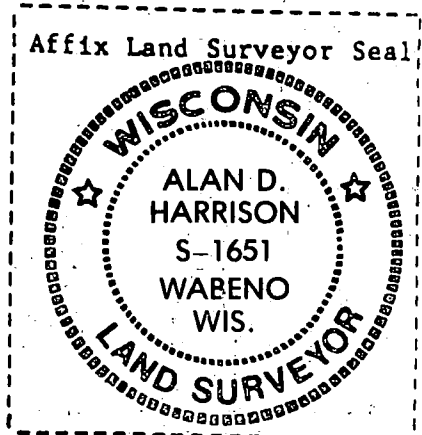

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 22, 23, 26, and 27, T.34N., R.16E.

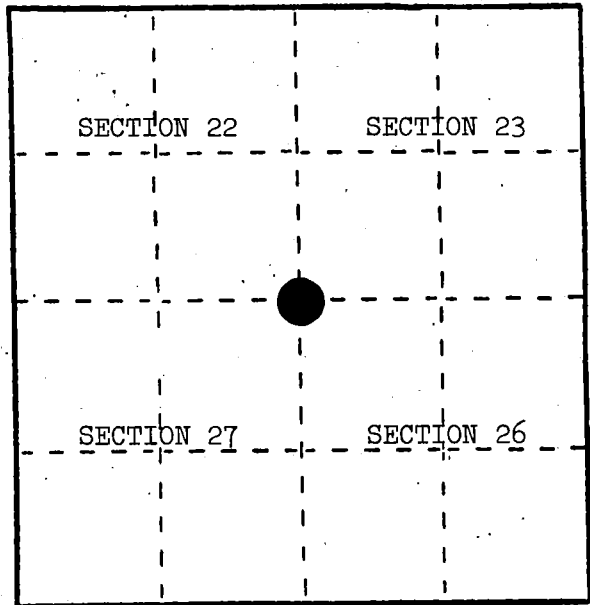

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Hemlock, 8", N.63°W., 33 links; Lind, 10", N.35°E., 61 links; Lind, 12", S.8°E., 50 links; Sugar, 8", S.74°W., 15 links; 7.00 chains north enter Cedar swamp.

November 15, 1983, Alan Harrison set proportionate position--searched and found plantation post. Found Hemlock stump remains and pulled from same S.63°E., 21.78'. No post or point, falls in skid road. At N.35°E., 40.3', shallow stump hole; S.8°E., 33.0', west edge of shallow stump hole; S.74°W., 9.90', falls in old skid road. Swamp edge north pulled 455', hit Cedar swamp edge.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 4", N.23°E., 50.12'
3. Sugar, 5", S.45°E., 23.11'
4. Sugar, 7", S.29°W., 68.76'
5. Sugar, 8", N.69°W., 32.42'
6. Steel Sign Post, Southwest, 1.6'

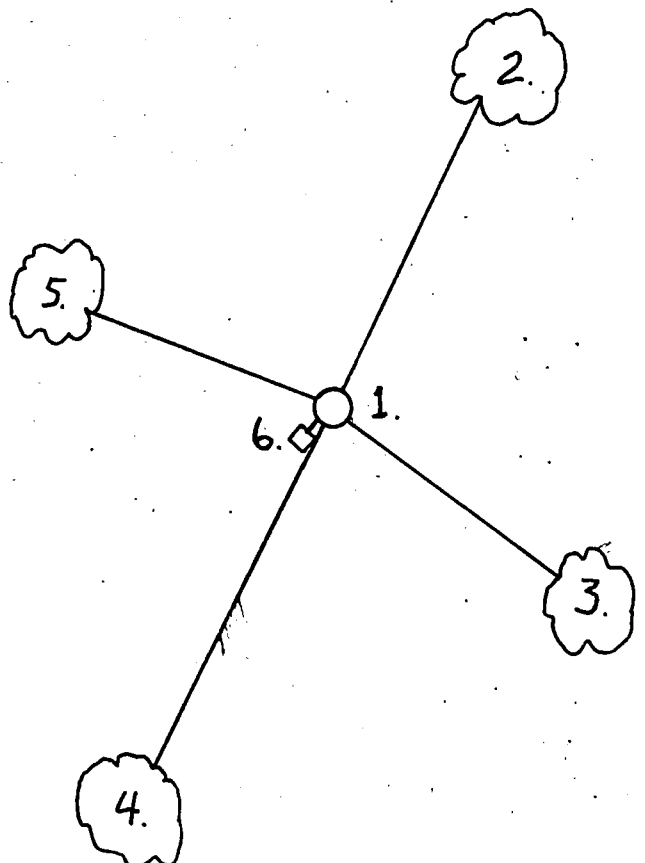

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of... January... A.D., 1985 at
... 8:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS
on page R-17

Paul Hochstetler
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

12/4/84

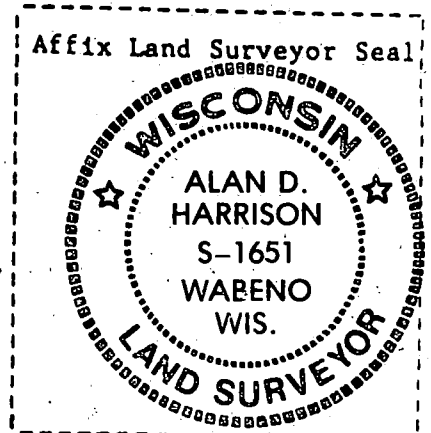


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 23 and 26, T.34N., R.16E.

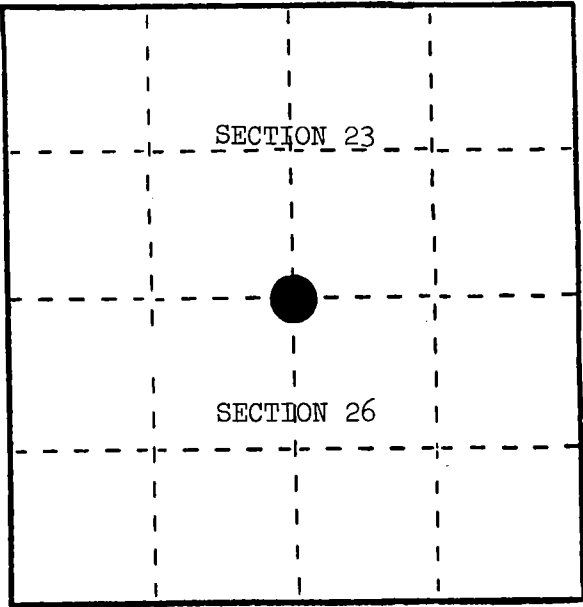

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 12", N.58°E., 5 links; Sugar, 24", S.24°W., 30 links.

August 29, 1984, Alan Harrison set proportionate position. Searched area and found a 14" Sugar with blaze on north side. No evidence of corner position.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 5", N.47°E., 24.47'
3. Sugar, 10", S.30°E., 26.08'
4. Sugar, 6", S.41°W., 21.90'
5. Steel Sign Post, Northwest, 1.76'

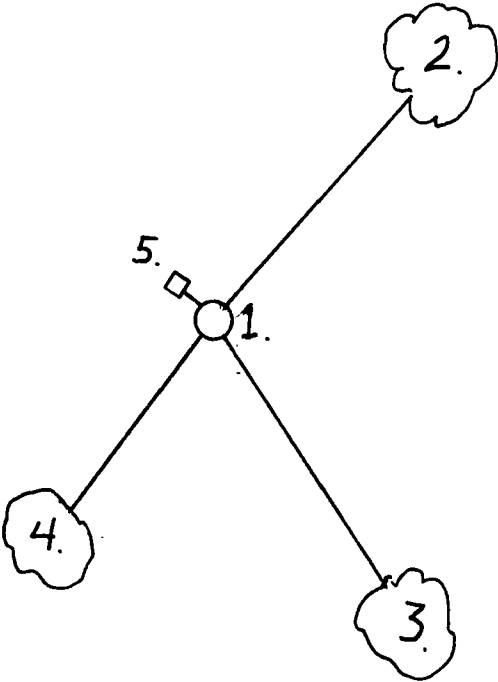

REGISTER'S OFFICE)
Forest County, Wis.)
Received for record this 25th day
of January, 1985, at
8:30 o'clock, A.M. and
recorded in Vol. 19, R-19, REGISTER
Paul Aschbacher
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

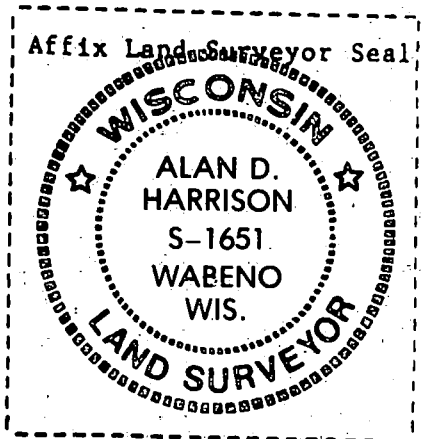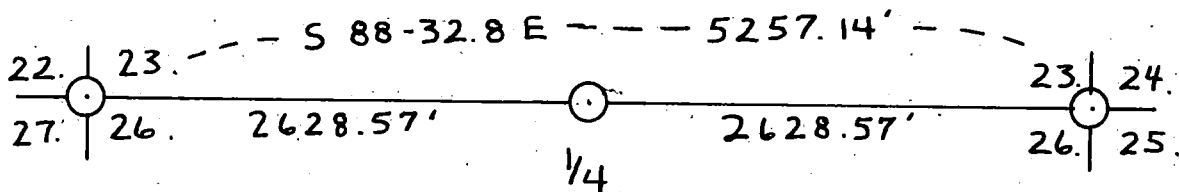

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 23, 24, 25, and 26, T.34N., R.16E.

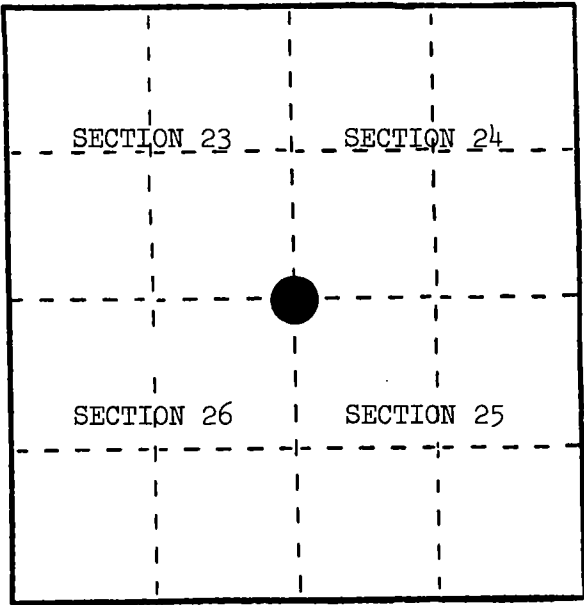

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 12", S.42°E., 14 links; Sugar, 8", S.12°W., 11 links; Sugar, 12", N.15°W., 37 links; Sugar, 12", N.23°W., 23 links.

July 25, 1984, Alan Harrison set proportionate position--found no evidence of corner. Area is on top of north slope with pole timber on site.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 6", N.48°E., 38.69'
3. Sugar, 8", S.83°E., 27.23'
4. Sugar, 7", S.12°W., 47.66'
5. Sugar, 6", N.17°W., 20.01'
6. Steel Sign Post, Southwest, 4.08'

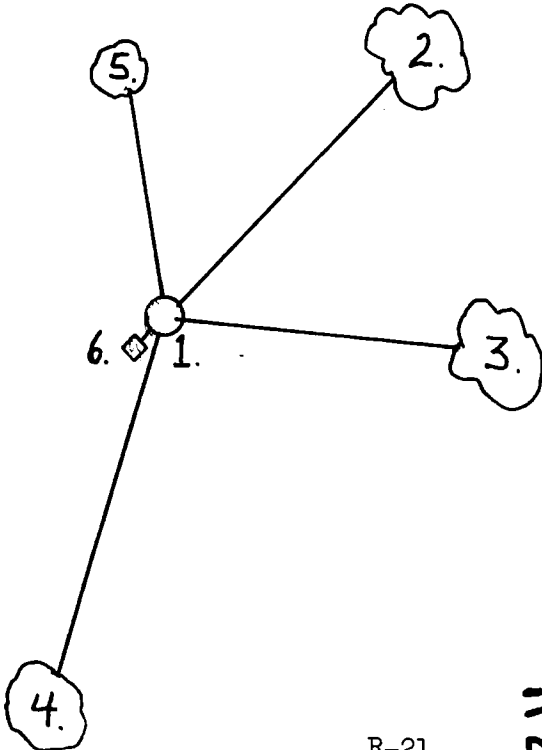

REGISTER'S OFFICE)
Forest County, Wis.)
Received for record this 25th day
of January A.D., 1985 at
8:30 o'clock A.M. and
recorded in Vol. CORNER RESTORATIONS
on page 24
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

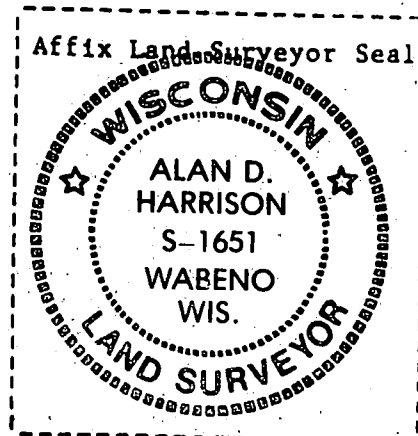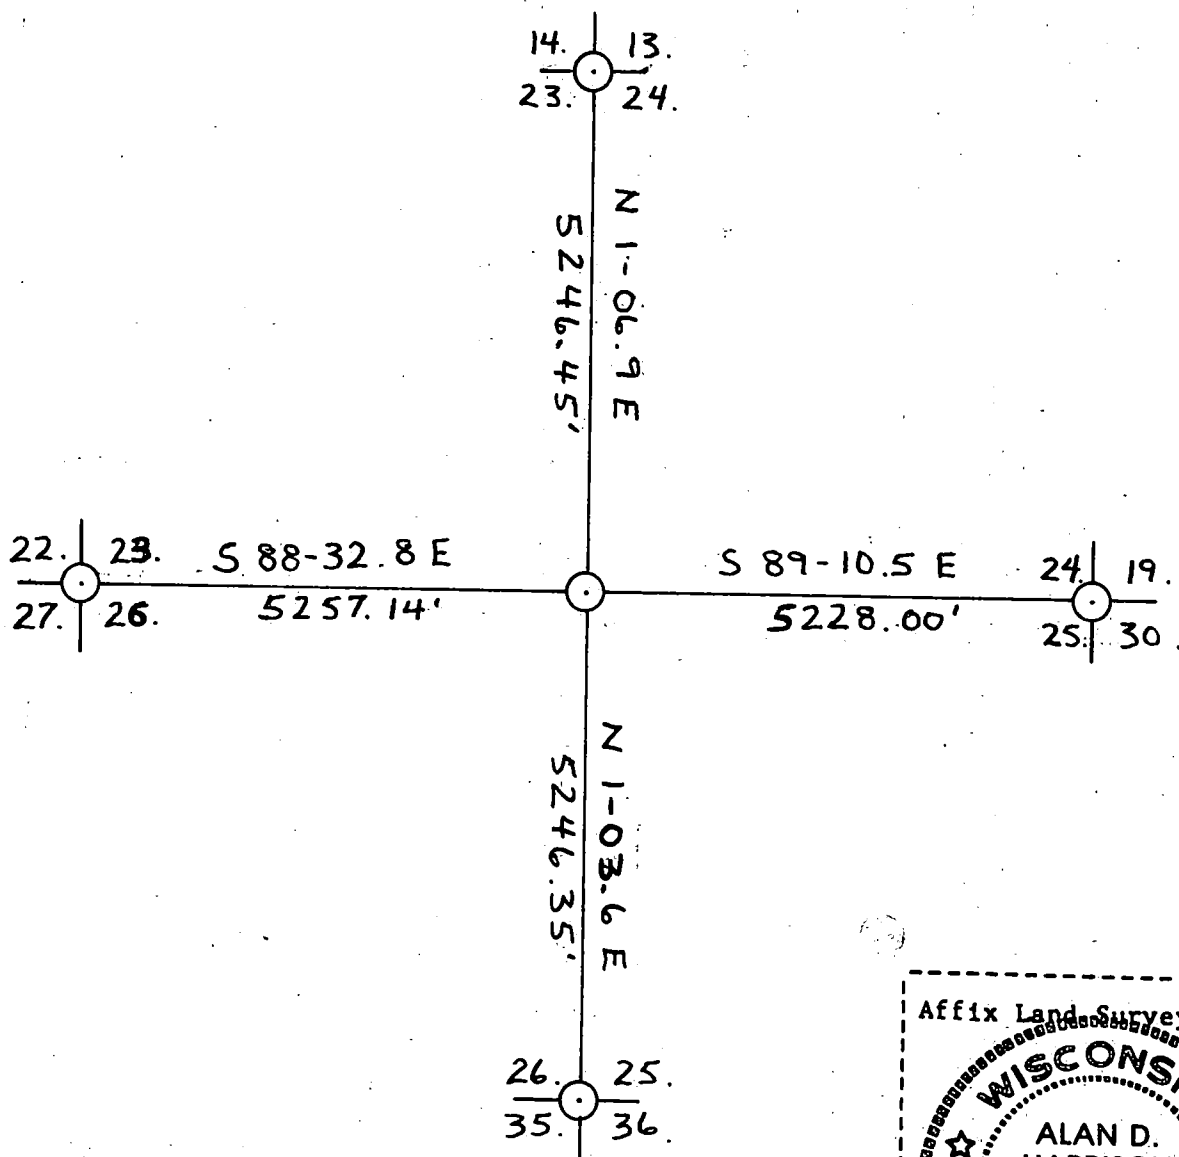

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/4/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 24 and 25, T.34N., R.16E.

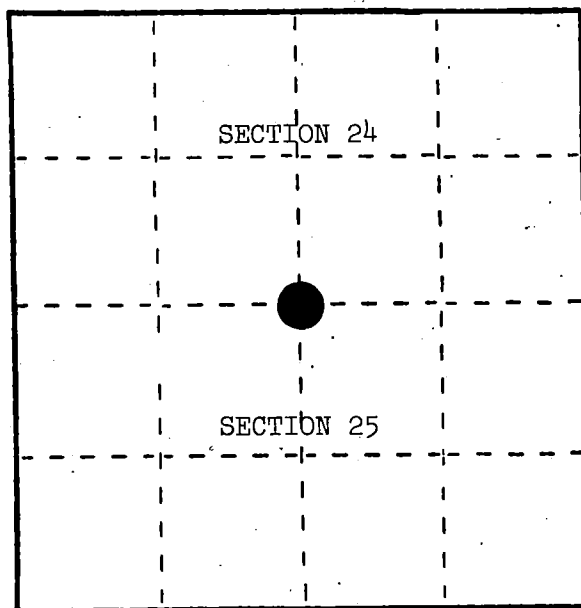

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 16", S.74°E., 15 links; Beech, 10", N.32°E., 12 links.

October 15, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Corner position marked by "X" on a flat rock 4" above ground 3' x 2' x 12" below ground.
2. Witnessed by a 2" x 30" aluminum monument stamped to identify the corner, S.89°E., 12.33'
3. Sugar, 8", N.09°E., 23.88'
4. Red Oak, 12", S.47°E., 58.82'
5. Sugar, 6", S.85°W., 48.27'
6. Steel Sign Post, East, 13.97'

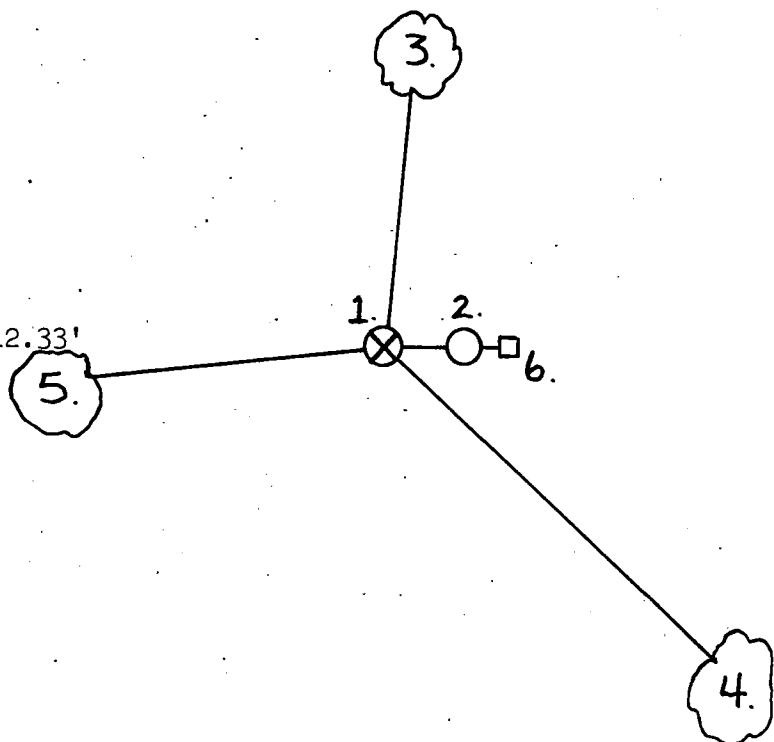

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this.....day
of January.....A.D., 1985
at 8:30 o'clock.....A.....M. and

recorded in Vol. CORNER RESTORATIONS
on page 23.

Paul Aschmune
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

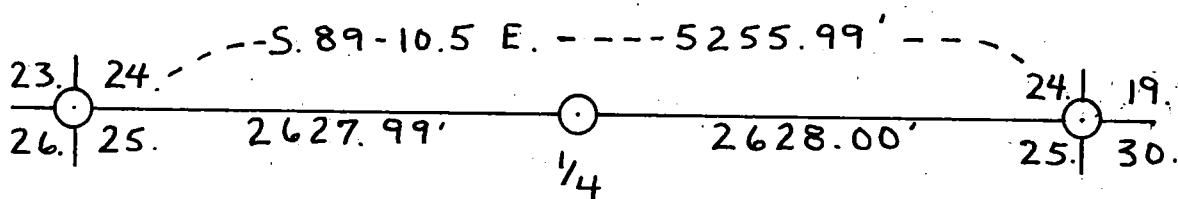

Affix Land Surveyor Seal

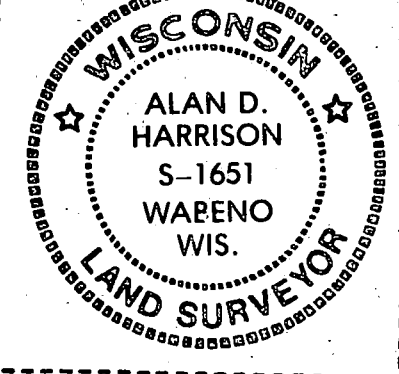

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 19, 24, 25, and 30, T.34N., R.16-17E.

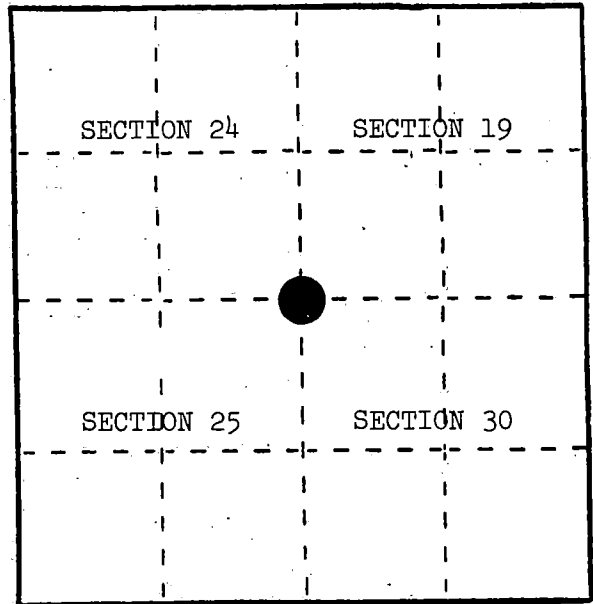

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1839, Tom Sprague set post with the following BTs: Beech, 12", S.58°W., 31 links; Beech, 12", N.24°W., 38 links.

June 27, 1984, Alan Harrison set proportionate position--search found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 6", N.31°E., 63.62'
3. Sugar, 5", S.31°E., 43.09'
4. Sugar, 11", S.33°W., 31.76'
5. Sugar, 8", N.61°W., 12.92'
6. Steel Sign Post, South, 1.80'

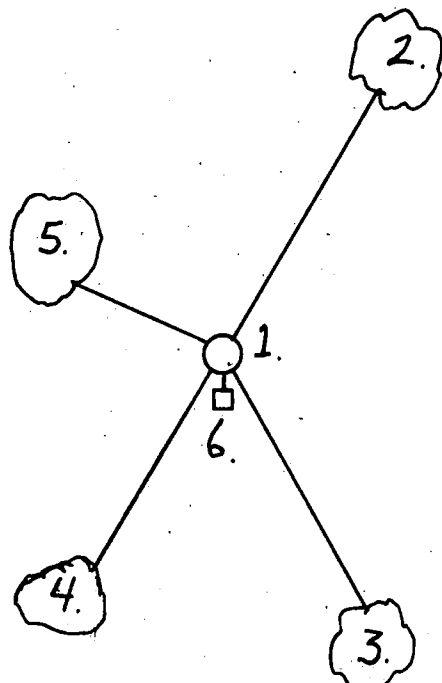

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 25th day
of January, 1985 A.D., at
.....8:30 o'clock.....A.....M. and

recorded in Vol. CORNER RESTORATIONS
on page R-25

Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

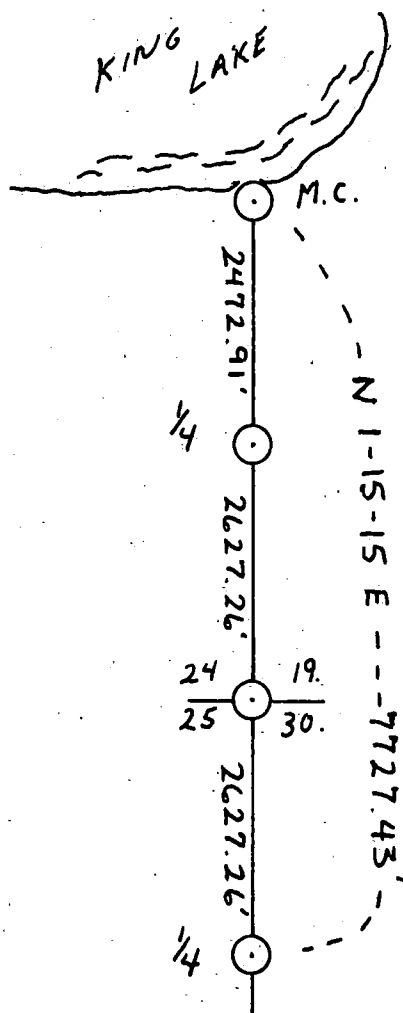

Affix Land Surveyor Seal

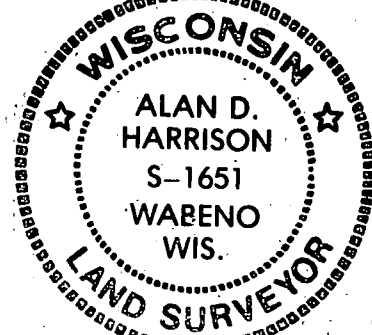

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

WEST $\frac{1}{4}$ CORNER OF SECTION 30, TWP.34 N.,
 R.16 E.

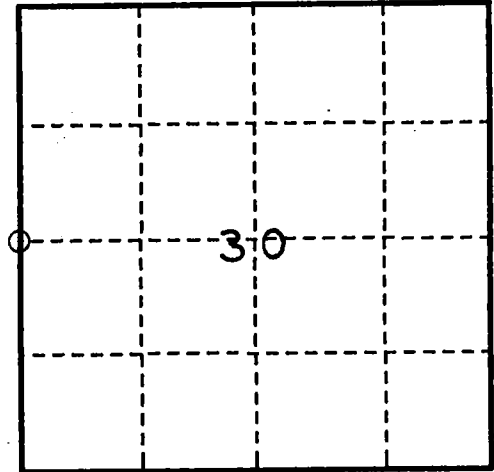

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - ORIGINAL SURVEY BY CURTIS, B.Ts - YELLOW BIRCH 18" N.64° W. 61 LKS.
 SUGAR 12" N.47° E. 27 LKS.

1984 - HARRISON R.L.S. NO. S-1651 SET 2" DIA. ALUMINUM MONUMENT, B.Ts
 BASSWOOD 12" N.11° E. 23.01FT., SUGAR 8" S.12° W. 16.29FT., YELLOW BIRCH
 10" N.61° W. 35.29FT., WITNESS - STEEL SIGN POST EAST 1.45FT.


1993 - DOBBRATZ, R.L.S. NO. S-973 FOUND MONUMENT, STEEL SIGN POST
 AND B.Ts DISTANCE TO B.T. YELLOW BIRCH IS INCORRECT.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. BASSWOOD 15" N.11° E. 23.10FT. (EXISTING)
2. STEEL SIGN POST EAST 1.40FT. (EXISTING)
3. B.T. SUGAR 12" S.12° W. 16.33FT. (EXISTING)
4. YELLOW BIRCH 14" N.61° W. 39.38FT. (EXISTING)
5. 2" DIA. ALUMINUM MONUMENT (EXISTING)

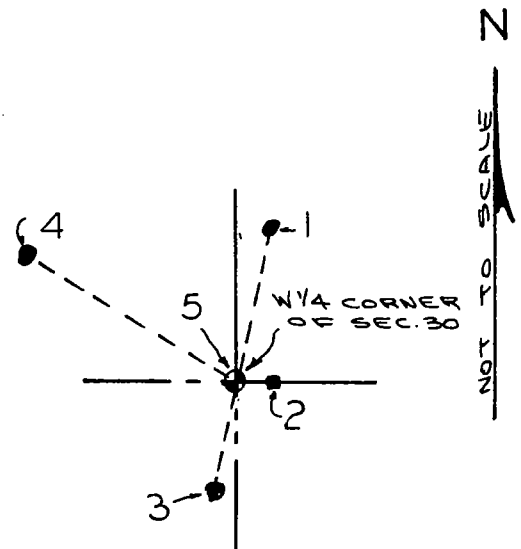


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

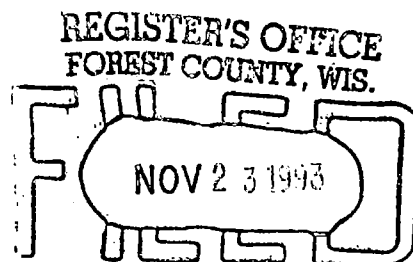

At 2 o'clock A. M.
Paul A. [unclear] Register of Deeds

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

8/5/93


Date

CERTIFICATE READY FOR FILING:

Ralph [unclear]
Acting

District Ranger

Affix Land Surveyor Seal

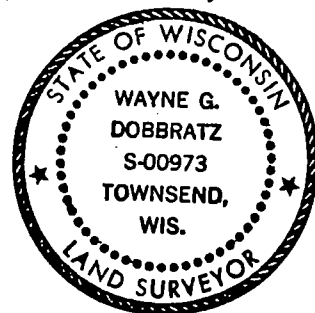


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Quarter corner to Sections 25 and 30, T.34N., R.15-16E.

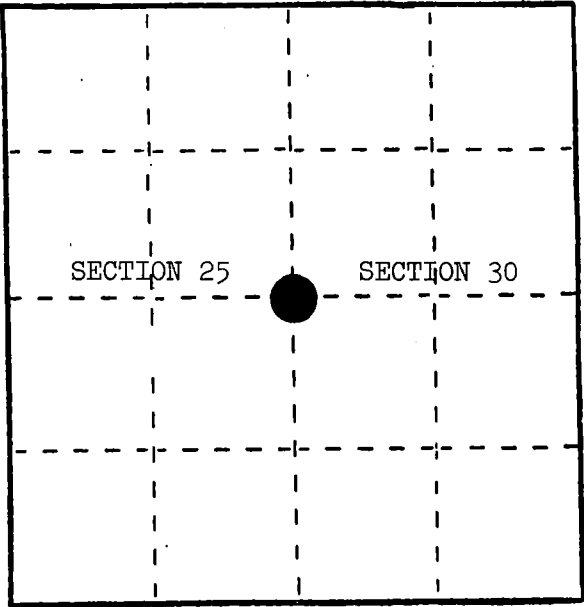

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Yellow Birch, 18", N.64°W., 61 links; Sugar, 12", N.47°E., 27 links.

June 6, 1984, Alan Harrison set proportionate position--found no evidence of this corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Basswood, 12", N.11°E., 23.01'
3. Sugar, 8", S.12°W., 16.29'
4. Yellow Birch, 10", N.61°W., 35.29'
5. Steel Sign Post, East, 1.45'

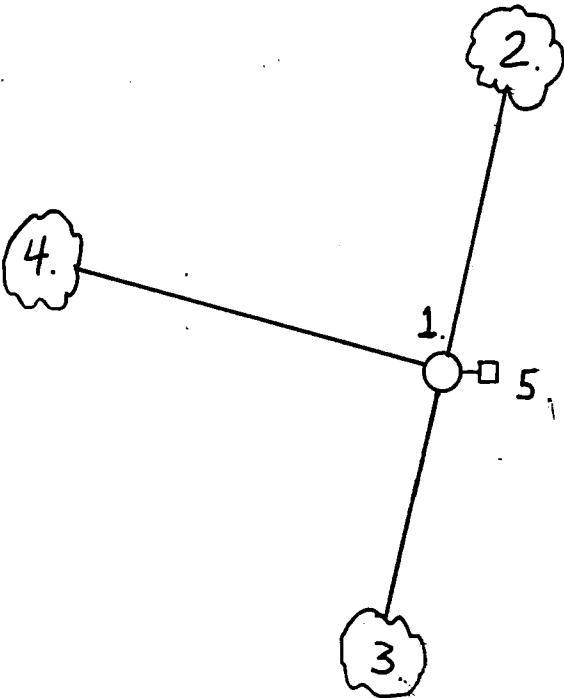

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this...25th...day
of...January...A. D., 1985...at
...8:30...o'clock...A.....M. and
recorded in Vol. CORNER RESTORATIONS
on page...
Paul A. Schindler
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

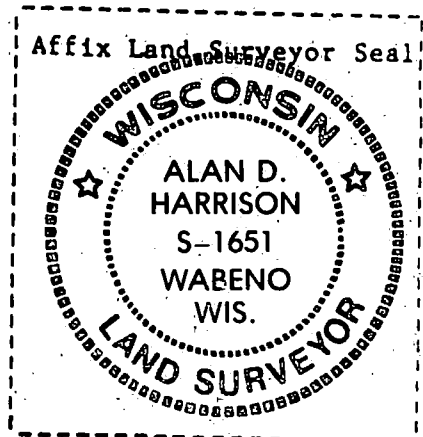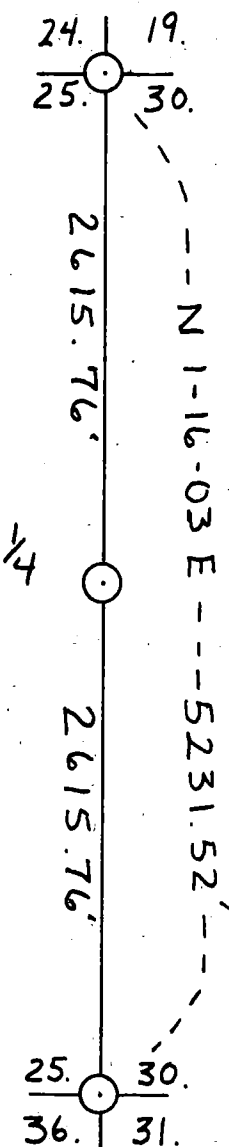

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

I N S T R U C T I O N S : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 29 and 30, T.34N., R.16E.

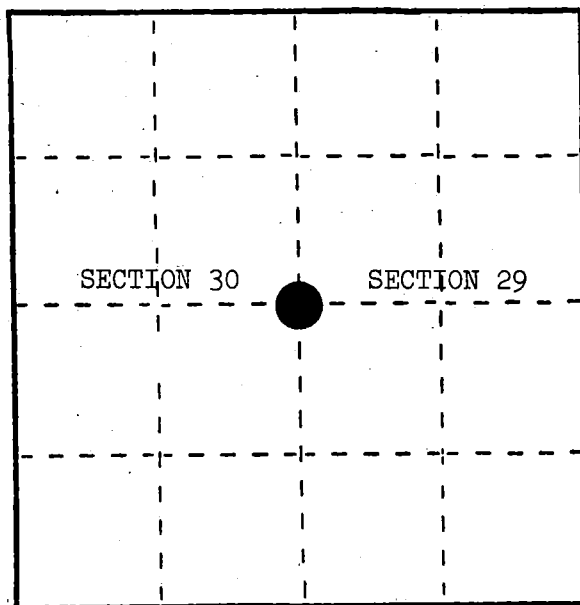

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 7", N.15°W., 40' links; Sugar, 7", S.29°E., 24' links.

July 12, 1984, Alan Harrison set proportionate position. This position falls in center of 2 year old wildlife opening. No evidence of corner found.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Red Pine, 5", N.4°E., 35.99'
3. Aspen, 6", S.28°E., 59.48'
4. Black Cherry, 7", S.17°W., 85.32'
5. Steel Sign Post, West, 1.67'

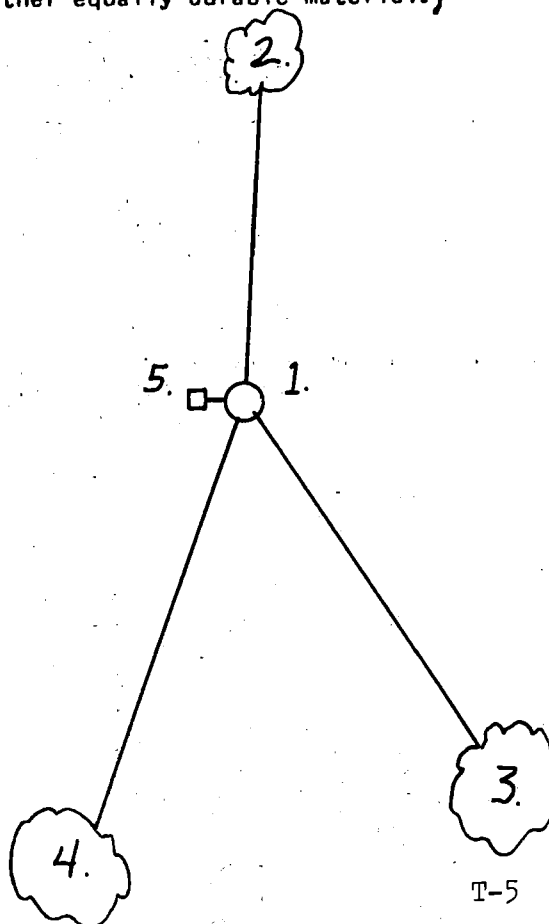

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 25th day
of January A. D., 1985 at
8:30 o'clock A. M. and
recorded in Vol. CORNER RESTORATIONS
on page T-5
Paul A. Schenck
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

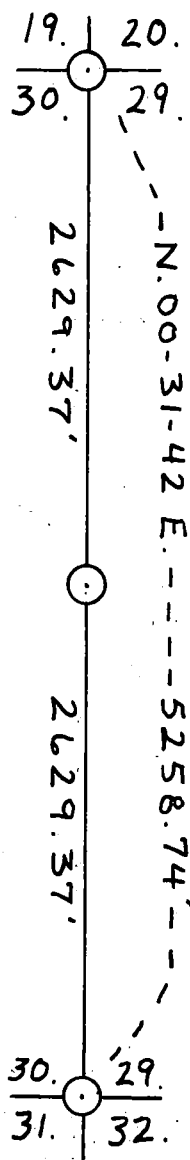

(1) Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Alan D. Harrison

Signature

12/4/84

Date

Affix Land Surveyor Seal

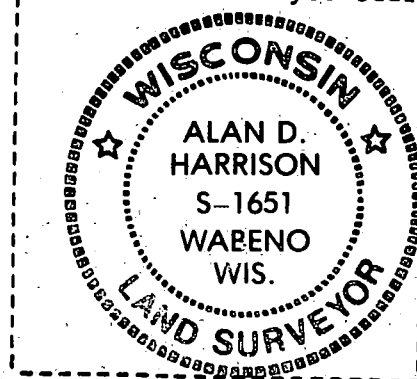


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 28 and 29, T.34N., R.16E.

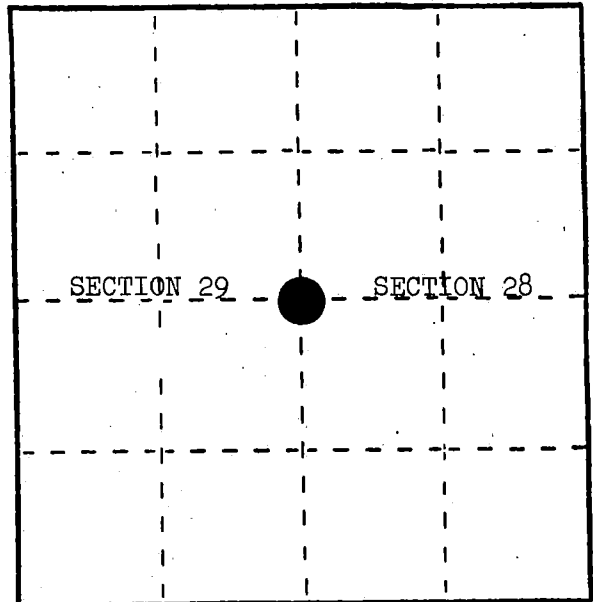

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 10", S.32°W., 14 links; Birch, 20", S.23°E., 13 links.

July 23, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Basswood, 10", N.35°E., 14.05'
3. Sugar, 6", S.55°E., 46.45'
4. Hemlock, 14", N.26°W., 41.08'
5. Steel Sign Post, Southwest, 1.41'

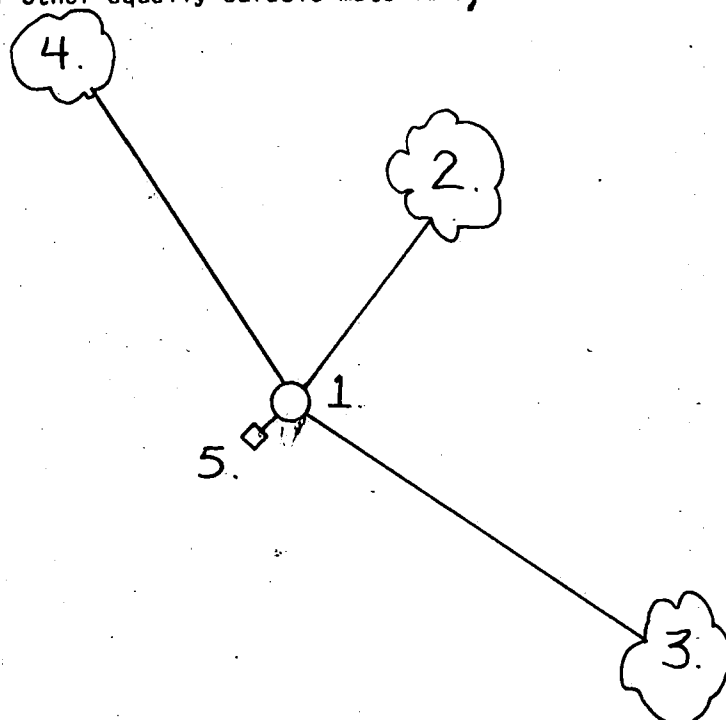

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of January A.D., 1985 at
..... 3:30 o'clock.... A..... M. and

recorded in Vol. CORNER RESTORATIONS
on page T-9

Paul H. Schenck
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

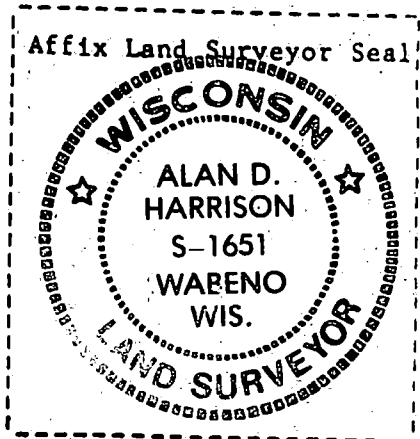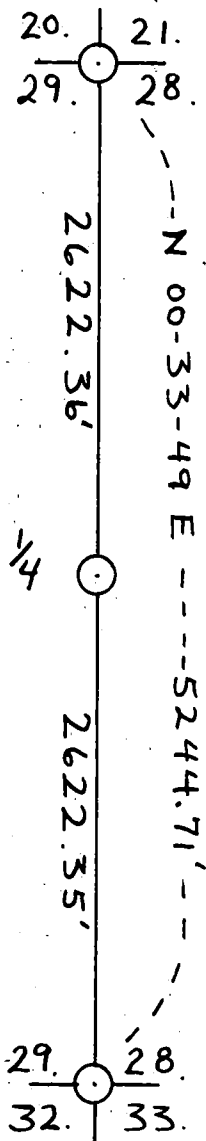

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Alan D. Harrison 12/4/04
Signature Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Quarter corner to Sections 27 and 28, T.34N., R.16E.

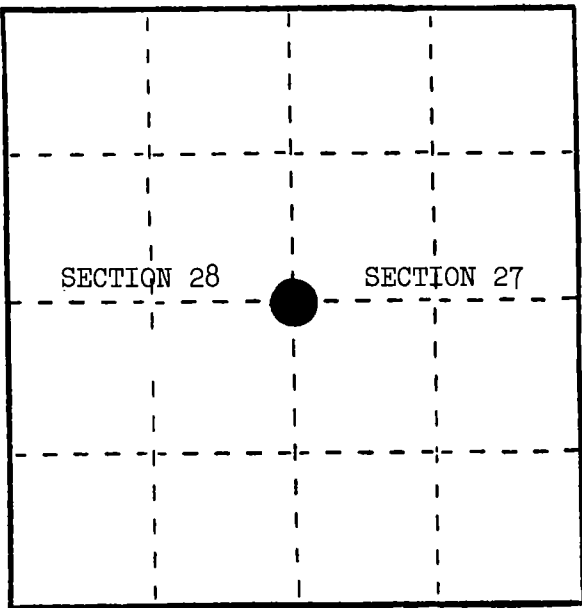


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Birch, 24", S.47°W., 13 links; Birch, 20", S.28°E., 8 links.

August 13, 1984, Alan Harrison set proportionate position. Searched area, found many large Birch, Sugar, and Hemlock stumps in area, but no Birch combination that fits.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 2" x 30" aluminum monument stamped to identify the corner.
 - Sugar, 10", S.79°E., 27.47'
 - Hemlock, 14", S.15°W., 38.41'
 - Hemlock, 20", N.32°W., 34.69'
 - Steel Sign Post, Southeast, 2.23'

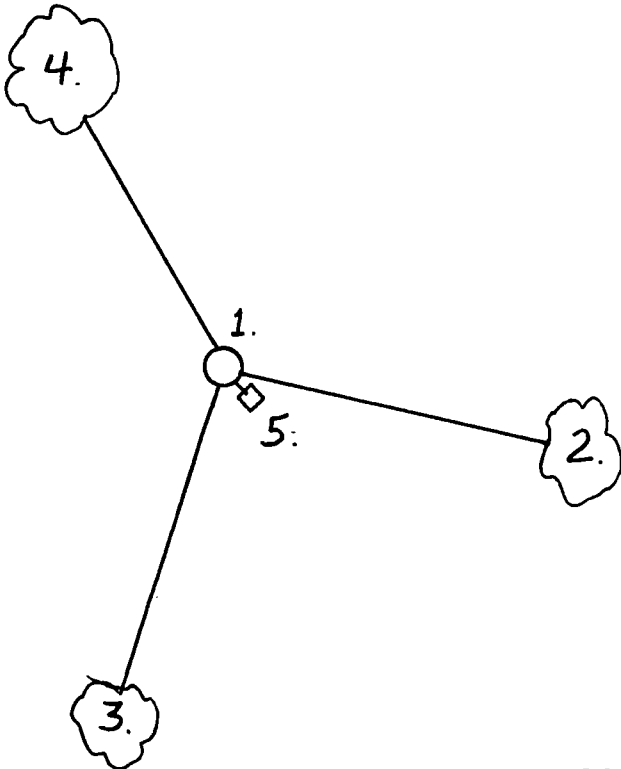

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this... 25th day
of... January... A.D., 1985 at
... 8:30 o'clock... A... M. and
recorded in Vol. CORNER RESTORATIONS
on page... 13
Paul A. Schindler
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Neither

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

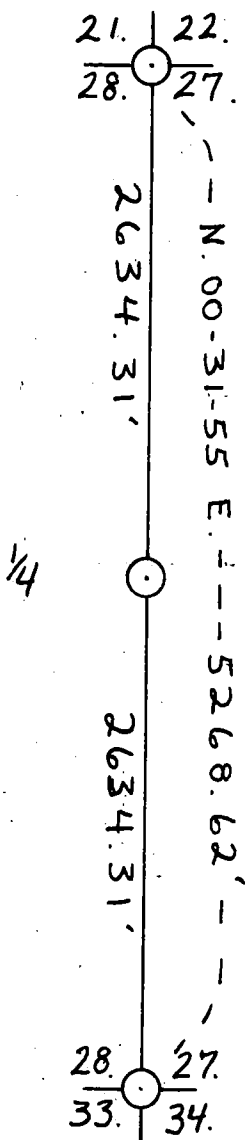

Affix Land Surveyor Seal

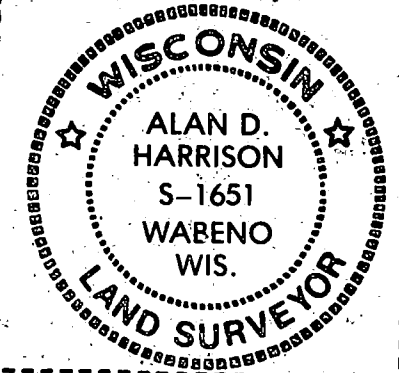

Alan D. Harrison

(I) (Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 26 and 27, T.34N., R.16E.

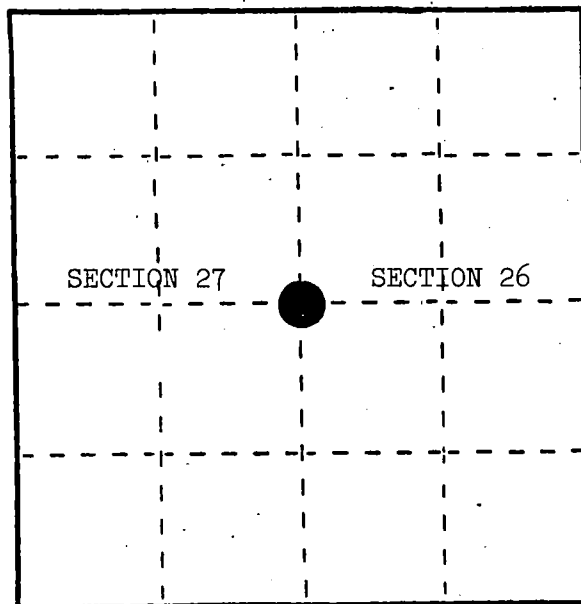

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Beech, 12", S.56°W., 35 links; Beech, 8", N.30°E., 18 links.

June 12, 1984, Alan Harrison set proportionate position and conducted search for corner-- found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Basswood, 9", S.79°E., 38.28'
3. Sugar, 6", S.17°W., 29.32'
4. Sugar, 10", N.78°W., 21.54'
5. Steel Sign Post, North, 1.25'

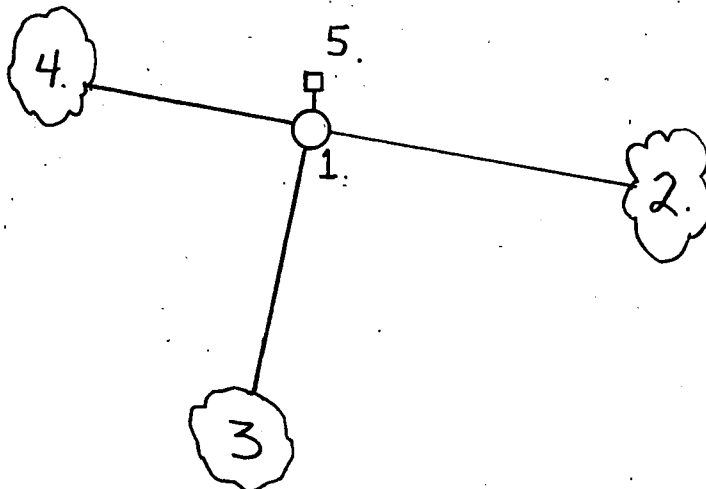

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 25th day

of January 1985 at

8:30 o'clock A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 17

Paul A. Schenck
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

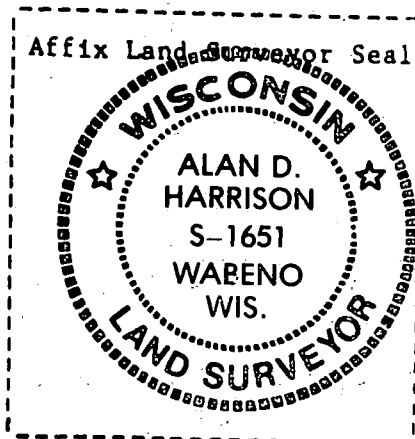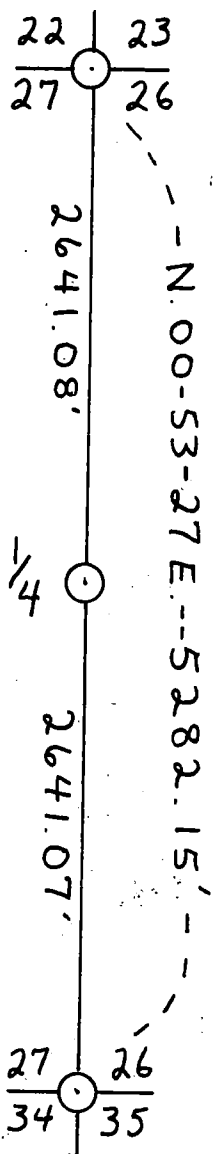

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 25 and 26, T.34N., R.16E.

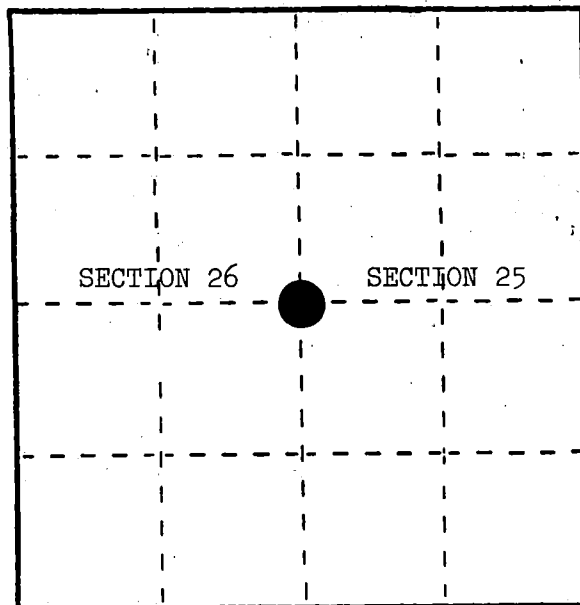

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Beech, 12", S.68°E., 9 links; Sugar, 14", S.53°W., 32 links.

August 9, 1984, Alan Harrison set north-south proportionate position--searched area, found no evidence of original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 6", N.32°E., 52.13'
3. Sugar, 8", S.12°E., 70.43'
4. Sugar, 6", N.14°W., 20.41'
5. Steel Sign Post, Southeast, 1.85'

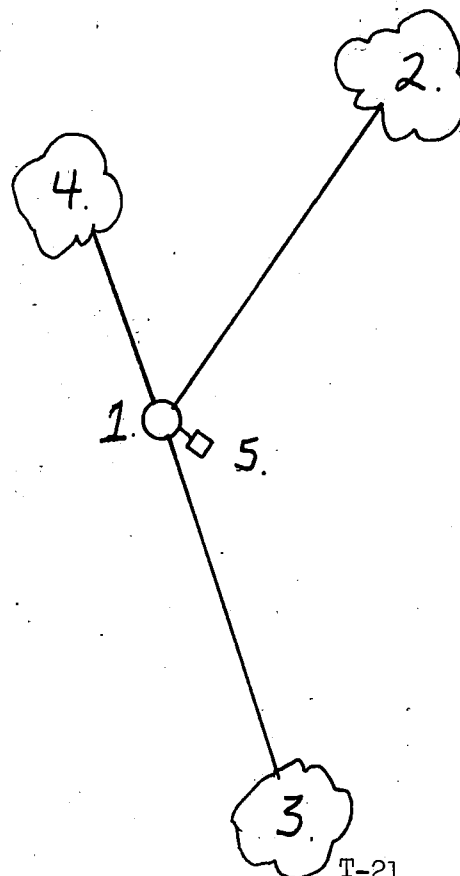

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of... January ... A.D., 1985 at
... 8:30 o'clock... A ... M. and

recorded in Vol. CORNER RESTORATION
on page T-21

Paul Aschbacher
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

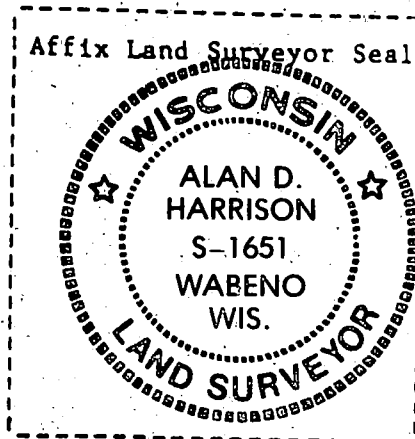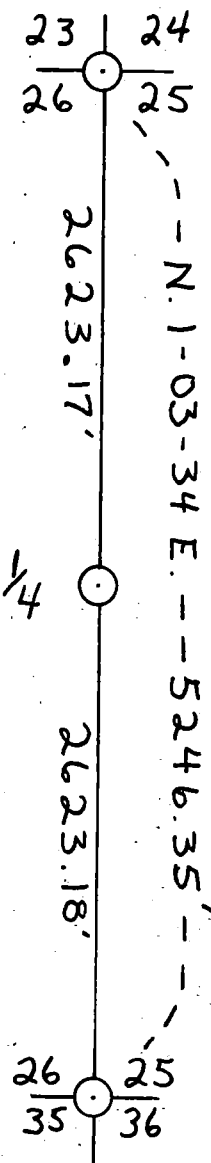

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 25 and 30, T.34N., R.16-17E.

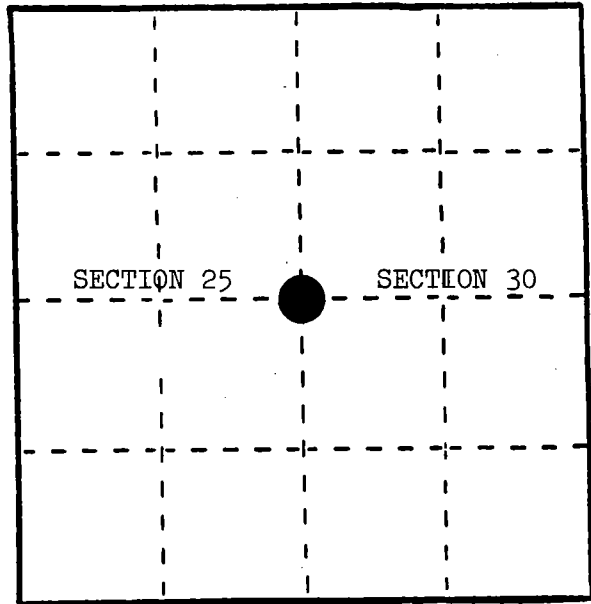

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set post with the following BTs: Cedar, 12", S.21°W., 38 links; Cedar, 12", N.19°W., 33 links.


August 30, 1974, Resvick found 4" x 4" scribed wood post on west side of old post point; Forest Service location poster on Cedar; 2 chains south to edge of swamp. No BTs found.

April 16, 1984, Milo Stefan found a 2½" steel pipe with brass cap. Surveyor 903, Carl Elfstrom, Amberg, Wisconsin.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2½" iron pipe stamped to identify the corner.
2. Cedar, 6", N.6°E., 74.30'
3. Cedar, 7", N.85°E., 43.26'
4. Black Ash, 8", S.11°W., 17.72'
5. Steel Sign Post, South, 1.15'

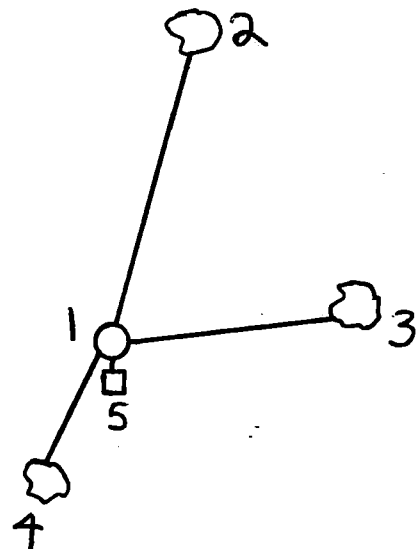

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of... January... A.D., 1985
at... 8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page 25

Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan

Signature

11/30/84

Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS :**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner between Sections 25, 30, 31, and 36, T.34N., R.15-16E.

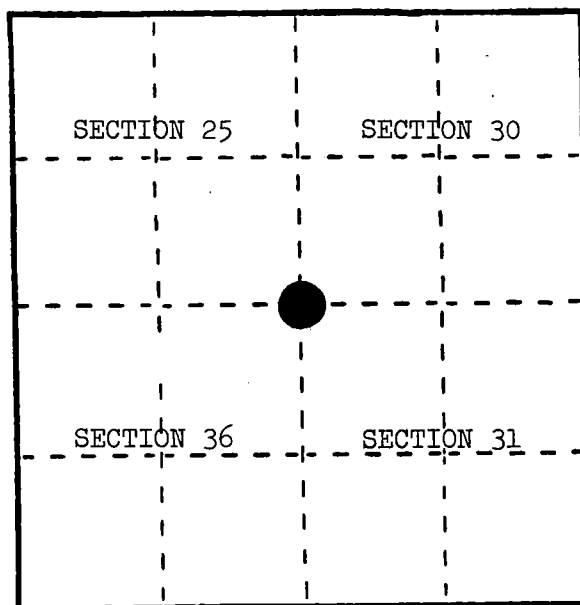

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Elm, 18", S.20°W., 61 links; Sugar, 12", N.35°W., 26 links; Sugar, 18", N.58°E., 40 links; Yellow Birch, 36", S.30°E., 66 links.

1954, Connor Co. found wood stake.


November 5, 1974, Resvick found no evidence of the corner.

April 30, 1984, Milo Stefan found 40" Yellow Birch stump. Pulled from stump N.30°W., 43.56' to corner position. Large stump hole, N.58°E., 27.8'; shallow stump hole, S.20°W., 40.26'; large, 8' long, turnout, N.35°W., 17.2'. Pulled north, 662.64', for 30" Birch. Looks good for corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum pipe with tablet stamped to identify the corner.
2. Basswood, 6", N.53°E., 31.30'
3. Sugar, 12", S.36°E., 28.24'
4. Sugar, 10", S.43°W., 28.87'
5. Yellow Birch, 13", N.36°W., 25.61'
6. Steel Sign Post, South, 2.0'

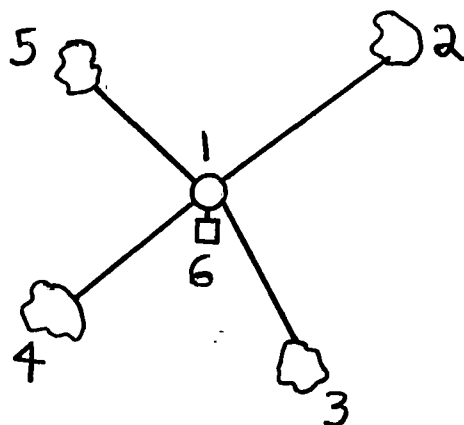

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day

of... January... A.D., 1985

at... 8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page V-1
Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

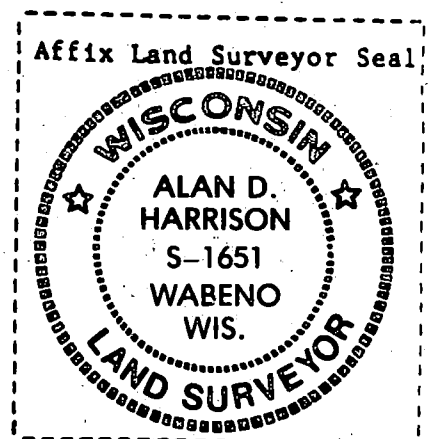

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 30 and 31, T.34N., R.16E.

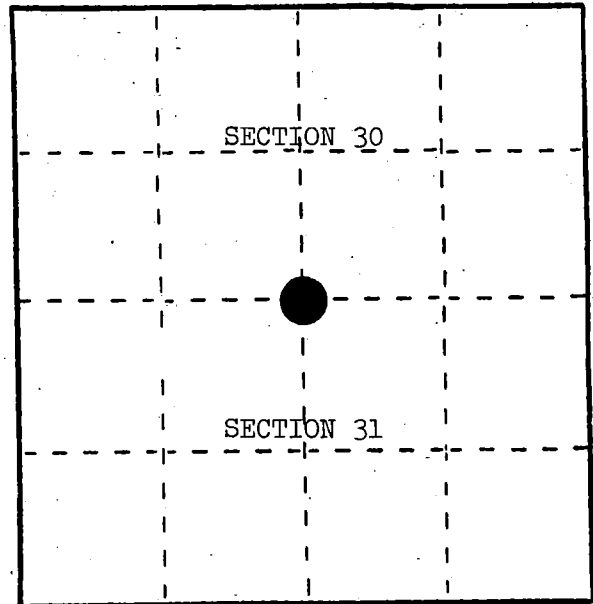

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post 53.40 chains with the following BTs: Hemlock, 7", N.13°E., 18 links; Elm, 14", S.45°E., 17 links. 7.60 chains east enter Cedar swamp, bears north-south.


Novak found a 24" Elm that he believed to be original BT.

July 18, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 4", N.01°E., 59.26'
3. Basswood, 6", S.10°W., 104.66'
4. Black Cherry, 12", N.82°W., 79.36'
5. Steel Sign Post, Southeast, 1.6'

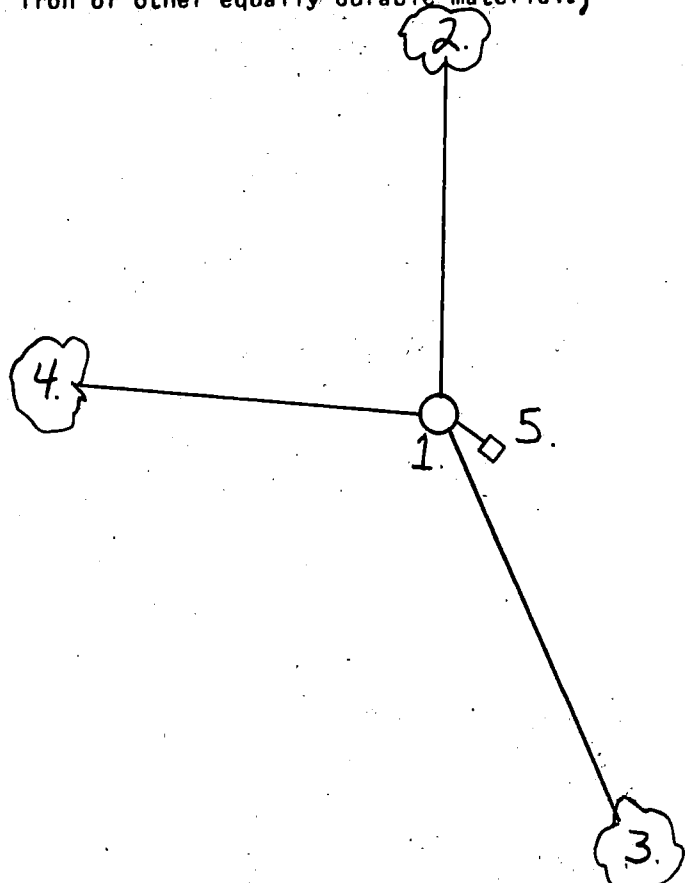

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day

of January... A.D., 1985 at

8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page V-3
Paul Aschenbrenner
REGISTER

434116300020

V-3

V3

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

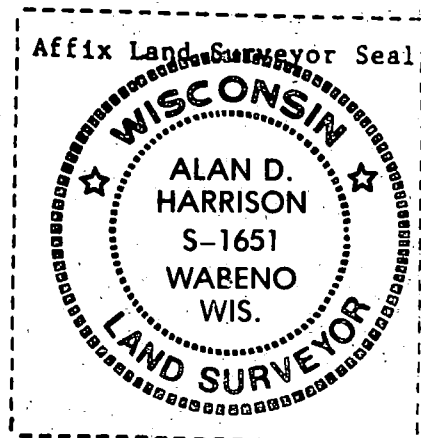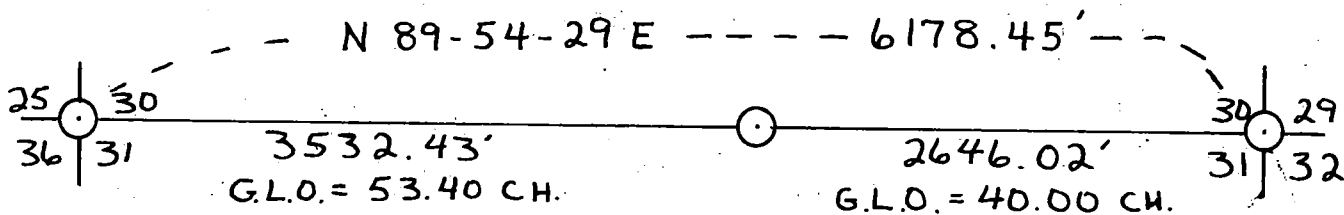

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/4/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

SOUTHEAST CORNER OF SECTION 30, TWP.
 34 N., R. 16 E.

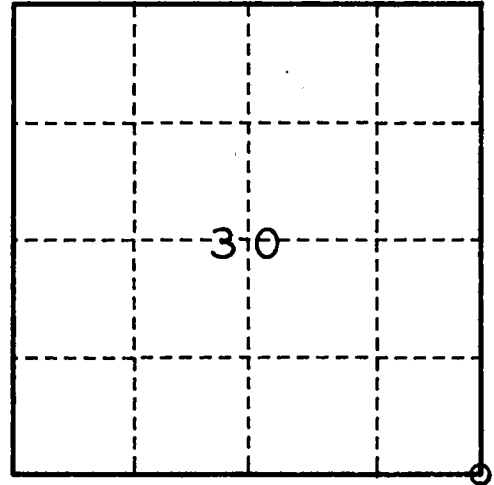

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET WOOD POST, B.Ts - CEDAR 10" N.77°W. 20 LKS., CEDAR 8" N.36°E. 13 LKS., CEDAR 12" S.83°E. 18 LKS., CEDAR 10" S.43 W. 17 LKS.

1935 - ROAD SURVEY INDICATES A SQUARED CEDAR POST 3FT. HIGH AND A FOREST SERVICE POSTER

1984 - HARRISON R.L.S. NO. S-1651, SET A 2" DIA. ALUMINUM MONUMENT AT SECTION CORNER, B.Ts - TAMARACK 16" N.7°E. 42.84FT., CEDAR 6" S.25°W. 21.12FT., CEDAR 14" N.58°W. 67.33FT., WITNESS -STEEL SIGN POST SE 1.21FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, B.Ts AND SIGN POST MADE ONE NEW B.T. AS NOTED BELOW.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. CEDAR 14" N.56°W. 67.33FT. (EXISTING)
2. B.T. SPRUCE 12" N.26°W. 64.05FT. (NEW)
3. B.T. TAMARACK 16" N.12°E. 42.92FT. (EXISTING)
4. 2" DIA. ALUMINUM MONUMENT AT CORNER (EXISTING)
5. STEEL SIGN POST SOUTHEAST 1.21FT. (EXISTING)
6. B.T. CEDAR 7" S.25°W. 21.07FT. (EXISTING)

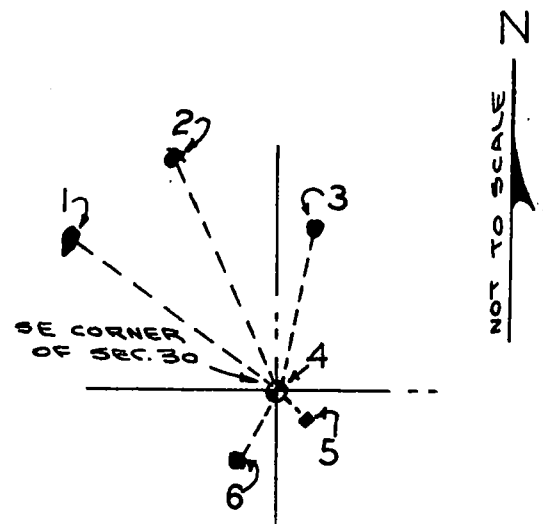


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

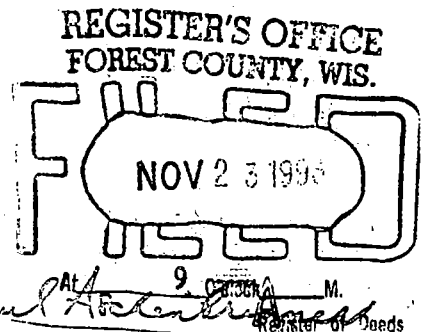

(1) I, WAYNE G. DOBBRATZ
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

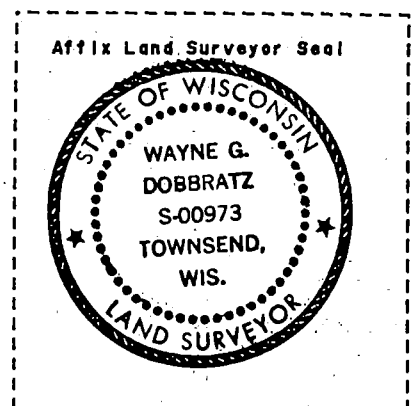

Signature

9/7/93

Date

CERTIFICATE READY FOR FILING:


Ralph [Signature] 11-5-93
Acting District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section corner to Sections 29, 30, 31, and 32,
 T.34N., R.16E.

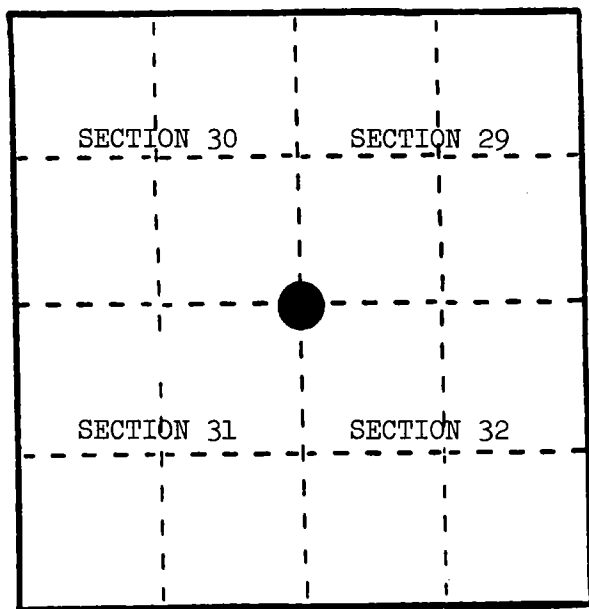

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Cedar, 10", N.77°W., 20 links; Cedar, 8", N.36°E., 13 links; Cedar, 12", S.83°E., 18 links; Cedar, 10", S.43°W., 17 links. 4 chains, south, leave swamp northwest-southeast; 10.40 chains, west, stream 8 links runs south; 1.75 chains, north, stream 8 links runs southeast; 10.75 chains, north, stream 8 links runs southwest.


December 4, 1935, road survey indicates a squared Cedar post, 3' high, and Forest Service poster.

June 24, 1984, Alan Harrison pulled from road survey notes to area of approximate section corner. Searched area, found 10" Cedar stump with possible scribe marks burnt over on southwest side. Pulled S.36°W., 8.58', and set picket, pulled S.43°W., 11.22' to face of Cedar stump, 12" diameter, pulled north at 1.90 chains, creek 5 links wide runs northwest; thence, north at 10.7 chains, creek runs southwest.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. Tamarack, 16", N.7°E., 42.84'
3. Cedar, 6", S.25°W., 21.12'
4. Cedar, 14", N.58°W., 67.33'
5. Steel Sign Post, Southeast, 1.21'

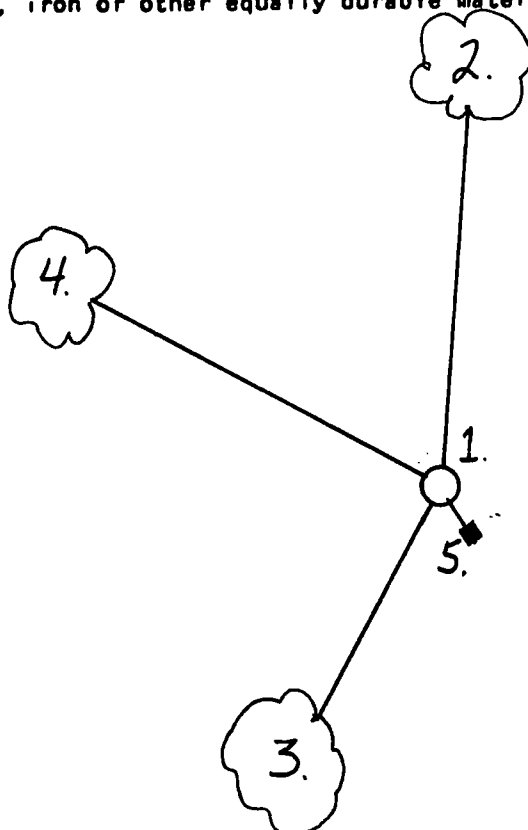

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 25th day
 of January, A.D., 1985
 at 8:30 o'clock A.M. and
 recorded in Vol. CORNER RESTORATIONS
 on page V-5
Paul Aschenbrenner
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(i) Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/4/84
Date

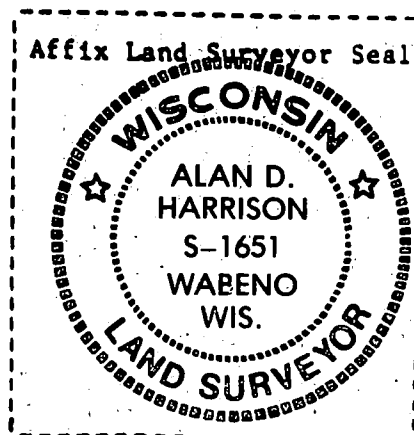


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 29 and 32, T.34N., R.16E.

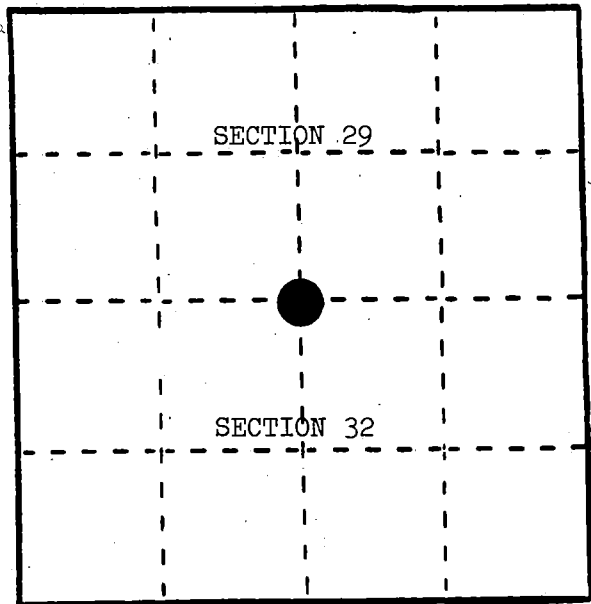

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post with the following BTs: Sugar, 12", N.69°W., 19 links; Lind, 8", N.7°W., 38 links.

August 15, 1984, Alan Harrison set proportionate position--conducted search of area, found no evidence of corner.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Basswood, 5", N.34°E., 27.52'
3. Sugar, 6", S.57°E., 63.08'
4. Sugar, 4", S.38°W., 61.10'
5. Steel Sign Post, West, 2.00'

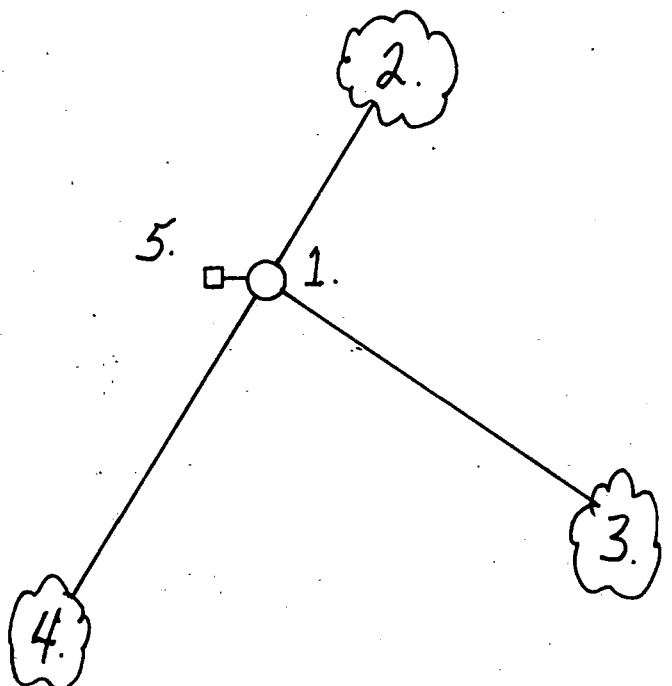

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of... January... A.D., 1985 at

... 8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page V-7
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

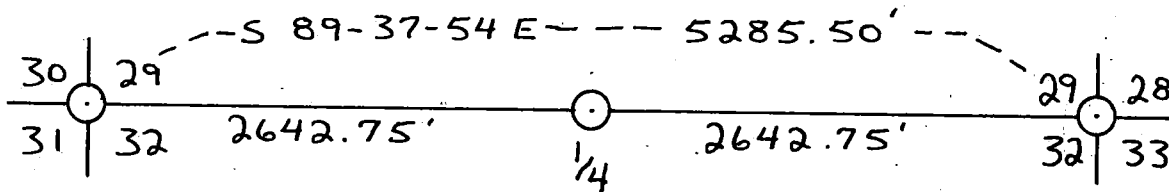

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/10/84
Signature Date

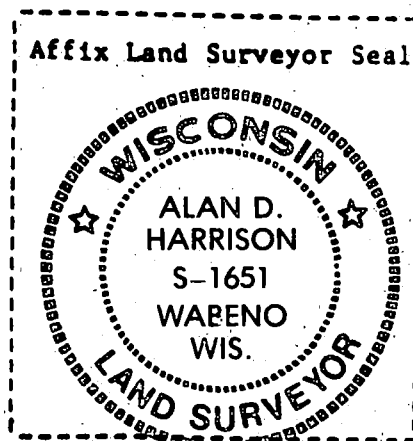


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 28, TWP. 34 N.,
 R. 16 E.

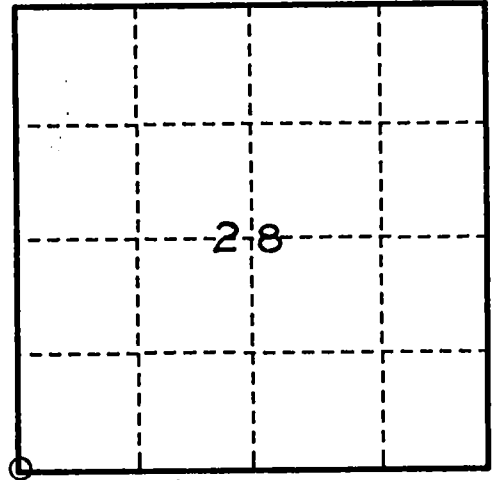

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET SECTION CORNER, B.Ts - BIRCH 20" N.16°W. 26 LKS., SUGAR 16" N.39°E. 41 LKS., BIRCH 6" S.55°E. 20 LKS., BIRCH 24" S.72°W. 28 LKS.

1962 - CONNOR CO. FOUND SOME EVIDENCE POSSIBLE TAG

1984 - HARRISON R.L.S. NO.S-1651, SET 2" DIA. ALUMINUM MONUMENT AT CORNER, B.Ts - YELLOW BIRCH 7" N.25°E. 27.59FT., SUGAR 4" S.70°E. 37.47FT., BEECH 20" S.32°W. 35.02FT., BASSWOOD 7" N.24°W. 37.52FT. WITNESS- STEEL SIGN POST NW 1.52FT.


1993 - DOBBRATZ R.L.S. NO.S-973, FOUND MONUMENT, STEEL SIGN POST AND B.Ts, EXCEPT B.T. BEECH 20" S.32°W. 35.02FT. IS BROKEN OFF AND DEAD.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. YELLOW BIRCH 8" N.25°E. 27.64FT. (EXISTING)
2. 2" DIA. ALUMINUM MONUMENT AT CORNER (FOUND)
3. B.T. SUGAR 5" S.70°E. 37.45FT. (EXISTING)
4. B.T. SUGAR 11" S.86°W. 50.18FT. (NEW)
5. STEEL SIGN POST NW 1.52FT. (EXISTING)
6. B.T. BASSWOOD 8" N.24°W. 37.55FT. (EXISTING)

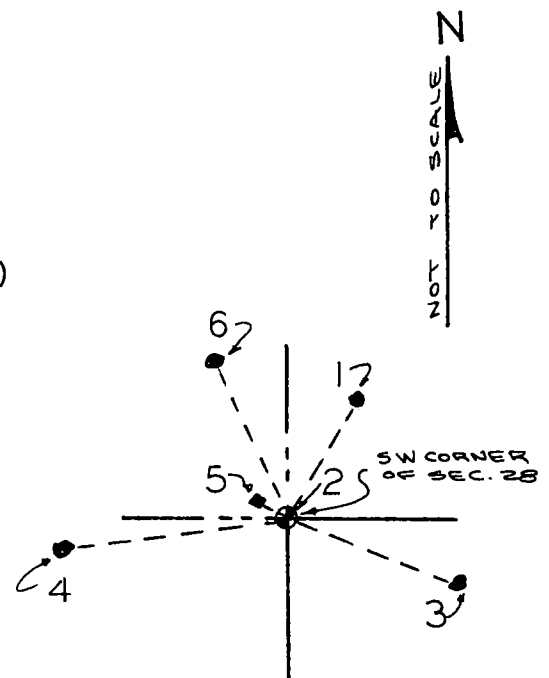


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

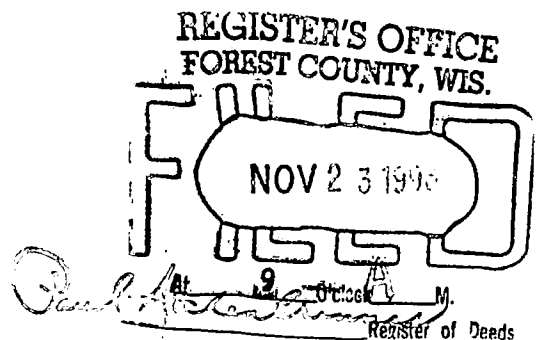

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

8/7/93

Date

CERTIFICATE READY FOR FILING:

Ralph C. Keller 11-5-93
Acting District Ranger

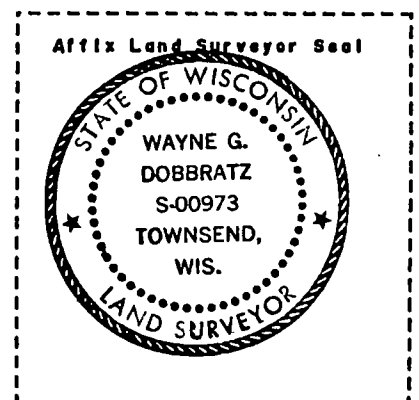

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 28, 29, 32, and 33,
T.34N., R.16E.

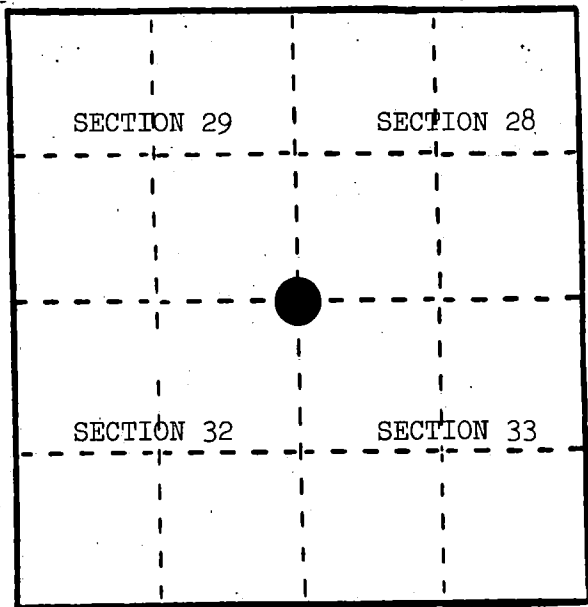

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Birch, 20", N.16°W., 26 links; Sugar, 16", N.39°E., 41 links; Birch, 6", S.55°E., 20 links; Birch, 24", S.72°W., 28 links.


Connor Company found some evidence--possible tag in 1962.

July 18, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; in a mound of stone.
2. Yellow Birch, 7", N.25°E., 27.59'
3. Sugar, 4", S.70°E., 37.47'
4. Beech, 20", S.32°W., 35.02'
5. Basswood, 7", N.24°W., 37.52'
6. Steel Sign Post, Northwest, 1.52'

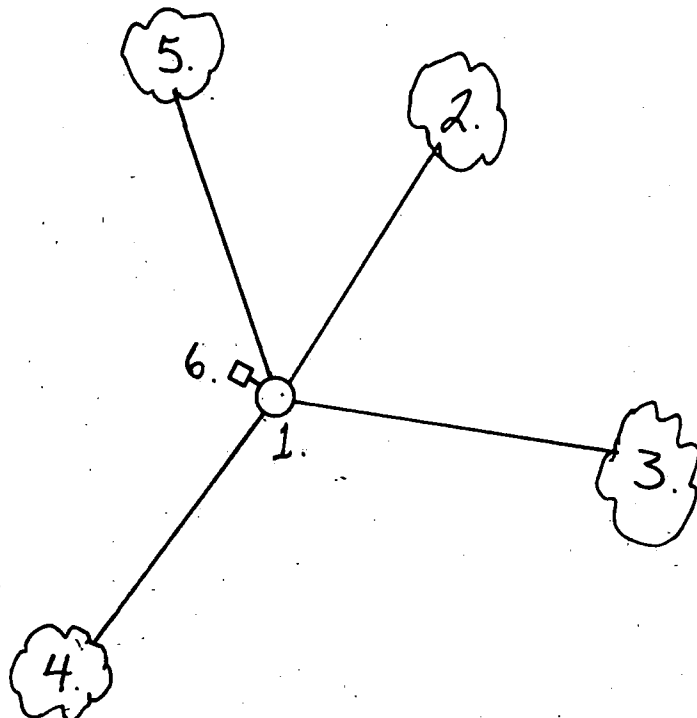

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of... January... A. D., 1985 at
8:30 o'clock... A. M. and

recorded in Vol. CORNER RESTORATIONS

on page V-9... Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

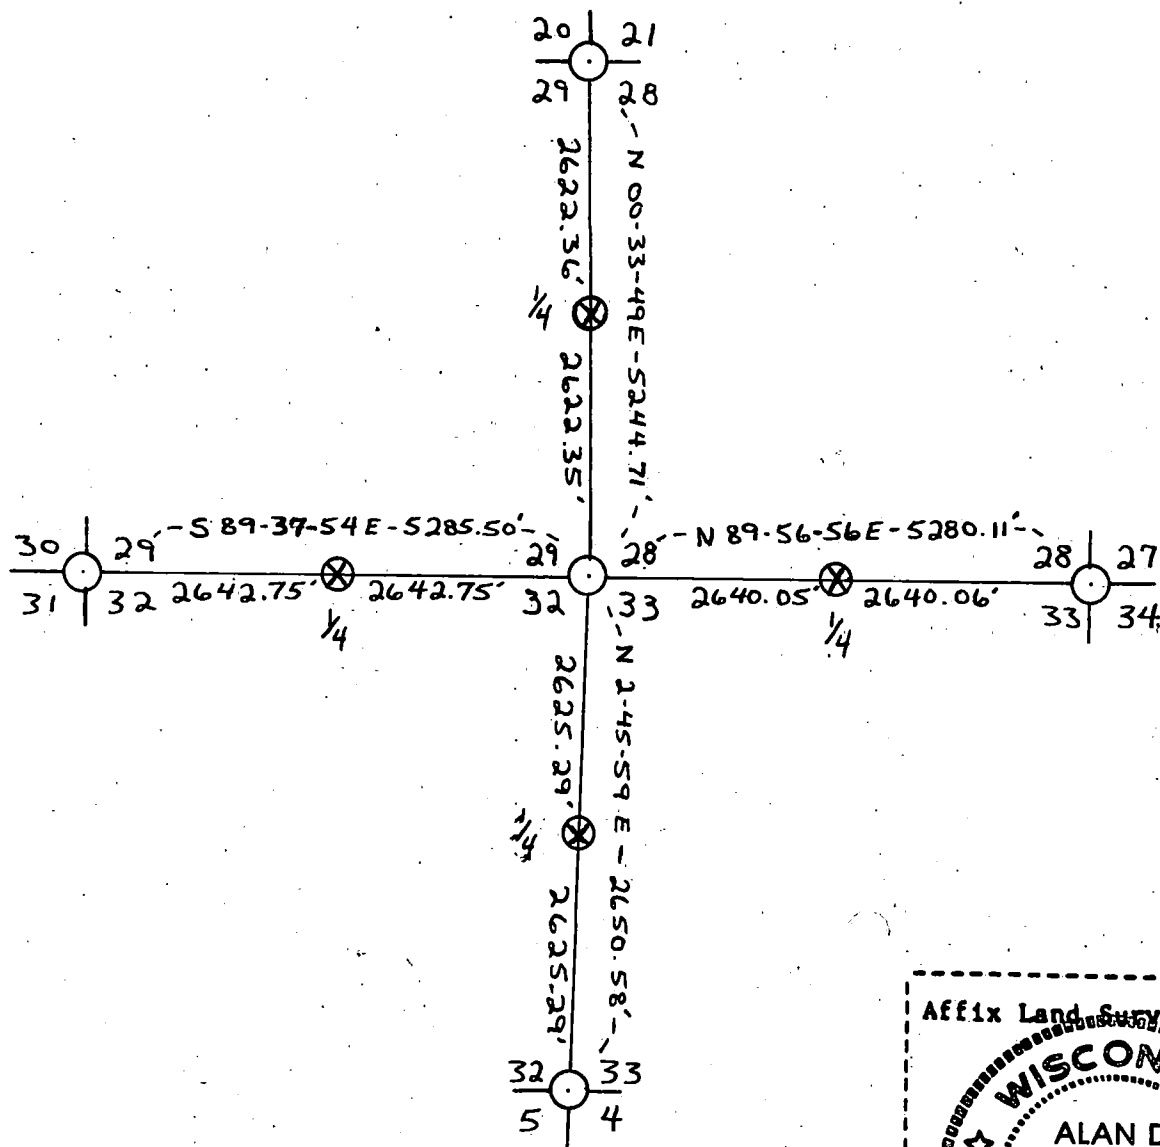

Affix Land Surveyor Seal

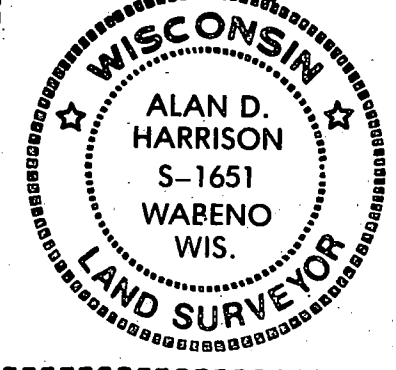

(i) 1. Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/10/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 28 and 33, T.34N., R.16E.

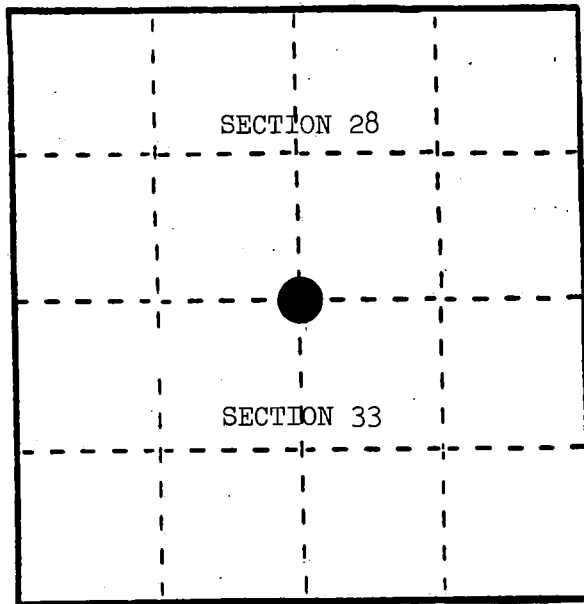

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post at 39.96 chains with the following BTs: Hemlock, 7", S.26°E., 12 links; Sugar, 10", N.24°W., 30 links.

August 15, 1984, set proportionate position--conducted search, found no evidence of corner position.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Basswood, 7", S.27°W., 39.95'
3. Sugar, 4", N.81°W., 5.09'
4. White Ash, 8", N.9°E., 76.42'
5. Steel Sign Post, Northeast, 1.58'

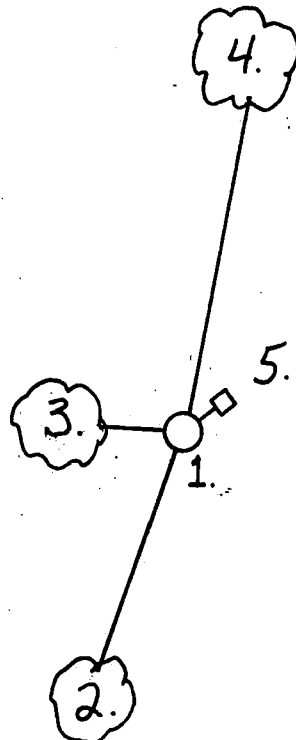

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day

of... January ...A.D., 1985

at... 8:30 o'clock... A...M. and

recorded in Vol. CORNER RESTORATIONS

on page V-11
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

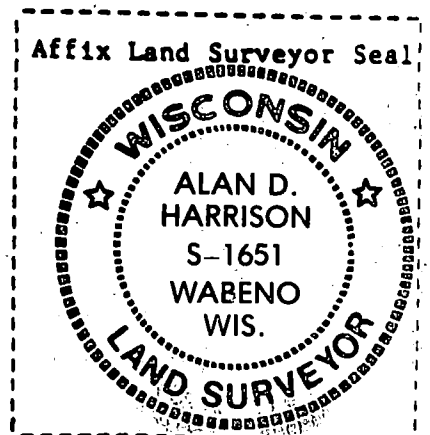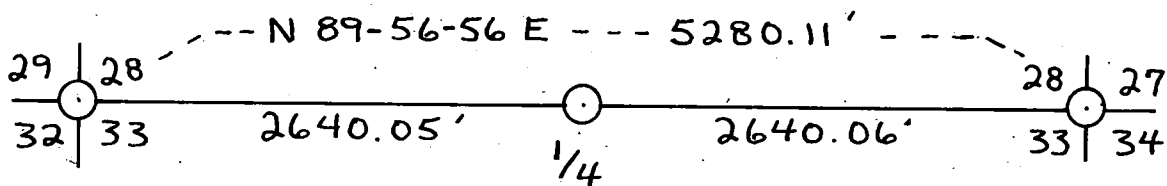

(i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 27, TWP. 34N.,
 R.16 E.

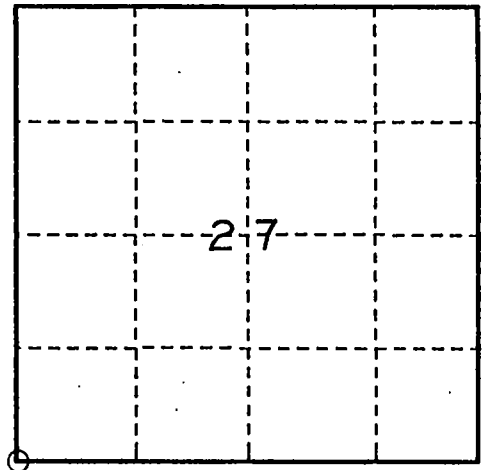

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, SET SECTION CORNER, B.Ts - FIR 8" N42°W. 11 LKS., SUGAR 12" N.23°E. 24 LKS., HEMLOCK 8" S.46°E. 29 LKS. FIR 10" S.55°W. 47 LKS.

1933 - KOLBE FOUND HARDWOOD STAKE BELIEVED TO BE ORIGINAL CORNER

1959 - SANDBERG FOUND 4" X4" CEDAR POST, NOT ORIGINAL

1984 - HARRISON R.L.S. NO. 1651, SET 2" DIA. ALUMINUM MONUMENT AT CORNER, B.Ts - BLACK ASH 5" N.61°E. 32.36FT., BLACK CHERRY 6" S.64°E. 25.74FT., YELLOW BIRCH 6" S.21°W. 41.17FT., YELLOW BIRCH 5" N.42°W. 38.41FT., WITNESS - STEEL SIGN POST SOUTH 1.62FT.


1993 - DOBBRATZ R.L.S. NO.S-973, FOUND MONUMENT, STEEL SIGN POST AND B.Ts, EXCEPT 2 B.Ts HAVE INCORRECT BEARINGS.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T BLACK ASH 6" N.61°E. 32.36FT. (EXISTING)
2. 2" DIA. ALUMINUM MONUMENT AT CORNER (EXISTING)
3. B.T. BLACK CHERRY 7" S.22°E. 25.62FT. (CORRECTED)
4. STEEL SIGN POST SOUTH 1.62FT. (EXISTING)
5. B.T. YELLOW BIRCH 10" S.30°W. 41.15FT.(CORRECTED)
6. B.T. YELLOW BIRCH 6" N.42°W. 38.45FT. (EXISTING)

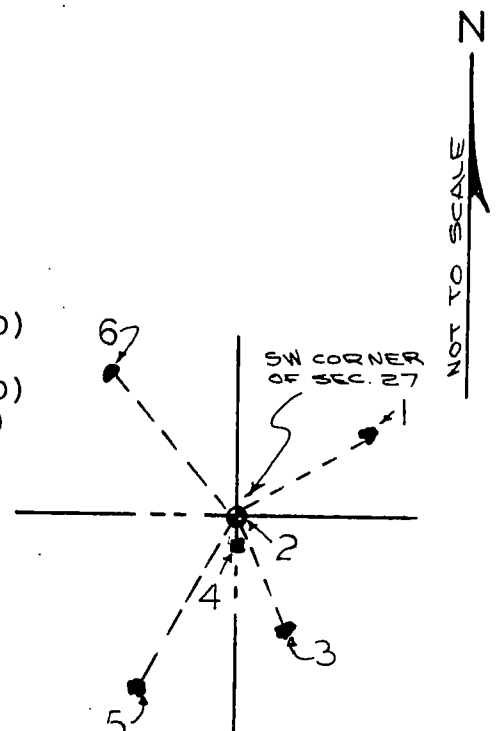


43416280000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

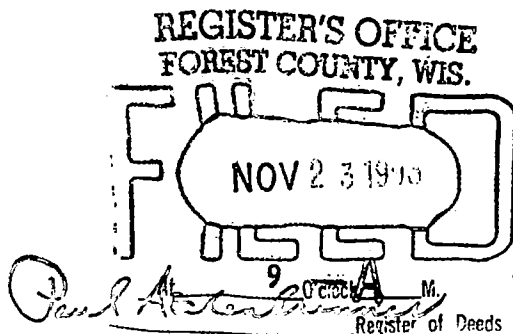

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

8/10/93

Date

CERTIFICATE READY FOR FILING:

Ralph [unclear] 11-5-93
Acting District Ranger

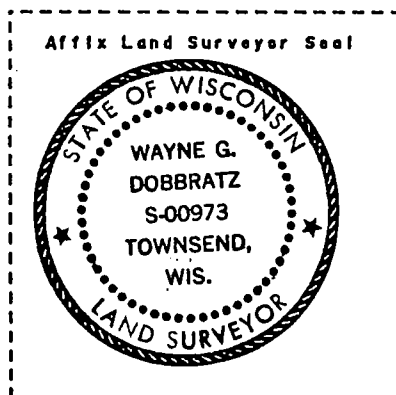


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 27, 28, 33, and 34, T.34N., R.16E.

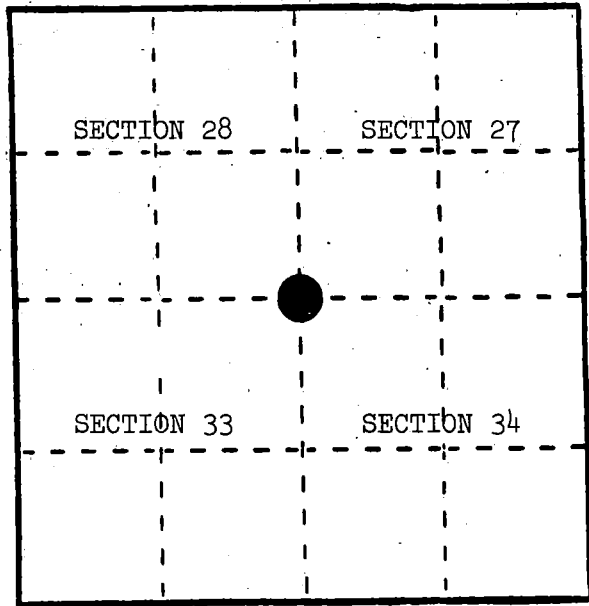

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Fir, 8", N.42°W., 11 links; Sugar, 12", N.23°E., 24 links; Hemlock, 8", S.46°E., 29 links; Fir, 10", S.55°W., 47 links.

December 22, 1933, Robert Kolbe found hardwood stake, 24" high. He believed it to be original corner.


January 30, 1959, Nels Sandberg found 4" x 4" Cedar post (estimated 20 years old), does not believe to be original.

July 25, 1984, Alan Harrison set proportionate position--searched area, found squared wood post, 70', east; root holes (tree burnt out), N.23°E., 15.84'; root holes (Hemlock pieces), S.46°E., 19.14'; no evidence of other BTs.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
2. Black Ash, 5", N.61°E., 32.36'
3. Black Cherry, 6", S.64°E., 25.74'
4. Yellow Birch, 9", S.21°W., 41.17'
5. Yellow Birch, 5", N.42°W., 38.41'
6. Steel Sign Post, South, 1.62'

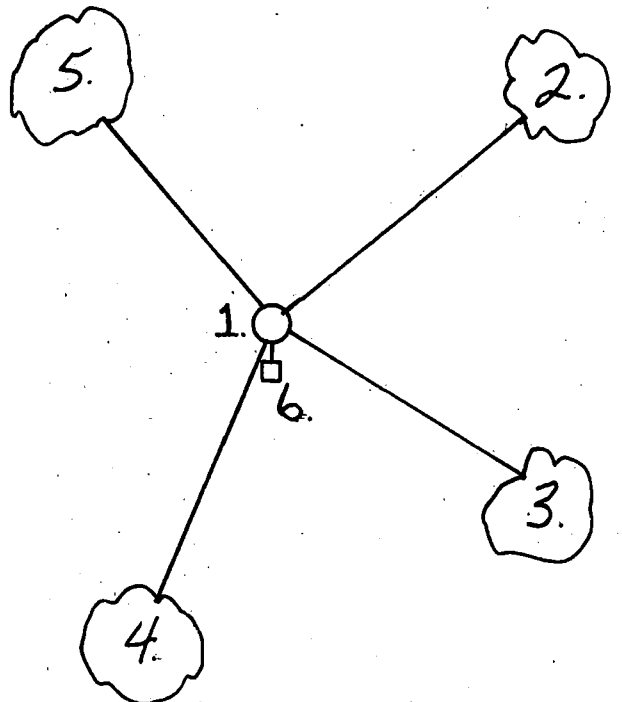

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 25th day

of January 1985 A. D., 1985 at

8:30 o'clock A. M. and

recorded in Vol. CORNER RESTORATIONS

on page V-13

Paul Aschenbrenner

REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(i) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date

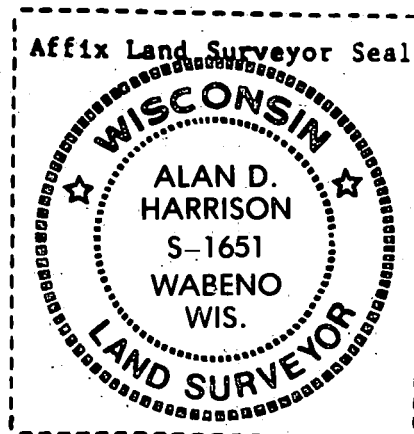


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

NORTH $\frac{1}{4}$ CORNER OF SECTION 34, TWP.34 N.,
 R. 16 E.

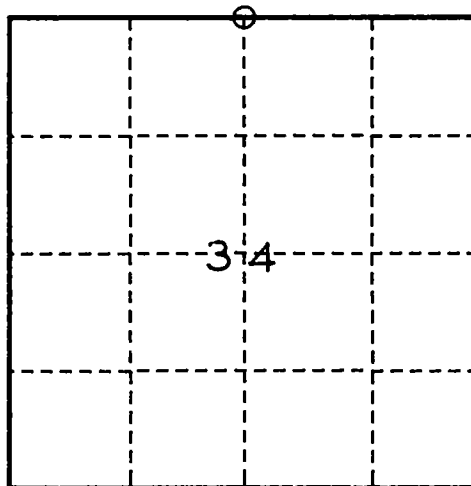

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


1858 - ORIGINAL SURVEY BY McBRIDE, SET WOOD POST AT $\frac{1}{4}$ CORNER, B.Ts - SUGAR 10" S.29°W. 14 LKS., HEMLOCK 10" N.8°E. 39 LKS.
 1984 - HARRISON R.L.S. NO.S-1651, SET 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER WHICH FALLS IN A HOLE 5 FT. DEEP. B.Ts -BLACK CHERRY 5" N.2°E. 28.87FT., ROCK ELM 12" N.85°E. 17.54FT., ASPEN 13" S.9°W. 49.13FT., WITNESS - STEEL SIGN POST WEST 3.64FT.
 1993 - DOBBRATZ, R.L.S. NO.S-973, FOUND MONUMENT AND SIGN POST AS NOTED, ALL B.Ts ARE DEAD OR DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. ASPEN 6" N.8°W. 13.88FT. (NEW)
2. 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER (EXISTING)
3. B.T. ASPEN 7" S.30°E. 30.60FT. (NEW)
4. B.T. BLACK CHERRY 7" S.52°W. 3.05FT. (NEW)
5. STEEL SIGN POST WEST 3.64FT. (EXISTING)

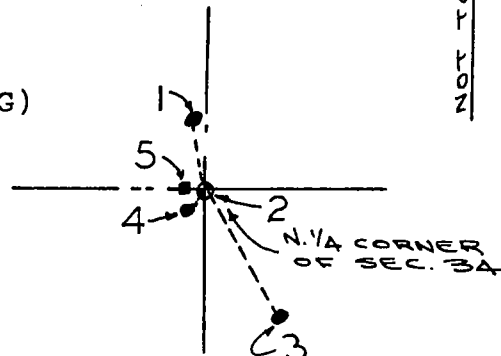


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

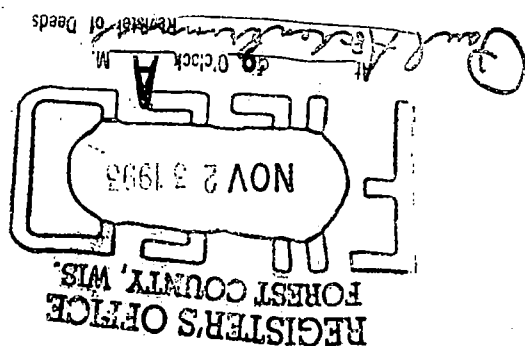

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

9/25/93

Date

CERTIFICATE READY FOR FILING:

Ralph C. Wells 11-5-93
Acting District Ranger

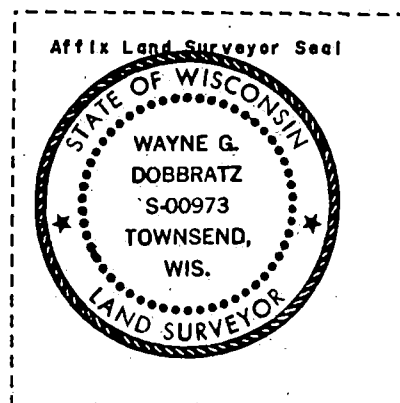


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 27 and 34, T.34N., R.16E.

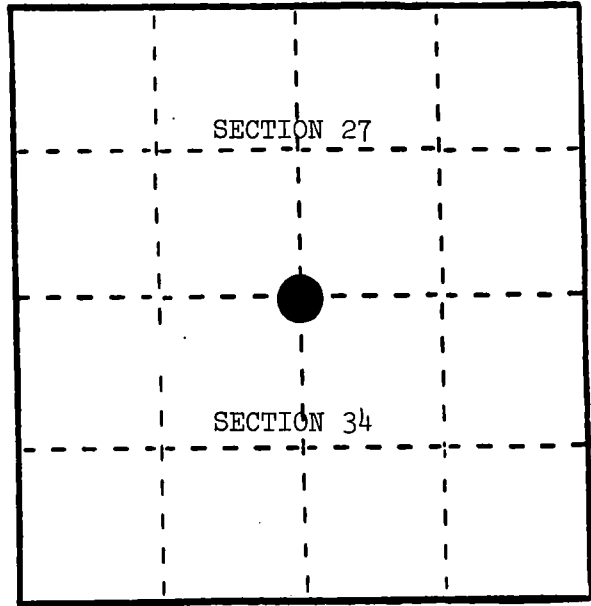

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 10", S.29°W., 14 links; Hemlock, 10", N.8°E., 39 links. 5 chains east, enter Cedar swamp, bears northeast and southwest. 10.70 chains east, stream 10 links wide, runs southwest.

August 9, 1984, Alan Harrison set proportionate position--conducted search, found no evidence of corner. Position falls in a 10' x 12' excavation, 5' deep (possibly a root cellar). East, 340', is swamp edge. Corner is in 3 acre opening--old homestead.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; placed in the excavation pit.
2. Black Cherry, 5", N.2°E., 28.87'
3. Rock Elm, 12", N.85°E., 17.54'
4. Aspen, 13", S.9°W., 49.13'
5. Steel Sign Post, West, 3.64'

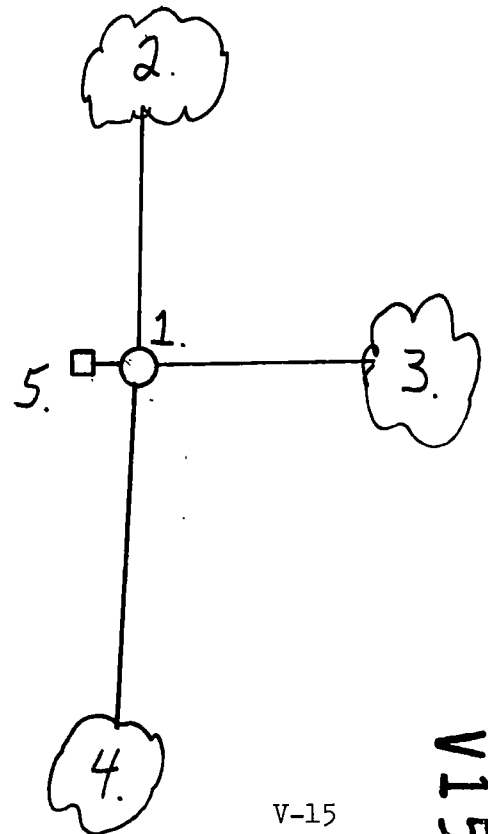

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this... day

of... A.D., 19...

... o'clock... M. and

recorded in Vol. CORNER RESTORATIONS

on page 1-15

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

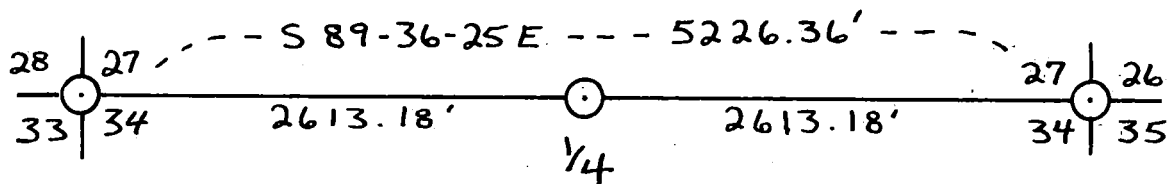

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/12/84
Signature Date

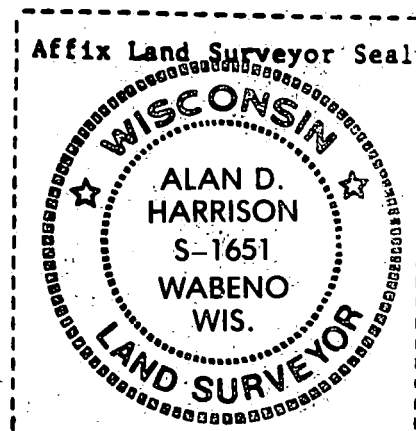


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.


Section corner to Sections 26, 27, 34, and 35, T.34N., R.16E.

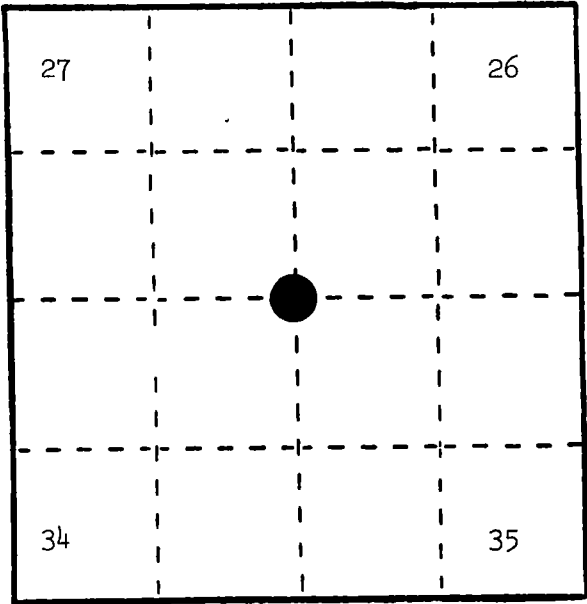

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of October A.D., 1986 at
2:45 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page V-17
Paul Aschendorfer
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
In 1858, James McBride set post with the following BTs: Birch, 7", N.25°E., 26 links; Cedar, 10", S.41°E., 8 links; Birch, 10", S.17°W., 30 links; Black Ash, 8", N.38°W., 22 links.
In 1973, Milo Stefan and Jean Resvick found a fallen Cedar post next to a 1 1/2" iron pipe; also, found the following BTs: Birch stump, N.25°E., 17.1 feet; Cedar snag, 18", S.41°E., 5.3 feet; Birch snag, 18", S.17°W., 19.8 feet; Black Ash, fallen and very rotted, N.38°W., 14.5 feet.
In 1974, Jean Resvick replaced post and pipe with a brass cap monument and references: Black Ash, 9", N.57°E., 10.25 feet; Black Ash, 6", N.58°W., 7.11 feet; Steel Sign Post, northeast, 0.5 feet.
In 1986, Alan Harrison found northeast BT dead and made new references.
- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 1. 2" x 60" brass capped monument by J. Resvick
- 2. Black Ash, 8", N.69°E., 37.14 feet
- 3. Black Ash, 7", S.24°E., 13.92 feet
- 4. Black Ash, 10", S.64°W., 34.10 feet
- 5. Black Ash, 6", N.58°W., 7.11 feet
- 6. Steel Sign Post, northeast, 0.50 feet

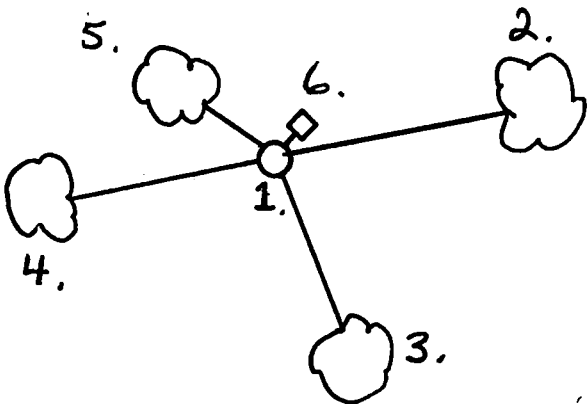

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

10/9/86
Date

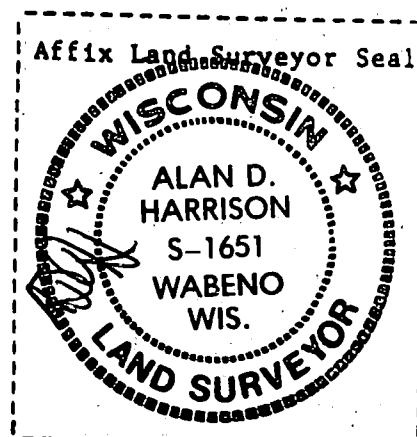

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 5th day of June, 19 73, I found evidence of the Northwest section corner of Section 35 Township 34N, Range 16E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Survey in 1858 by James McBride 80.00 chains north between sections 34 and 35 set post
 Birch 7 inches, bears N25°E 26 lks.
 Cedar 10 inches, bears S41°E 8 lks.
 Birch 10 inches, bears S17°W 30 lks.
 B. Ash 8 inches, bears N38°W 22 lks.

Description of corner evidence found:

1. Steel pipe by post point
2. Birch stump bears N25°E 26 lks.
3. Cedar snag 18 inches, bears S41°E, 8 lks., scribed
4. Birch snag 18 inches, bears S17°W, 30 lks. scribed

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post point with a 2 inch inside diameter galvanized pipe 5 feet long filled with concrete with a brass cap marked T34N R16E S27, S26, S34, S35, 1974, S-802
 From which the following new bearing trees bear
 Black Ash 9 inches bears N57°E 10.25 ft.
 Black Ash 6 inches bears N58°W 7.11 ft.
 Sign post, NE, 0.5 ft.

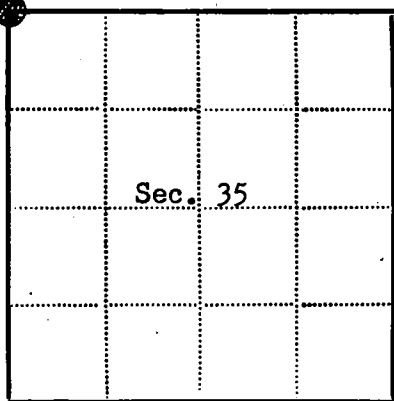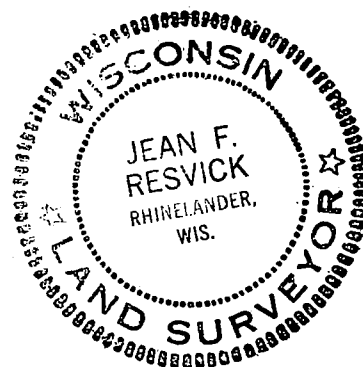

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 28 day of Feb. 19 74.

Signature Jean F. Resvick Title Land Surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT No. 105093

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 19 74, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 34N, Range 16E, Section 35, Index No. V-17, Page No. _____

43416 27 0000

V17


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 26 and 35, T.34N, R.16E.

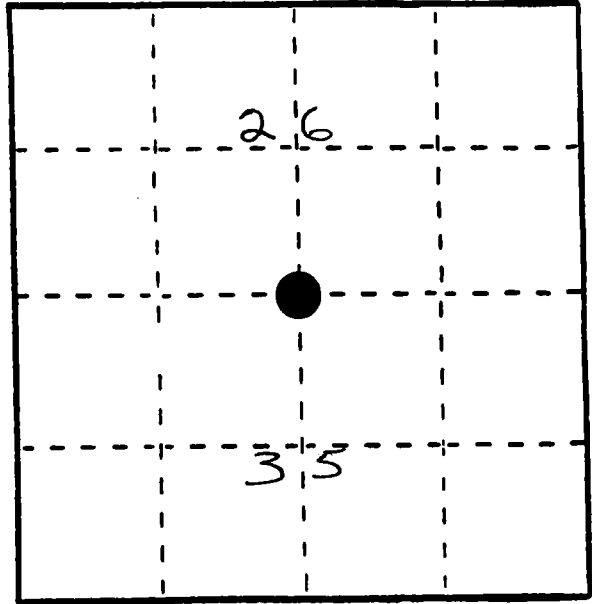

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set post at 40.30 chains with the following BTs: Sugar, 20", N17°E, 25 links; Sugar, 20", S32°W, 31 links. 11.80 chains east, stream 10 links wide, runs south. 5.20 chains west, enter Cedar swamp, bears northeast and southwest.

August 28, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. White Ash, 8", N17E, 31.00'
3. Black Cherry, 7" S15W, 18.72'
4. Sugar, 7", N65W, 81.79'
5. Steel Sign Post, Southeast, 1.25'

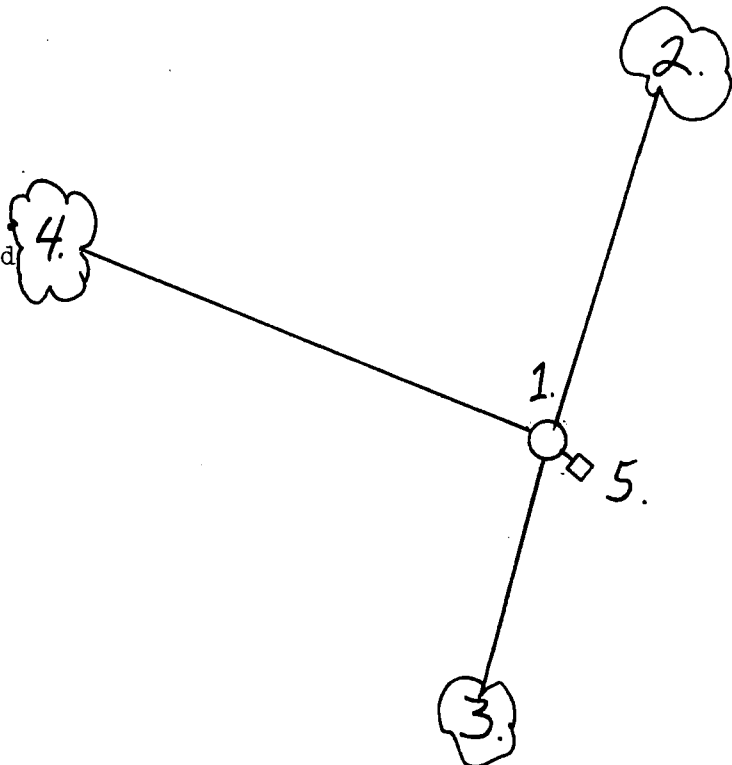

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this... 25th day
of... January... A. D., 1985 at

8:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS

on page 8-19
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

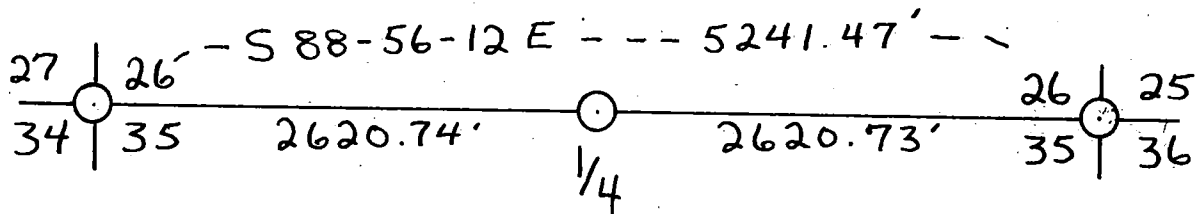

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/10/84
Signature Date

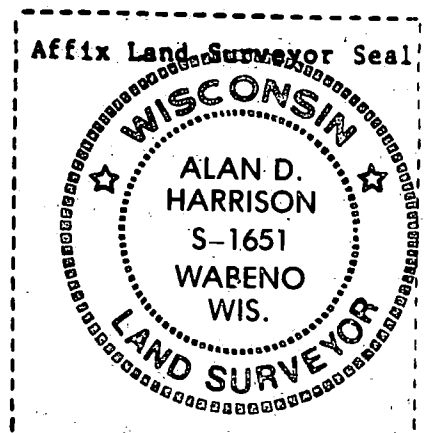


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 25, 26, 35, and 36,
T.34N., R.16E.

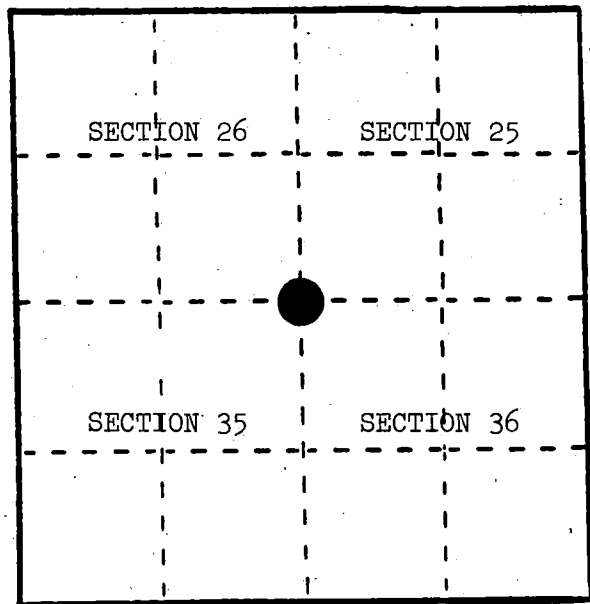

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Sugar, 10", N.36°W., 13 links; Sugar, 8", N.12°E., 15 links; Sugar, 12", S.14°E., 43 links; Sugar, 8", S.64°W., 35 links.


In 1974, Tom Tallier found old, squared wood post and possible stump holes of original BTs.

July 24, 1984, Alan Harrison set proportionate position. Found squared wood post, as per Tallier. Center of stump hole, N.36°W., 8.58'; center of stump hole, N.12°E., 9.90'; center of stump hole, S.14°E., 28.40'; center of stump hole, S.64°W., 23.10'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. "X" on S $\frac{1}{2}$ of cracked rock, 2 $\frac{1}{2}$ ' x 3' x 2', N.23°E., 29.38'
3. "X" on rock, 4' x 4' x 2', S.25°E., 14.54'
4. Steel Sign Post, Southwest, 6.48'
5. Steel Sign Post, Northwest, 1.79'

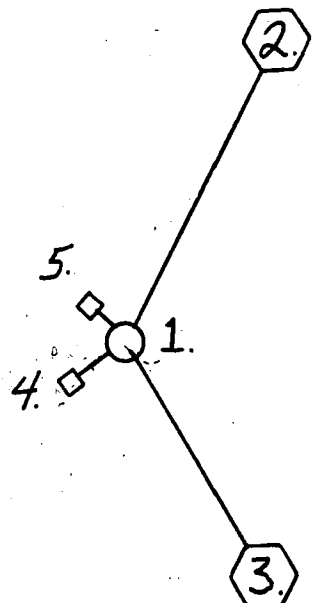

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 25th day
of January, A.D., 1985 at
8:30 o'clock, A. M. and

recorded in Vol. CORNER RESTORATIONS
on page 21

Paul Aschenbrenner
REGISTER

43416260000

V-21

V21

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(i) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date

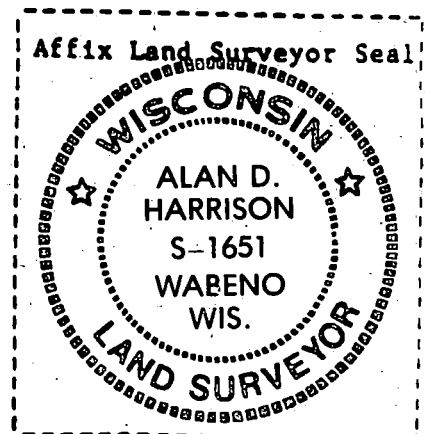


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 25 and 36, T.34N., R.16E.

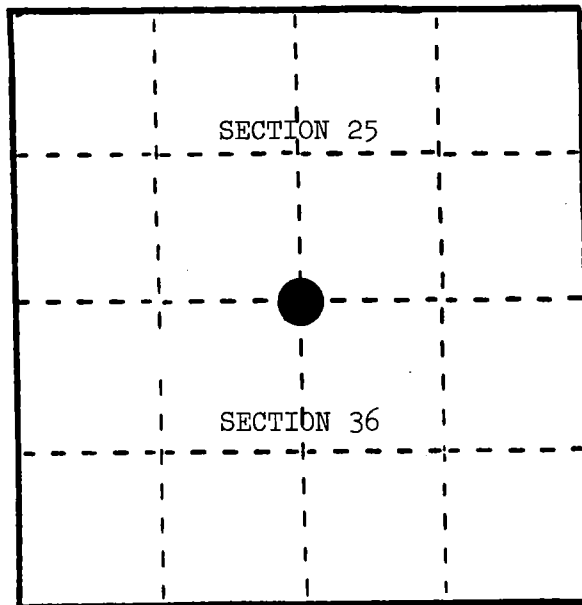

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 16", S.12°E., 21 links; Sugar, 7", N.24°E., 33 links.

October 16, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Aspen, 3", S.48°E., 11.74'
3. Sugar, 5", S.71°W., 67.40'
4. Sugar, 5", N.50°W., 60.19'
5. Steel Sign Post, Northeast, 1.11'

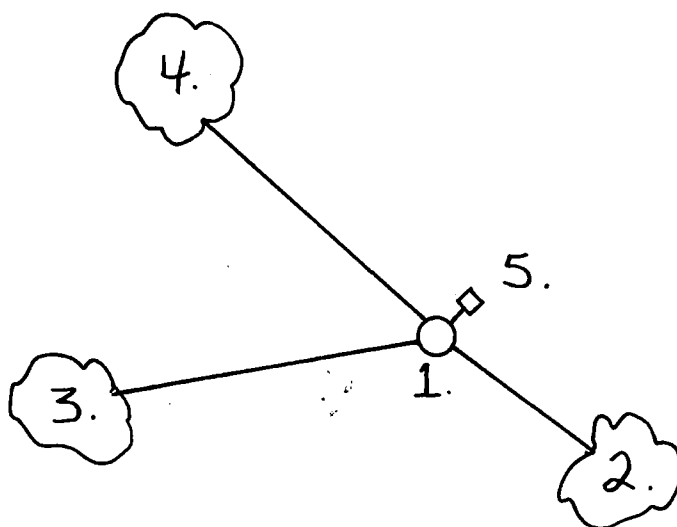

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 25th day
of January, A.D., 1985
at 8:30 o'clock, A.M. and

recorded in Vol. CRNER RESTORATIONS

on page V:23
Paul Achenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate, $\frac{1}{2}$ mile east and west.

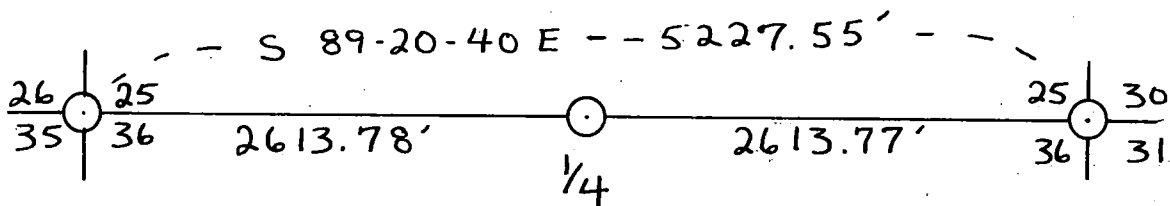


(i) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date

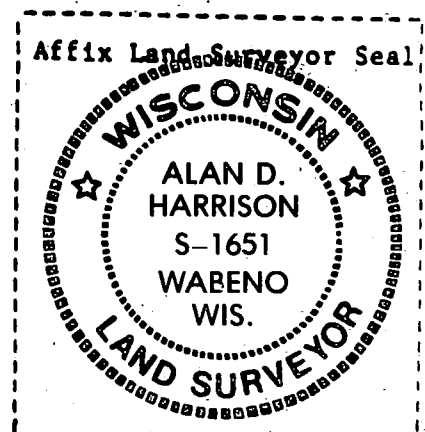


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 25, 30, 31, and 36,
T.34N., R.16-17E., Forest and Marinette
Counties, Wisconsin.

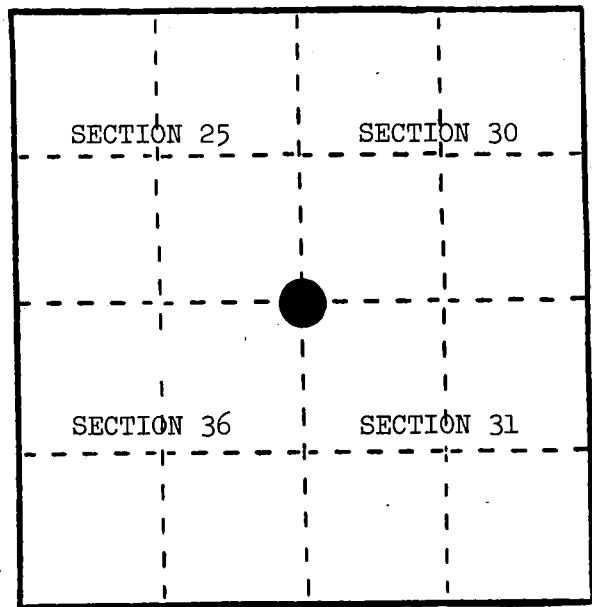


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Corner position found marked by a large rock pile with post hole painted with blue paint. Large roots of Hemlock in mound of windthrown tree, S.50°W., 33'. We placed a 2" x 36" aluminum monument in post hole.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Yellow Birch, 8", N.31°E., 28.94'
2. Basswood, 6", S.25°E., 48.98'
3. Red Oak, 18", S.79°W., 83.33'
4. Red Oak, 7", N.48°W., 78.67'
5. Steel Sign Post, North, 3.3'
6. 2" x 36" aluminum monument stamped to identify the corner.

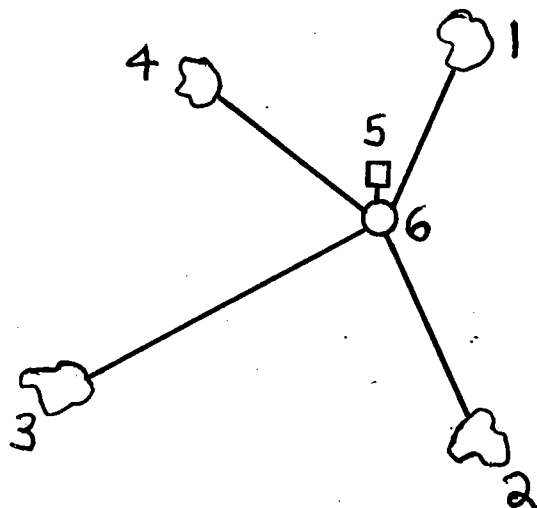

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 25th day
of January, A.D., 1985
at 8:30 o'clock A.M. and
recorded in Vol. CORNER RESTORATIONS
on page 25
Paul A. Schumacher
REGISTER

43416250000

V-25

V25

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 31 and 36,
T.34N., R.15-16E.

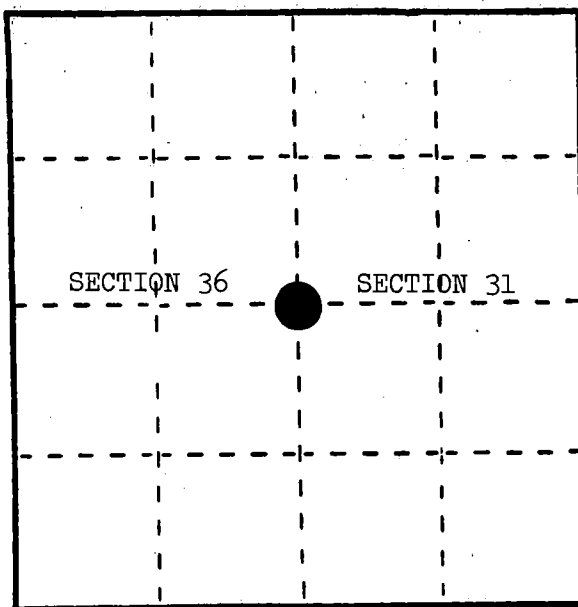

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Hemlock, 20", S.60°W., 29 links; Hemlock, 22", N.70°E., 11 links. North, .20 chains, Indian trail bears east and west; 1.25 chains south, river runs southeast.

November 5, 1974, Resvick found no evidence of corner. Unable to put river calls together.

April 30, 1984, Alan Harrison found post hole from the remains of Hemlock BTs. From post hole, trail, north, 13', and river, south, 90'--fits with original calls.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

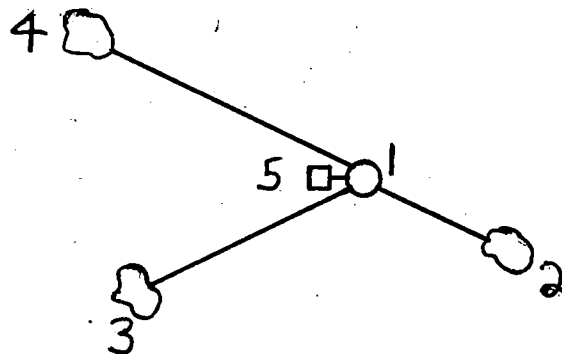

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Black Cherry, 6", S.60°E., 15.25'
3. Red Maple, 6", S.47°W., 26.29'
4. Basswood, 10", N.48°W., 63.25'
5. Steel Sign Post, West, 1.24'

REGISTER'S OFFICE

Forest County, Wis.

Received for record this.....day

of January.....A. D., 1985 at

8:30 o'clock.....A.....M. and

recorded in Vol. CORNER RESTORATIONS

on page X-1

Paul A. Schenck
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Bearings of original BTs should read S.70°W., and N.60°E., (Distances O.K.).

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/27/84
Date

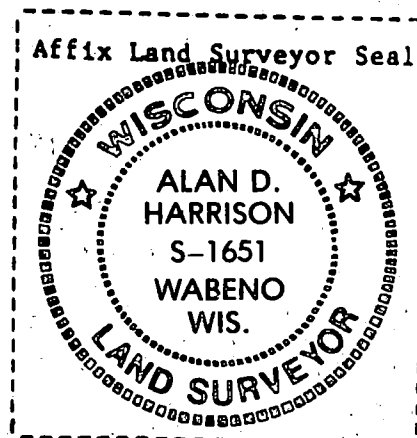


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 31 and 32, T.34N., R.16E.

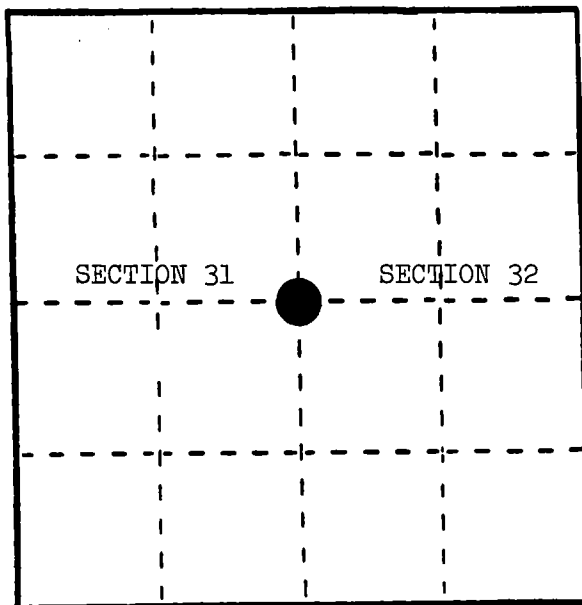

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 10", N.67°E., 45 links; Birch, 14", S.65°W., 34 links.

July 9, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" aluminum monument stamped to identify the corner.
- Sugar, 12", N.81°E., 24.35'
- Sugar, 8", S.19°W., 21.27'
- Sugar, 6", N.65°W., 31.08'
- Steel Sign Post, Southeast, 1.50'

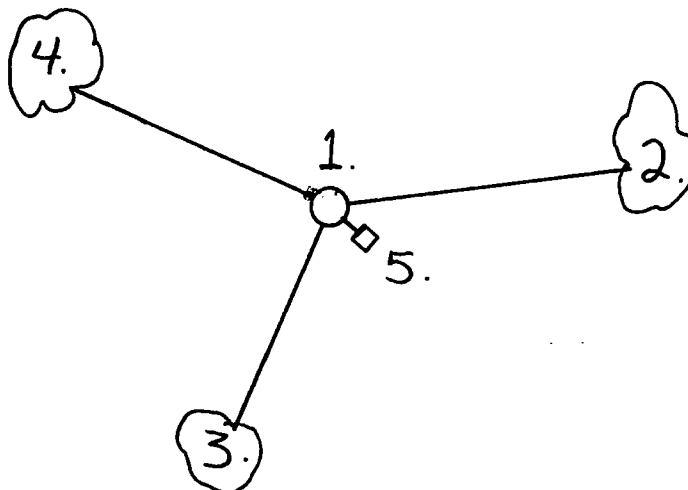

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 25th day
 of January, A.D., 1985
 at 8:30 o'clock A. M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 5
Paul Aschenbrenner
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

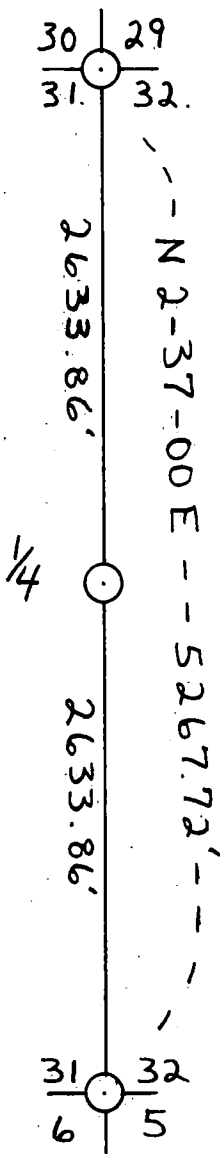

(i) Alan D. Harrison


(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

Date

12/10/84

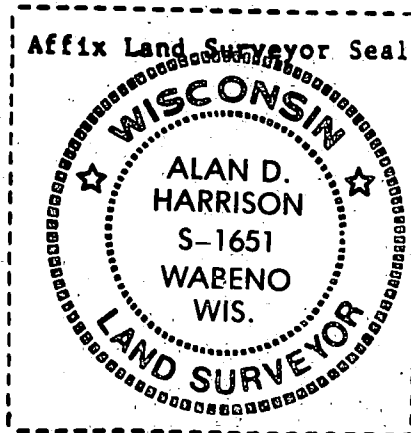


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

WEST $\frac{1}{4}$ CORNER OF SECTION 33, TWP. 34 N.,
 R. 16 E.

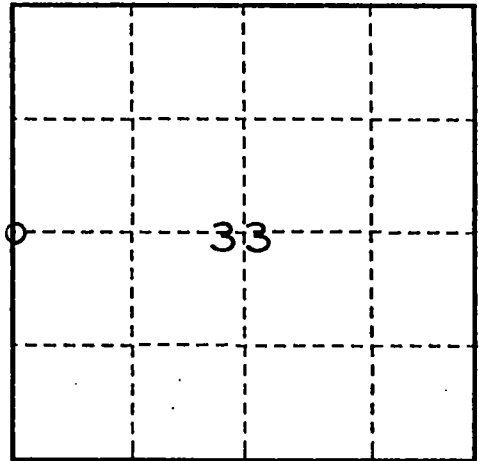

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1858 - ORIGINAL SURVEY BY McBRIDE, B.Ts.- SUGAR 8" S.31°E. 18 LKS.,
 SUGAR 10" S.87°W. 11 LKS.

1984 - HARRISON R.L.S. NO. S-1651 SET 2" DIA. ALUMINUM MONUMENT, B.Ts.
 SUGAR 6" N.48°E. 16.37FT., SUGAR 6" S.47°E. 3.58FT., SUGAR 7" S.28°W.
 19.38FT. WITNESS - STEEL SIGN POST NW 1.43FT.


1993 - DOBBRATZ R.L.S. NO. S-973, FOUND MONUMENT, STEEL SIGN POST
 AND B.Ts . B.T. SUGAR 7" S.28°W. 19.38 BEARING IS INCORRECT.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. SUGAR 7" N.48°E. 16.37FT. (EXISTING)
2. B.T. SUGAR 7" S.47°E. 3.58FT. (EXISTING)
3. B.T. SUGAR 8" S.42°W. 19.40FT. (EXISTING)
4. STEEL SIGN POST NW 1.43FT. (EXISTING)
5. 2"DIA. ALUMINUM MONUMENT (EXISTING)

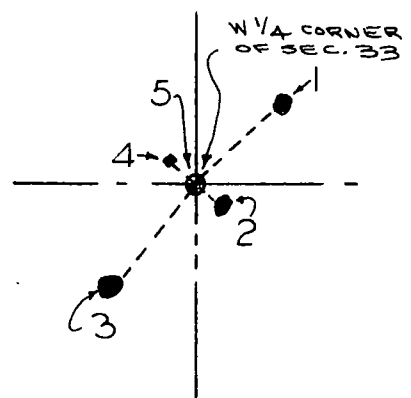


(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)


(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

REGISTER'S OFFICE
FOREST COUNTY, WIS.

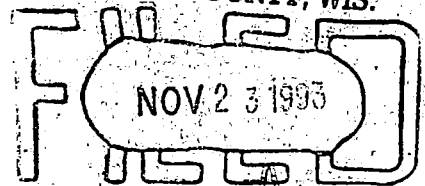

Paul A. ... M.
Register of Deeds

Affix Land Surveyor Seal.

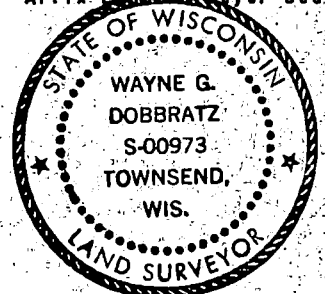

(1) I, WAYNE G. DOBBRATZ 8/5/93

(type or print name), certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Ralph ... 11-5-93
Acting District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 32 and 33, T.34N., R.16E.

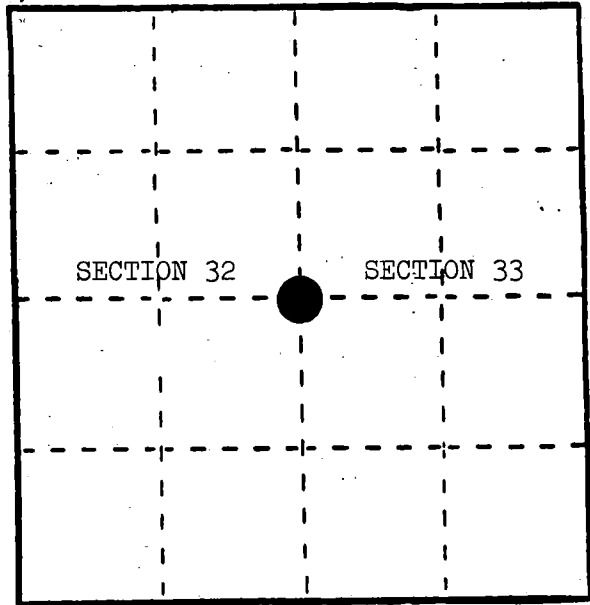

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 8", S.31°E., 18 links; Sugar, 10", S.87°W., 11 links. 4.00 chains north, enter Cedar swamp, bears northwest and southeast.

July 24, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; in a mound of stone.
2. Sugar, 6", N.48°E., 16.37'
3. Sugar, 6", S.47°E., 3.58'
4. Sugar, 7", S.28°W., 19.38'
5. Steel Sign Post, Northwest, 1.43'

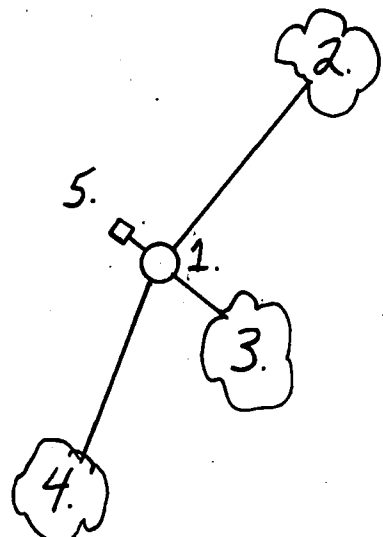

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day

of January... A.D., 1985 at

8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page X-9
Paul Hechenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


Yes.

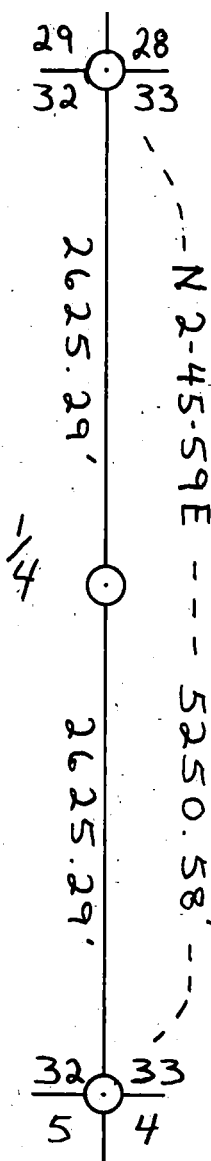

(i) 1. Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/10/84
Signature Date

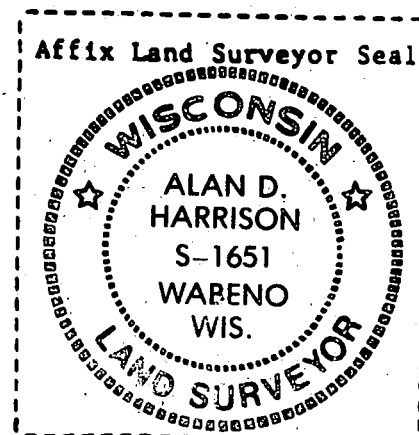


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 33 and 34, T.34N., R.16E.

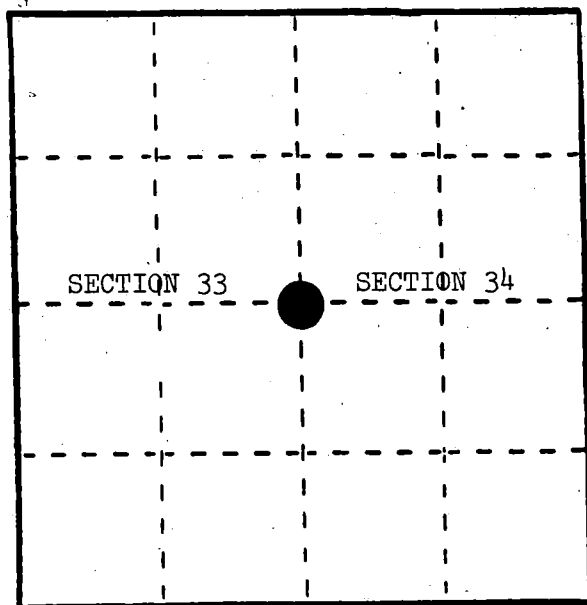

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Ironwood, 6", N.70°E., 9 links; Lind, 15", S.44°W., 15 links. 11.00 chains north, stream 20 links wide, runs southwest.

July 30, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner; in a mound of stone.
2. Red Oak, 12", S.28°E., 22.23'
3. Sugar, 6", S.42°W., 3.71'
4. Sugar, 5", N.6°W., 15.37'
5. Steel Sign Post, North, 3.59'

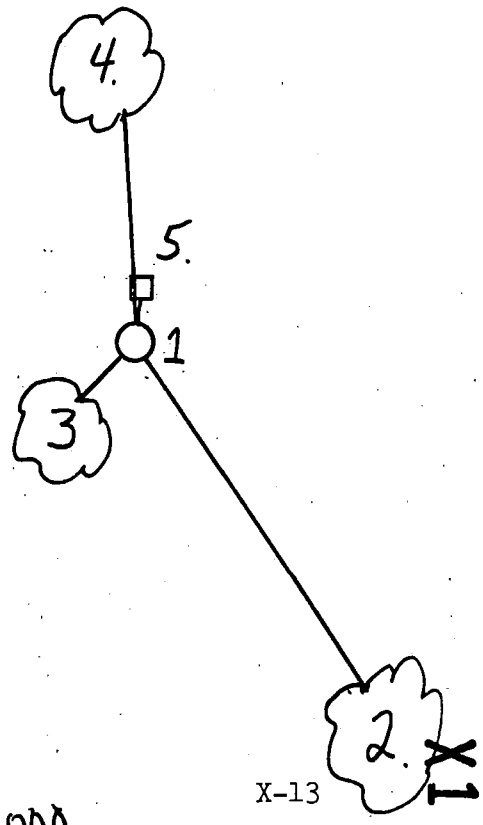

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of January... A.D., 1985 at
8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page 13

Paul Achenbrenner
REGISTER

43416332000

X-13

X13

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

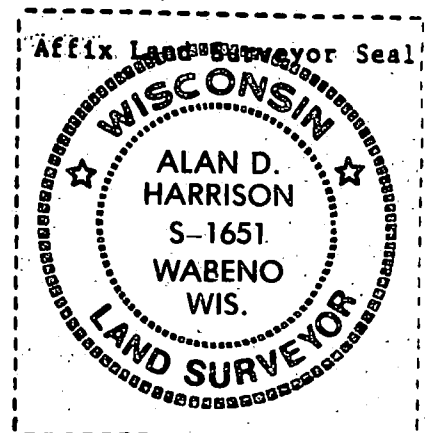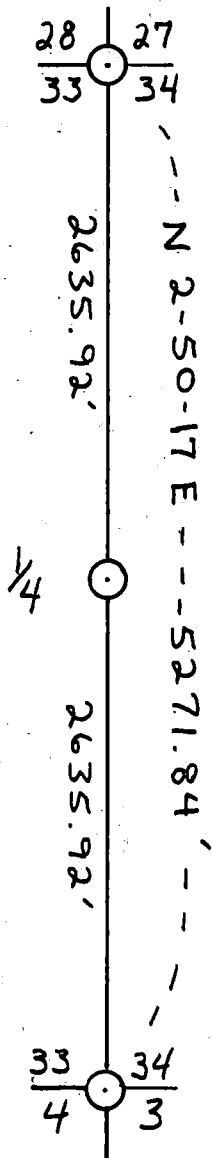

(i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/12/84
Signature Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

EAST $\frac{1}{4}$ CORNER OF SECTION 34, TWP. 34 N.,
 R. 16 E.

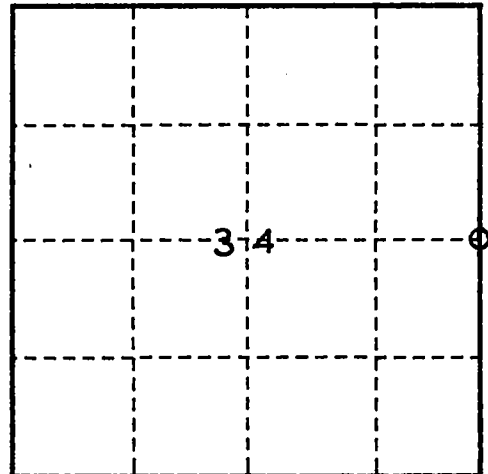

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


- 1858 - ORIGINAL SURVEY BY McBRIDE, SET WOOD POST, B.Ts - SUGAR 18" S.48°E. 9 LKS., SUGAR 10" S.47°W. 35 LKS., SUGAR 14" SOUTH 13.10 CHS.
 1984 - STEFAN R.L.S. NO. S-1558, SET A 2" DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER, B.Ts- YELLOW BIRCH 8" S.74°E. 36.09FT., SUGAR 18" S.53°W. 117.35FT., HEMLOCK 12" N.43°W. 69.93FT. WITNESS - STEEL SIGN POST NE 1.20FT.
 1993 - DOBBRATZ R.L.S. NO.S-973, FOUND MONUMENT, B.Ts AND SIGN POST YELLOW BIRCH B.T IS DOWN, MADE NEW B.T. AS LISTED BELOW

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. STEEL SIGN POST NE 1.13FT.(EXISTING)
2. B.T. BEECH 13" N.80°E. 16.95FT. (NEW)
3. B.T. SUGAR 18" S.53°W. 117.35FT. (EXISTING)
4. $\frac{1}{4}$ CORNER 2" DIA. ALUMINUM MONUMENT (EXISTING)
5. B.T. HEMLOCK 14" N.43°W. 69.88FT. (EXISTING)

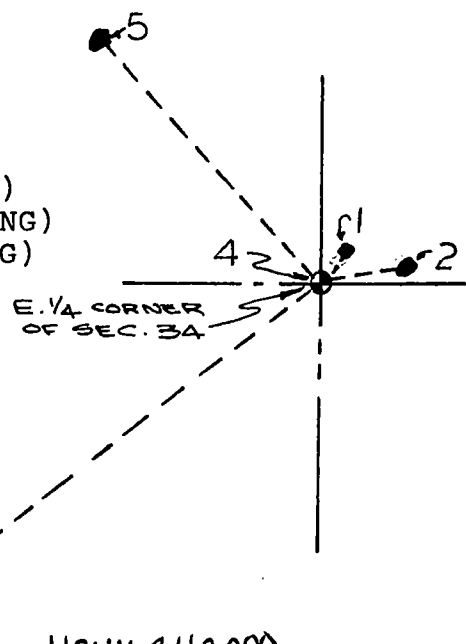


43416342000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

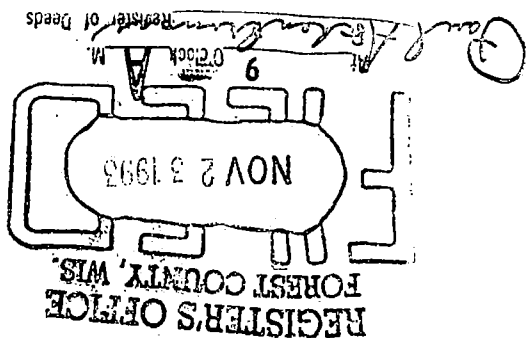

(1) I, WAYNE G. DOBBRATZ

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature


Date

9/19/93

CERTIFICATE READY FOR FILING:

Acting

District Ranger

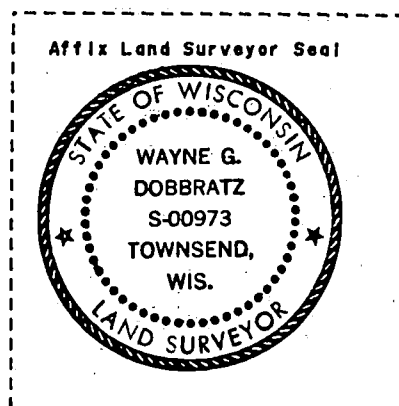


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS :**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 34 and 35, T.34N., R.16E.

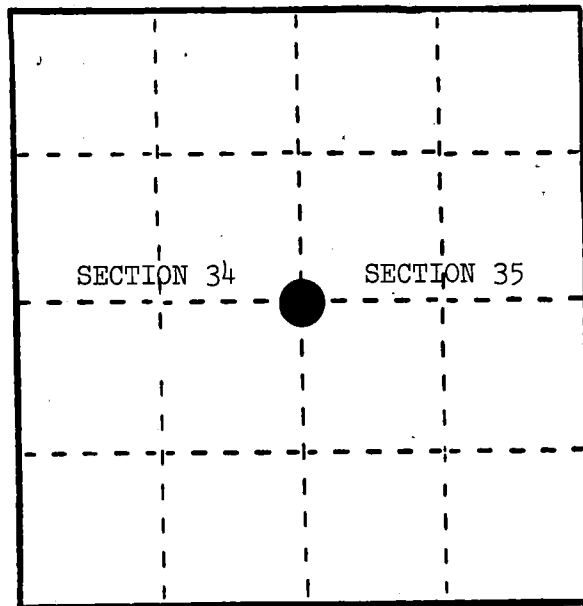

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 18", S.48°E., 9 links; Sugar, 10", S.47°W., 35 links. 13.10 chains south, Sugar, 14"

June 11, 1984, Milo Stefan set proportionate position--searched area, found blazed line running north (25-30 years old). No other evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
- Yellow Birch, 8", S.74°E., 36.09'
- Sugar, 18", S.53°W., 117.35'
- Hemlock, 12", N.43°W., 69.93'
- Steel Sign Post, Northeast, 1.2'

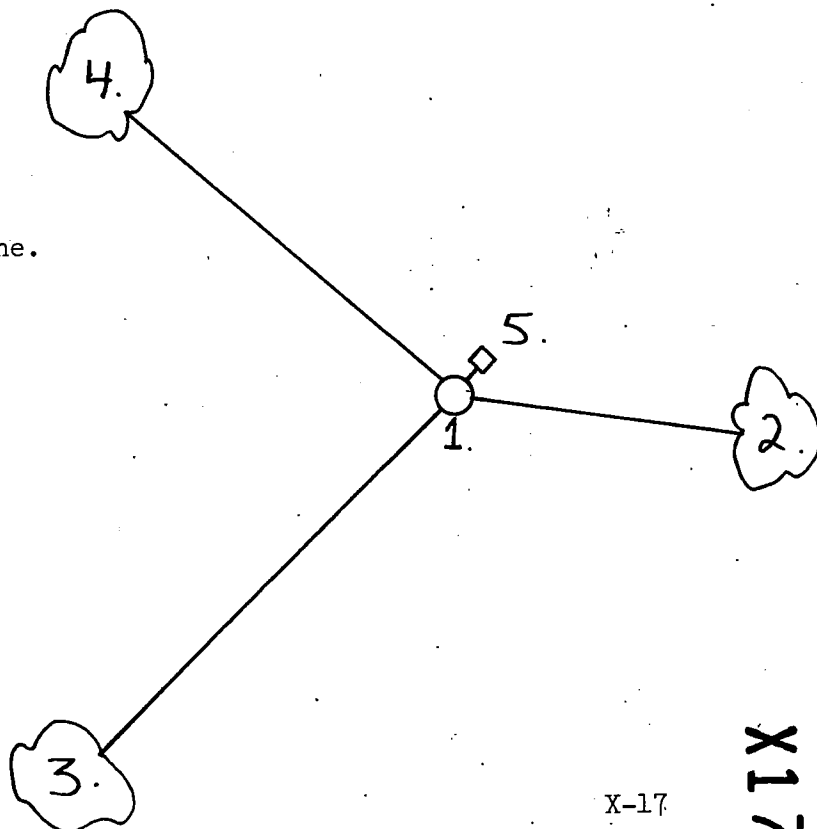

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day
of January... A.D., 1985 at

8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 8-17
Paul Ackerman
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


Neither.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

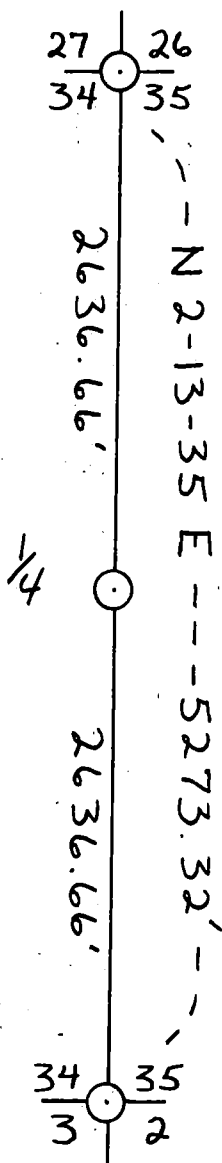

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

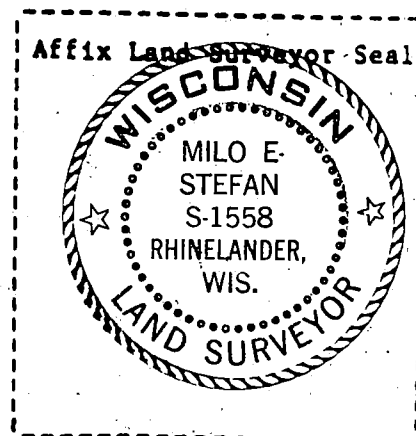

Signature


Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner to Sections 35 and 36, T.34N., R.16E.

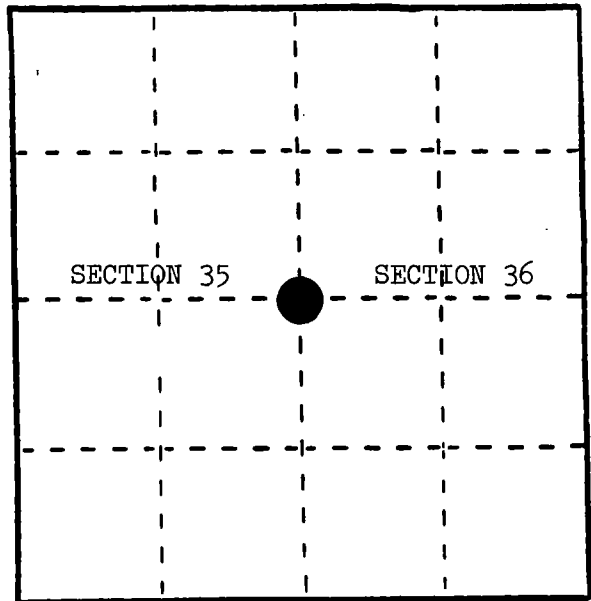

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with the following BTs: Sugar, 6", N.35°W., 11 links; Hemlock, 10", S.83°E., 17 links.

August 28, 1984, Alan Harrison set proportionate position--searched area, found no evidence of corner position. Position falls on north sloping rock outcrop.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
2. Red Maple, 8", N.29°E., 24.34'
3. Red Oak, 6", S.79°E., 34.66'
4. Red Oak, 12", S.28°W., 12.17'
5. Steel Sign Post, Southeast, 2.51'

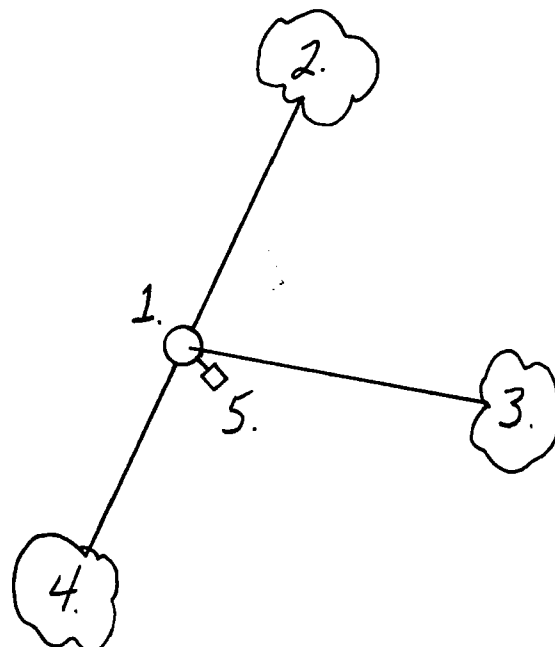

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this 25th day
 of January, A.D., 1985 at
8:30 o'clock, A.M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 121
Paul Aschenbrenner
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

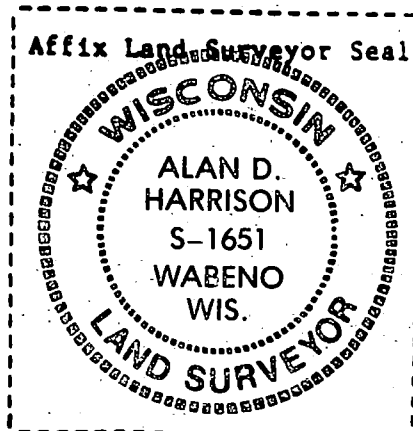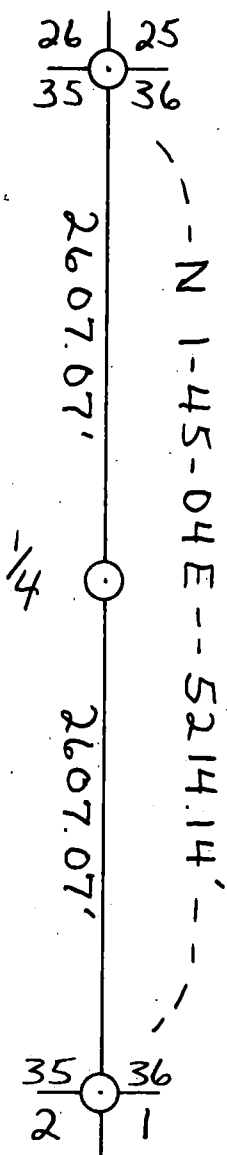

(1) Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/10/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 31 and 36, T.34N., R.16-17E.

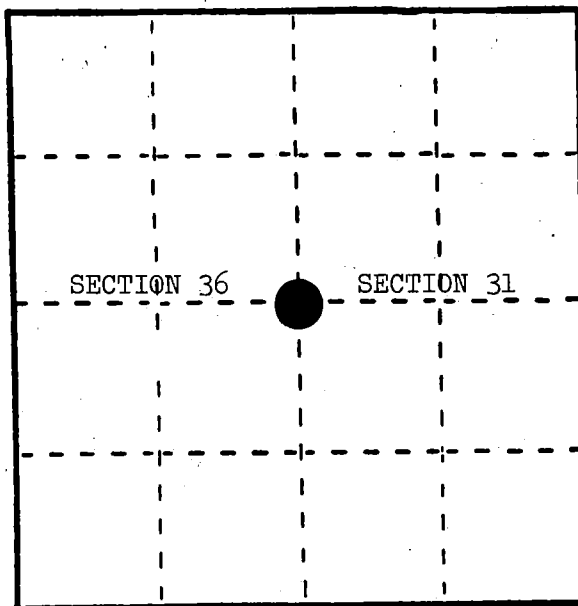

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1839, Tom Sprague set post with the following BTs: Hemlock, 12", S.51°W., 15 links; Hemlock, 12", N.13°W., 8 links. 5 chains south, descend hill--enter swamp.

In 1944, Owen Smith set new $\frac{1}{4}$ at proportional position. Made the following new BTs: White Pine, 14"; Red Oak, 8".


August 30, 1974, Resvick found slab of old post lying on ground; Forest Service poster and Marathon Paper Company tag on tree east of post; post hole which contained fibers of post point.

April 16, 1984, Milo Stefan found post hole and fallen post of Owen Smith's corner from Pine and Oak BTs.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Red Oak, 10", N.18°E., 16.15'
3. Hemlock, 6", S.33°E., 62.28'
4. Red Oak, 7", N.10°W., 27.70'
5. Steel Sign Post, North, 1.42'
6. Smith's White Pine, S.3°E., 35.55'

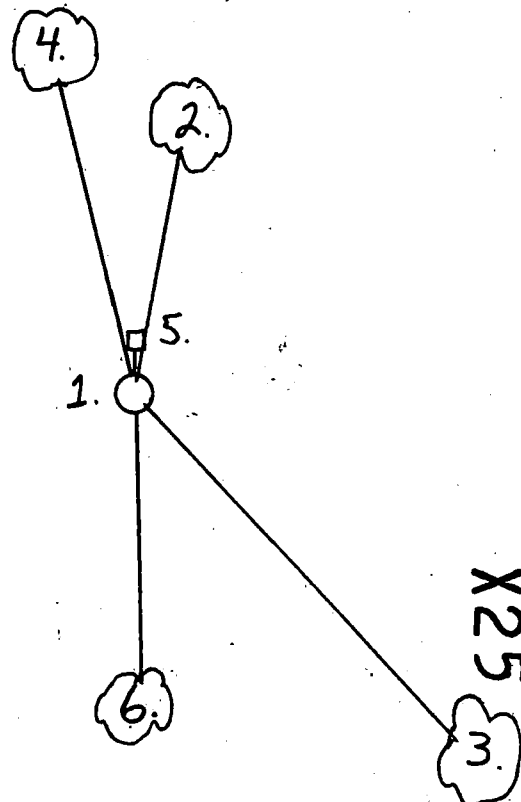

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 25th day
of January, 1985 A.D., at
8:30 o'clock, A.M. and

recorded in Vol. CORNER RESTORATIONS

on page X-25
Paul Aschenbrenner
REGISTER

X-25

43416362000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Neither.

(i) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Affix Land Surveyor Seal




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Town corner common to Sections 1, 6, 31, and 36, T.33-34N., R.15-16E.

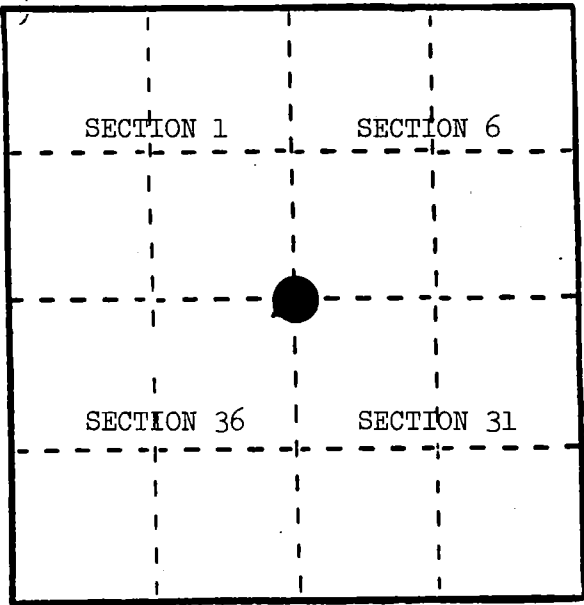

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post at 92.34 chains with the following BTs: Yellow Birch, 15", N.21°W., 41 links; Cedar, 11", N.21°E., 50 links; Yellow Birch, 14", S.49°E., 47 links; Yellow Birch, 17", S.46°W., 12 links. 3.00 chains north, swamp, 14.38 chains north, Cedar, 9", 9.00 chains south, Alder bottom, 5 chains west, swamp, 8.40 chains west, Oconto River.

April 16, 1984, Milo Stefan (from natural feature calls) found Birch stump and pulled N.46°E., 7.92', and found post hole from which a Birch stump bears N.21°W., 27.06'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1. 2" x 36" aluminum monument stamped to identify corner location.
- 2. Sugar, 4", N.15°E., 6.52'
- 3. Basswood, 10", S.56°E., 41.50'
- 4. Red Maple, 9", S.55°W., 22.16'
- 5. Sugar, 4", N.14°W., 71.14'
- 6. Steel Sign Post, Northeast, 1.60'

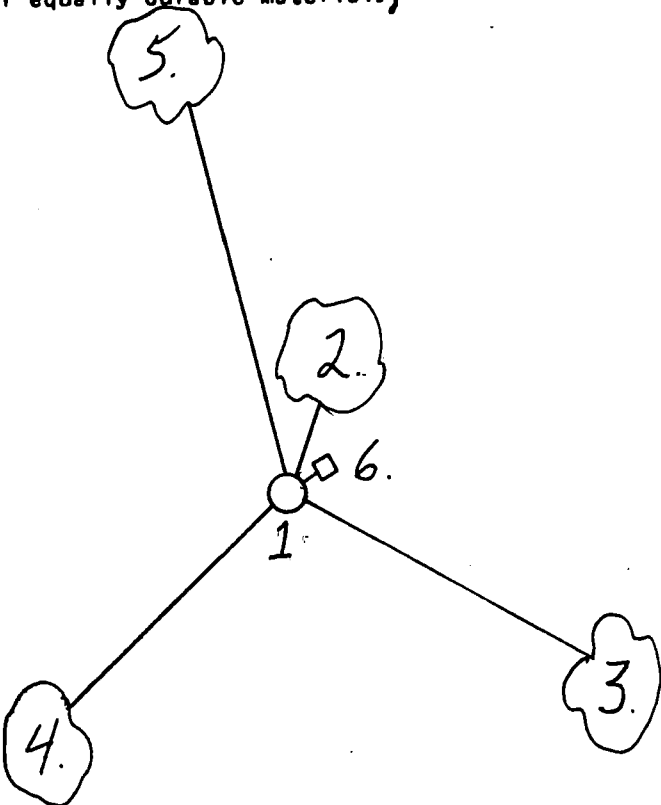

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 25th day
of January, 1985, at
8:30 o'clock A.M. and
recorded in Vol. CORNER RESTORATIONS
on page 7-1
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

(i) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/12/84
Date

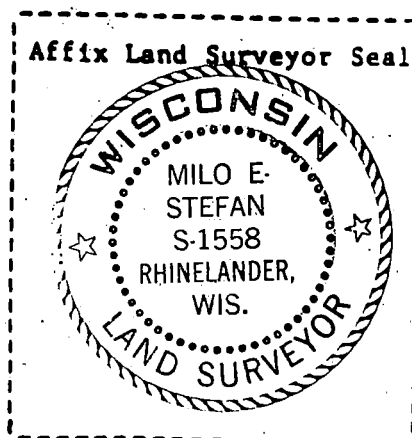


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 6 and 31,
T.33-34N., R.16E.

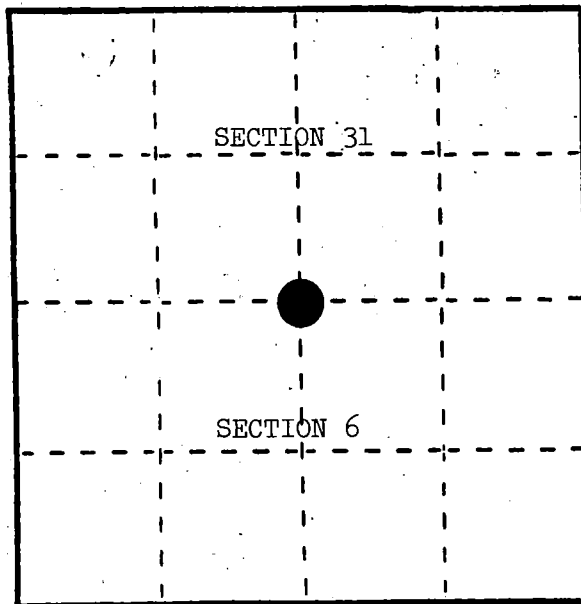

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Beech, 8", N.40°W., 27 links; Sugar, 18", S.5°E., 8 links.


September 17, 1969, Resvick searched area and found no evidence of corner location.

May 16, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 6", N.41°E., 17.46'
3. White Ash, 12", S.54°E., 36.08'
4. Sugar, 8", S.69°W., 28.42'
5. Steel Sign Post, Northeast, 1.1'

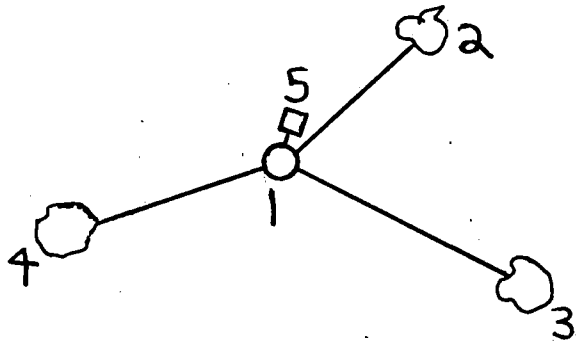

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 25th day

of January... A.D., 1985 at

8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 7-3
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate.

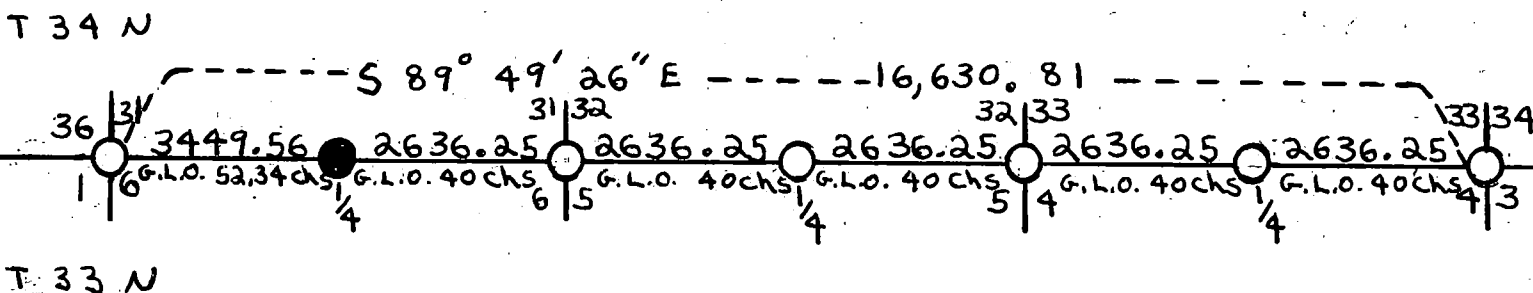

Affix Land Surveyor Seal



- (1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 5, 6, 31, and 32,
T.33-34N., R.16E.

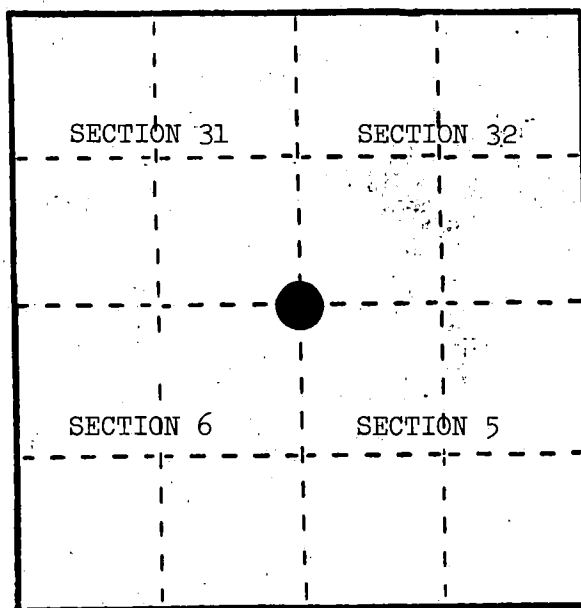

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Sugar, 15", N.18°W., 68 links; Sugar, 12", N.72°E., 17 links; Linn, 15", S.40°E., 60 links; Elm, 12", S.30°W., 22 links.

May 16, 1984, Alan Harrison set proportionate position. Searched area, found no evidence of corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Basswood, 7", N.76°E., 48.88'
3. White Ash, 9", S.75°E., 83.39'
4. Sugar, 7", S.46°W., 19.88'
5. Sugar, 6", N.11°W., 17.68'
6. Steel Sign Post, Northeast, 1.6'

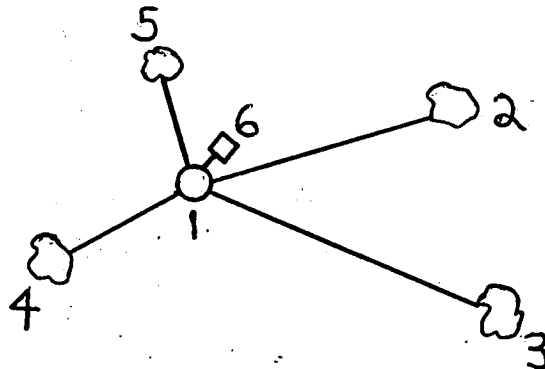

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day
of January... A.D., 1985 at
8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS
on page 7-5

Paul A. Schreiner
REGISTER

4341631 0000

Z-5

25

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes. Single proportionate.

T 34 N

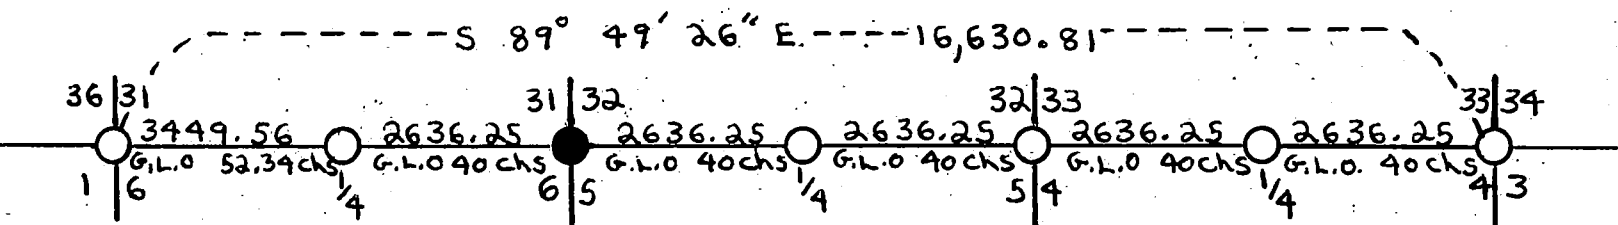

T 33 N

Affix Land Surveyor Seal



(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature


11/30/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 5 and 32, T.33-34N., R.16E.

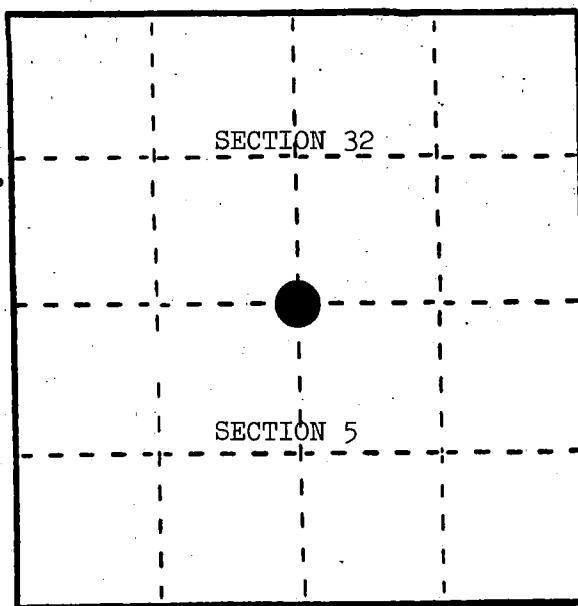

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Sugar, 10", N.8°W., 7 links; Ironwood, 9", S.20°W., 24 links.

May 29, 1984, Milo Stefan set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
2. Sugar, 7", N.41°E., 38.84'
3. Sugar, 9", S.16°E., 55.06'
4. Basswood, 10", N.38°W., 20.24'
5. Steel Sign Post, Southwest, 1.6'

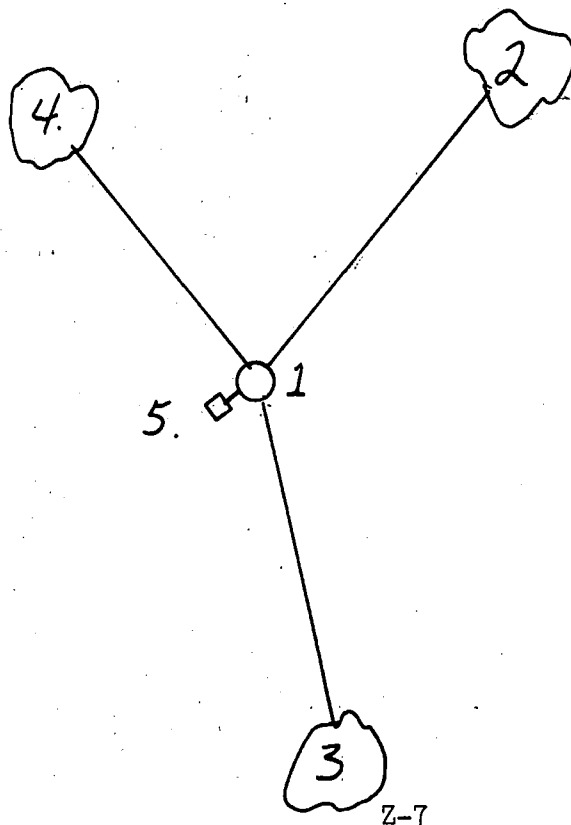

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this... 25th day
 of... January... A.D., 1985 at
 ... 8:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATIONS

on page 7-7
Paul Aschenbrenner
 REGISTER

43416320020

Z-7

27

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

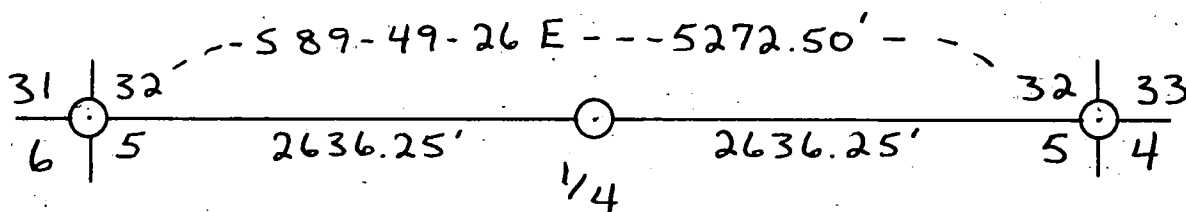

- (i) 1. Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/12/84
Date

Affix Land Surveyor Seal




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Section corner to Sections 4, 5, 32, and 33, T.33-34N., R.16E.

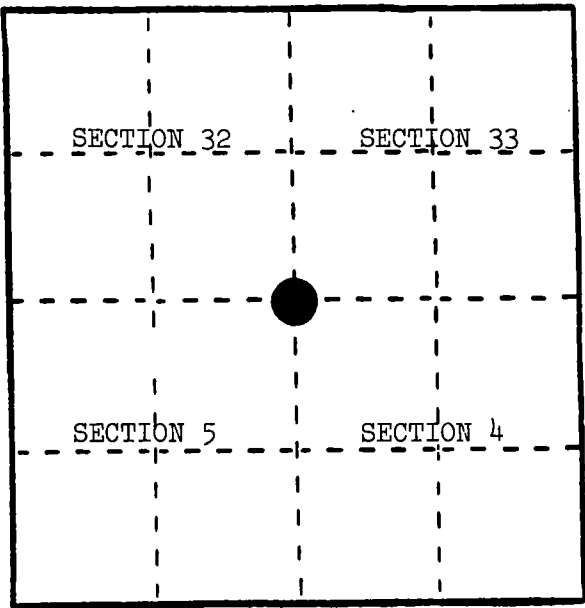

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Beech, 15", N.40°W., 77 links; Sugar, 14", N.15°E., 16 links; Sugar, 24", S.16°E., 58 links; Ironwood, 8", S.45°W., 5 links.

May 16, 1984, Milo Stefan set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 7", N.42°E., 24.79'
3. Sugar, 4", S.72°E., 18.45'
4. White Ash, 11", S.56°W., 11.20'
5. White Ash, 8", N.34°W., 6.20'
6. Steel Sign Post, Northeast, 1.1'

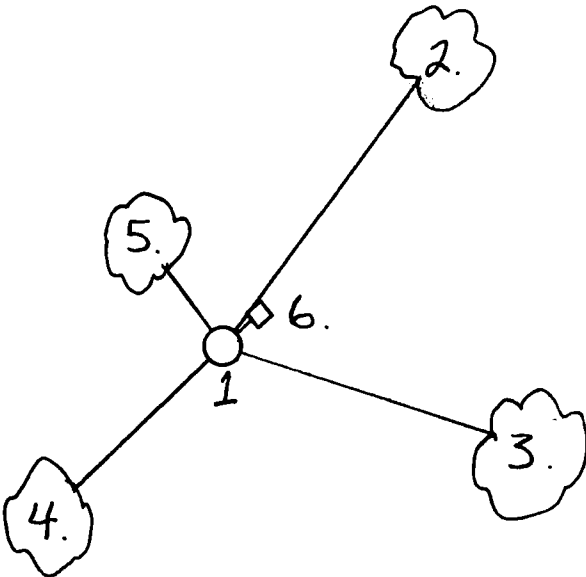

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this... 25th day
of... January... A.D., 1985
... 8:30 A.M. and
recorded in Vol. CORNER RESTORATIONS
on page 7-9
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

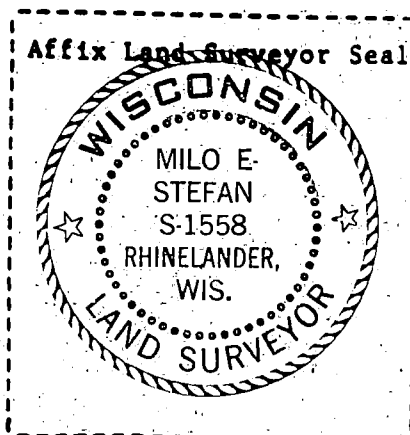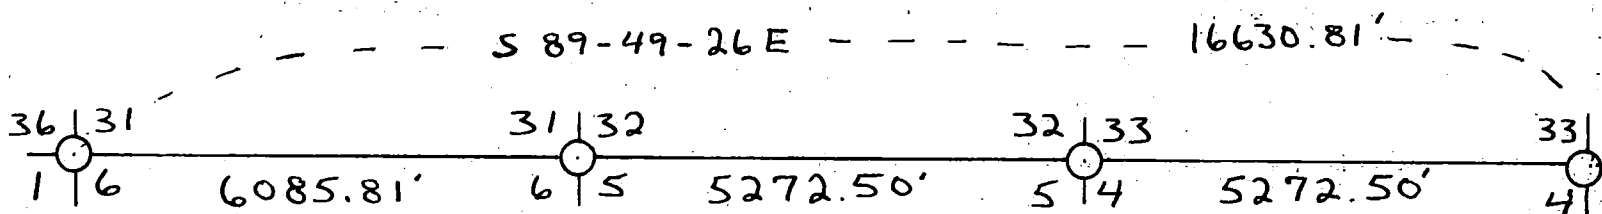

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature


12/22/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 4 and 33, T.33-34N.
 R.16E.

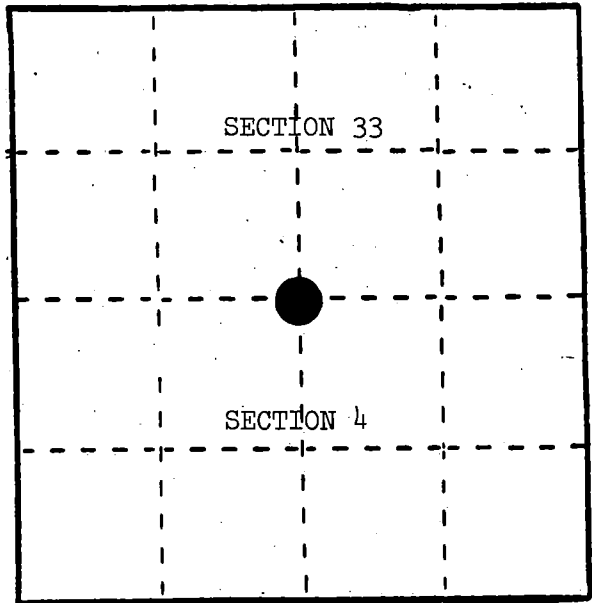

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Beech, 14", N.38°W., 57 links; Beech, 10", S.19°E., 7 links.

June 11, 1984, Milo Stefan set proportionate position--searched area, found no evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
2. Sugar Maple, 8", N.62°E., 8.73'
3. Sugar Maple, 8", S.06°W., 66.28'
4. Yellow Birch, 8", S.65°W., 58.32'
5. Steel Sign Post, Northwest, 1.3'

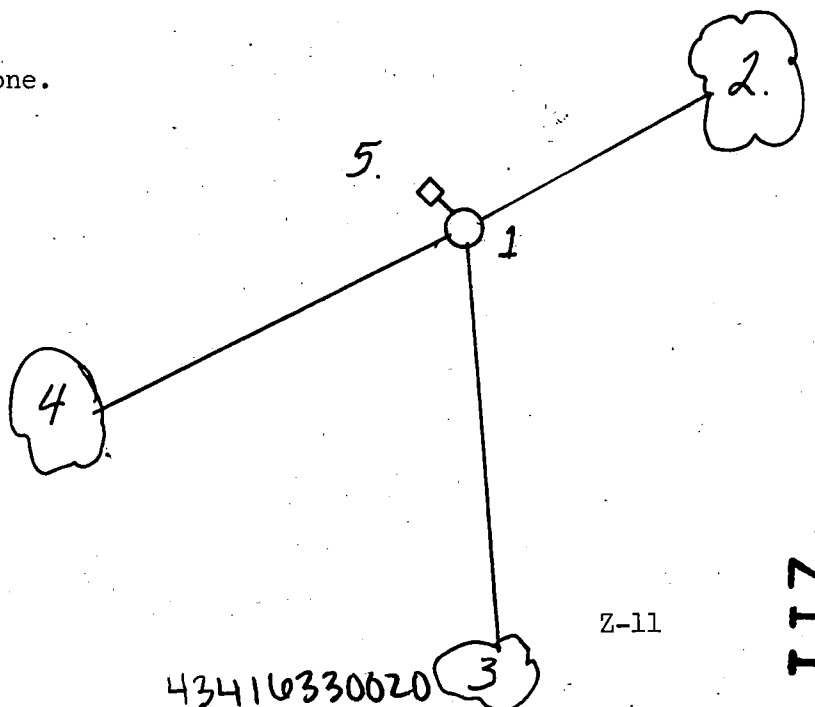

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this... 25th day
 of... January... A.D., 1985 at
 8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 7-11... Paul Aschenbrenner
 REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

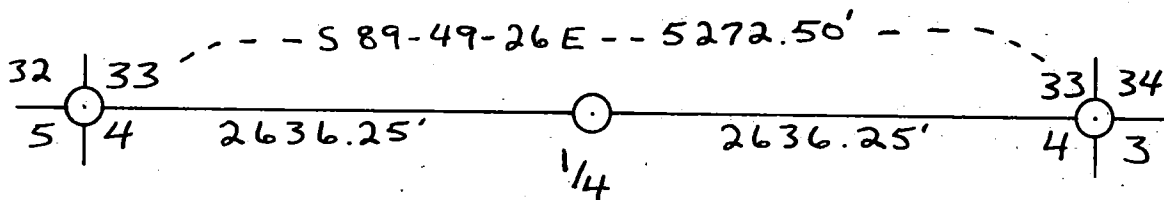

Affix Land Surveyor Seal



Milo E. Stefan

(i) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/12/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

SOUTHWEST CORNER OF SECTION 34, TWP.34 N.,
 R. 16 E.

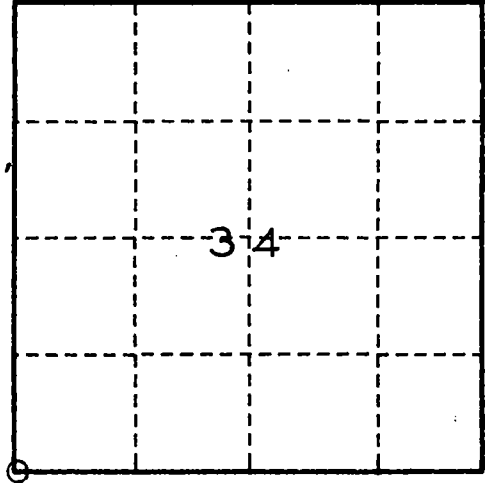

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - ORIGINAL SURVEY BY CURTIS, SET SECTION CORNER, B.Ts - Y. BIRCH 12" S.21°E. 21 LKS., CEDAR 14" N.17°E. 9 LKS., CEDAR 14" S.19°W. 28 LKS., CEDAR 14" N.53°W. 23 LKS.

1974 - RESVICK, R.L.S. NO. S-802, SET SECTION CORNER - 2" DIA. IRON PIPE WITH BRASS CAP, B.Ts - YELLOW BIRCH 8" N.17°E. 4.98FT., CEDAR 10" S.71°W. 14.18FT., ELM 6" S.33°E. 8.45FT., HEMLOCK 7" N.70°W. 22.34FT., WITNESS- STEEL SIGN POST SE 0.50FT.


1993 - DOBBRATZ, R.L.S. NO. S-973, FOUND MONUMENT, SIGN POST AND 2 OF THE ABOVE B.Ts STILL ALIVE - CEDAR 12" S.71°W. 14.18FT. AND HEMLOCK 8" N.70°W. 22.34FT., OTHERS ARE DEAD OR DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

WITNESS

1. B.T. HEMLOCK 12" N.87°E. 30.80FT. (NEW)
2. STEEL SIGN POST SE 0.50FT. (NEW)
3. B.T. ASH 9" S.32°W. 25.23FT. (NEW)
4. B.T. CEDAR 12" S.71°W. 14.18FT. (EXISTING)
5. B.T. HEMLOCK 8" N.70°W. 22.34FT. (EXISTING)
6. 2" DIA. IRON PIPE WITH BRASS CAP AT SECTION CORNER (EXISTING)

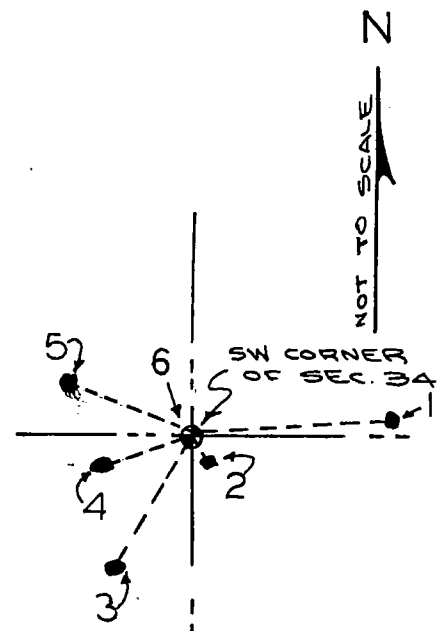


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

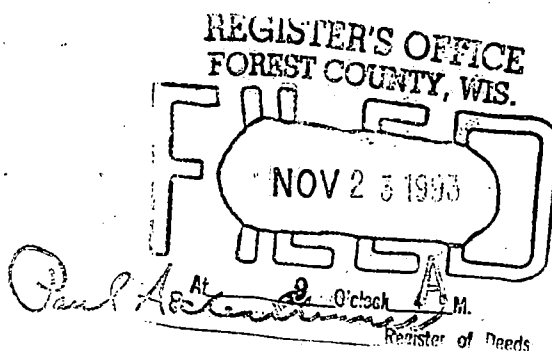

(1) I, WAYNE G. DOBBRATZ
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

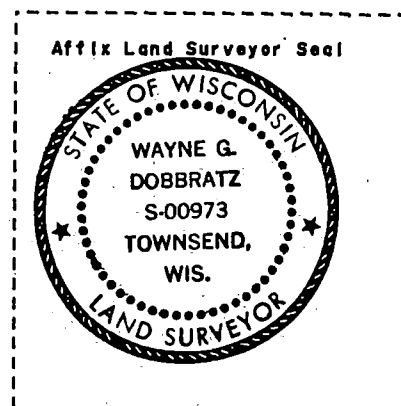

Wayne G. Dobbratz 9/26/93
Signature Date

CERTIFICATE READY FOR FILING:

Ralph [unclear] 11-5-93
Acting District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 9th day of July, 19 73, I found evidence of the Southeast Section corner of Section 33 Township 34N, Range 16E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1857 by Artemas Curtis 80.00 chains west between sections 3 and 34 set post
 Cedar 14 inches, bears N17°E 9 lks.
 Y. Birch 12 inches, bears S21°E 21 lks.
 Cedar 14 inches, bears S19°W 28 lks.
 Cedar 14 inches, bears N53°W 23 lks.



Description of corner evidence found:

1. wood post point
2. Cedar fallen bears N14E 9 lks.
3. Y. Birch stump bears S18E 21 lks.
4. Cedar stump bears S22W 28 lks.
5. Cedar stump bears N50W 23 lks.
6. Y. Birch 8 inches, bears N17E, 4.98 ft.
7. Cedar 10 inches bears S71W, 14.18 ft.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced wood post point with a 2 inch inside diameter galvanized pipe 5 feet long filled with concrete with a brass cap marked T34N, R16E, S33, S34, S4, S3, T33N, 1974, S-802

From which the following new bearing trees bear
 Elm 6 inches, bears S33°E 8.45 ft.
 Hemlock 7 inches, bears N70°W 22.34 ft.
 Steel sign post SE, 0.5 ft.

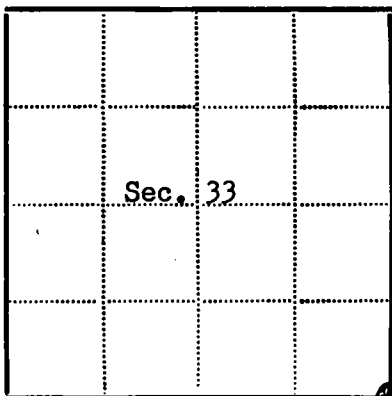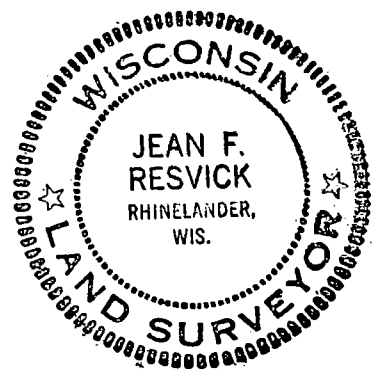

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 28 day of Feb. 19 74.

Signature Jean F. Resvick Title Land Surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT
Number 105094

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5th day of April 19 74, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 34N, Range 16E, Section 33, Index No. Z-13, Page No. _____

H3411233 0000


213

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 3 and 34, T.33-34N., R.16E.

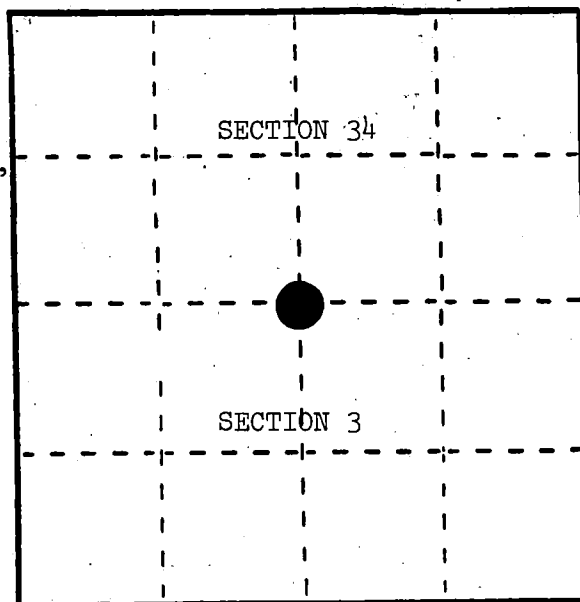

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Sugar, 9", N.56°W., 14 links; Hemlock, 28", S.62°E., 43 links.

May 3, 1984, Milo Stefan set proportionate position--searched area for original corner location, found no evidence. A painted line ran north and south.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
- Hemlock, 16", N.51°E., 57.00'
- Red Oak, 16", S.35°E., 50.75'
- Yellow Birch, 9", N.68°W., 26.68'
- Steel Sign Post, West, 1.4'

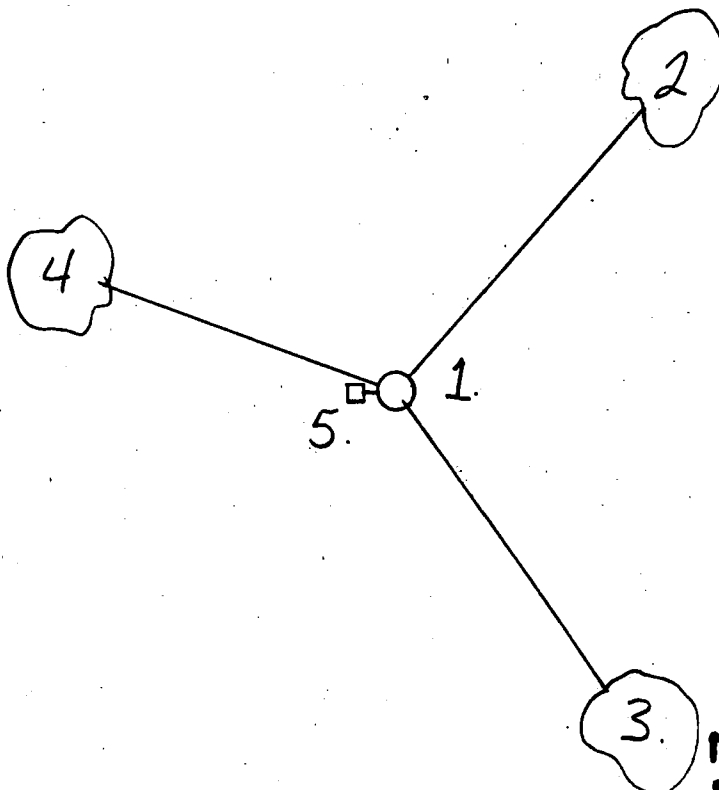

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this... 25th day
 of... January... A.D., 1985 at
 8:30 o'clock... A.M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 7-15
 Paul Aschenbrenner
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

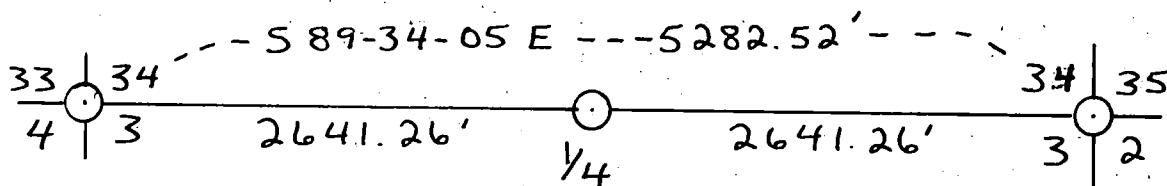

Affix Land Surveyor Seal



- (i) 1. Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature


12/12/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section corner to Sections 2, 3, 34, and 35, T.33-34N., R.16E.

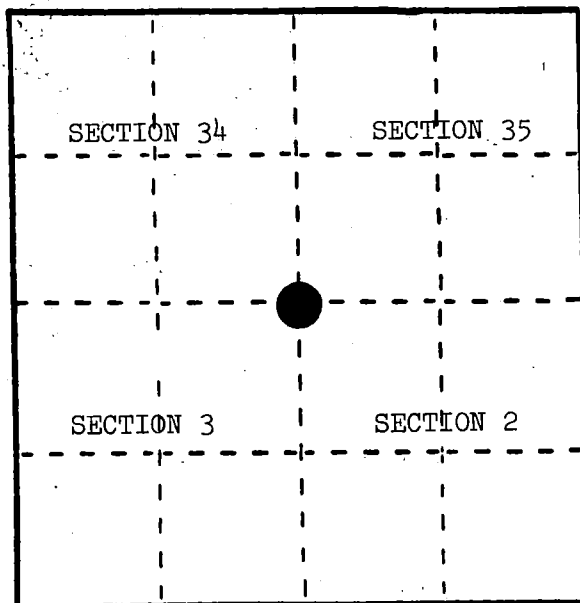

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post with the following BTs: Yellow Birch, 12", N.6°W., 46 links; Hemlock, 18", N.62°E., 8 links; Sugar, 10", S.78°E., 18 links; Hemlock, 20", S.64°W., 34 links.

May 2, 1984, Milo Stefan set proportionate position--searched area; found a location poster in wheel tracks of skidder trail. Could not find corner or BTs. Proportionate position falls near location tag.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
- Red Oak, 7", N.58°E., 62.25'
- Red Oak, 12", S.16°E., 44.51'
- Red Oak, 16", S.78°W., 68.88'
- Sugar, 8", N.30°W., 23.24'
- Steel Sign Post, West, 2.00'

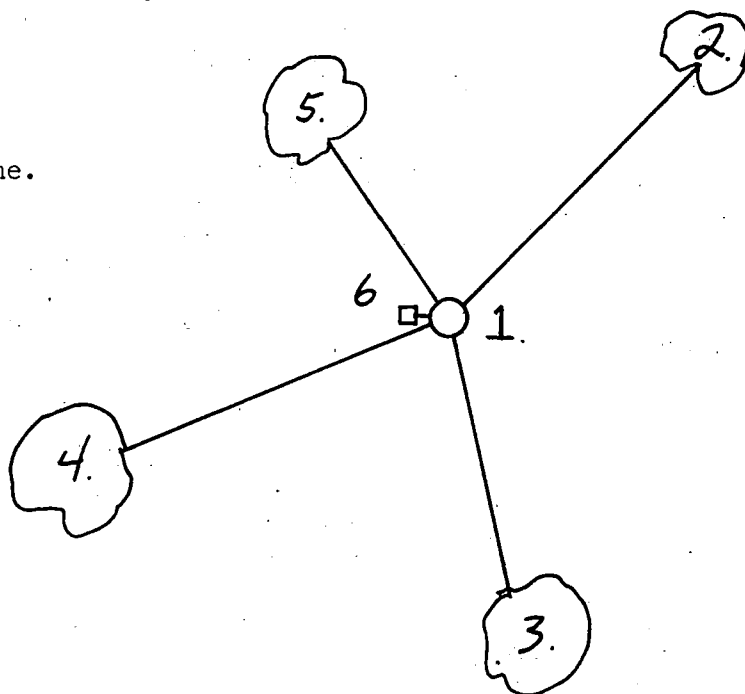

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this 25th day
 of January.....A.D., 1985 at
8:30 o'clock.....A.....M. and
 recorded in Vol. CORNER RESTORATIONS
 on page 7-17

Paul Aschenbrenner
 REGISTER

Z-17

43416340000

217

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Neither.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

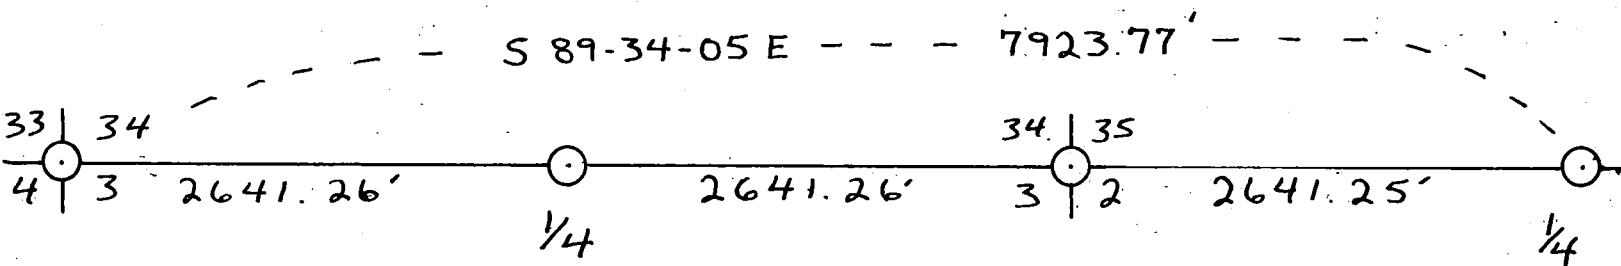

(1) Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/12/84
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 2 and 35, T.33-34N., R.16E.

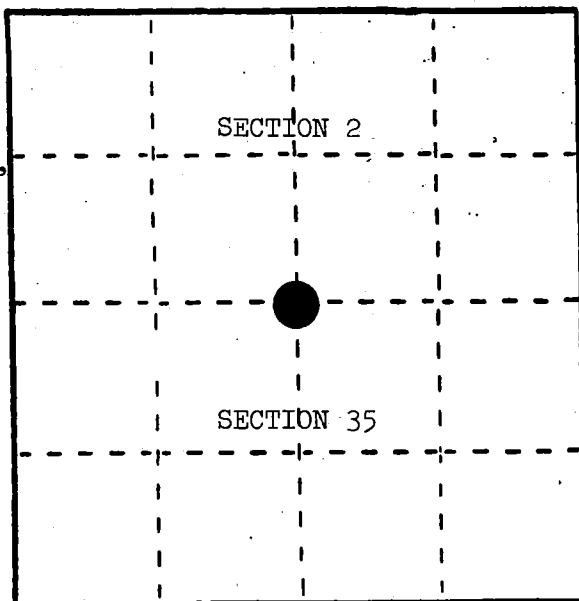

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set post with the following BTs: Hemlock, 26", N.62°W., 36 links; Beech, 15", S.46°E., 35 links.

April 27, 1984, Milo Stefan set proportionate position--searched area, found a post hole with burnt post point, 20" deep; also, found double Beech progeny at S.46°E., 23.10'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument stamped to identify the corner; in a mound of stone.
- White Pine, 5", S.76°E., 81.21'
- Red Oak, 8", S.23°E., 50.34'
- Red Oak, 10", N.33°E., 42.53'
- Steel Sign Post, Northeast, 1.7'

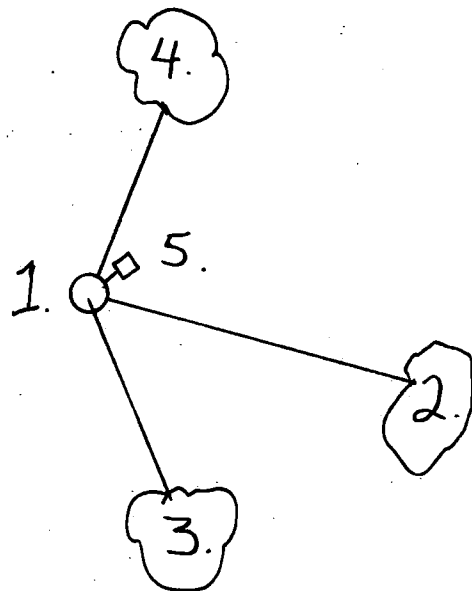

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this... 25th day
 of... January... A. D., 1985 at
 ... 8:30 o'clock... A... M. and
 recorded in Vol. CORNER. RESTORATIONS
 on page 2-19
Paul A. Schenck
 REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) 1. Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/12/84
Date

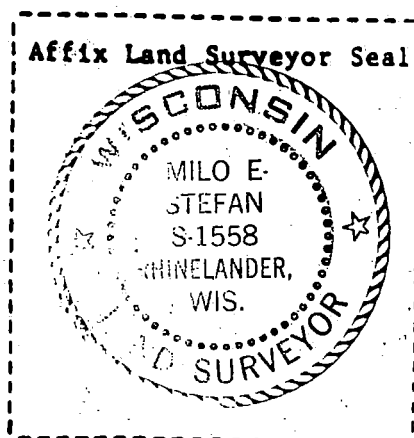

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 1, 2, 35, and 36,
T.33-34N., R.16E., Forest and Marinette
Counties, Wisconsin.

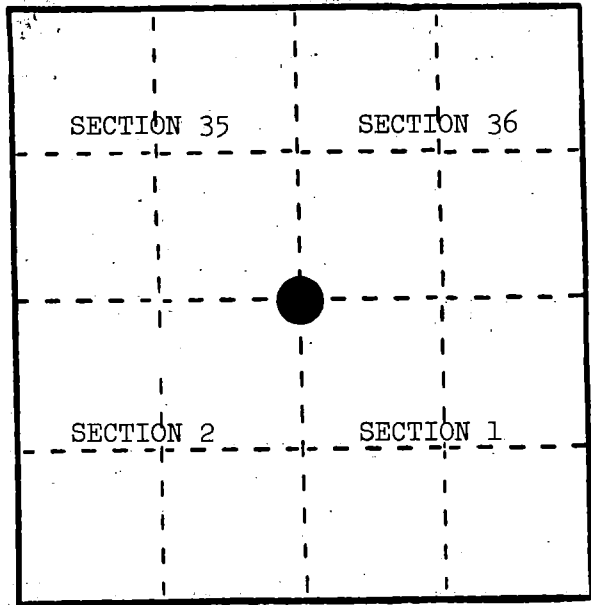


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Corner position found marked by a rock pile with a rusted location poster in it. Blazes on Red Oak, N.12°E., 7.32'; Red Maple, S.62°E., 10.55'. Stump hole, S.53°E., 22.40'; stump hole, S.73°W., 13.20'. We placed a 2" x 36" aluminum monument in said mound of stone.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Red Oak, 12", N.11°E., 7.33'
2. Red Oak, 12", S.41°E., 12.98'
3. Sugar Maple, 5", S.54°W., 10.50'
4. Sugar Maple, 6", N.50°W., 54.27'
5. Steel Sign Post, Southeast, 1.4'
6. 2" x 36" aluminum monument stamped to identify the corner.

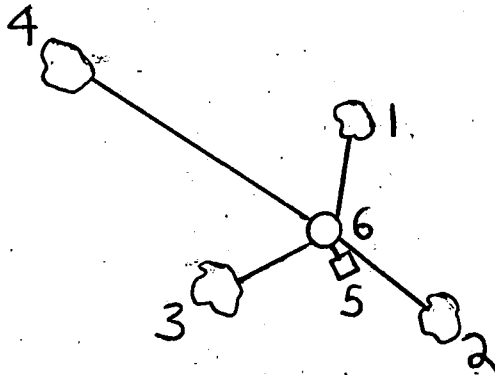

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day
of... A.D., 19... at
... o'clock... M. and

recorded in Vol. **CORNER RESTORATIONS**
on page **3-21**

Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between Sections 1 and 36,
T.33-34N., R.16E.

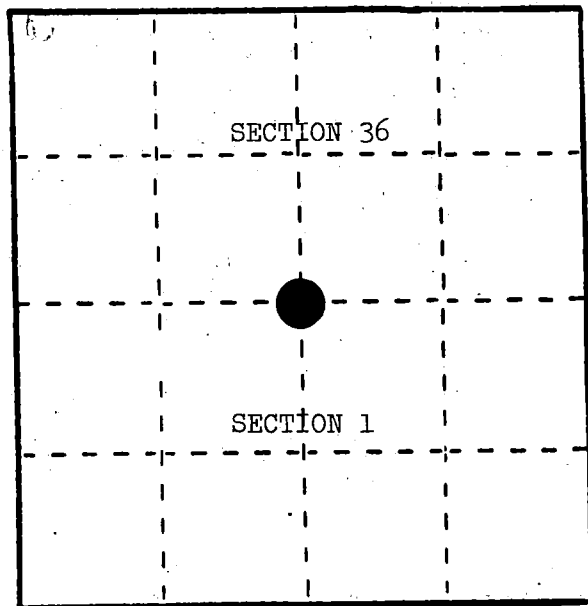

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set wood post with the following BTs: White Birch, 8", N.45°E., 39 links; White Pine, 18", S.83°W., 160 links.


April 16, 1984, Milo Stefan found fence corner; also, found post fallen down with Forest Service tag--found no post hole.

November 2, 1984, Milo Stefan set proportionate position, which agrees with N. Smith's 1922 survey of Section 1, T.33N., R.16E.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Red Oak, 10", S.29°E., 39.49'
3. Red Oak, 9", S.14°W., 6.81'
4. Red Oak, 9", N.11°E., 29.79'
5. Steel Sign Post, Northeast, 1.19'

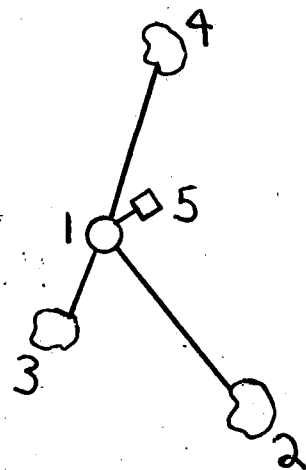

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... day

of... January... A.D., 1985 at

8:30 o'clock... A.M. and

recorded in Vol. CORNER RESTORATIONS

on page 7-23

Paul Ackembrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

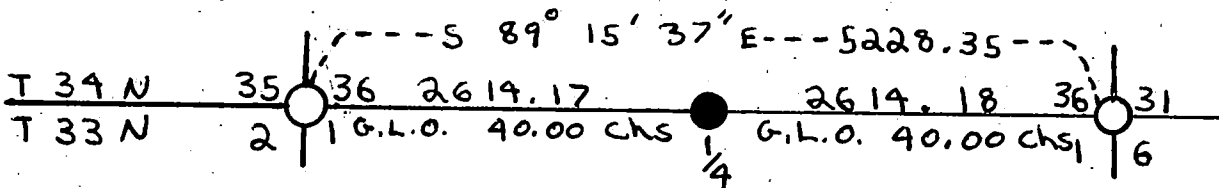

Affix Land Surveyor Seal



(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

11/30/84
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Township corner to T.33-34N., R.16-17E., Forest, Marinette, and Oconto Counties, Wisconsin.

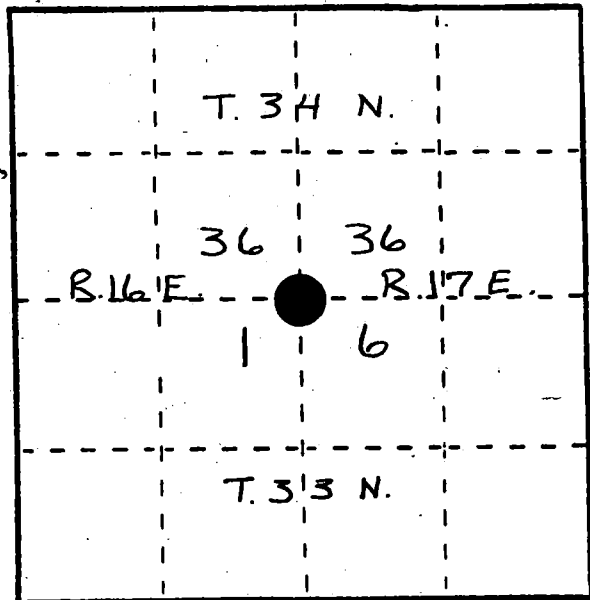


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found Oconto County monument in place alongside 1" iron pipe and fallen post in a mound of earth.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Red Oak, 10", N.74°E., 82.90' (New BT)
2. White Pine, 16", S.37°E., 66.10' (New BT)
3. White Pine, 14", S.57°W., 34.29'; 1" iron rod in front of tree.
4. White Pine, 16", N.54°W., 110.73' (New BT)
5. Steel Sign Post, North, 1.2' (New)
6. Oconto County Monument

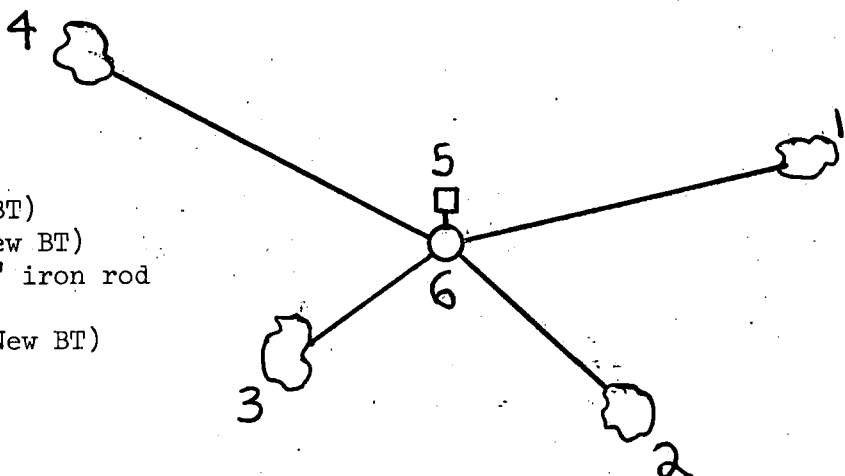

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this... 25th day
 of... January... A. D., 1985 at
 ... 8:30 o'clock... A... M. and

recorded in Vol. CORNER RESTORATION
 on page 25

Paul Aschenbrenner
 REGISTER

43416360000

Z-25

225

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal

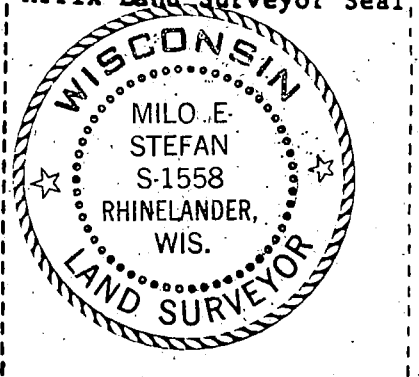

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 1 & 2,
T.35N., R.16E., & Sections 35 & 36,
T.36N., R.16E., 4th P.M.

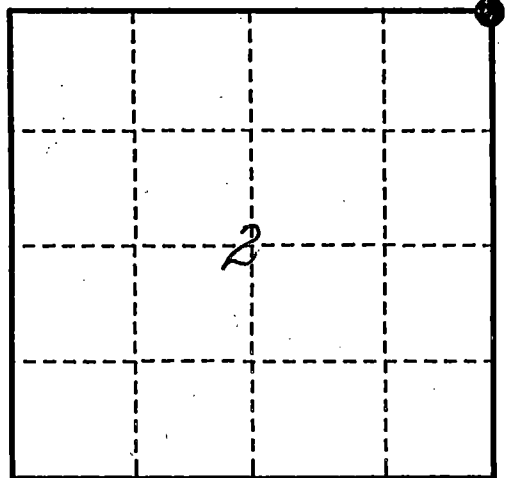

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Found monument as set by Resvick in 1969. Three BTs and sign post in good condition. Elm BT is dead.

Made one new BT: Basswood, 10", N.62°W., 23.90'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" Iron pipe/brass cap.
2. Sugar Maple, 8", N.46°E., 27.59'.
3. Basswood, 10", S.77°E., 43.52'.
4. Sugar Maple, 6", S.40°W., 5.19'.
5. Basswood, 10", N.62°W., 23.90'.
6. Steel sign post, South, 1.6'.

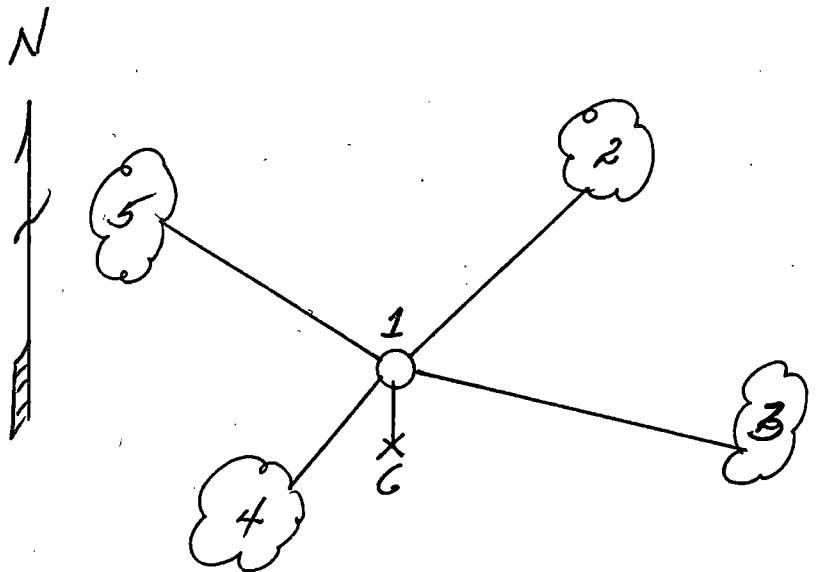

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 9th day
of March, A.D., 1993 at
9:15 o'clock A.M. and recorded
in Vol 3536 Corner Restorations
page B-21
David Childs Deputy
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

- (1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992

Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 13 & 14,
T.35N., R.16E., 4th P.M.

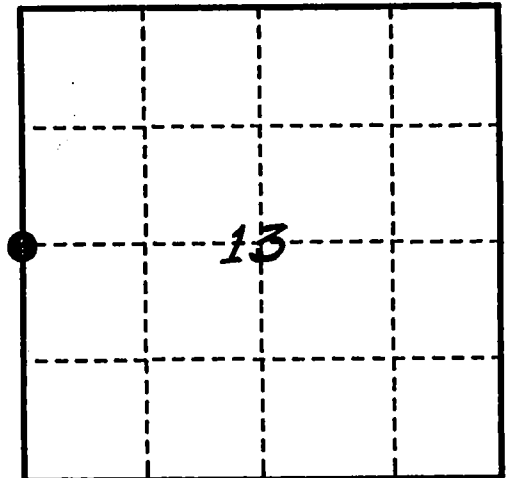

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Found monument, two sign posts and Elm BT in good condition. Aspen BT - dead. We made a new BT: Basswood, 3", N.13°E., 36.70'.

This corner was restored by Pritzlaff and Lenca in 1985.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" Aluminum monument.
2. Basswood, 3", N.13°E., 36.70'.
3. Steel sign post, N.36°E., 6.6'.
4. Aspen (dead), 5", S.65°E., 10.58'.
5. Steel sign post, S.29°W., 5.9'.
6. Elm, 5", N.29°W., 97.85'.

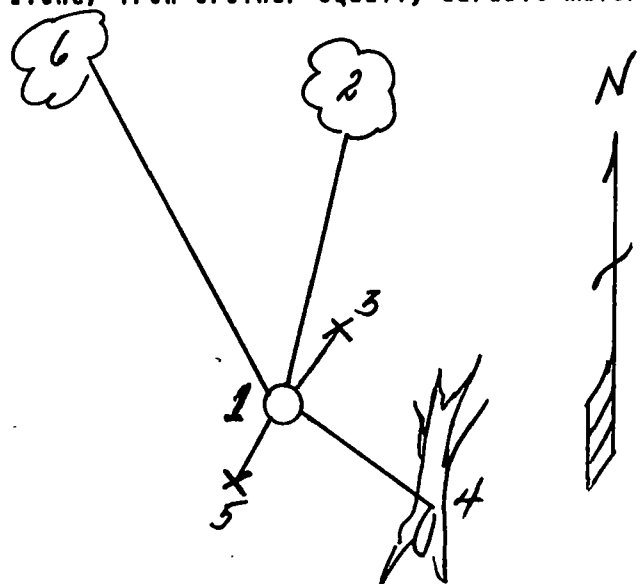

REGISTER'S OFFICE!
Forest County, Wis.

Received for record this 9th day
of March, A.D., 1995 at

9:15 o'clock A. M. and recorded

In Vol. 35-16 Casey Restorations

page 2-21

Paul Chittos Deputy
Register of Deeds

43516142000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992
Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

West Sixteenth Corner between Sections
13 & 24, T.35N., R.16E., 4th P.M.

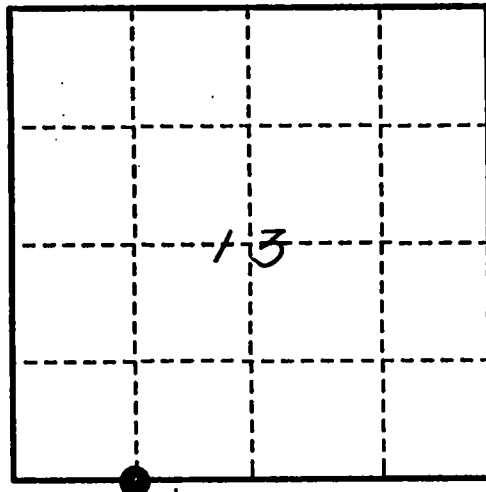

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found monument and sign post as set by Pritzlaff and Lenca in 1985 in good condition.
All three BTs down and/or dead. We made two new BTs:


White Spruce, 4", N.75°W., 61.07'

Black Cherry, 3", N.7°W., 72.47'

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" Aluminum monument.
2. Spruce (dead), 30", N.12°E., 51.45'.
3. Elm (dead), 8", S.23°W., 24.86'.
4. Aspen (wind-thrown), 8", N.74°W., 51.20'.
5. White Spruce, 4", N.75°W., 61.07'.
6. Black Cherry, 3", N.7°W., 72.47'.
7. Steel sign post, N.65°W., 1.7'.

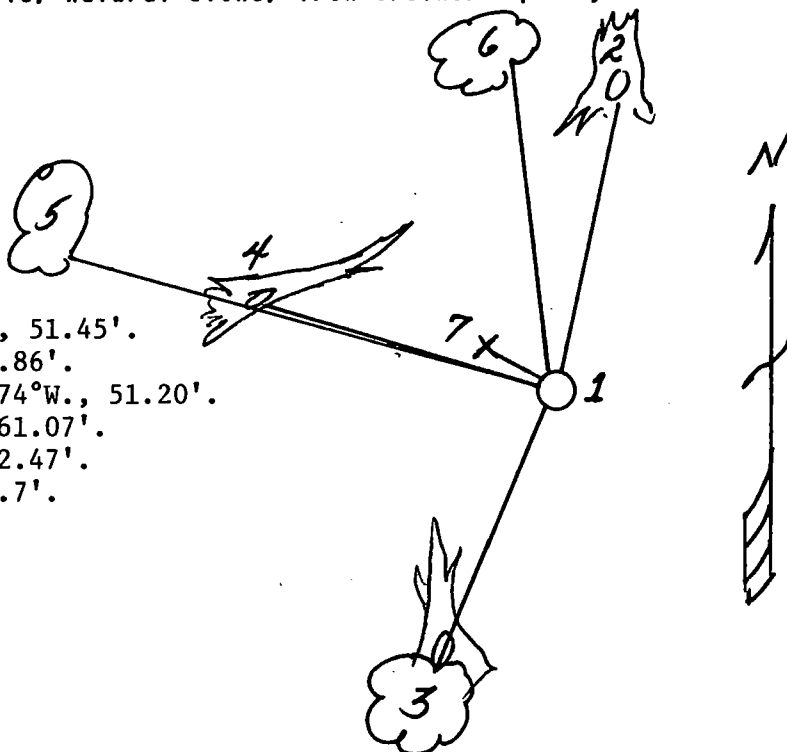

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 9th day
of March, A.D., 19 93 at
9:15 o'clock A.M. and recorded
in Vol. 35-16 Corner Restorations
page 11-22

Shirley Chittlo, Deputy
Register of Deeds

4351613 DB30

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

November 20, 1992

Date

CERTIFICATE READY FOR FILING:

Dale R. Covey
Acting District Ranger

