

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner between Sections 6 and 31, T.35-36N
 R.15E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 142657.11639
 E-2310572.88427

Geographic Coordinates
 N-45-33-00.01245
 W-88-39-53.07803

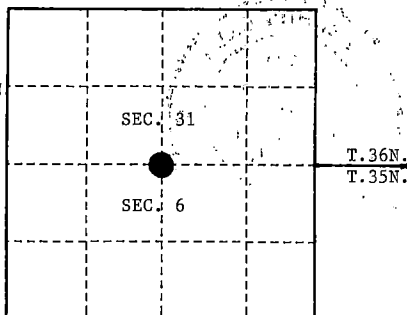

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
 Original survey in 1857 by Artemas Curtis. Setwood post, from which the following bear; Cedar, 8", N.06°W., 29 lks., Cedar, 6", S.12°W., 9 lks. West, 8.75 chains, stream 125 lks. wide runs South-Southeast.


In 1965, Jean Resvick, RLS with the Forest Service, found a 4"x4"x4' high cedar post scribed, 1/4 S. Also found a T-fence North that is approximately 60 years old. Found both original bearing tree stump holes. Measured West 577 feet to stream. Replaced cedar post with a 2"x60" galvanized iron pipe with a brass cap stamped to identify the corner. Blazed and scribed the bearing trees as noted below.

In 1995, Alan Harrison, RLS with the Forest Service, found the monument and bearing trees as set by Jean Resvick in 1965.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2"x60"iron pipe with brass cap stamped to identify corner.
2. Black Ash, 4", N.63°E., 22.18 feet
3. Cedar, 4", S.15°E., 25.72 feet
4. Black Ash, 8", S.45°W., 26.46 feet
5. Balsam, 4", N.18°W., 23.88 feet

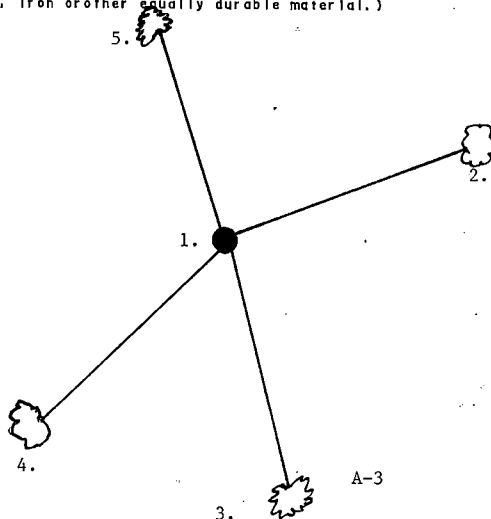

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2.)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 30th day
of November, A.D., 1995, at
1:30 o'clock P.M. and recorded
in Vol. Corr. Restoration
PAGE 35-36-15-17-3
John C. White, Deputy
Register of Deeds

Alan D. Harrison

(1) I,


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:



District Ranger

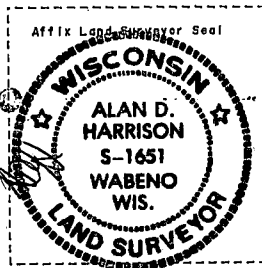

ORIG

SHEET 1 OF 3

Being the North and West Section Lines of Section 2,
Township 35 North, Range 15 East, Fourth Principal Meridian
FOREST COUNTY, WISCONSIN

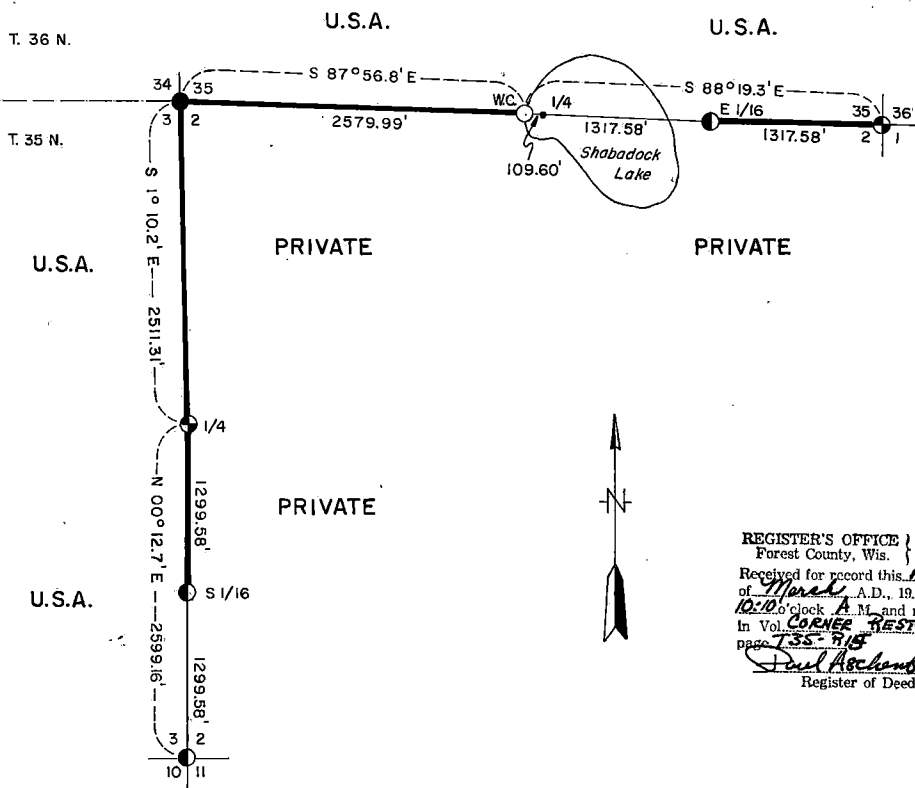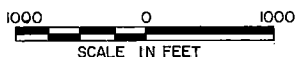

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 14th day
of March A.D., 1986 at
10:10 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 135-115
Paul Aschambrenner
Register of Deeds

LEGEND

- 2" Iron Pipe with Brass Cap, 36" Long
 ● 2" Aluminum Monument, 36" Long
 ● 2" Aluminum Monument, 60" Long
 ○ 2" Aluminum Monument, 120" Long
 — Marked Boundary Line of U.S. Government Lands

Conversion Factor:
Feet to Meters - 0.304801
Meters to Feet - 3.280833

435 15 03 ~~0000~~

Stock No. 26273

Sheet 2 of 3

SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 2 and for locating and marking the boundaries of U. S. Government land on the perimeter of Section 2, Township 35 North, Range 15 East, Fourth Principal Meridian, Forest County, Wisconsin.

The U. S. Government lands in this section were acquired in 1935, 1938, and 1939.

The original Government subdivision survey of this township was made in 1859.

The corner positions recovered, restored, and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 3000.

The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED1. Corner to Sections 1, 2, 35, and 36, T.35-36N., R.15E.

Corner position recovered from the remains of the original bearing trees and distance from recovered original line tree west.

Corner References:

Black Spruce	4"	N.16°E.	20.12 feet
Red Maple	7"	S.69°E.	37.25 feet
Black Spruce	7"	S.26°E.	31.89 feet
White Birch	10"	S.41°W.	9.86 feet
Steel Sign Post		West	1.90 feet

2. Corner to Sections 2, 3, 34, and 35, T.35-36N., R.15E.

Corner found monumented by William Cochrane, R.L.S. Certificate on file.

3. Corner to Sections 2, 3, 10, and 11, T.35N., R.15E.

Corner position found marked by a 5" x 5" Cedar post from which the remains of the original bearing trees were located.

Corner References:

White Birch	8"	N.86°E.	31.14 feet
Balsam	6"	N.56°E.	30.43 feet
White Birch	8"	S.29°E.	44.33 feet
Steel Sign Post		East	1.35 feet

4. Quarter Corner to Sections 2 and 3, T.35N., R.15E.

Corner position found marked by a 2" iron pipe in a mound of rock from which the remains of the original bearing trees and N. Smith's 1907 bearing tree were located.

Corner References:

Hemlock	16"	S.59°E.	57.50 feet
Yellow Birch	12"	S.7°W.	33.80 feet
Basswood	12"	N.39°W.	9.28 feet
Steel Sign Post		South	1.75 feet

Stock No. 26273

Sheet 3 of 3

5. Witness Corner to Quarter Corner to Sections 2 and 35, T.35-36N., R.15E.
 Corner found marked by 3/4" iron pipe and 6" x 6" wood post from which
 the remains of one original and two resurvey bearing trees were located.
 Quarter corner falls in lake.
 Corner References:

Tamarack	6"	N.49°E.	15.54 feet
Tamarack	4"	S.40°E.	19.15 feet
Tamarack	4"	S.9°W.	37.28 feet
Steel Sign Post		West	2.60 feet

CORNERS ESTABLISHED

1. East One-Sixteenth to Sections 2 and 35, T.35-36N., R.15E.
 Corner established midpoint and on line between the northeast corner and
 the north quarter corner of Section 2.
 Corner References:

Cedar	7"	N.8°E.	15.04 feet
Balsam	9"	S.83°E.	18.08 feet
Cedar	10"	N.87°W.	27.08 feet
Steel Sign Post		East	2.50 feet

2. South One-Sixteenth to Sections 2 and 3, T.35N., R.15E.
 Corner established midpoint and on line between the southwest corner and
 the west quarter corner of Section 2.
 Corner References:

Black Spruce	6"	N.28°E.	9.50 feet
Black Spruce	7"	S.66°E.	11.87 feet
Tamarack	6"	N.82°E.	13.33 feet
Steel Sign Post		North	2.60 feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin]
 County of Forest] SS

I, Milo E. Stefan, Cadastral Surveyor, U. S. Forest Service and a registered
 surveyor in the State of Wisconsin, hereby certify that I have surveyed
 Section 2, Township 35 North, Range 15 East, Fourth Principal Meridian,
 State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land
 surveyed. I have surveyed said section in accordance with the rules for
 survey of the public lands and with the statutes of the State of Wisconsin.



Milo E. Stefan
 Cadastral Surveyor, U. S. Forest Service
 R.L.S., State of Wisconsin
 Certificate S-1558

Plat Ready For Filing:

Dale B. Stange
 District Ranger

Date of Survey: 1982

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner: to Sections 5, 6, 31 and 32,
 T.35-36N., R.15E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 142675.22390
 E-2313192.88042

Geographic Coordinates
 N-45-32-59.75470
 W-88-39-16.26368

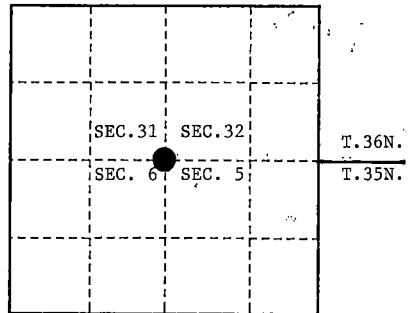

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
 Original Government Survey in 1857 by Artemas Curtis. Set wood post, from which the following bear; Elm, 8", N.25°W., 39 lks., Sugar, 18", N.55°E., 38 lks., Sugar, 14", S.66°E., 20 lks., Sugar, 12", S.80°W., 26 lks.

In 1973, Thomas Arnott, RLS, set a railroad spike at the intersection of County Highway "H" and Venters Road, for the corner position. Fence line bears West. Set an iron pipe S.55°E., 41.41 feet. An Elm, 8", bears N.59°E., 44.02 feet.


In 1982, John Fisher, RLS with North Country Surveyors, found railroad spike and corner references as set by Thomas Arnott in 1973. Set a 2"x36" aluminum monument for a Witness Corner and the following new bearing trees listed below.

In 1995, Alan Harrison, RLS with the Forest Service, found the railroad spike and corner references as set by Thomas Arnott and John Fisher.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad Spike in Cty. Hwy. "H" for Section Corner
2. Sugar, 10", N.46°E., 59.72 feet
3. Elm, 8", N.59°E., 44.02 feet
4. Basswood, 11", N.70°E., 54.60 feet
5. Iron Pipe, S.55°E., 41.41 feet
6. 2"x36" Witness Corner Monument, N.89°24'36"W, 45.00 feet
7. Basswood, 9", N.87°W., 44.02 feet
8. Steel Sign Post, West of W.C.

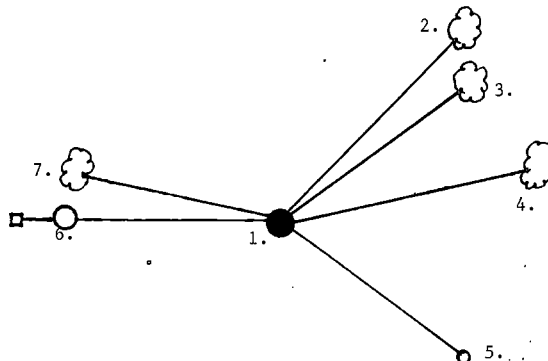

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2.)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 30th day
of January, A.D., 19 95, at
2:30 o'clock P.M. and recorded
in Vol. Chas. Restoration
page 353-15, 1-5
Paul C. Deery
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

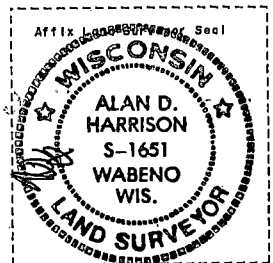

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 20th day of August, 1974, I found evidence of the north quarter corner of Section 4 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in 1857 by Artemas Curtis.
40.00 chains west between sections 4 and 33 set post
Hemlock 8, N36E, 41 lks
Sugar 12, S32W, 39 lks

Description of corner evidence found:

4" x 4" squared post with a well point driven in the ground alongside.
From squared post, a hemlock scribed snag, 14", bears N39°E, 45 lks
At a point, S36°W, 41 lks from the hemlock bearing tree snag, a sugar stump bears, S32°W, 39 lks.

Description of monument and accessories I established to perpetuate the location of this corner:

At the corner position as determined from the original evidence found, set a 2 inch inside diameter galvanized pipe 3 ft. long, filled with concrete with a brass cap stamped: T36N, R15E, 1/4, S4, S33, T35N, 1975, S-802.
From which the following new blazed and scribed bearing trees bear:
Hemlock, 10", S50°W, 22.65 feet
Hemlock, 14", N12°W, 35.16 feet
Set a steel sign post 1.0 feet north of the monument.

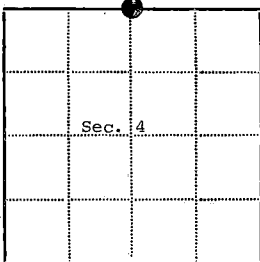

● - Corner monument restored
□ -

Resident witnesses

Dated at Rhinelander, Wisconsin, this 20 day of March 1975.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 31st day of March 1975, and was filed in Book No. Corner Page No. A-11 of County Records. Document Number 106867

Signature Eugene Stangor Title Register of Deeds

Township 35 North, Range 15 East, Section 4, Index No. A-11, Page No.

43615330020

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 13th day of January, 1983, I found evidence of the North Quarter corner of Section 3 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by Artemas Curtis
40.00 chains, set wood post
Cedar, 15", N22°E, 45 lks.
Hemlock, 12", S37°W, 29 lks.

Description of corner evidence found:


Hemlock stump remains, S37°W, 19.5'
Cedar windfall, N22°E, 29.6'
Local Evidence: 6" x 6" x 5' Cedar post with 2" iron pipe in mound of stone
Hemlock, 10", N17°W, 17.1'
Fir, 6", S29°W, 7.6'
Yellow Birch with location poster (874-9)

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced iron pipe and Cedar post with a 2" x 60" aluminum monument in mound of stone with tablet stamped as follows:
T36N, R15E, ¼, S34, S3, T35N, 1983, RLS-1558
From which the following bear:
Yellow Birch, 7", N66°E, 23.44'
Hemlock, 14", S7°E, 16.56'
Hemlock, 12", N22°W, 16.61'
Steel Sign Post, 7', South, 1.8'

DOCUMENT NO.

124182

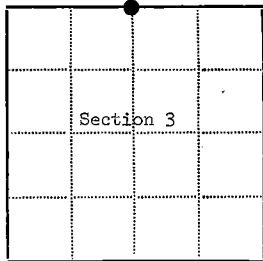

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelanders, Wisconsin, this 2 day of MAY, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stasny Title Register of Deeds


Township 35 North, Range 15 East, Section 3, Index No. A-15, Page No. 21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Witness corner to quarter corner to Sections 2 and 35, T.35-36N., R.15E.

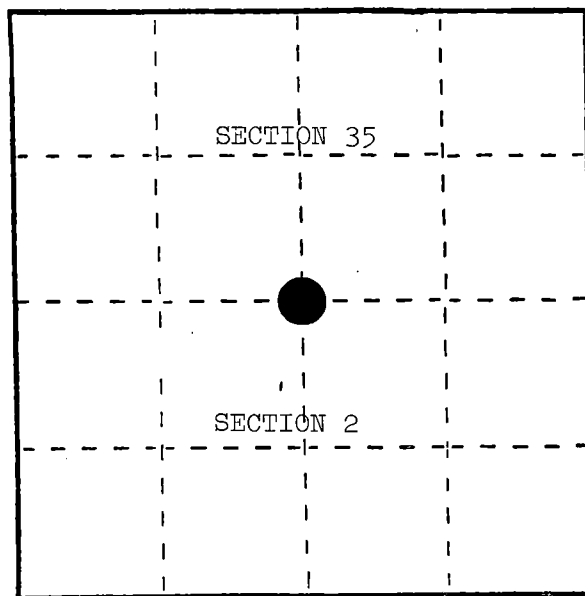

REGISTER'S OFFICE
 Forest County, Wis.
 Received for record this 14th day
 of March, A.D., 1986 at
10:35 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page A-19
Paul Aschenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis went 41.66 chains across slough and set witness post to quarter corner and made the following BTs: Tamarack, 5", S.19°W., 38 links; Tamarack, 6", N.29°W., 76 links.

In 1982, Milo Stefan found corner marked by a 3/4" iron pipe alongside of a 6" x 6" wood post. Found remains of one original and two resurvey bearing trees. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 120" aluminum monument stamped to identify the corner location.
2. Tamarack, 6", N.49°E., 15.54 feet
3. Tamarack, 4", S.40°E., 19.15 feet
4. Tamarack, 4", S.9°W., 37.28 feet
5. Steel Sign Post, West, 2.60 feet

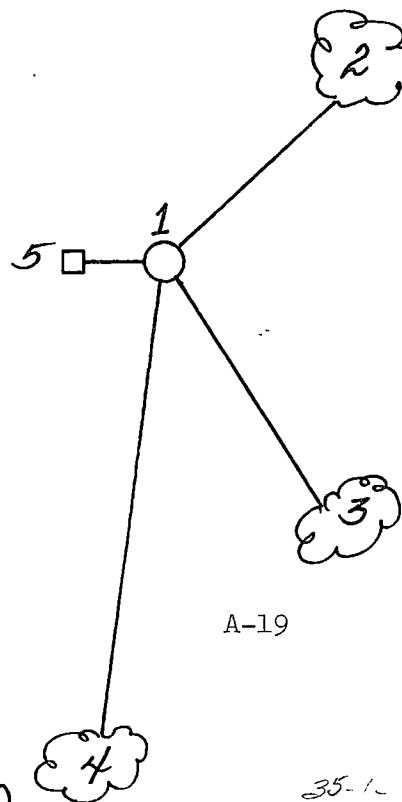

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Corner to Sections 1, 2, 35, and 36, T.35-36N., R.15E.

REGISTER'S OFFICE /
Forest County, Wis.

Received for record this 14 day
of March A.D., 1982 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page A-21
Paul Aschenbrenner
Register of Deeds

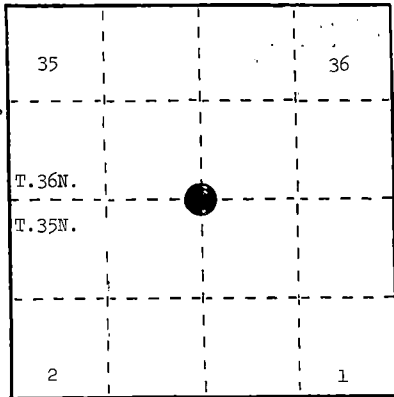

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis set wood post and made the following BTs: Hemlock, 10", N.76°W., 27 links; Hemlock, 16", N.53°E., 41 links; Yellow Birch, 16", S.61°E., 59 links; Yellow Birch, 6", S.34°W., 26 links.

In 1982, Milo Stefan found stump remains of three of the original bearing trees by survey of town line east and west and from distances of original line tree west. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Black Spruce, 4", N.16°E., 20.12 feet
3. Red Maple, 7", S.69°E., 37.25 feet
4. Black Spruce, 7", S.26°E., 31.89 feet
5. White Birch, 10", S.41°W., 9.86 feet
6. Steel Sign Post, West, 1.90 feet

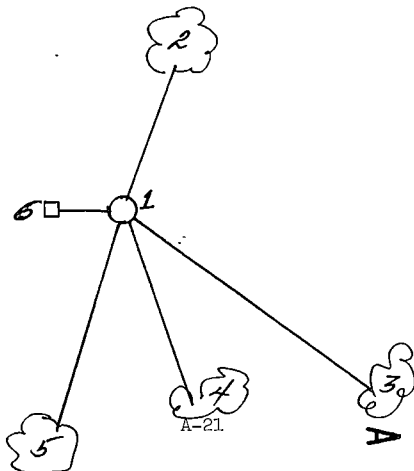

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Yes, plantation post with location poster, N.52°E., 113 feet.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date

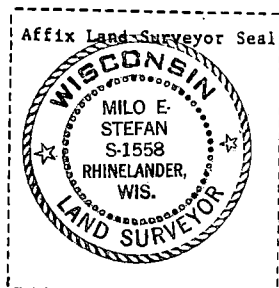

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 8th day of July, 1982, I found evidence of the North Quarter corner of Section 1 Township 35N, Range 15E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemus Curtiss
40.00 chains, set $\frac{1}{4}$ section wood post
Sugar, 14", N41W, 43 lks., 28.38 feet
Basswood, 20", S31E, 41 lks., 27.06 feet


Description of corner evidence found:

Mound of stone with post hole in middle
Possible stump hole, N41W, 28.0 feet
Basswood clump and large stump hole, S31E, 27.0 feet

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument in mound of stone with tablet stamped as follows:
T36N, R15E, S36, $\frac{1}{4}$, S1, T35N, 1982, RLS-1558
From which the following bear:
Hemlock, 14", N85E, 20.35 feet
Sugar, 12", S20W, 11.04 feet
Sugar, 6", N67W, 42.79 feet
Steel sign post, SW, 2.0 feet

DOCUMENT NO.
124181

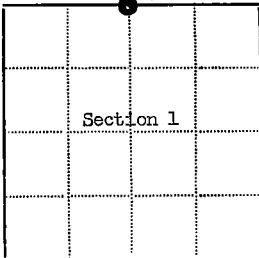

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 2 day of MAY 1982

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September 12 1983, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35N, Range 15E, Section 1, Rider No. A-23, Page No. 63

43615300020

A 21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter Corner between Sections 5 & 6, T.35N., R.15E.,
Forest County WI.

State Plane Coordinates Wisconsin North Zone
N - 140327.43092
E - 2313248.57533

Geographic Coordinates
N - 45-32-36.56962
W - 88-39-16.04004

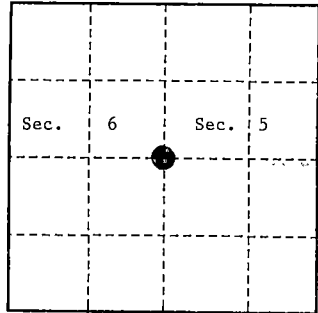

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1859 by James McBride. Set wood post and the following bearing trees; Birch, 10", N.67°E., 24 links, Birch, 8", N.48°W., 37 links.


In 1965, Jean Resvick (RLS) restored the corner position at the intersection of the center-line of a North-South road, and fence lines East and West. Set a 1" square head bolt at the corner position. Set a 2" X 60" galvanized iron pipe West 33.00 feet from corner position for witness corner.

In 1995, Alan Harrison (RLS) found corner position in blacktop of County Hwy "H". Found witness corner monument S.82°W., 31.78 feet. Set a steel sign post 1.00 feet West of W.C. Monument. Blazed and scribed 2 new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. P.K. nail in blacktop for corner position.
2. Tamarack, 7", N.76°E., 29.80 feet (NBT)
3. Tamarack, 10", N.37°W., 65.02 feet (NBT)
4. 2" X 60" W.C. Monument, S.82°W., 31.78 feet
5. C/L County Hwy "H", East, 1.80 feet
6. Steel Sign Post, 1.00 feet West of W.C. Monument

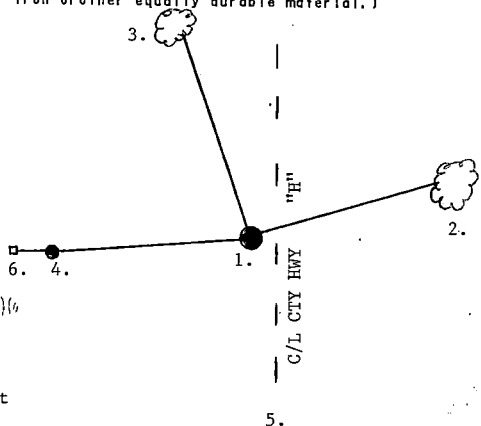

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 22nd day
of January, A.D., 19 95 at
9:30 o'clock P.M. and recorded
in Vol. Land Restorations
page 3515 C-5
John P. Deady
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

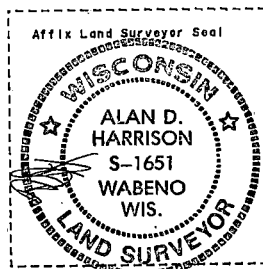

Document Number

189318

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page C-17
Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required By s. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
HEMLOCK 14" N86°W 23 LINKS
SUGAR MAPLE 12" N39°E 19 LINKS

1907 - NATHAN SMITH, FOUND POST AND ORIGINAL SUGAR MAPLE AS HIGH STUMP.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 16" N45°W 38 LINKS

1982 - MILO STEFAN, SURVEYOR, S-1558, FOUND A 2" IRON PIPE IN MOUND OF ROCKS WITH ROTTED WOOD POST ALONGSIDE FROM WHICH THE REMAINS OF THE ORIGINAL AND SMITH'S BTS WERE LOCATED. SET 2" X 36" ALUMINUM MONUMENT STAMPED TO IDENTIFY CORNER LOCATION.

SET THE FOLLOWING WITNESSES:
HEMLOCK 18" S69°E 57.50 FEET
YELLOW BIRCH 12" S07°W 33.80 FEET
BASSWOOD 12" N39°W 9.28 FEET
STEEL SIGN POST SOUTH 1.75 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


FOUND ALUMINUM MONUMENT IN A MOUND OF STONES.

FOUND THE FOLLOWING WITNESSES:
BIRCH 16" (DEAD) S10°W 33.62 FEET - FOUND NAIL IN TREE
BASSWOOD 18" N43°W 9.35 FEET - SET NAIL IN TREE
HEMLOCK 21" N07°E 18.34 FEET - FOUND NAIL IN TREE
HEMLOCK 20" S55°E 57.62 FEET - SET NAIL IN TREE
STEEL SIGN SOUTH 1.50 FEET


SET THE FOLLOWING WITNESSES:
MAPLE 10" S14°W 44.23 FEET - SET NAIL IN TREE

ALL TREES HAVE CHEST & STUMP BLAZES.

THE WEST 1/4
CORNER OF SECTION 2
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

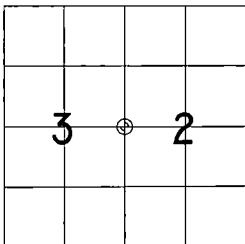

⊕ = LOCATION OF CORNER

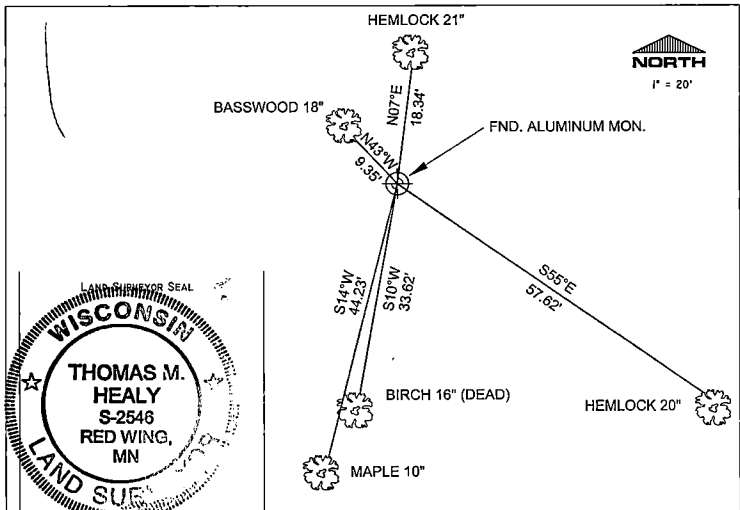

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. C-17

SIGNATURE

DATE

43519.032000

C-17


DOCUMENT NUMBER **129844**

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 2 and 3, T.35N., R.15E.

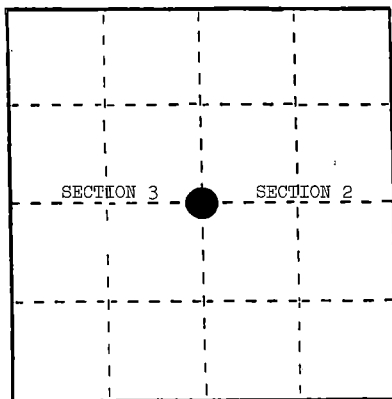

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 14th day
 of March, A.D., 1982, at
10:35.0 o'clock A.M. and recorded
 in Vol. C-17 CORNER RESTORATIONS

page 6-17
Saul Aschendorner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set quarter post and made the following BTs: Hemlock, 14", N.85°W., 23 links; Sugar, 12", N.39°E., 19 links.


In 1907, Nathan Smith found post and original Sugar as high stump. Made new BTs: Sugar, 16", N.45°W., 38 links.

In 1982, Milo Stefan found 2" iron pipe in mound of rock with rotted wood post alongside-- from which the remains of the original and Smith's BTs were located. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Hemlock, 16", S.59°E., 57.50 feet
3. Yellow Birch, 12", S.7°W., 33.80 feet
4. Basswood, 12", N.39°W., 9.28 feet
5. Steel Sign Post, South, 1.75 feet

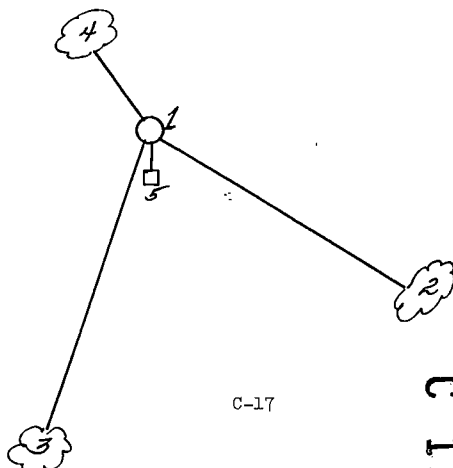

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner to Sections 1 and 2, T.35N., R.15E.

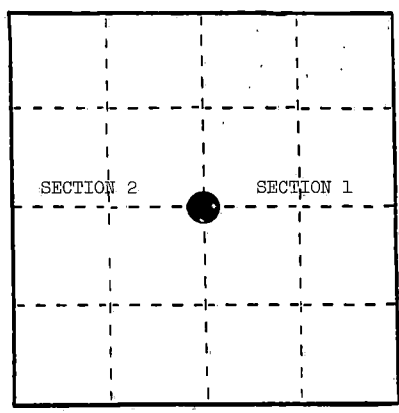

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 14th day
of March A.D., 1982 at
10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 31
T. Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859 James McBride set wood post and made the following BTs: Sugar, 8", N.33°E., 10 links; Sugar, 10", N.33°W., 11 links.

In 1982, Milo Stefan found fallen 4" x 4" wood post alongside of plantation post--from which the remains of the original BTs were located. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Red Pine, 11", N.5°E., 26.93 feet
3. Red Pine, 12", S.73°E., 40.01 feet
4. Basswood, 11", N.48°W., 23.84 feet
5. Steel Sign Post, Southeast, 1.60 feet

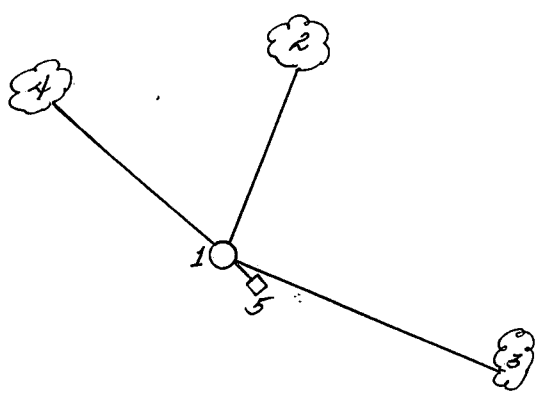

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date

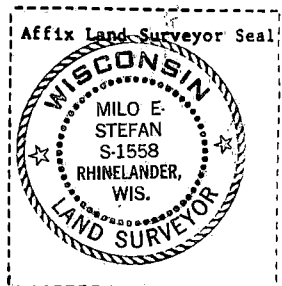

138169

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 1, 12, 6 & 7,
T35N, R14 - 15E, 4th P.M.


REGISTER'S OFFICE

Forest County, WI

Received for record this 6th dayof September A.D., 1989at 10:25 o'clock A M. andrecorded in Vol. 5-1 of recordson page 1

Paul A. Schenck

REGISTER

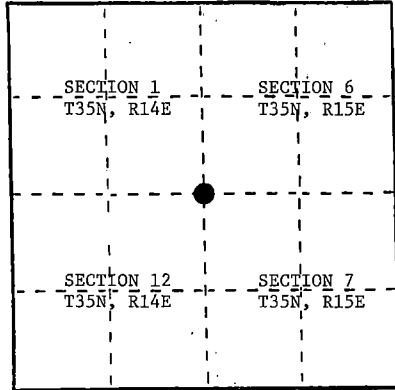

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis established this corner. All evidence being destroyed in the construction and reconstruction of State Highway #32 over the years, the last time in 1985.

In 1965 Forest Service surveyor Jean Resvick restored this corner in the centerline of the highway and fence line easterly. A reference monument was placed 114.00 feet easterly of the corner. This reference monument is in place.

In 1980 Forest Service surveyor William Cochran found the Resvick corner and used it to subdivide Sections 1 and 12 of Range 14 East. He placed a reference monument N88°-32.6'W, 86.00 feet of the corner.


On 7/10/85 DOT filed with the County Clerk a "Preservation of Landmarks" form on this corner whereby 4 additional W.C. monuments were established. OVER (g&h)

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Forest Service brass tablet on 2" x 60" iron pipe, east 114.00'
- 3) Forest Service brass tablet on 2" x 60" iron pipe, N88°-32.6'W, 86.00'
- 4) DOT Berntsen aluminum monument, W.C. #1, N46°-44'E, 94.38'
- 5) DOT Berntsen aluminum monument, W.C. #2, S58°-52'E, 78.08'
- 6) DOT Berntsen aluminum monument, W.C. #3, S46°-44'W, 68.29'
- 7) DOT Berntsen aluminum monument, W.C. #4, N58°-52'W, 52.74'
- 8) Steel sign post, SW of DOT W.C. #3, .68'

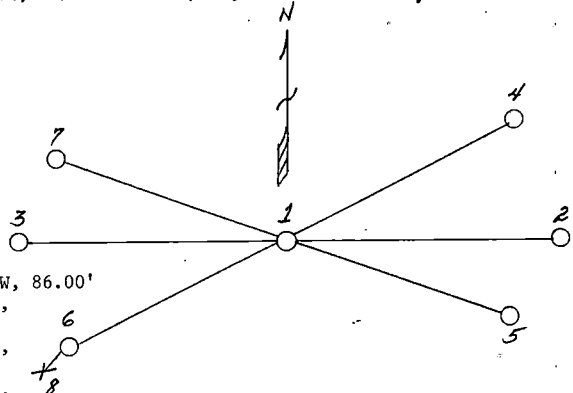

43514010000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

a found perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Continued from b):

On 3/23/89 I located the Forest Service and DOT reference monuments and placed a PK nail in the surface of the highway for the corner position and ran a traverse to this point for the subdivision of Section 7, T35N, R15E. After confirmation that this point was the corner, I restored and placed a railroad spike at the position of the PK nail.

Subscribed and sworn to before me this _____ day of _____, 1989.

Notary Public

My

Exp.

Notary

State

of

Milo E. Stefan

- (1) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

July 7, 1989

Date

Certificate ready for filing:

D. S. Staege
District Ranger

Affix Land Surveyor Seal



138170


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 6 & 7,
T35N, R15E, 4th P.M.

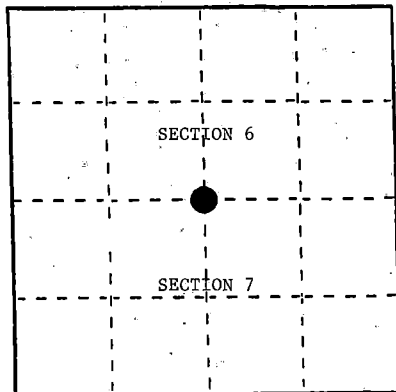

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept, A.D., 1989 at
10:35 o'clock A.M. and recorded
in Vol. 100 CORNER RESTORATIONS

page 1

Paul A. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride established this corner and set a wood post and BTs:

12" W. Pine, N21°E, 41 Links 8" W. Pine, S5°W, 15 Links

In 1965, Forest Service surveyor, Jean Resvick, restored this corner by placement of a 2" x 60" galv. iron pipe/B.C. and made four new BTs. The restoration certificate was never completed on this corner that we can now locate:


3/21/89 I found the iron pipe/B.C. removed and lying next to the NW BT.

6/27/89 I restored the corner by replacing it in the proper location from the original White Pine bearing trees and the Resvick bearing tree.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2" x 60" Galvanized Iron Pipe with Brass Cap.
- 2) 4" Black Spruce, N33°E, 13.39'
- 3) 4" Black Spruce, S32°E, 21.41'
- 4) 6" Black Spruce, S20°W, 26.46'
- 5) 5" Black Spruce, (Dead), N67°W, 5.62'
- 6) 6" Black Spruce, N24°W, 20.30'
- 7) 16"-18" White Pine stump with "BT" blaze plain, N21°E, 27.1'
- 8) 18"-20" White Pine stump with "BT" blaze plain, S5°W, 9.9'
- 9) Steel Sign Post, NW, 1.70'

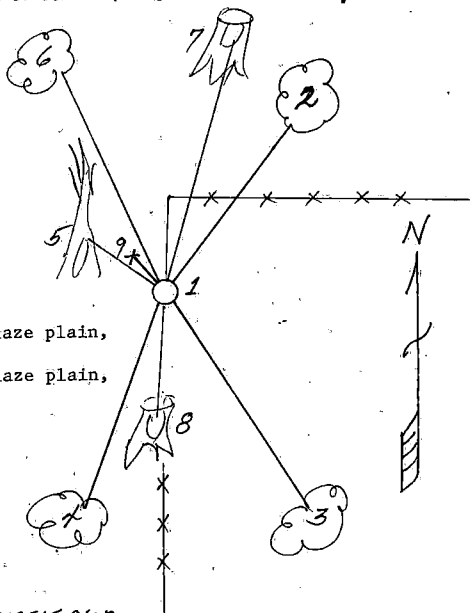

43515060020

E-3 25-15

C-7

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/30/89
Date

Certificate ready for filing.

Dale S. Staeger
District Ranger

Affix Land Surveyor Seal



138171

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● - Corner monument restored.

Section Corner to Sections 5, 6, 7 & 8,
T35N, R15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.


Received for record this 16th day
of Sept, A.D., 1989 at

10:25 o'clock A.M. and recorded

In Vol. CORNER RESTORATIONS

page E-5

Paul H. Schenck
Register of Deeds

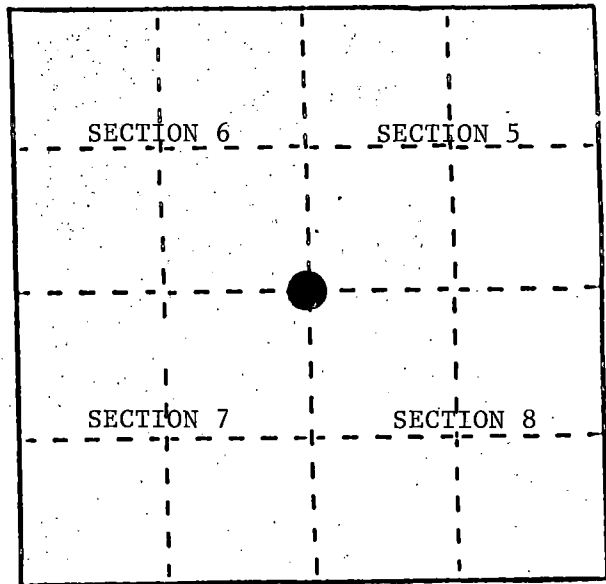

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post with four BTs. As road construction has destroyed all evidence of the original corner, the BTs are no longer here.


An iron pipe 1" x 24" marks the accepted Section Corner position. It lies at the intersection of roads, in all four directions. This iron pipe was witnessed by two Forest Service references in 1965 when Jean Resvick worked Section 6. This same pipe was used by Thomas Arnott and John Fisher when Section 5 was subdivided in 1982.

6/28/89 I replaced the 1" x 24" iron pipe with a 2 1/2" x 36" aluminum monument. As Resvick's W.C. to the southeast was badly damaged, we also replaced it with a 1" x 36" drive type aluminum monument. We stamped both tablets, placed steel sign post at the W.C. and made two additional references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" aluminum monument 2" below road surface.
- 2) 1" x 36" aluminum monument in mound of stone, SE, 49.90'
- 3) 6" x 60" concrete monument, SW, 38.00'
- 4) 18" White Spruce, N83°E, 127.00'
- 5) SE corner of cabin foundation, N55°W, 119.50'
- 6) Steel sign post, SE of RM to the SE, .77'

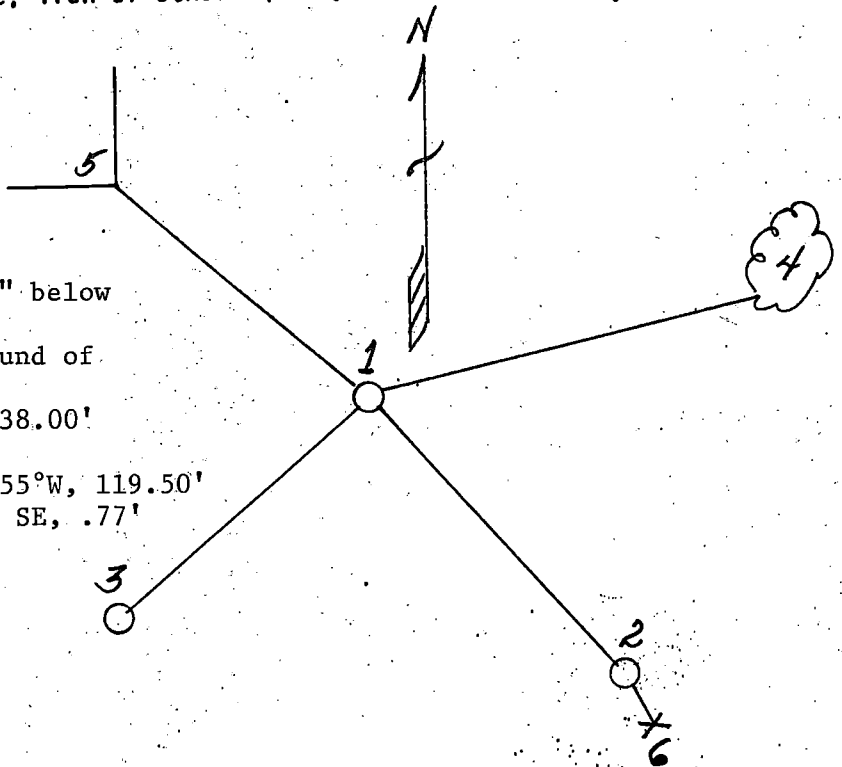

4351506 0000

E-5

35-15

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Milo E. Stefan

- (i) I, Milo E. Stefan, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

July 7, 1989

Date

Affix Land Surveyor Seal.



CERTIFICATE READY FOR FILING:

Dale S. Stage
District Ranger

Document Number
210674

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 5th day
of December A.D., 2012 at
10:00 o'clock A.M. and recorded
in Vol. Corner Restoration
page 501
Chitra Monette
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required By s. A-E 7.08, WI Adm. Code)

History of original corner establishment and subsequent restorations and description of any record, monument, occupational, testimonial or other evidence considered:

- 1859 James McBride, Deputy Surveyor, established corner
Tom Amott sets railroad spike for corner (no date)
1982 John Fisher finds railroad spike in his survey of Section 5
1989 Milo Steffan finds railroad spike in his survey of Section 8
2000 Ayres Associates survey for County Highway H reconstruction and find
County monument at corner location
2012 H. Guy sets a PK nail for corner using Ayres Associates traverse
through corner and corners East and West and makes new ties

Corner was: (Check All That Apply)


- ☒ Restored through acceptance of an obliterated evidence location
☐ Restored through acceptance of a found perpetuated location
☐ Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location)
☐ Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found)

Describe the monument and accessories used to perpetuate the location of this corner. (include a plan view drawing and indicate what was set and/or found)


- ▲ 2" forest Service
Monument
● 5/8" x 24" iron rod set

SCALE 1" = 30'


The North 1/4
corner of Section 8
T. 35 N., R. 15 E.,
Fourth Principal Meridian,
Marinette County, Wisconsin

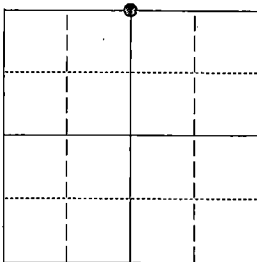

● = Location of Corner

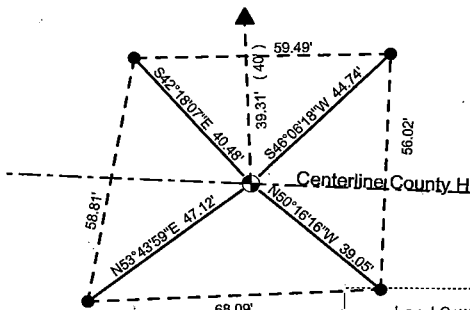

Land Surveyor Seal

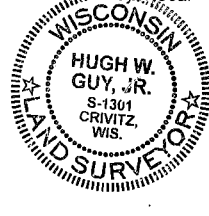

Hugh W. Guy Jr. RLS #1301
(type or print name) certify that the corner location shown in this record was determined by
me or under my direction and control and that this U.S. Public Land Survey Monument Record
is correct and complete to the best of my knowledge and belief.

Signature

Date

11-10-2012

Index No. _____

43515050620

E-7

138172

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.


Quarter Corner to Sections 5 & 8,
T35N, R15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16 day
of Sept, A.D., 1989 at

10:25 o'clock A.M. and recorded
in Vol. E-7 page 1

Paul Achenbrenner
Register of Deeds

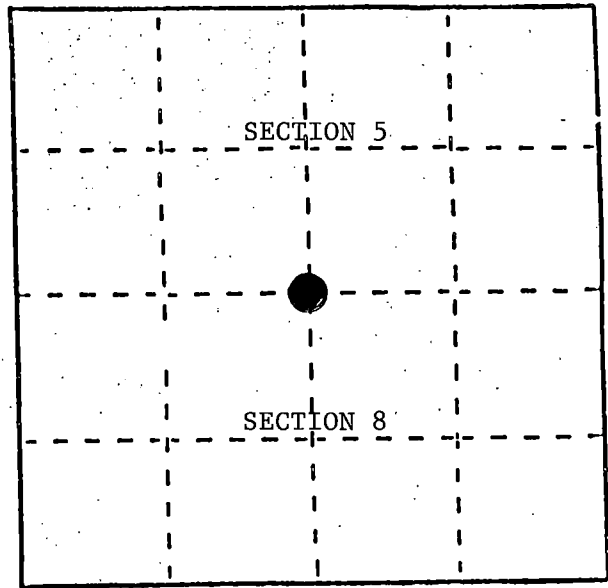

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride established this corner and set a wood post and BTs:
8" Hemlock, N17°E, 24 Links 6" Fir, S27°E, 41 Links

1973 - Thomas Arnott restored this corner by lost methods and placed a railroad spike in the road surface.


1982 - John Fisher used the Arnott corner to subdivide Section 5 for the Forest Service. He made bearing trees and established a Witness Corner N1°-40'W, 40.00 feet.

3/23/89 - I found corner in good condition needing no further work.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Witness Corner, N1°-40'W, 40.00'
- 3) 6" Cedar, N17°E, 45.61'
- 4) 5" Cedar, S2°W, 45.20'
- 5) 5" Cedar, N34°W, 47.81'
- 6) Steel sign post, N1°-40'W of W.C., 1.0 feet

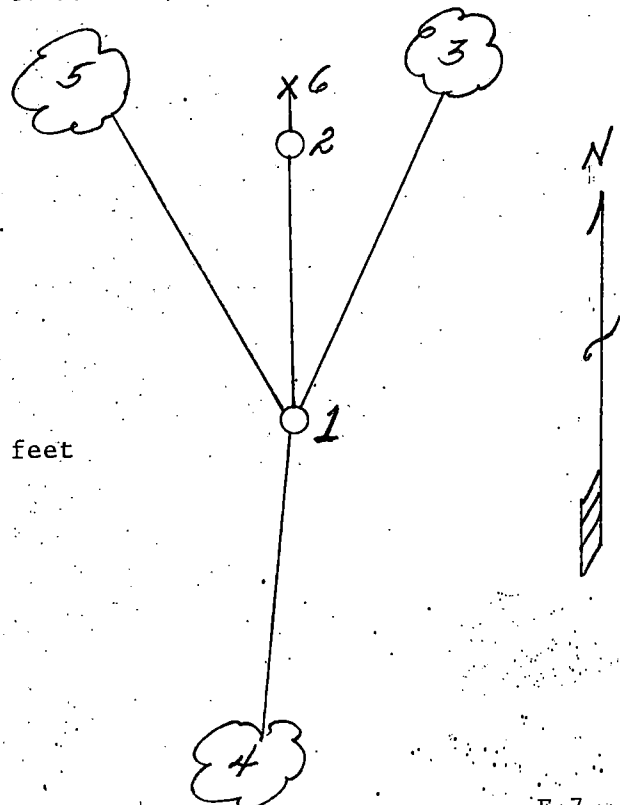

43515050020

E-7

35-15

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal.



- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 8, 1989
Date

CERTIFICATE READY, FOR FILING:

Dale S. Stange
District Ranger

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 5th day
of December A.D., 2012 at
10:00 o'clock A.M. and recorded
in Vol. Corner Restoration
page E-9
[Signature]
Register of Deeds

Document Number

210675

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required By s. A-E 7.08, WI Adm. Code)

History of original corner establishment and subsequent restorations and description of any record, monument, occupational, testimonial or other evidence considered:

- 1859 James McBride, Deputy Surveyor, established corner
- Tom Arnott sets railroad spike for corner (no date)
- 1982 John Fisher finds railroad spike in his survey of Section 5
- 1989 Milo Steffan finds railroad spike in his survey of Section 8
- 2000 Ayres Associates survey for County Highway H reconstruction and find County monument at corner location
- 2012 H. Guy sets a PK nail for corner using Ayres Associates traverse through corner and corners East and West and makes new ties

Corner was: (Check All That Apply)


- ☒ Restored through acceptance of an obliterated evidence location
- ☐ Restored through acceptance of a found perpetuated location
- ☐ Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location)
- ☐ Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found)

Describe the monument and accessories used to perpetuate the location of this corner. (include a plan view drawing and indicate what was set and/or found)


- ☐ 3/4" x 24" iron rod set
- ☒ 5/8" x 24" iron rod set

SCALE 1" = 40'

The Northeast
corner of Section 8,
T. 35 N., R. 15 E.,
Fourth Principal Meridian,
Marinette County, Wisconsin

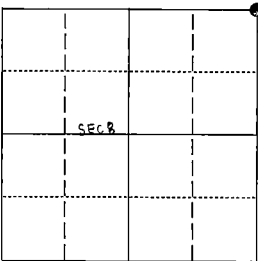

● = Location of Corner

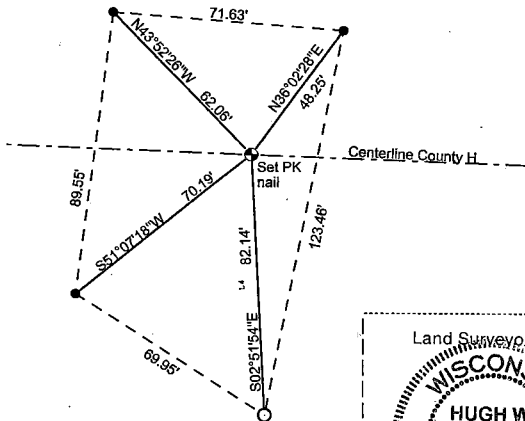


Hugh W. Guy Jr. RLS #1301
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

[Signature]
Signature Date

11-10-2012

Index No. _____

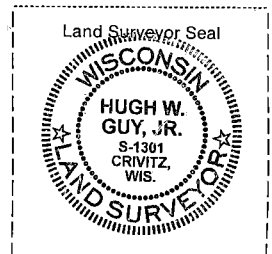

43515050000

E-9

138173


U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Section Corner to Sections 4, 5, 8 & 9,
T35N, R15E, 4th P.M.

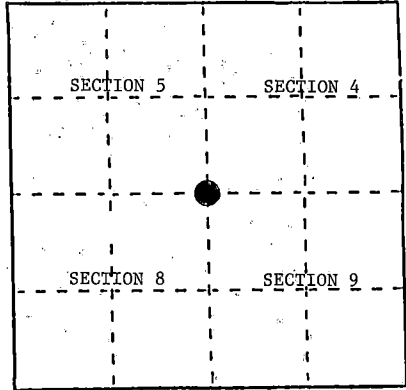

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept. A.D., 1989 at

10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 54

Paul Ackendrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post with BTs:

10" Hemlock, N57°E, 50 Links

12" Birch, S26°E, 25 Links

8" Birch, S44°W, 17 Links

8" Hemlock, N40°W, 20 Links

1973 - Thomas Arnott restored corner at intersection of County Highway "H" and Venters Road North. Also, fence line Southerly. He set railroad spike for the corner.


1982 - John Fisher used this corner to subdivide Section 5 for the Forest Service. He made bearing trees and established a Witness Corner, South, 33.00 feet.

3/23/89 - I found corner in good condition needing no further work.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Witness Corner, South, 33.00'
- 3) 6" Sugar Maple, N45°E, 46.76'
- 4) 6" Red Pine, S19°W, 52.47'
- 5) 7" Sugar Maple, N37°W, 50.60'
- 6) Steel Sign Post, South, 1.00' of W.C.

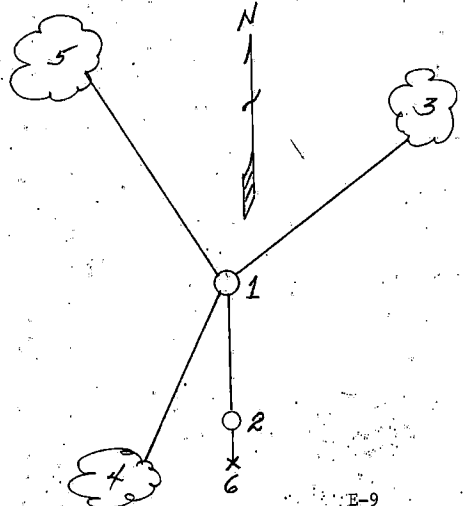

43515050000

E-9

35-15

E-9

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 8, 1989
Date



CERTIFICATE READY FOR FILING:

Dale S. Staeger
District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 3, 4, 9 and 10,
 T.35N., R15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 137683.73067-N
 2324142.10079-E

Geographic Coordinates
 45-32-08.62245-N
 088-36-43.65804-W

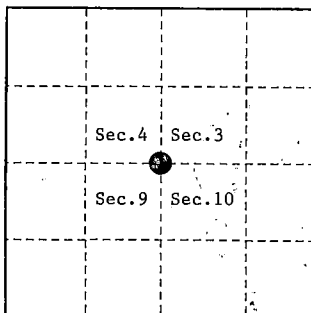

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Tamarack, 18", N.09°W., 24 links, Tamarack, 8", N.83°E., 40 links, Birch, 8", S.35°E., 15 links, Tamarack, 8", S.25°W., 49 links, 1.50 chains west, leave swamp and 1.25 chains north, leave swamp.

In 1962, Victor Hedman, RLS, found original Birch stump southeast and original Tamarack stump southwest. Set a 2" x 60" galvanized iron pipe with a brass cap stamped to identify the corner. Made new bearing trees; Tamarack, 4", S.31°E., 36.90 feet, Spruce, 5", S.25°W., 26.80 feet, Spruce, 4", N.30°W., 14.35 feet, Tamarack, 3", N.65°E., 13.65 feet.


On 8-28-91, Alan Harrison, RLS, found monument as described. Also found the southwest and northwest bearing trees to be dead. Blazed and scribed 2 new bearing trees; Red Maple, 7", S.30°W., 36.73 feet, Red Maple, 8", N.21°W., 10.72 feet, Steel Sign Post, South, 1.30 feet.

On 12-15-93, Alan Harrison, RLS, found monument and bearing trees as set in 1962 and 1991. The northeast Tamarack of 1962 is now dead. Blazed and scribed a new bearing tree; Hemlock, 9", N.29°E., 33.09 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" galvanized iron pipe with a tablet stamped to identify corner.
2. Hemlock, 9", N.29°E., 33.09 feet.
3. Tamarack, 4", S.31°E., 36.90 feet.
4. Red Maple, 7", S.30°W., 36.73 feet.
5. Red Maple, 8", N.21°W., 10.72 feet.
6. Steel Sign Post, South, 1.30 feet.

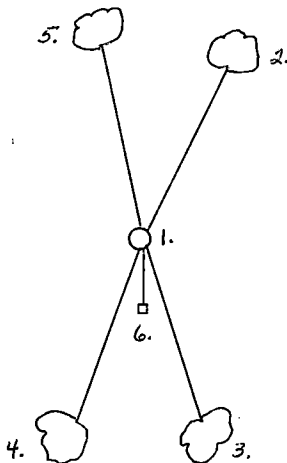

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)


- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE /
Forest County, Wis.

Received for record this 23rd day
of December, A.D., 19 94 at
9:00 o'clock A.M. and recorded
in Vol. Case Proportions
page 35-15-E-13

Paul Clark Deputy
Register of Deeds

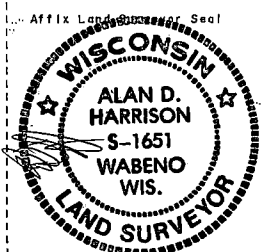

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

Date

10/26/94


CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger

State of Wisconsin }
County of Forest County } ss.

I Jean F. Resvick, do hereby
certify that on the 29th day
of October, 1962, I found
evidence of the section
corner of section 3, 4, 9, and 10
Township 35, North, Range
15 E, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

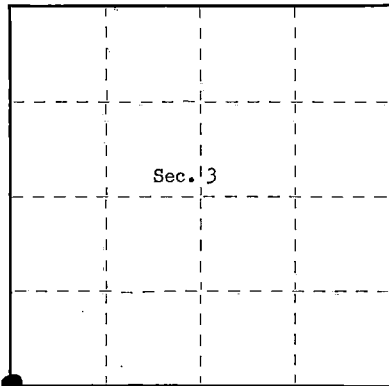

○ = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:
Surveyed in 1859 by James McBride


80 chains north between Sections 9 & 10
Set wood post
Tamarack 18", N 9 W, 24 lks.
Tamarack 8", N83E, 40 lks.
Birch 8", S35E, 15 lks.
Tamarack 8", S25W, 44 lks.

7.70 chains south leave swamp
19.50 chains east leave swamp
1.25 chains north leave swamp
1.50 chains west leave swamp

Description of corner evidence found:

1. Birch stump 10", S35E, had been blazed as if scribed, interior, rotted out.
2. Tamarack stump 12", S25W, scribe marks showing.
3. Bearing and distances check to common point from each stump

Description of monument and accessories I established to perpetuate the original location of this corner:
At point established from remains of the original bearing trees above I set
a 2 inch inside diam. galvanized iron pipe, 5 feet long, filled with concrete,
flanged at bottom, with brass cap marked,

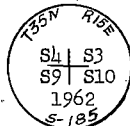

from which I blazed and scribed the following bearing trees:

Tamarack 4", S31° 30' E, 36.90 ft. (55.9 links)
Spruce 5", S25° 30' W, 26.80 ft. (40.6 links)
Spruce 4", N30° W, 14.35 ft. (21.7 links)
Tamarack 3", N 65 E, 13.65 ft. (20.7 links)

Dated at Rhineland Wis., this 18th day of August, 1963.


Signature Jean F. Resvick Title Cadastral Surveyor - U. S. Government Registration No. S-185*
(County Surveyor, Registered Land Surveyor, or other duly authorized official) *Reviewed and Approved

Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 4 day of November, 1963
at 9:00 o'clock A M.

Anna Peterson
(Register of Deeds)

By _____ Deputy

Index No. 176 13
E 13

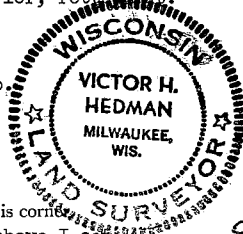

0000101521

87827

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 3 & 10,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 137700.48086-N
 2326659.47339-E

Geographic Coordinates
 45-32-08.35200-N
 088-36-08.29513-W

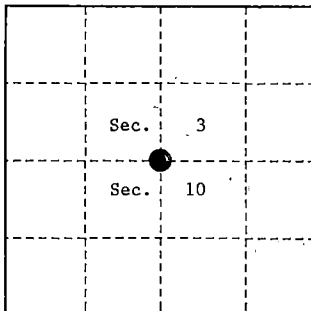

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Spruce, 8", N.16°W., 18 links, Tamarack, 10", S.60°E., 15 links.


In 1963, Milo Stefan, RLS, found a cedar post as described on form 874-9 dated 3-18-36. Also found a 3" flue pipe alongside the cedar post. Replaced post with a 2" x 36" Aluminum Monument with an aluminum cap stamped to identify the corner. Made new bearing trees; Sugar, 6", N.77°E., 7.82 feet, Sugar, 16", S.19°E., 34.31 feet, Sugar, 5", S.25°W., 9.54 feet, Steel Sign Post, North, 2.00 feet.

On 12-14-93 Alan Harrison, RLS, found bearing trees as set in 1963. Cut down all bearing trees for G.P.S. observations. Blazed and scribed new bearing trees; Sugar, 7", S.86°E., 47.07 feet, Sugar, 8", S.09°W., 40.02 feet, Sugar, 13", N.34°W., 42.13 feet. Monument set in 1963 is gone. Re-set a new 2½" x 36" Aluminum Monument with a tablet stamped to identify the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" Aluminum Monument with tablet stamped to identify corner.
2. Sugar, 7", S.86°E., 47.07 feet.
3. Sugar, 8", S.09°W., 40.02 feet.
4. Sugar, 13", N.34°W., 42.13 feet.
5. Steel Sign Post, North, 2.00 feet.

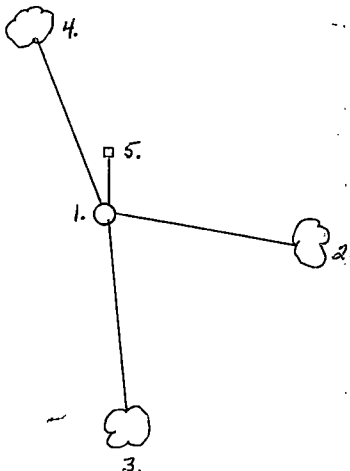

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of November, A.D., 19 94 at
2:00 o'clock P.M. and recorded
in Vol. Cann. Restorations
page 35-15, E-15

Paul Little, Deputy
Register of Deeds

Affix Local Registrar Seal

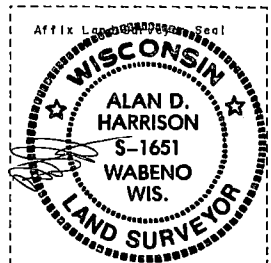

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Eric Vago
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 13th day of January, 19 83, I found evidence of the North Quarter corner of Section 10 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
39.80 chains, set wood post
Spruce, 8", N16°W, 18 lks.
Tamarack, 10", S60°E, 15 lks.


Description of corner evidence found:

No original evidence found
Local Evidence: Cedar post as described on 874-9, dated 3/18/36. 3" flue pipe 3' above ground, alongside post.
Blue painted line on blazes south, picket line and some blazes and paint (blue) north.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post and iron pipe with a 2" x 36" aluminum monument in mound of stone with tablet stamped as follows:
T35N, R15E, 1, S3, S10, 1983, RLS-1558
From which the following bear:
Sugar Maple, 6", N77°E, 7.82'
Sugar Maple, 16", S19°E, 34.31'
Sugar Maple, 5", S25°W, 9.54'
Steel Sign Post, 7', North, 2.0'

DOCUMENT NO.
124184

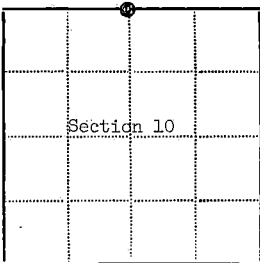

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 2 day of MAY 19 83.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September 19 83, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Staszynski Title Register of Deeds

Township 35 North, Range 15 East, Section 10, Index No. E-15, Page No. 76

43515030020


DOCUMENT NUMBER **129846**

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Corner to Sections 2, 3, 10, and 11, T.35N., R.15E.

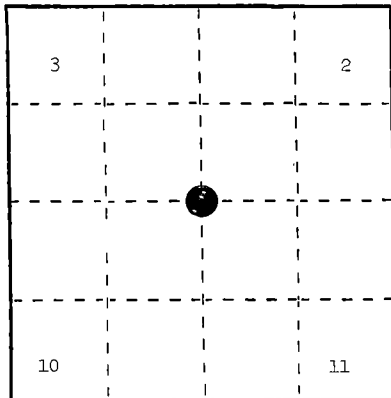

REGISTER'S OFFICE }
 Forest County, Wis.

Received for record this 14th day
 of March, A.D., 1986 at
10:35.0 clock A.M. and recorded
 in Vol. CORNER RESTORATIONS

page E-17
Paul Heckenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set wood post and made the following BTs: Birch, 15", N.34°E., 22 links; Cedar, 8", S.42°E., 15 links; Birch, 14", S.74°W., 23 links; Spruce, 10", N.12°W., 32 links.

In 1982, Milo Stefan found corner marked by a fallen 5" x 5" wood post--from which the stumps of the original BTs were located. Location poster on dead Cedar, 12", S.50°E., 14.0 feet. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner location.
2. White Birch, 8", N.86°E., 31.14 feet
3. Balsam, 6", S.56°E., 30.43 feet
4. White Birch, 8", S.29°E., 44.33 feet
5. Steel Sign Post, East, 1.35 feet

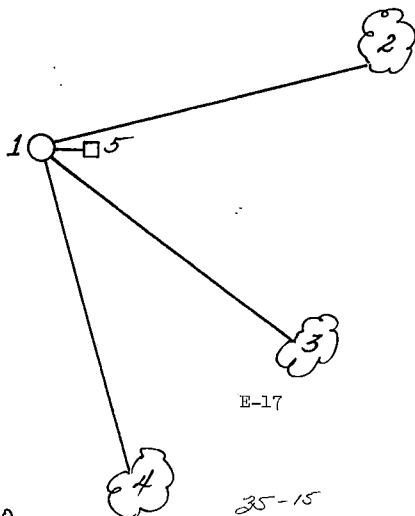

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.



(1) I, Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

Date

Document Number

189313

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November A.D., 2005 at
3:52 o'clock P.M. and recorded
in Vol. Corner Restoration
page E-19
Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SPRUCE 4" N22°W 14 LINKS
SPRUCE 5" S25°E 6 LINKS

1904 - NATHAN SMITH, FOUND THE ORIGINAL BT'S BROKEN OVER. DISTANCE FROM THE SECTION CORNER TO THE WEST IS 38.69 CHAINS (2552.88 FEET). DISTANCE FROM THE SECTION CORNER TO THE EAST 39.77 CHAINS (2624.82 FEET).

SET THE FOLLOWING WITNESSES:
SPRUCE 4" N46°E 16 LINKS
SPRUCE 4" S07°W 19 LINKS

1994 - ALAN HARRISON, SURVEYOR, S-1651, RESTORED THE CORNER AT PROPORTIONATE DISTANCE TO NATHAN SMITH'S MEASUREMENTS IN HIS 1904 SURVEY OF SECTION 11. THE CORNER POSITION IS ALSO ON LINE BETWEEN OPPOSING SECTION CORNERS. NO OTHER CORNER EVIDENCE WAS RECOVERED. AT THE CORNER POSITION SET A 2-1/2" X 60" ALUMINUM MONUMENT WITH A TABLET STAMPED TO IDENTIFY CORNER.

SET THE FOLLOWING WITNESSES:
TAMARACK 7" S07°E 26.25 FEET
TAMARACK 7" S36°W 60.08 FEET
TAMARACK 7" N70°W 13.31 FEET
STEEL SIGN POST SOUTHWEST 0.60 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND ALUMINUM MONUMENT FLUSH WITH GROUND WITH CAP STAMPED RLS 1651

FOUND THE FOLLOWING WITNESSES:


TAMARACK 7" N73°W 13.33 FEET - FOUND NAIL IN TREE
TAMARACK 7" S11°E 26.23 FEET - FOUND NAIL IN TREE
TAMARACK 7" S36°W 60.07 FEET - FOUND NAIL IN TREE
STEEL SIGN SOUTHWEST 0.60 FEET

SET THE FOLLOWING WITNESSES:


TAMARACK 7" N85°E 61.30 FEET - SET NAIL IN TREE

ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTH 1/4
CORNER OF SECTION 2,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

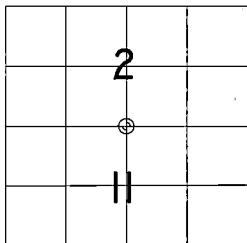

⊕ = LOCATION OF CORNER

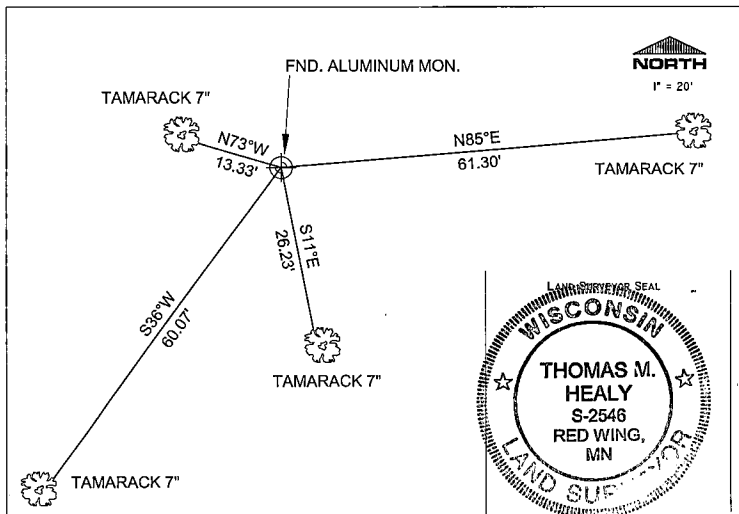

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT HANDWRITING THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

INDEX No. E-19

4351502.0020

E-19

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 2 & 11,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 137765.57176-N
 2331724.25625-E

Geographic Coordinates
 45-32-08.10842-N
 088-34-57.13978-W

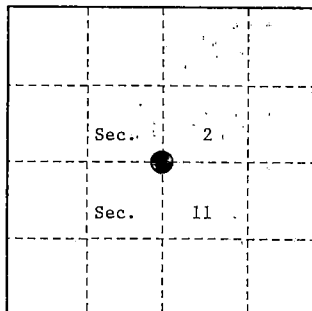

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Spruce, 4", N.22°W., 14 links, Spruce, 5", S.25°E., 6 links, 15 chains East leave swamp.


In 1904 Nathan Smith (RLS), surveyed Section 11 and found the original bearing trees broken over. Distance from the Section Corner to the West is 38.69 chains (2552.88 feet). Distance from the Section Corner to the East 39.77 chains (2624.82 feet). Made new B.T.'s; Spruce, 4", N.46°E., 16 links, Spruce, 4", S.07°W., 19 links.

On 6-27-94, Alan Harrison (RLS), restored the corner at proportionated distance to Nathan Smith's measurements in his 1904 survey of Section 11. The corner position is also on line between opposing Section Corners. No other corner evidence was recovered. At the corner position set a 2½" x 60" Aluminum Monument with a tablet stamped to identify corner. Made new bearing trees; Tamarack, 7", S.07°E., 26.25 feet, Tamarack, 7", S.36°W., 60.08 feet, Tamarack, 7", N.70°W., 13.31 feet, Steel Sign Post, Southwest, 0.60 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 60" Aluminum Monument with tablet stamped to identify corner.
2. Tamarack, 7", S.07°E., 26.25 feet.
3. Tamarack, 7", S.36°W., 60.08 feet.
4. Tamarack, 7", N.70°W., 13.31 feet.
5. Steel Sign Post, Southwest, 0.60 feet.

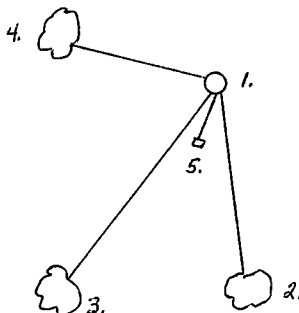

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

No.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

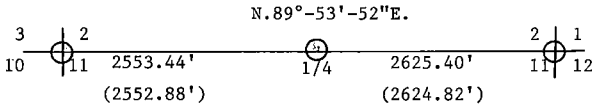

() Nathan Smith's 1904 distance

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of November, A.D., 19 94 at
2:00 o'clock A.M. and recorded
in Vol Chas. Restoration
pages 3515-E19
Paul Chittenden Deputy
Register of Deeds

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Distict Ranger



DOCUMENT NUMBER 129847

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.


○ = Corner monument restored.

Corner to Sections 1, 2, 11, and 12, T.35N., R.15E.

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 14th day
of March, A.D., 1986 at
10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page E-21

Paul A. Schenck
Register of Deeds

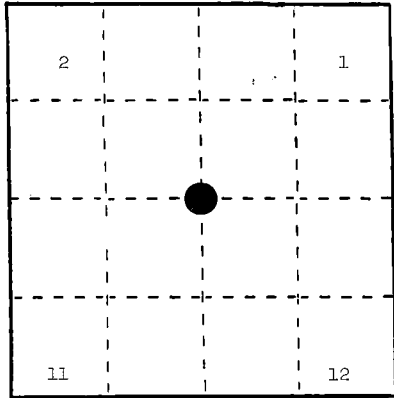

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post and made the following BTs: Hemlock, 14", N.48°W., 42 links; Sugar, 14", N.60°E., 25 links; Sugar, 12", S.48°E., 11 links; Sugar, 16", S.51°W., 10 links.


In 1905, N. Smith was at this corner when surveying in Sections 1 and 11. No new BTs added.

In 1982, Milo Stefan retraced Smith's survey through this corner area along section lines. Found post point on north edge of old grade. Distances fit with Smith's surveys. Set monument and made references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Basswood, 10", N.53°E., 8.47 feet
3. Sugar, 8", S.35°E., 45.90 feet
4. Sugar, 6", S.39°W., 39.60 feet
5. Sugar, 4", N.22°W., 60.35 feet
6. Steel Sign Post, North, 1.80 feet

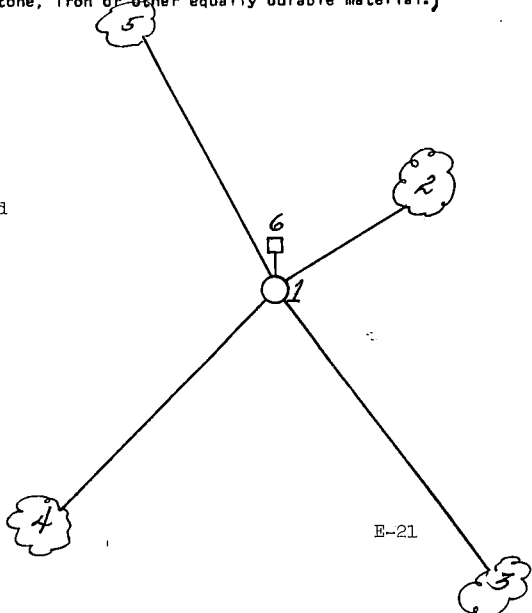

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 1, 2, 11 & 12,
T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
Wisconsin North Zone
137770.25668-N
2334349.65012-E

Geographic Coordinates
45-32-07.69045-N
088-34-20.26291-W

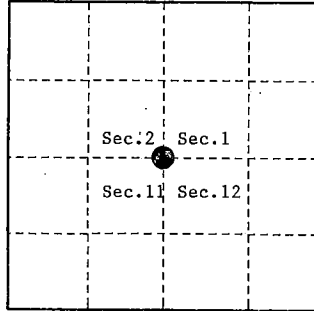

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Hemlock, 14", N.48°W., 42 links, Sugar, 14", N.60°E., 25 links, Sugar, 12", S.48°E., 11 links, Sugar, 16", S.51°W., 10 links.

In 1905 Nathan SMith, RLS, was at this corner, surveying in Sections 1 and 11. No new bearing trees were made.


In 1982, Milo Stefan, RLS, retraced Nathan Smith's survey through this corner area along Section Lines. Found post point on North edge of old grade. Distances fit with Smith's surveys. Set a 2" x 36" Aluminum Monument with tablet stamped to identify corner. Made new bearing trees; Basswood, 10", N.53°E., 8.47 feet, Sugar, 8", S.35°E., 45.90 feet, Sugar, 6", S.39°W., 39.60 feet, Sugar, 4", N.22°W., 60.35 feet, Steel Sign Post, North, 1.80 feet.

On 12-14-93, Alan Harrison, RLS, found the monument and bearing trees as set in 1982. Cut down the Northeast Basswood bearing tree for G.P.S. observations. Made a new bearing tree; Basswood, 10", N.25°E., 23.40 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" Aluminum Monument with tablet stamped to identify corner.
- Basswood, 10", N.25°E., 23.40 feet.
- Sugar, 8", S.35°E., 45.90 feet.
- Sugar, 6", S.39°W., 39.60 feet.
- Sugar, 4", N.22°W., 60.35 feet.
- Steel Sign Post, North, 1.80 feet.

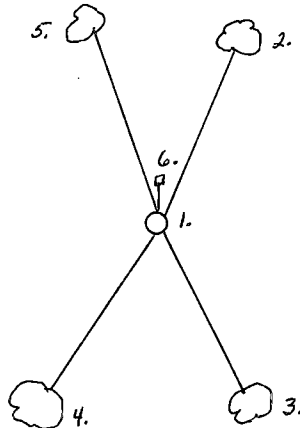

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of November, A.D., 1994 at
9:00 o'clock A.M. and recorded
in Vol. Case Restorations
page 35-15 E-21
Paul Little, Deputy
Register of Deeds

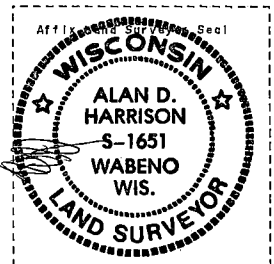

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Joe Vap
District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 1 and 12,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 137893.81701
 E - 2336963.49303

Geographic Coordinates
 N - 45 - 32 - 08.44463
 W - 088 - 33 - 43.51821

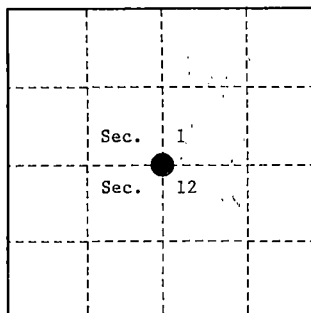

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post and made the following B.T.'s; Birch, 10", N.15°E., 19 links, Fir, 10", S.33°W., 11 links.

In 1905, N. Smith found original corner and Birch BT standing (green).

In the 1930s, R. Reinike found Spruce post in good condition and scribed Hemlock B.T., S.32°E., 23 links, Placed location poster on Aspen, 5", S.72°E., 9 links.


In 1982, Milo Stefan found mound of rock with post hole--from which a broken-off Aspen with location tag at base was found, S.72°E., 5.9 feet and remains of original Birch stump, N.15°E., 12.5 feet. Set monument and new references.

In 1994, Alan Harrison, RLS, found the monument and corner references as set by Milo Stefan in 1982. Made 2 new bearing trees; Hemlock, 16", S.78°E., 72.43 feet, Spruce, 12", S.05°E., 62.23 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" X 36" Aluminum Monument
Stamped to identify corner.
2. Hemlock, 15", N.42°E., 42.64 feet.
3. Hemlock, 16", S.78°E., 72.43 feet.
4. Spruce, 12", S.05°E., 62.23 feet.
5. Spruce, 12", S.24°W., 12.73 feet.
6. Red Pine, 6", N.17°W., 48.73 feet.
7. Steel Sign Post, Southeast, 1.46 feet.

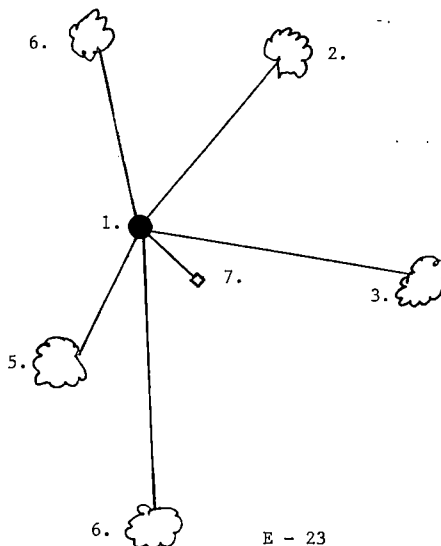

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 10th day
of May A.D. 1995 at
3:30 o'clock P. and recorded
in Vol. Gran Pastures
page 375, E-23
Paul Chittles Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

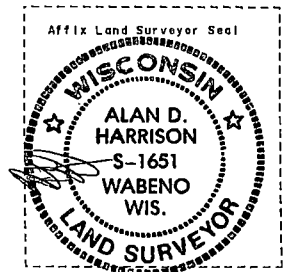


DOCUMENT NUMBER 129848

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 1 and 12, T.35N., R.15E.

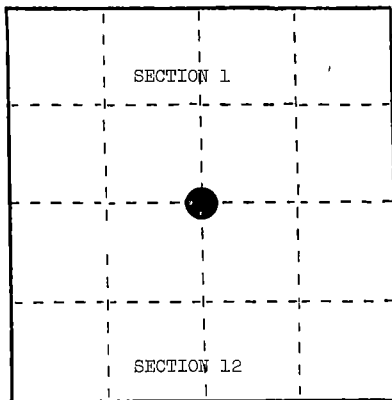

REGISTER'S OFFICE }
 Forest County, Wis.

Received for record this 14th day
 of March A.D., 1986 at

10:55 o'clock A.M. and recorded
 in Vol. E-23 **CORNER RESTORATIONS**

Page 5
Paul Aschenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post and made the following BTs: Birch, 10", N.15°E., 19 links; Fir, 10", S.33°W., 11 links.

In 1905, N. Smith found original corner and Birch BT standing (green).


In the 1930s, R. Reinike found Spruce post in good condition and scribed Hemlock BT, S.32°E., 23 links. Placed location poster on Aspen, 5", S.72°E., 9 links.

In 1982, Milo Stefan found mound of rock with post hole--from which a broken-off Aspen with location tag at base was found, S.72°E., 5.9 feet and remains of original Birch stump, N.15°E., 12.5 feet. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Hemlock, 15", N.42°E., 42.64 feet
3. Spruce, 12", S.24°W., 12.73 feet
4. Red Pine, 6", N.17°W., 48.73 feet
5. Steel Sign Post SE 1.46 feet.

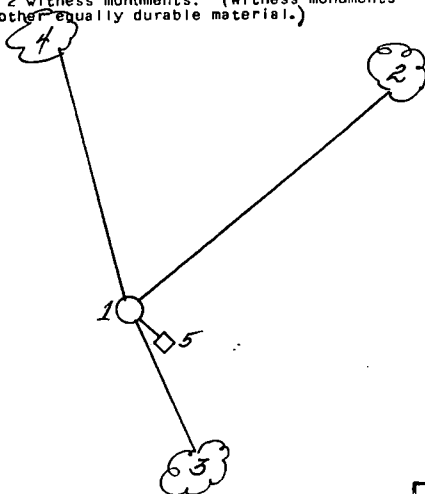

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

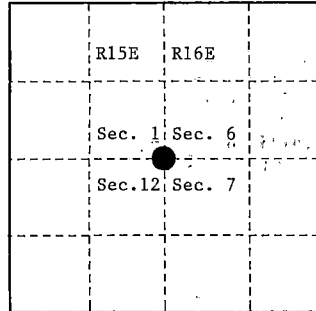

Section Corner to Sections 1, 6, 7 and 12,
 T.35N., R.15 - 16 E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 137918.97033
 E - 2339595.56099

Geographic Coordinates
 N - 45 - 32 - 08.22083
 W - 088 - 33 - 06.54245

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis set a wood post and the following B.T.'s; Tamarack, 18", S.38°W., 19 links, Cedar, 9", N.54°W., 18 links, Tamarack, 16", N.72°E., 21 links, Cedar, 12", S.72°E., 50 links.


In 1977, Jean Resvick, RLS, found a 1½" diameter iron pipe, 2 wood posts fallen over, and original bearing tree evidence; Tamarack, fallen log, S.38°W., 12.5 feet, scribed, Cedar, fallen log, N.54°W., overgrowth, 12 feet, Tamarack, fallen log, N.72°E., 14.0 feet, scribed. He replaced iron pipe with a 2" X 60" galvanized iron pipe, with a brass cap stamped to identify corner. Made the following B.T.'s; Cedar, 10", N.60°E., 17.85 feet, Cedar, 9", S.30°E., 10.87 feet, Cedar, 9", S.62°W., 10.10 feet, Cedar, 8", N.72°W., 26.45 feet, Steel Sign Post, 6 inches, North.

In 1994, Alan Harrison, RLS, found monument and bearing trees as set by Resvick in 1977. Cut down all of Resvick's bearing trees for G.P.S. observations. Made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" X 60" iron pipe with brass cap stamped to identify corner.
2. Cedar, 13", N.16°E., 62.50 feet.
3. Cedar, 10", N.78°E., 50.05 feet.
4. Cedar, 9", N.65°W., 57.40 feet.
5. Steel Sign Post, Northwest, 2.00 feet.

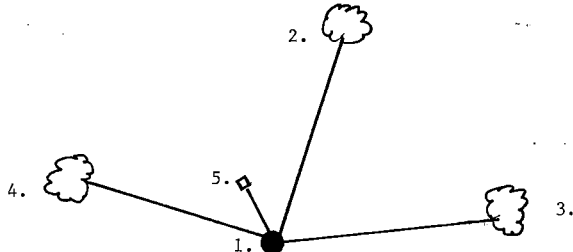

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 10th day
of May, A.D., 19 95 at
8:30 o'clock A. M. and recorded
in Vol. Case Restoration
page 55-156; F-25
Paul Chitka, Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

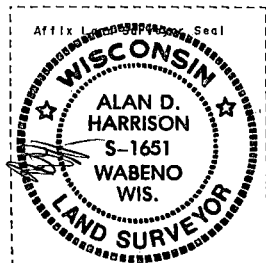

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 21 day of June, 1977, I found evidence of the Northeast Section corner of Section 12 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Survey in 1857 by Artemas Curtis
80.00 chains North between Sections 7 and 12, set post
Tamarack, 18, S38W, 19 lks.
Cedar 9, N54W, 18 lks.
Tamarack 16, N72E, 21 lks.
Cedar 12, S72E, 50 lks.

Description of corner evidence found:

1 1/4" iron pipe, 6 feet long
Two wood posts fallen over
Tamarack, fallen log S38W, 12.5 ft. scribed
Cedar, fallen log, N54W, over growth, 12 feet
Tamarack, fallen log, N72E, 14.0 ft. scribed

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced iron pipe with a 2 inch inside diameter, galvanized iron pipe, 5 feet long, filled with concrete, with brass cap stamped:
T35N, R15E, R16E, S1, S6, S12, S7, 1977, S-802
Blazed and scribed the following new bearing trees
Cedar 10, N60E, 17.85 ft.
Cedar 9, S30E, 10.87 ft.
Cedar 9, S62W, 10.10 ft.
Cedar 8, N72W, 26.45 ft.
Set steel sign post 6 inches north of monument

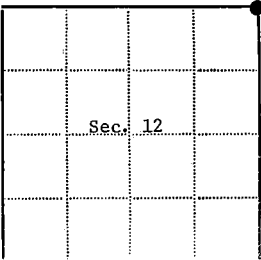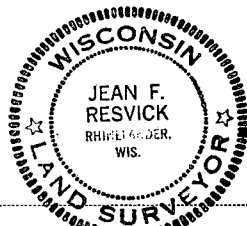

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland, Wisconsin, this 21 day of July, 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113287

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February, 1978, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 12, Index No. E-25, Page No. _____

43515 01 0000

E
25


U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 7 & 12,
T35N, R14 and 15E, 4th P.M.

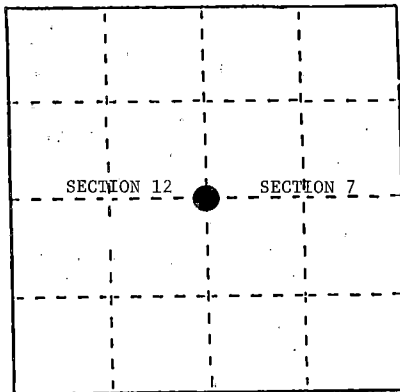

REGISTER'S OFFICE

Forest County, Wis.

Received for record this 16 day

of Sept. A.D. 1989 at

10:35 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page 9-1

Paul H. Berntsen

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed in the construction and reconstruction of State Highway #32.

In 1980 Forest Service surveyor William Cochrane restored this corner by lost methods and placed a railroad spike in the highway and a reference monument N88°-55.1'W, 89.00 feet. This railroad spike was removed in the 1985 resurfacing of the highway and the DOT placed four Witness Corners to this corner.

7/10/85 the DOT filed a "Preservation of Landmarks" form with the County Clerk.


On 3/23/89 I located the Forest Service reference monument and the DOT Witness Corners and placed a PK nail in the surface of Highway 32 for the corner position. This being used as the Quarter Corner for the subdivision of Section 7, T35N, R15E. After confirmation that this position conforms to the survey to the west I restored on 7/1/89 and replaced the PK nail with a railroad spike in the surface of Highway #32.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Forest Service brass tablet on 2" x 60" iron pipe, N88°-55.1'W, 89.00 feet
- 3) DOT Berntsen aluminum monument, W.C. #1, S51°-10'W, 41.11'
- 4) DOT Berntsen aluminum monument, W.C. #2, N61°-04'W, 49.81'
- 5) DOT Berntsen aluminum monument, W.C. #3, N51°-10'E, 81.63'
- 6) DOT Berntsen aluminum monument, W.C. #4, S61°-04'E, 76.79'
- 7) Steel sign post, SW, .43' from DOT W.C. #1

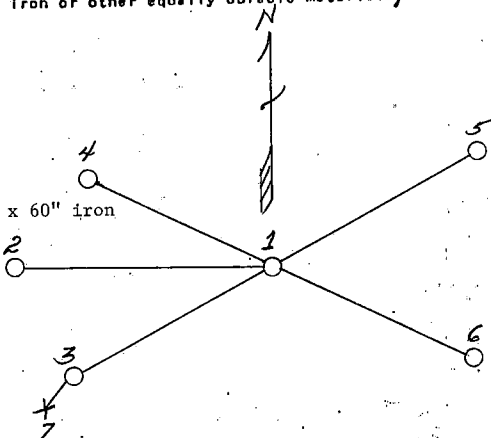

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence of use for proportioning in determining the corner location?

Affix Land Surveyor Seal.



(i) 1. Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date

CERTIFICATE READY FOR FILING:

Dale B. Stage
District Ranger

232163

FOREST COUNTY, WI
CORTNEY BRITTEN CLEERMAN
REGISTER OF DEEDS
RECEIVED FOR RECORD


OCT 23 2020

Time: 9:00 AM.
Vol: Corner Restoration
Page Number: 6-1

U.S. PUBLIC LAND SURVEY MONUMENT RECORD FOREST COUNTY

TYPE OF MONUMENT: BERNTSEN STEEL SURVEY MARKER NAIL
WISCONSIN COUNTY COORDINATE SYSTEM (FOREST)
DATUM: NAD 83 (2011 ADJUSTMENT)
NORTHING 555594.053
EASTING 894192.887
DRAWN BY: ANDREW HUNTER

SECTION 7
TOWN 35 NORTH
RANGE 15 EAST

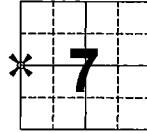

BASIS FOR MONUMENT LOCATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL OR OTHER EVIDENCE CONSIDERED:

SEE PREVIOUS TIE SHEET PREPARED BY
MILO E. STEFAN DATED JULY 7, 1989 FOR
MONUMENT HISTORY.

I COMPLETED A FIELD SURVEY PRIOR TO HIGHWAY
CONSTRUCTION ALONG S.T.H. "32" AND FOUND A R.R.
SPIKE IN ASPHALT AS CALLED FOR.

THIS MONUMENT FIT WELL WITH THE 4 EXISTING
WITNESS MONUMENTS AND THE PUBLISHED COUNTY
COORDINATES, AND WAS ACCEPTED AS THE TRUE
CORNER LOCATION. I SET A BERNTSEN STEEL SURVEY
MARKER NAIL, AND VERIFIED EXISTING WITNESS TIES
AFTER CONSTRUCTION WAS COMPLETED.

SEAL:




CERTIFIED CORRECT:

Andrew L. Hunter
PROFESSIONAL LAND SURVEYOR

DATE OCTOBER 15, 2020


TIE SKETCH

SHOW AT LEAST FOUR TIES, ALSO FENCE LINES, ROADS, TOPO, SIZE AND TYPE OF WITNESS TREES AND ANY OTHER PERTINENT SITE DETAILS. IF OFF THE ROAD, THE BEST WAY TO ARRIVE AT THE CORNER.

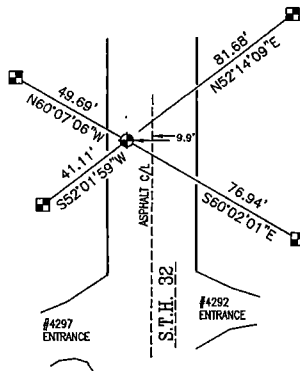

□ FOUND DOT BERNTSEN
ALUMINUM MONUMENT

◆ SET BERNTSEN STEEL SURVEY MARKER NAIL



SCALE 1"=50'

6-1

43514122000

138175

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 7 & 8,
T35N, R15E, 4th P.M.

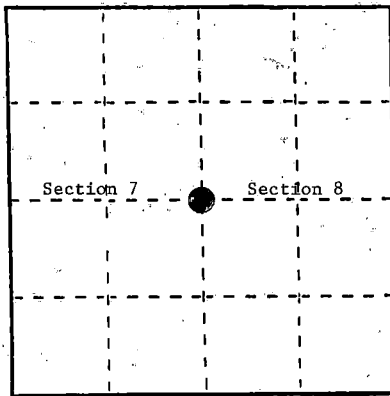

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept. A.D. 1989 at
10:35 o'clock A.M. and recorded
in Vol. 95 **CORNER RESTORATIONS**
page 5

Paul Hochstetler
Register of Deeds.

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride established this corner and set a wood post with BTs:
8" Hemlock, S28°E, 20 links 10" Birch, S31°W, 22 links

4/18/89, Milo E. Stefan found a 1 1/2" x 12" iron pipe 6" below road surface. In past discussions with a local surveyor, Thomas Arnott, he stated that he had found an iron pipe here 8 - 10 years ago. Past use of this area has held this road intersection as the general quarter corner location. As this iron pipe fits alignment and distance to the section corners north and south, I accept as the perpetuated corner location. No evidence of the original corner would possibly remain here due to mans' activities.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 3/4" x 24" iron rod, 8" below road surface with found iron pipe along side.
- 2) 2 1/2" x 36" aluminum monument, East, 25.00' as a Witness Corner.
- 3) 8" Cedar, N31°E, 47.70'
- 4) 4" Red Maple, S23°E, 39.06'
- 5) 12" Red Pine, S61°W, 65.83'
- 6) 10" Tamarack, N56°W, 75.00'
- 7) Steel Sign Post, East 24.00'

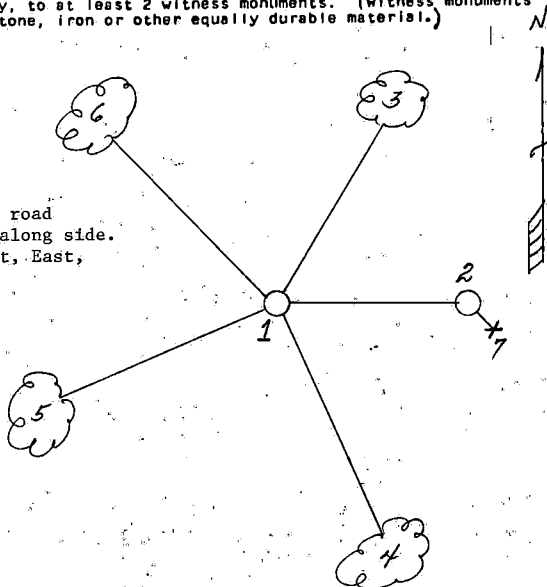

43515072000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal



- (i) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing: Daniel Stange

District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan do hereby certify that on the 21 day of October, 19 80, I found evidence of the West Quarter corner of Section 9 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in June 1859.
Set Wood Post.
Hemlock 12", S70°E, 20 lks.
Hemlock 16", N60°W, 30 lks.

Description of corner evidence found:

Wood post in mound of rock
Hemlock Stump remains S70°E, 13.2'
Hemlock Stump remains N60°W, 19.8'


Description of monument and accessories I established to perpetuate the location of this corner:

At corner position set 2 inch by 30 inch aluminum pipe with cap stamped:
T35N, R15E, 1/4, S8, S9, 1980, R.L.S. 1558

From which the following bear:

Sugar Maple 8", S30°E, 10.70'
W. Spruce 5", S32°W, 20.51'
W. Spruce 13", N43°W, 32.39'

DOCUMENT NO.
119861

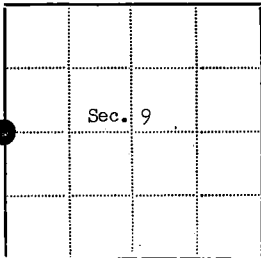

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Leona Wisconsin, this 3 day of November 19 80.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. 1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June, 19 81, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugen Stegany Title Register of Deeds

Township 35N, Range 15E, Section 9, Index No. G-9, Page No. _____

43515082000

69

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 21st day of October, 1982, I found evidence of the West 1/4 corner of Section 9 Township 35N, Range 15E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set $\frac{1}{4}$ section wood post
Hemlock, 12", S70E, 20 lks., 13.2 feet
Hemlock, 16", N60W, 30 lks., 19.8 feet

Description of corner evidence found:


Found 5" x 5" x 2' Cedar post in mound of stone.
Hemlock stump, 18" - 20", N60W, 19.8 feet
Hemlock stump remains, S70E, 13.2 feet

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 30" aluminum pipe in mound of stone with cap stamped as follows:
T35N, R15E, S8, $\frac{1}{4}$, S9, 1980, RLS-1558
From which the following bear:
Sugar Maple, 8", S30E, 10.70 feet
White Spruce, 5", S32W, 20.51 feet
White Spruce, 13", N43W, 32.39 feet
Steel sign post, NE, 1.4 feet

DOCUMENT NO.

124183

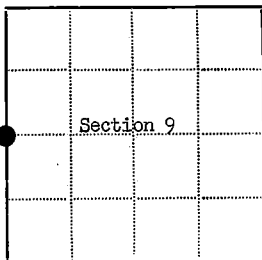

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 2 day of MAY 1982.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene H. Stangor Title Register of Deeds

Township 35N, Range 15E, Section 9, Index No. G-9, Page No. 43


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 9 and 10,
 T.35N., R.15E., Forest County, Wisconsin.

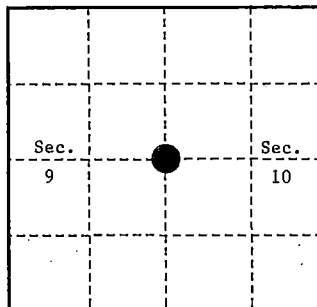

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Birch, 10", N.50°W., 19 links; Hemlock, 8", S.31°E., 29 links.

In 1904, N.H. Smith found original corner.


In 1906, N.H. Smith found corner obliterated and re-established the corner with the following BTs: Hemlock, 12", N.12½°W., 42 links; Sugar, 12", N.57 3/4°E., 63 1/3 links.

In 1991, Alan Harrison (RLS) found 1" Re-Bar in a post hole with no bt. evidence. Position of Re-Bar fit well with the Smith survey and is accepted as a pertetuation of the corner by Smith.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. indicate north.

- 2½"x 36" aluminum monument with tablet stamped to identify the corner.
- Basswood, 10", N.85°E., 18.09 feet
- Power Pole, #35-15 9E20, N.85°W., 29.48 feet
- Sugar, 10", N.04°W., 15.76 feet
- Steel Sign Post, West, 0.90 feet

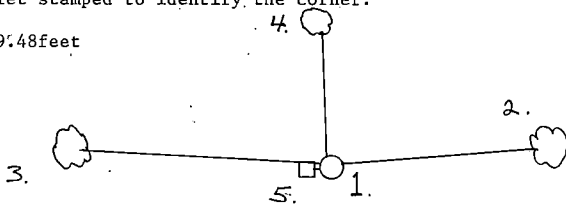

REGISTER'S OFFICE }
 Forest County, Wis.

Received for record this 13th day
 of May A.D., 1992 at
 11:20 o'clock A.M. and recorded
 in Vol. 144431
 page 13

Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Sue V. [Signature]
District Ranger

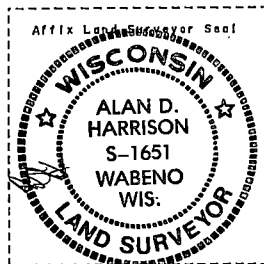

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 10 & 11,
 T.35N., R.15E., Forest County, Wisconsin

State Plane Coordinates
 Wisconsin North Zone
 135194.73333-N
 2329204.47553-E

Geographic Coordinates
 45-31-43.17365-N
 088-35-33.17214-W

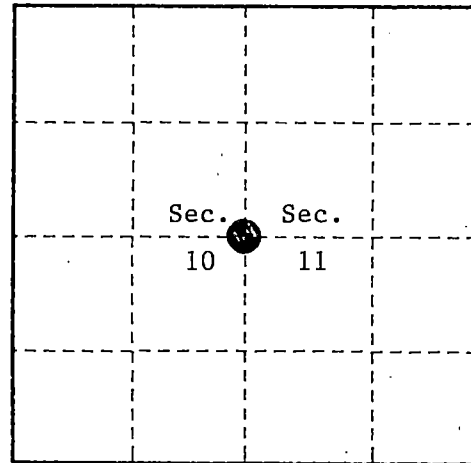

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Spruce, 8", N.54°W., 20 links, Tamarack, 14", N.65°E., 14 links 4.00 chains North, Creek, SW.


In 1983 Milo Stefan, RLS, found a very decayed original Tamarack stump. Also found the following local evidence; Fallen Cedar Post, with location poster attached. From post, 10" Cedar, N.46°E., 22 links with axe mark at B.T. blaze (set by N.H. Smith in 1906). Spruce, 8", N.65°E., 9.2 feet growing on Tamarack B.T. remains. Replaced post with a 2" x 36" Aluminum Monument with tablet stamped to identify corner. Made new bearing trees; White Spruce, 7", N.69°E., 10.03 feet, White Spruce, 7", S.55°W., 50.81 feet, Red Maple, 5", N.42°W., 13.42 feet, Steel Sign Post, West, 0.30 feet.

On 12-16-93, Alan Harrison, RLS, found the monument as described above and all bearing trees dead & down. Blazed and scribed new bearing trees; White Spruce, 11", N.49°E., 53.10 feet, White Spruce, 11", N.67°E., 50.31 feet. Moved Steel Sign Post 3.50 feet South of Monument. No other B.T.'s are available.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" Aluminum Monument with tablet stamped to identify corner.
2. White Spruce, 11", N.49°E., 53.10 feet.
3. White Spruce, 11", N.67°E., 50.31 feet.
4. Steel Sign Post, South, 3.50 feet.

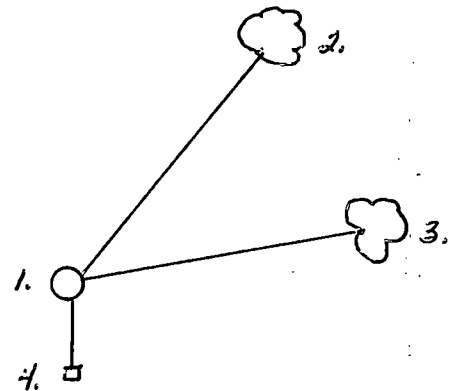

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?


(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of November, A.D., 1994, at
8:00 o'clock A. M. and recorded
in Vol. County Restoration
page 55-15-16-17

Paul P. Dwyer
Register of Deeds

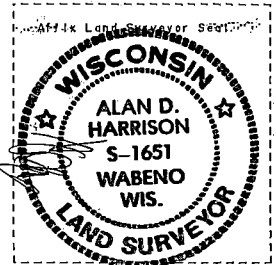

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 13th day of January, 1983, I found evidence of the West Quarter corner of Section 11 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set wood post
Spruce, 8", N54°W, 20 lks., 13.2'
Tamarack, 14", N65°E, 14 lks., 9.24'

Description of corner evidence found:


BT original evidence found--very decayed Tamarack stump
Local Evidence: Fallen Cedar post, scribed "18" with location poster attached.
From post is a 10" Cedar, N46°E, 22 lks., with axe mark at BT blaze. (Set by N. H. Smith in 1906.)
Spruce, 8", N65°E, 9.2', growing on the remains of the Tamarack BT.

Description of monument and accessories I established to perpetuate the location of this corner:

We replaced post with a 36" x 2" aluminum monument with tablet stamped as follows:
T35N, R15E, $\frac{1}{4}$, S10, S11, 1983, RLS-1558
From which the following bear:
White Spruce, 7", N69°E, 10.03'
White Spruce, 7", S55°W, 50.81'
Red Maple, 5", N42°W, 13.42'
Steel Sign Post, 7', West, .3'



DOCUMENT NO.
124185

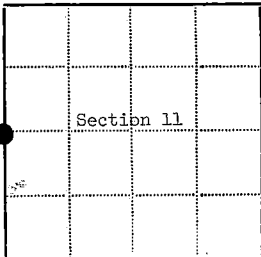

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 13th day of January, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene H. Stetson Title Register of Deeds

Township 35 North, Range 15 East, Section 11, Index No. G-17, Page No. 26

43515102000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter Corner between Sections 11 and 12,
 T.35N., R15E., Forest County, Wisconsin

State Plane Coordinates
 Wisconsin North Zone
 N - 135163.35417
 E - 2334402.00403

Geographic Coordinates
 N - 45 - 31 - 41.94811
 W - 088 - 34 - 20.18582

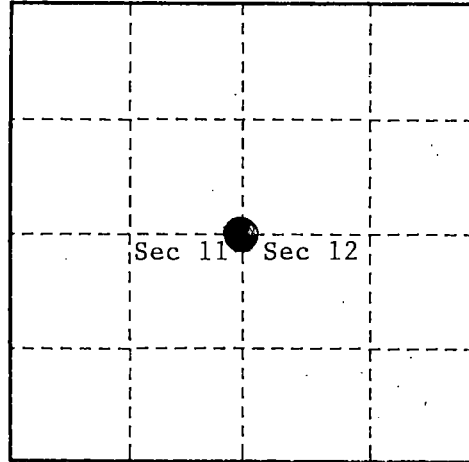

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1859 by James McBride. Set wood post and the following B.T.'s;
 Sugar, 16", N.51°E., 13 lks., Sugar, 24", S.50°W., 20 lks.

In 1904 Nathan Smith found an original B.T. broken off. Marks plain. He measured 39.74½ chains from the SE Section Corner of Section 11.


In 1982 Milo Stefan, RLS, found a mound of stone at the corner area. No other evidence located.

In 1984, Alan Harrison, RLS, found mound of stone as found by Stefan in 1982. According to Phil Gentz, adjacent landowner, the rock pile has been there for many years and used as the corner. Distance from rock pile South to Section Corner is 39.61 chains vs. 39.74½ chains measured by Nathan Smith in 1904. In center of rock pile set a 2" X 36" aluminum monument and made bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" X 36" aluminum monument with tablet stamped to identify corner.
2. Basswood, 14", N.13°E., 35.19 feet.
3. Sugar, 13", S.52°E., 30.91 feet.
4. Sugar, 11", S.83°W., 38.86 feet.
5. Steel Sign Post, Northeast, 1.90 feet.

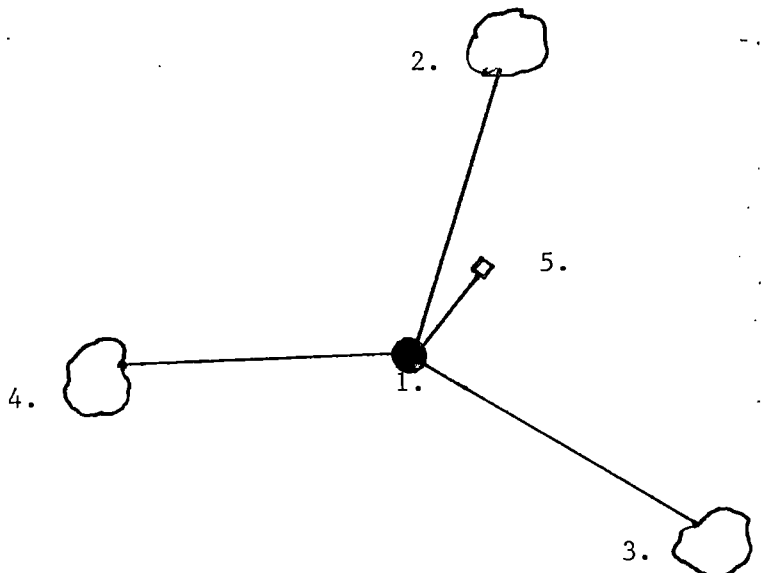

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(1.)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No

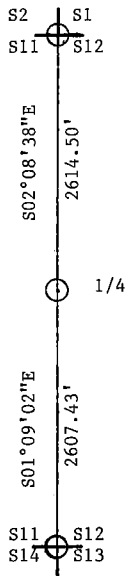

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May, A.D., 19 95 at
8:30 o'clock A.M. and recorded
in Vol. Case Reestablishment
page 52, 53, 54
Paul Childs Deputy
Register of Deeds

Affix Land Surveyor Seal

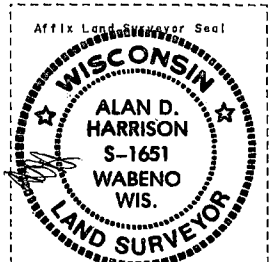

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 7 and 12,
 T.35N., R.15 - 16E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 135283.02367
 E - 2339628.35839

Geographic Coordinates
 N - 45 - 31 - 42.19530
 W - 088 - 33 - 06.75689

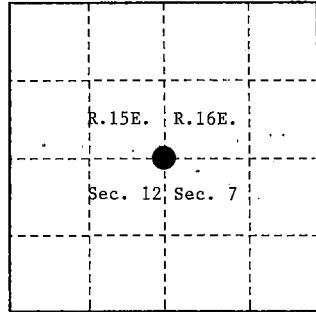

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post and the following B.T.'s; Tamarack, 13", S.74°W., 23 links, Tamarack, 13", S.85°E., 6 links. South, 20.00 chains leave swamp, South 25.00 chains enter swamp.


In 1977, Jean Resvick, RLS, found an iron pipe and wood post. Found both original bearing tree stumps, and fit both swamp calls to the South. In place of iron pipe, set a 2" X 36" galvanized iron pipe with a brass cap stamped to identify the corner. Blazed and scribed new B.T.'s; Black Spruce, 7", S.80°E., 20.16 feet, Cedar, 8", S.19°W., 20.85 feet, Steel Sign Post, North, 0.50 feet.

In 1994, Alan Harrison, RLS, found monument and bearing trees as set by Resvick in 1977. Cut down all bearing trees for G.P.S. observations. Made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" X 36" iron pipe with brass cap stamped to identify corner.
2. Cedar, 9", N.61°E., 60.80 feet.
3. Cedar, 8", S.75°W., 44.70 feet.
4. Cedar, 7", N.04°W., 25.35 feet.
5. Steel Sign Post, North, 0.50 feet.

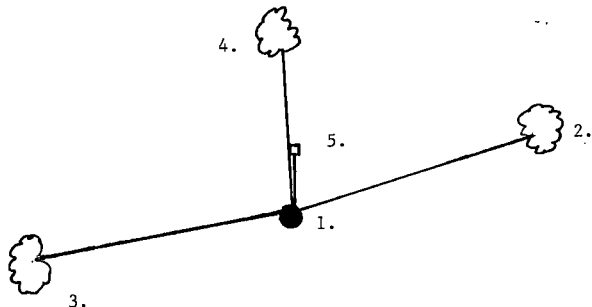

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May, A.D., 1995, at
8:30 o'clock A.M. and recorded
in Vol. Canon, Restoration
page 35-36, 37-38

Paul Curtis, Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

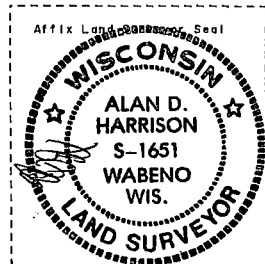

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I, Jean F. Resvick, do hereby certify that on the 21 day of June, 1977, I found evidence of the East Quarter corner of Section 12 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in 1857 by Artemas Curtis
40.00 chains north between sections 7 and 12, set post
Tamarack 13, S74W, 23 lks.
Tamarack 13, S85E, 6 lks.
20.00 ch. south leave swamp bears west
25.00 ch south enter swamp bears west

Description of corner evidence found:

Iron pipe and wood post
Tamarack stump, S74W, 15.2 feet, rotten
Tamarack stump, S85E, 4.0 feet, rotten
South 20 chains leave swamp
South 25 chains enter swamp

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced the iron pipe, with a 2 inch inside diameter, galvanized iron pipe, 3 feet long, filled with concrete, with an additional 3 feet of pipe thread on bottom with brass cap stamped:
T35N, R15E, R16E, 1/4, S12, S7, 1977, S-802
Blazed and scribed the following new bearing trees:
Black spruce 7, S80E, 20.16 ft.
Cedar 8, S19W, 20.85 ft.
Set steel sign post 6 inches north of monument.

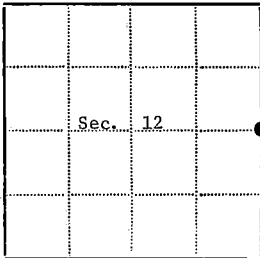

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 21 day of July 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113288

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 12, Index No. G-25, Page No.

138176

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 7, 12, 13 and 18, T35N, R15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 16th day
of Sept A.D. 1989 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 1-1
Paul Hochstetler
Register of Deeds

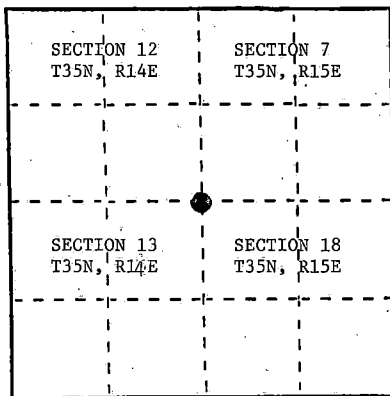

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed in the construction and reconstruction of State Highway #32 over the years, the last time in 1985.

In 1980 Forest Service surveyor, William Cochrane, restored this corner and placed a railroad spike in the highway and a reference monument N89°-18.3'W, 91.00 feet. He used this corner to subdivide Sections 12 and 13, T35N, R14E.


On 7/10/1985 DOT filed with the County Clerk a "Preservation of Landmark" form on this corner whereby four additional Witness Corner Monuments were established.

On 3/23/89 I located the Forest Service Reference Corner and DOT Witness Corners and ran our traverse through DOT Witness Corner 2 and 3. On 7/1/89 I placed a railroad spike in the surface of Highway #32 and placed a steel sign post southeast of DOT Witness Corner #2 .47 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Forest Service brass tablet on a 2" x 60" iron pipe N89°-18.3'W, 91.00 feet
- 3) DOT Berntsen aluminum monument, WC #1, N52°-51'E, 69.68'
- 4) DOT Berntsen aluminum monument, WC #2, S66°-05'E, 60.04'
- 5) DOT Berntsen aluminum monument, WC #3, S52°-51'W, 73.96'
- 6) DOT Berntsen aluminum monument, WC #4, N66°-05'W, 71.22'
- 7) Steel sign post SE of DOT WC #2, .47'

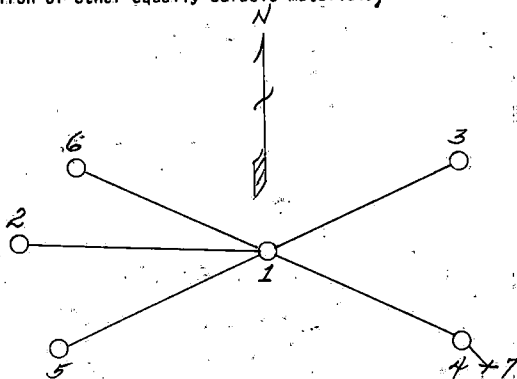

4351412-2000

J-1
RC-15

J-1

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date

Certificate ready for filing:

Dale B. Staeger
District Ranger

Affix Land Surveyor Seal



138177


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 7 & 18,
T35N, R15E, 4th P.M.

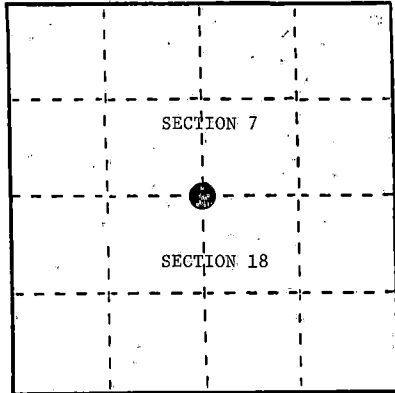

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of Sept, A.D., 1989 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 51-3
Paul Ackabrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859 James McBride established this corner and set a wood post and BTs:
12" Sugar, N20°W, 33 links 14" Lynn, S46°E, 21 links

5/10/89 - We located progeny from the original Basswood (Lynn) BT and a stump hole from the original Sugar BT. We restore this corner from what I feel is the remains of the original BTs. An iron pipe bears N50°E, 12.46'. An old fence runs northerly just east 2 - 3 feet from the restored corner. The centerline of a long established road bears east and south from the restored corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 8" Black Ash, N22°E, 17.54'
- 3) 6" Black Ash, S86°E, 24.62'
- 4) 8" Sugar, S66°W, 70.55'
- 5) 6" Sugar, N32°W, 19.79'
- 6) Steel Sign Post, NE, 1.31'

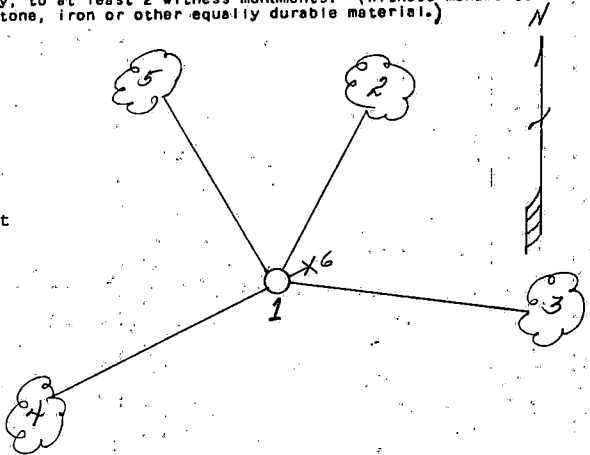

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing:

David S. Stange
District Ranger

Affix Land Surveyor Seal




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 9 and 16,
 T.35N., R.15E., Forest County, Wisconsin.

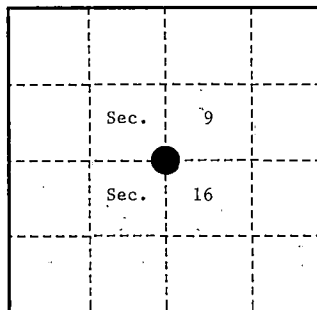

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Birch, 14", N.62°E., 20 links; Birch, 8", S.53°W., 30 links.


In 1904, N.H. Smith found original corner and he used the quarter corner and the section corner to the east to establish the east one-sixteenth corner to sections 9 and 16.

In 1991, Alan Harrison (R.L.S.) found no evidence of original or any subsequent corner. Set corner position at double distance from the section corner thru the east one-sixteenth as set by Smith and recovered. Position fits the 1904 survey well and is accepted as the corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2½" x 36" aluminum monument with tablet stamped to identify the corner.
- Sugar, 10", N.30°E., 36.17 feet.
- Sugar, 8", N.72°E., 5.55 feet.
- Sugar, 8", N.83°W., 37.80 feet.
- Steel Sign Post, Southeast, 1.05 feet.

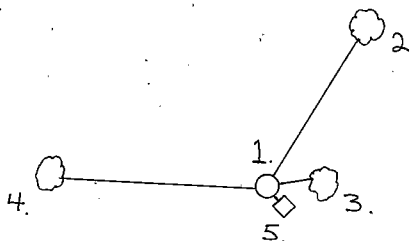

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 13th day
 of May, A.D., 1992 at

11:30 o'clock A.M. and recorded

in Vol. County Restorations

page 1-11

Paul Hochstetler
 Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) An obliterated evidence location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger



U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1659 - James McBride set the corner with the following witnesses:

Ironwood 12"	N78°W	40 Links	Sugar 24"	S55°W	45 Links
Sugar 8"	N10°E	42 Links	Sugar 12"	S33°E	38 Links

1904 - N. Smith called original BT's okay and distance south to quarter corner 2560.47'. Made new BT, Sugar 8" S71°E 25.08'

1918 - J. Melindy found old post and set 2" gas pipe in pit of stones, fence post at fence corner, S43°50'E, 34.90'. Distance south to quarter corner 2555'.

1977 - Milo Stefan set P.K. at intersection of County H and Goodman Park road. Fence line West. Distance South to quarter corner is 2554.21'.

1986 - Alan Harrison replaced P.K. with R.R. spike as best evidence of corner position.

Sugar 9"	N31°E	100.31'	Y. Birch 13"	S81°W	53.34'
Sugar 5"	S28°E	80.47'	2 1/2" x 36" alum reference mon	West	40.0'

1995 - John Garske, RLS 1685 found R.R. Spike. Plat of Survey for USFS. Refers to Alan Harrison witnesses:

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 30th day
of August A.D., 2012 at
8:55 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 113
Zachary J. Stevens
Register of Deeds

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
- ☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
- ☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
- ☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2012 - Zachary J. Stevens, RLS 2467-008, Found the remains of a PK/MAG nail with no head. Set new MAG nail in same position.

Found the following witnesses:


All witnesses from Alan Harrison have been removed except Y. Birch. Nail no longer is visible. Tree has witness tag and Blazes.

Set the following witnesses:


Maple stump	14"	S29°E	87.06'	set DH nail vertically in center of stump.
PP #3515-16E28		S18°W	81.78'	set DH nail
5/8 rebar with AYRES cap		N85°W	49.12'	Found 5/8" rebar with AYRES cap
5/8 rebar		N50°E	78.01'	set 5/8 rebar flush with ground in clear vision area

Corner falls 1' West of N/S center line of CTH "H"

The Northwest
corner of Section 15
T. 35N, R15E
Forest County, Wisconsin

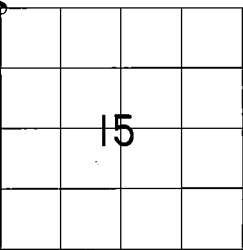

= LOCATION OF CORNER

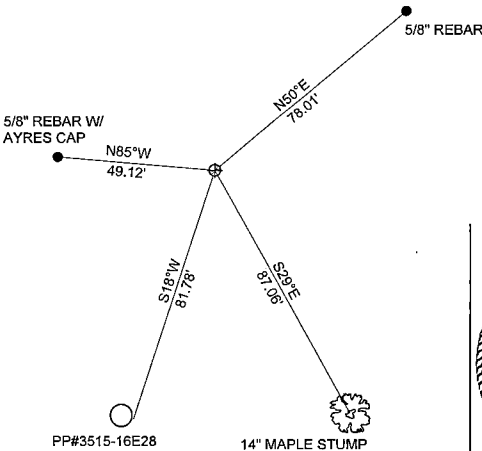

1" = 40'



I, ZACHARY J. STEVENS R.L.S. S 2467-008

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Zachary J. Stevens 8/30/12
SIGNATURE DATE

INDEX No. J-13

4351509 0000

DOCUMENT NUMBER **131261**


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Section corner to Sections 9, 10, 15, and 16,
T.35N., R.15E.

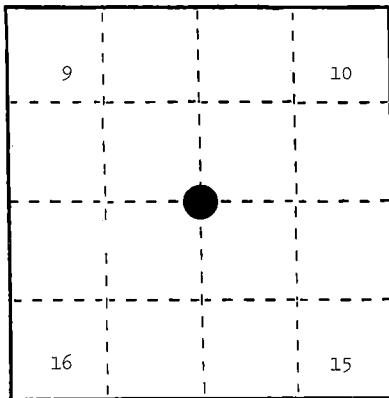

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 8th day
of October, A.D. 1986, at
1:25 o'clock P.M. and recorded
in Vol. 13 **CORNER RESTORATIONS**

Paul Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set corner with the following BTs: Ironwood, 12", N.78°W., 40 links; Sugar, 8", N.10°E., 42 links; Sugar, 12", S.33°E., 38 links; Sugar, 24", S.55°W., 45 links.

In 1904, N. Smith called original BTs okay and distance south to quarter corner 2560.47'. Made a new Sugar BT, 8", S.71°E., 25.08'.

In 1918, J. Melindy found old post and set 2" gas pipe in pit of stones, fence post at fence corner, S.43°50'E., 34.90'. Distance south to quarter corner is 2555'.


In 1977, Milo Stefan set P.K. at intersection of County " " and Goodman Park Road. Fence line west. Distance south to quarter corner is 2554.21'.

In 1986, Alan Harrison replaced P.K. with a R.R. spike as best evidence of corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. R.R. spike marking corner location.
2. Sugar, 9", N.31°E., 100.31'
3. Sugar, 5", S.28°E., 80.47'
4. Yellow Birch, 13", S.81°W., 53.34'
5. 2½" x 36" aluminum reference monument, West, 40.0'.

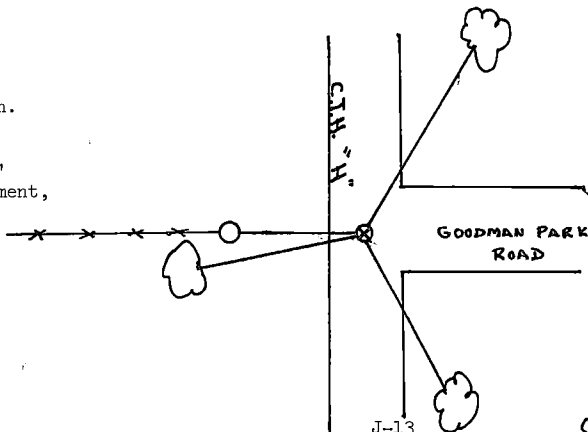

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

8/26/86
Date

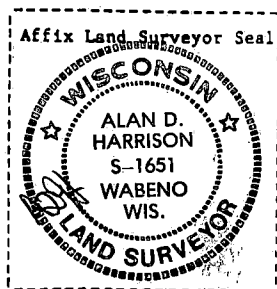

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1850 - James McBride set the corner with the following witnesses:

Hemlock 10" N02°E 37 Links Hemlock 10" S78°W 35 Links

1994 - Alan Harrison found a 1" diameter iron pipe as noted on form #874 dated 6-25-36. The iron pipe was located 6" below the surface of the old blacktop, of Forest Road #2136, which was previously called Road 350 according to form #874. Set a railroad spike flush with the surface of the new blacktop. Set the following witnesses:

Sugar 7" N17°E 33.04' 2 1/2" x 36" Reference Monument South 37.00' with steel sign post 0.7' South of monument
Sugar 12" N26°W 41.19' Centerline of road 2.8' South

1995 - John Garske, RLS 1685 found R.R. Spike. Plat of Survey for USFS. Refers to Alan Harrison witnesses:

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 30th day
of August A.D., 2012 at
8:55 o'clock A.M. and recorded
in Vol. CHANCE RESTORATION
page 15

Zachary J. Stevens
Register of Deeds

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2012 - Zachary J. Stevens, RLS 2467-008, Found the remains of a PK/MAG nail with no head. Set new MAG nail in same position.

Found the following witnesses:


Reference Monument South 37.06' Sign still in place South of Reference Monument
Sugar 7" now 10" N17°E Nail not visible. Tree has witness tag and overgrown Blazes.
Sugar 12" now 14" N26°W Nail not visible. Tree has witness tag and overgrown Blazes.

Set the following witnesses:


Maple 10" N17°E 33.18' Set DH nail in old nail scar
Maple 14" N26°W 40.69' Set DH nail in old nail scar
Aspen 8" S72°E 104.13' Set DH nail. Aspen has new chest, stump and nail blazes

Corner falls 3' North of E/W center line of Goodman Park Road

The North 1/4 corner
corner of Section 15
T. 35N, R15E
Forest County, Wisconsin

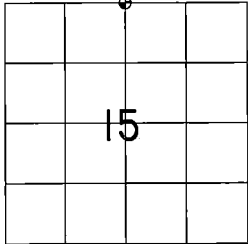

= LOCATION OF CORNER

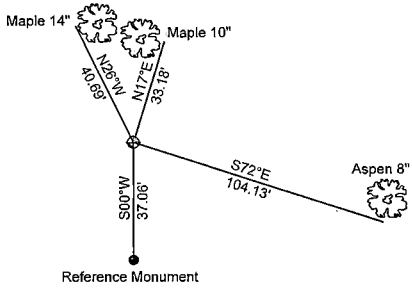

I, ZACHARY J. STEVENS R.L.S. S 2467-008

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Zachary J. Stevens 8/30/12
SIGNATURE DATE

INDEX No. J-15

43515100020

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 10 & 15,
T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates

Wisconsin North Zone


132591.92456-N

2326624.90784-E

Geographic Coordinates

45-31-17.93049-N

088-36-10.04301-W

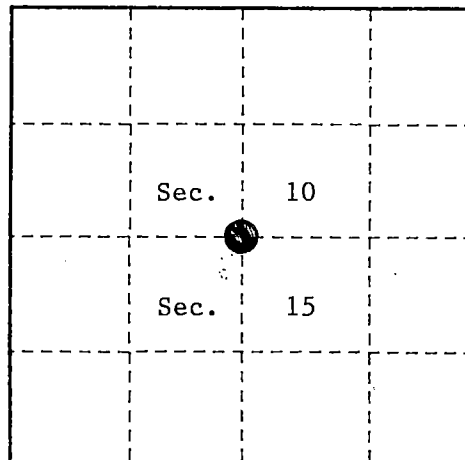

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Original survey in 1859 by James McBride. Set wood post and the following bearing trees; Hemlock, 10", N.02°E., 37 links, Hemlock, 10", 5.78°W., 35 links.

On 6-27-94, Alan Harrison (RLS) found a 1" diameter iron pipe as noted on form #874 dated 6-25-36. The iron pipe was located 6" below the surface of the old blacktop, of Forest Road #2136, which was previously called Road 350 according to form #874. Set a railroad spike flush with the surface of the new blacktop from which the following new corner references bear; Sugar, 7", N.17°E., 33.04 feet, 2½" x 36" Reference Monument, South, 37.00 feet, Sugar, 12", N.26°W., 41.19 feet, center-line of F.R. #2136, South, 2.80 feet, Steel Sign Post, 0.70 feet South of Reference Monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad spike flush with blacktop.
2. Sugar, 7", N.17°E., 33.04 feet.
3. 2½" x 36" Aluminum Reference Monument with tablet stamped to identify corner, South, 37.00 feet.
4. Sugar, 12", N.26°W., 41.19 feet.
5. Center-line F.R. #2136, South, 2.80 feet.
6. Steel Sign Post, 0.70 feet South of Reference Monument.

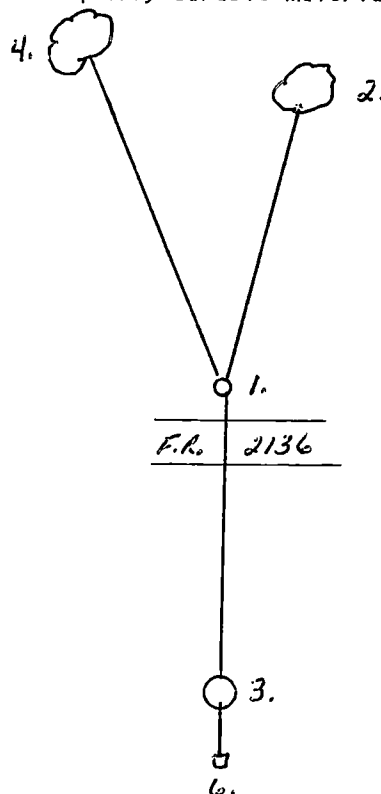

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.



REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of November A.D., 19 94 at
2:00 o'clock P.M. and recorded
in Vol. Case Restoration
page 35-15, 115
Paul Chittka, Deputy
Register of Deeds

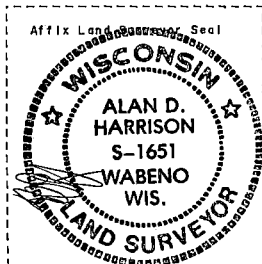

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMO NIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - James McBride set the corner with the following witnesses:

Hemlock 30"	N40°W	52 Links	Hemlock 24"	N25°E	15 Links
Sugar 12"	S36°E	57 Links	Birch 16"	S45°W	19 Links

1936 - John Hammes records show that on May 5, 1936 a iron pipe was found 10' below surface and bearing trees were found at N40W, S36E and S45W

1970 - Jean Resvick found 1 1/4" iron rod on South edge of road. Area has been clear of stumps for road improvements and plantation. Large stump holes check where hemlocks and Birch would have been. Set the following witnesses:

Spruce 10"	S57°E	26.18'	Reference Monument #1	S14°E	33.00' 6" dia concrete monument with brass cap
Spruce 8"	S05°E	20.34'	Reference Monument #2	N02°E	40.00' 2" galvanized iron pipe with brass cap
Spruce 5"	N13°W	44.80'	4" x 4" cedar post South 15'		

1987 - Alan Harrison recovered corner position by pulling distances from the corner references as set by J. Resvick. Plat of Survey shows a Brass capped monument found in place. Listed the following witnesses.

R. Pine 12"	N19°E	84.77'	Reference Monument #1	S14°E	33.00' 6" dia concrete monument with brass cap
W. Spruce 10"	S23°E	36.52'	Reference Monument #2	N02°E	40.00' 2" galvanized iron pipe with brass cap
W. Spruce 8"	N33°W	56.01'			

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
- ☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
- ☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
- ☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2012 - Zachary J. Stevens, RLS 2467-008, Found the remains of a PK/MAG nail with no head. Set new MAG nail in same position.

Found the following witnesses:

R. Pine 12" now 18"	N19°E	85.18'	found nail and washer just visible. Tree has witness tag and overgrown Blazes.
W. Spruce 10" now 14"	S23°E		Nail not visible. Tree has witness tag and overgrown Blazes.
W. Spruce 8" now 12"	N33°W		Nail not visible. Tree has witness tag and overgrown Blazes.
Reference Monument #1	S14°E	33.04'	6" dia concrete monument with brass cap
Reference Monument #2	N02°E	40.11'	2" galvanized iron pipe with brass cap

Set the following witnesses:

W. Spruce 14"	S23°E	36.93'	Set DH nail. Tree has witness tag and overgrown Blazes.
W. Spruce 12"	N33°W	55.68'	Set DH nail. Tree has witness tag and overgrown Blazes.


Corner falls 0.1' North of the South edge of pavement of Goodman Park Road

REGISTER'S OFFICE
Forest County, Wis.


Received for record this 30th day
of August, A.D., 2012 at
2:55 o'clock A.M. and recorded
in Vol. 109 Restorations
page 17

Zachary J. Stevens
Register of Deeds

The Northeast corner
corner of Section 15
T. 35N, R15E
Forest County, Wisconsin

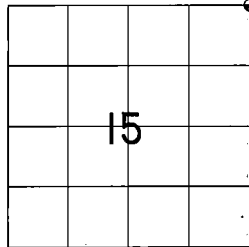

= LOCATION OF CORNER

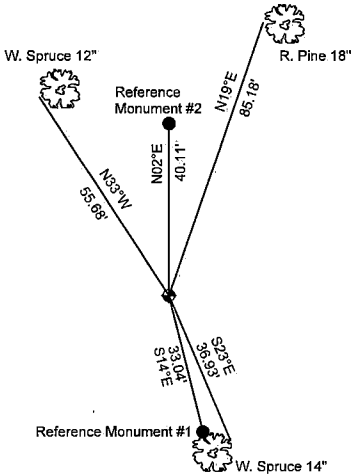

1" = 30'

LAND SURVEYOR SEAL



I, ZACHARY J. STEVENS R.L.S. S 2467-008

(TYPE OR PRINT AND CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

Zachary J. Stevens 8/30/12
SIGNATURE DATE

INDEX No. J-17

4351910000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 30th day of June, 1969, I found evidence of the Northeast Section corner of Section 15 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
80.00 chains north between sections 14 and 15, set post
Hemlock 30, N4OW, 52 lks.
Hemlock 24, N25E, 15 lks.
Sugar 12, S36E, 57 lks.
Birch 16, S45W, 19 lks.
John Hammes records show that on May 5, 1936 a iron pipe was found 10" below surface and bearing trees were found at N4OW, S36E and S45W.

Description of corner evidence found:

Found 1 1/4 inch diameter iron rod on south edge of road. Area has been clear of stumps for road improvements and plantation. Large stump holes check where Hemlocks and Birch would of been.

Description of monument and accessories I established to perpetuate the original location of this corner:




1 1/4 inch diameter iron rod left in place to mark corner. Blazed and scribed the following new bearing trees. Spruce 10, bears S57E, 26.18 ft., Spruce 8, bears S5E, 20.34 ft., Spruce 5, bears N13W, 44.80 ft. Set 4 x 4 cedar post south 15 ft.

Reference Mark Number 1

At S14E, 33 ft. set 6 inch diameter concrete monument, 4 ft. long 6 in. above ground with brass cap marked:

Reference Mark Number 2

At N2E, 40 ft. set 2 in. inside diameter galvanized wrought iron pipe, 5 ft. long, with brass cap marked:

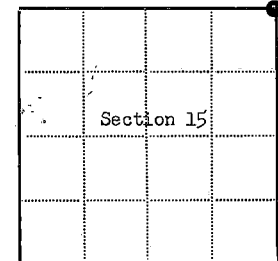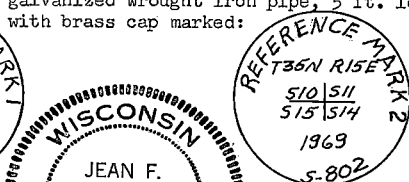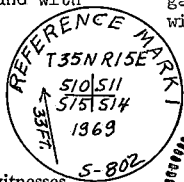

Resident witnesses

Dated at Rhineland
1970

Signature Jean F. Resvick

(County Surveyor, Registered Land Surveyor or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT NUMBER 98041

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. 1-17 Page No. 1-17 of County Records.

Signature Eugene Stetson Title Register of Deeds

Township 35 North, Range 15 East, Section 15, Index No. J-17, Page No. 1-17

43515100000


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter Corner to Sections 11 and 14, T.35N., R.15E.

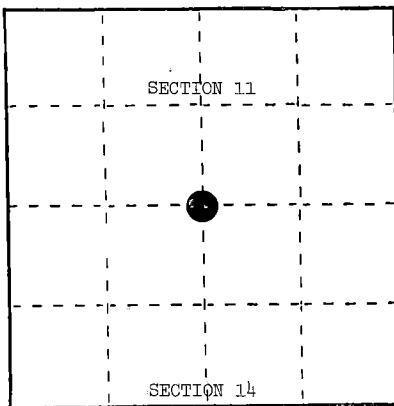

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 31st day

of March A.D. 1988 at

1:10 o'clock P.M. and recorded

in Vol. CORNER RESTORATIONS

page 19

Paul Archambault

Register of Deeds


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Birch, 12", S.42°E., 18 links; Birch, 14", N.57°E., 14 links. In 1904, N. Smith found original corner and witnesses to be okay. In 1908, J. Melendy found 4" x 4" Ironwood post from resurvey with the following original BTs: Birch, 14", S.24½°E., 18 links; Birch, 18", N.57°E., 13½ links. He then set a 5" x 5" Elm post in place of previous post. In 1936, John Hammes found a Cedar stake in good condition on north side of road. He did not believe stake to be original due to lack of any original evidence. In 1969, J. Resvick found Cedar post in mound of rock on south side of road. Set corner north, 33 feet from post found in road. In 1987, Alan Harrison (RLS) restored position by retracement of J. J. Melendy's survey from Center ¼ through the CN 1/16. Corner position agrees with N. Smith's 1904 survey and J. Melendy's 1908 survey.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad spike in road surface.
2. Jack Pine, 8", N.34°E., 73.81 feet
3. Sugar, 6", S.32°E., 70.30 feet
4. Jack Pine, 12", N.27°W., 56.75 feet
5. Steel Sign Post, North, 24.05 feet

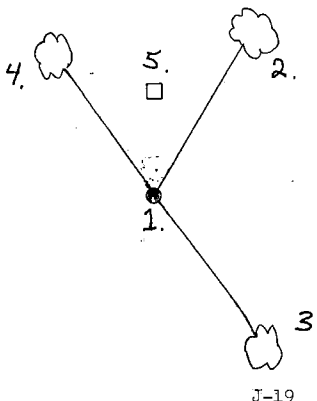

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Yes, corner by J. Resvick (1969), east, 104 feet.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


Yes.

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/28/88
Signature Date

Certificate ready for filing:

Doris Stacey
District Ranger

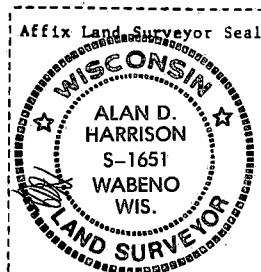

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 11 and 14,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 132589.69166
 E - 2331753.61265

Geographic Coordinates
 N - 45 - 31 - 17.01140
 W - 088 - 34 - 58.02477

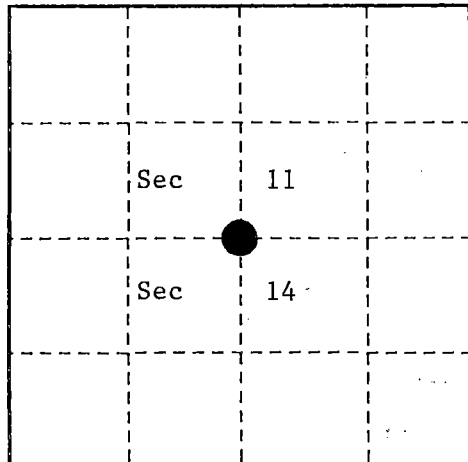

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following B.T.'s; Birch, 12", S.42°E., 18 links, Birch, 14", N.57°E., 14 links.

In 1904, N. Smith found original corner and witnesses to be okay.

In 1908, J. Melendy found 4" X 4" Ironwood post from resurvey with the following original B.T.'s; Birch, 14", S.24½°E., 18 links, Birch, 18", N.57°E., 13½ links. He then set a 5" X 5" Elm post in place of previous post.

In 1936, John Hammes found a Cedar stake in good condition on North side of road. He did not believe stake to be original due to lack of any original evidence.

In 1969, J. Resvick found Cedar post in mound of rock on South side of road. Set corner North, 33 feet from post found in road.


In 1987, Alan Harrison, RLS, restored position by retracement of J. Melendy's survey from Center ¼ through the CN 1/16. Corner position agrees with N. Smith's 1904 survey and J. Melendy's 1908 survey.

In 1994, Alan Harrison, RLS, found bearing trees as set in 1987. Northeast Jack Pine B.T. is dead. Road has been re-surfaced therefore railroad spike is below top surface. Set P.K. nail over railroad spike. Made a new bearing tree; White Spruce, 15", N.42°E., 64.30 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. P.K. nail over railroad spike.
2. White Spruce, 15", N.42°E., 64.30 feet.
3. Sugar, 6", S.32°E., 70.30 feet.
4. Jack Pine, 12", N.27°W., 56.75 feet.
5. Steel Sign Post, North, 24.05 feet.
6. C/L F.R. # 2136, North, 4.00 feet.

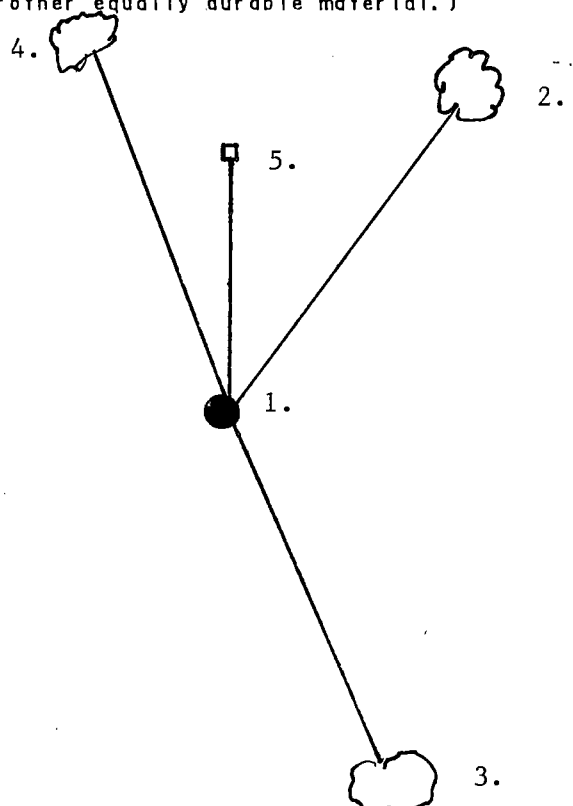

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE }
Forest County, Wis. {

Received for record this 10th day
of May A.D., 1995 at
8:30 o'clock A.M. and recorded
in Vol. 35-15-119 Restoration
page 35-15-119

Paul Chilla Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

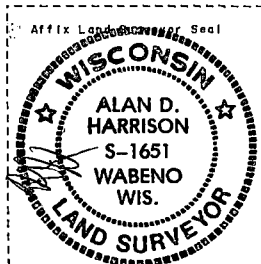

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick do hereby certify that on the 28th day of July, 1969, I found evidence of the North quarter corner of Section 14 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride.

40:00 chains west corrected between sections 11 and 14. Set wood post.

Birch 12, bears S42E, 18 lks. Birch 14, bears N57E, 14 lks.

John Hammes on May 4, 1936 found cedar stake at ground level in center of road and a cedar post on the north side road.

Description of corner evidence found:

4 x 4 cedar post in mound of rock 33 ft. south of centerline of road. Post scribed $\frac{1}{8}$ S.

At a point 33 ft. north of post dug in road and found discloration of post 1919.






Description of monument and accessories I established to perpetuate the original location of this corner:

At post hole found set a 2 inch inside diameter, galvanized iron pipe, 1 foot below surface of road. Blazed and scribed the following new bearing trees.

Jack Pine 13, bears N38E, 73.12 ft.

Jack Pine 10, bears N52W, 84.08 ft.

At 50 feet north and 50 feet south of corner set reference marks to corner. Reference marks are 2 inches inside diameter, galvanized wrought iron pipe 5 feet long filled with concrete, flanged on bottom with brass tablet stamped to identify corner.

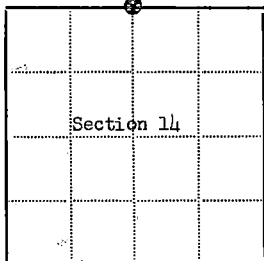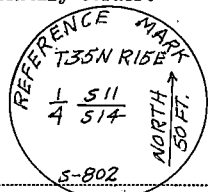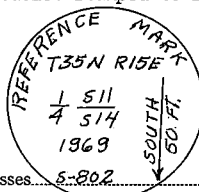

⊙ = Corner monument restored

□ =

Resident witnesses S-802

Dated at Rhinelander Wisconsin, this 24th day of Sept 1969.

Signature Jean F. Resvick Title Admitted Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT Number 98039

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. J-19 Page No. J-19 of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 35 North, Range 15 E, Section 14, Index No. J-19, Page No. 19

4351511007.0

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section Corner to Sections 11, 12, 13 and 14,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates

Wisconsin North Zone


N - 132550.68050

E - 2334499.80447

Geographic Coordinates

N - 45 - 31 - 16.14074

W - 088 - 34 - 19.47204

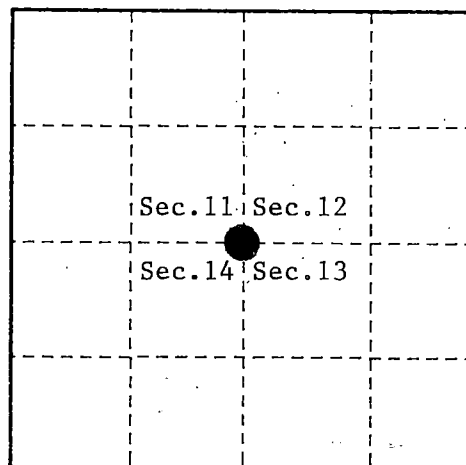

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride set wood post and the following B.T.'s; Hemlock, 18", N.17°W., 25 links, Birch, 18", N.24°E., 25 links, Hemlock, 16", S.10°E., 28 links, Linn, 16", S.51°W., 38 links South 3 chains enter swamp. East 9.50 chains, enter swamp.


In 1936, John Hammes found a cedar stake at ground level in center of road. Metal location poster on 3½" diameter cedar post, North, ½ chain.

In 1969, Jean Resvick, RLS, found a 5" X 5" cedar post with location tag on South side of road. Also found 4" X 4" cedar post North of road scribed "2 Rods South". Both posts are scribed with section numbers and have iron pipes alongside them. Resvick set a 2" X 30" galvanized iron pipe with brass cap stamped to identify corner. Blazed and scribed new B.T.'s; Yellow Birch, 7", S.38°W., 77.36 feet, Basswood, 11", N.35°W., 83.12 feet. Also set reference monuments North and South, 50.00 feet from corner.

In 1994, Alan Harrison, RLS, found monument below road surface. Set a railroad spike in new blacktop above monument. Found reference monuments and Yellow Birch B.T., Basswood B.T. is dead and down. Blazed and scribe a new B.T. and replaced damaged reference monument to the South.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- Railroad Spike in blacktop above 2" X 30" monument.
 - 2" X 60" Reference Monument North, 50.00 feet.
 - Sugar, 8", S.13°E., 44.95 feet.
 - 2½" X 36" Reference Monument South, 50.00 feet.
 - Yellow Birch, 7", S.38°W., 77.36 feet.
 - C/L F.R. # 2136, North, 4.40 feet.
 - Steel Sign Post, North, 2.00 feet, from North Reference Monument.
 - Steel Sign Post, South, 2.50 feet, from South Reference Monument.

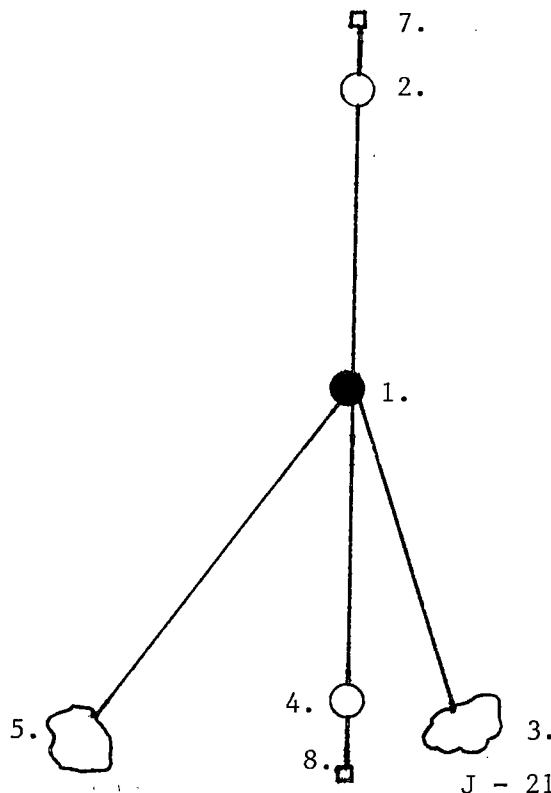

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)


(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day
of May, A.D., 1995 at
2:30 o'clock P.M. and recorded
in Vol. Book 12 and recorded
page 355-321
Alan D. Harrison
Register of Deeds

Affix Land Surveyor's Seal

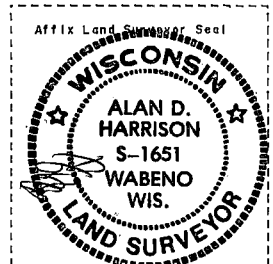

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 30th day of July, 19 69, I found evidence of the Northeast Section corner of Section 14 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride. 80 chains North between sections 13 and 14. Set wood post. Hemlock 18, bears N17W, 25 lks. Birch 18, bears N24E, 25 lks. Hemlock 16, bears S10E, 28 lks. Linn 16, bears S51W, 38 lks. 3 chains south enter swamp. 9.50 chs East enter swamp. John Hammes records on U.S. Forest Service Form, that on May 4, 1936 he found a cedar stake at ground level in center of road and a cedar post 33 feet North.

Description of corner evidence found:

Scribed 5 x 5 cedar post with metal location reading 5/5/1936 with initials J.H. on south side road. A 1½ inch pipe along side of post.

Scribed 4 x 4 cedar post with iron pipe along side of post on north side road. Post is scribed 2 rods S.

The road is in a cut and no evidence of stake in road was found. The distance between the two post found measured 1 chain.


Description of monument and accessories I established to perpetuate the original location of this corner:

At the Mid point between witness post found I set 2 inch inside diam., galvanized iron pipe 30 inches long, 6 inches below the surface of the road. From which the following blazed and scribed new bearing trees bear.

Yellow Birch 7, bears S38W, 77.36 ft.

Basswood 11, bears N35W, 83.12 ft.

At 50 feet North of section corner and 50 South of section corner, I set reference marks for section corner. Reference marks are 2 inches inside diam., galvanized wrought iron pipe 5 feet long, filled with concrete, flanged on bottom with brass tablets stamped to identify corner.

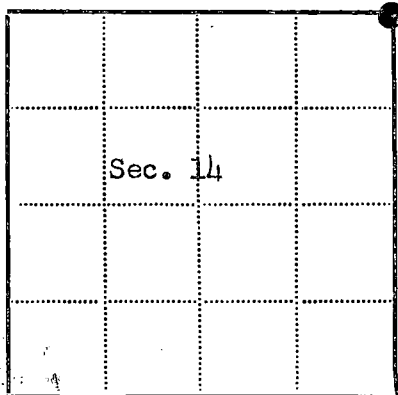

● = Corner monument restored

□ =



Resident witnesses

Dated at Rhinelander

1969

Signature Jean F. Resvick

(County Surveyor, Registered Land Surveyor, or other duly authorized person)

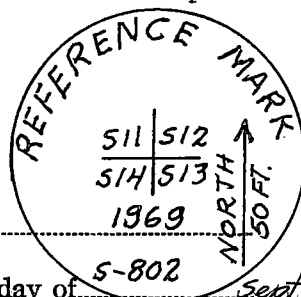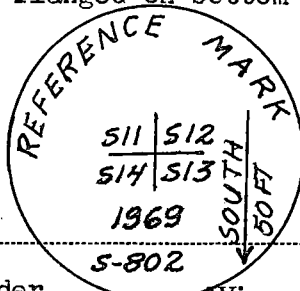Surveyors Registration No. S-802DOCUMENT NUMBER 98037Office of Register of Deeds County of ForestI hereby certify that the within instrument was filed in this REC-10 record on the 22nd day of May, 19 70, and was filed in Book WIS.No. J-21 Page No. J-21 of County Records.Signature Eugene Stutz Title Register of DeedsTownship 35 North, Range 15 East, Section 14, Index No. J-21, Page No. 21

435110000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 12 and 13, T.35N.,
 R.15E., Forest County, Wisconsin.

State Plane Coordinates

Wisconsin North Zone


N - 132562.71212

E - 2337097.14968

Geographic Coordinates

N - 45 - 31 - 15.79689

W - 088 - 33 - 42.99678

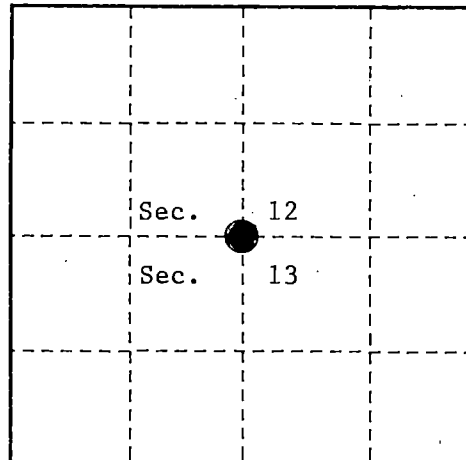

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride set wood post and the following B.T.'s; Birch, 20", N.30°W., 28 links, Hemlock, 14", S.24°W., 6 links.

In unknown year, John Hammes found a 5" diameter cedar stake 36" above ground. Metal location poster on post reads "Corner bears South 25 feet."


In 1977 Jean Resvick, RLS, found a scribed cedar post with a location poster attached. A 3/4" diameter iron pipe stands alongside post. Survey of Section line proves post to a witness post as set by John Hammes. At a point 25 feet South of post set a 2" X 36" galvanized iron pipe with a brass cap stamped to identify corner. Made new corner references; Spruce, 8", N.08°W., 71.62 feet, Hemlock, 17", S.29°W., 58.85 feet, SW corner of cabin, N.13°E., 60.10 feet.

In 1994, Alan Harrison, RLS, found B.T.'s and monument below the surface of the blacktop. Set a railroad spike above monument. Set steel sign post, North, 16.40 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad spike in blacktop above 2" X 36" monument.
2. SW Corner of cabin, N.13°E., 60.10 feet.
3. Hemlock, 17", S.29°W., 58.85 feet.
4. Spruce, 8", N.08°W., 71.62 feet.
5. Steel sign post, North, 16.40 feet.
6. C/L F.R. # 2136, South, 6.30 feet.

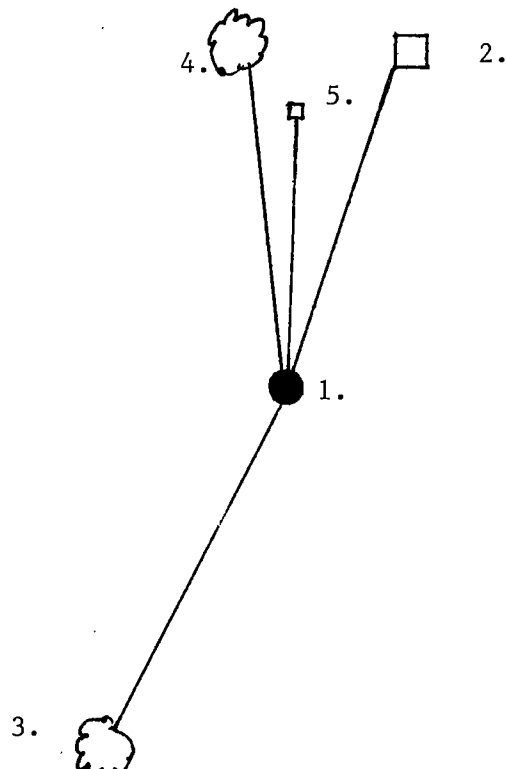

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May, A.D., 1995, at
8:30 o'clock A.M. and recorded
in Vol. Casey Reestablished
page 35-15, 1-13
Frank P. H. Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

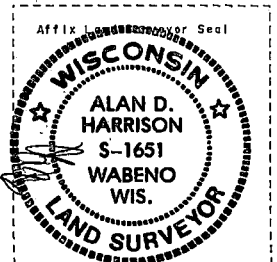

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 12 day of April, 1977, I found evidence of the South quarter corner of Section 12 Township 35 North Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Surveyed in 1859 by James McBride
39.75 chains west corrected between sections 12 & 13, set post
Birch 20, N30W, 28 lks.
Hemlock 14, S24W, 6 lks.
Department of Agriculture form 874-9 by John Hammes
Found cedar stake 5 inches diameter, metal location poster on post
from which corner bears South 25 feet.

Description of corner evidence found:

Scribed cedar post with rusted location poster with 3/4 inch iron pipe
along side of post.
Dug in road 25 feet south of post found no evidence.
Survey of section line indicates position to be relative to section corners.
Post found is accepted as witness post to 1/4 corner and corner was set
25 feet south of post found.

Description of monument and accessories I established to perpetuate the location of this corner:

Set a 2 inch inside diameter galvanized iron pipe, 3 feet long,
filled with concrete, 8 inches before surface of road, with brass cap stamped:
T35N, R15E, S12, 1/4, S13, 1977, S-802
Blazed and scribed following new bearing trees
Spruce 8, N8W, 71.62 ft.
Hemlock 17, S29W, 58.85 ft.
Southwest corner of cabin bears, N13E, 60.10 ft.

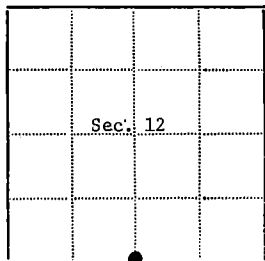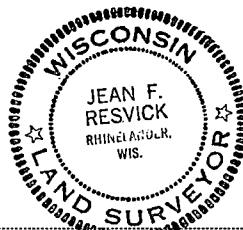

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 21 day of July 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113289

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 35 North Range 15 East Section 12 Index No. J-23 Page No. _____

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

East One - Sixteenth Corner between Sections 12 and 13, T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 132603.28249
 E - 2338384.89547

Geographic Coordinates
 N - 45 - 31 - 15.96679
 W - 088 - 33 - 24.90382

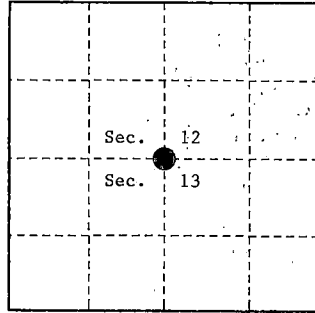


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1977, Jean Resvick, RLS, established the corner position at mid-point and on line between the Southeast Section Corner and the South Quarter Corner of Section 12. Set a 2" X 36" galvanized iron pipe with a brass cap stamped to identify corner. Made the following B.T.'s; Hemlock, 8", N.23°E., 57.77 feet, Hemlock, 21", S.40°E., 66.97 feet.

In 1994 Alan Harrison, RLS, found B.T.'s and monument below blacktop. The corner position was tied in to a 1994 G.P.S. survey of Section 12 and found to be out of position at a bearing of S.43° 24'44"E., 0.40 feet from the correct position. Moved the monument to its correct position and made new ties as noted below. Set railroad spike above monument.


- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

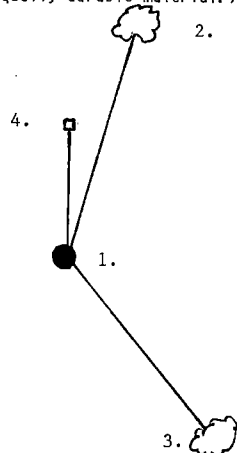

1. Railroad Spike in blacktop over 2" X 30" monument.
2. Hemlock, 8", N.23°E., 56.97 feet.
3. Hemlock, 21", S.40°E., 67.17 feet.
4. Steel Sign Post, North, 17.00 feet.
5. C/L of F.R. # 2136, South, 7.35 feet.

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

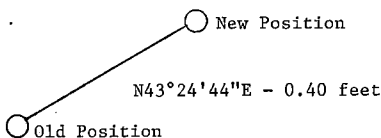

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Established at mid-point and on line between the Southeast Section Corner and the South Quarter Corner of Section 12.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May, A.D., 1992 at
8:30 o'clock A.M. and recorded
in Vol. County Registration
page 85-15-1-14

Paul Phillips, Deputy
Register of Deeds

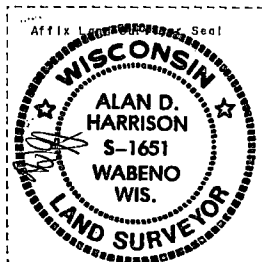

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

CERTIFIED LAND CORNER ~~RESTORATION~~ LOCATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 29 day of April, 1977, I ~~found evidence of the~~ located the East sixteenth corner of between sections 12 and 13 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that ~~from this evidence~~ I established a new monument and accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:


None

Description of corner evidence found:

Location of corner set on line and at midpoint between the section corner and quarter corner.
Section corner bears N89°14'E, 1288.32 ft.
Quarter corner bears S89°14'W, 1288.32 ft.

Description of monument and accessories I established to perpetuate the location of this corner:

At the corner position set a 2 inch inside diameter galvanized iron pipe, 3 feet long, filled with concrete, with brass cap stamped:
T35N, R15E, S12, E 1/16, S13, 1977, S-802
Corner buried in road.
Blazed and scribed the following bearing trees
Hemlock 8, N23E, 57.77 feet
Hemlock 21, S40E, 66.97 feet

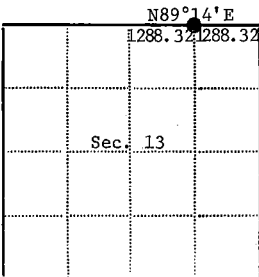

- ☒ - Corner monument restored
- ☐ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 26 day of September 1977..

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113290

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978., and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 13, Index No. J-24, Page No.

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I, Jean F. Resvick, do hereby certify that on the 3rd day of May, 1977, I found evidence of the Northeast Section corner of Section 13 Township 35 North Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis
80.0 chains North between sections 13 and 18, set post

Yellow birch 12, S44W, 29 links

Yellow birch 10, N68W, 40 links

Yellow birch 9, N72E, 28 links

Hemlock 14, S68E, 20 links

4.00 chains South leave swamp

15.00 chains North leave swamp

2.00 chains West enter swamp

8.30 chains West, stream 15 links

15.00 chains West, leave swamp

28.00 chains, East enter swamp

Description of corner evidence found:

Iron pipe 12 feet North of road at 571 feet east of stream at road crossing.

Distance North and South to quarter corners indicates that the section corner should be South and iron pipe found is a witness corner.

Iron pipe found as North one sixteenth corner between sections 13 and 18 indicates that iron pipe was used as a witness.

I accept iron pipe as being on line and 16 feet North of section corner.

The evidence found is accepted over proportional measurement.

Section corner thus located is S0°05'W, 2639.74 feet from quarter corner between Sections 7 and 12 and N0°17'W, 2631.88 feet from quarter corner between Sections 13 and 18.

Description of monument and accessories I established to perpetuate the location of this corner:

At the corner position set a 2 inch inside diameter galvanized iron pipe,

3 feet long, filled with concrete with brass cap stamped:

T35N, R15E, R16E, S12, S7, S13, S18, 1977, S-802



From which the following blazed and scribed bearing trees bear

Spruce 10, S44E, 75.17 feet

Hemlock 19, S14W, 93.22 feet

Spruce 22, N68W, 131.84 feet

Corner buried in road

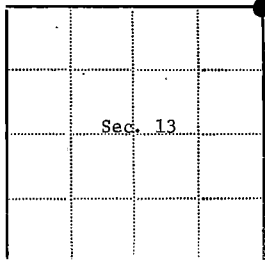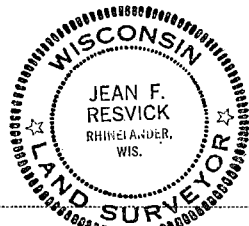

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 26 day of September 1977.Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)Surveyors Registration No. S-802DOCUMENT NUMBER **113291**Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978, and was filed in Book No. Page No. of County Records.

Signature Eugene Statzky Title Register of DeedsTownship 35 North, Range 15 East, Section 13, Index No. J-25, Page No.

43515120000

J
25

CERTIFIED LAND CORNER ~~RESTORATION~~ LOCATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 4 day of May, 1977, I found evidence of the located the North one sixteenth corner ~~sk~~ between Sections 13 and 18 Township 35 North, Ranges 15 and 16 East, Fourth Principal Meridian, as described hereon; and that ~~from this evidence~~ I established a ~~new~~ monument and accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:



None

Description of corner evidence found:

Location of corner set on line and at midpoint between section corner and quarter corner.
Section corner bears N0°17'W, 1315.94 feet
Quarter corner bears S0°17'E, 1315.94 feet
Iron pipe found bears east 4.4 feet

Description of monument and accessories I established to perpetuate the location of this corner:

At the corner position set a 2 inch inside diameter, galvanized iron pipe, 5 feet long, filled with concrete, with brass cap stamped:
T35N, R15E, N 1/16, R16E, S13, S18, 1977; S-802
from which the following new blazed and scribed new bearing trees bear
Hemlock 18, N65E, 97.36 feet
Set steel sign post 0.30 ft. NW of monument

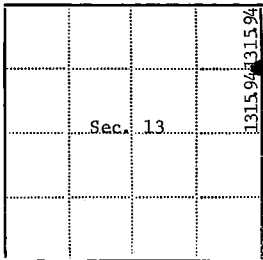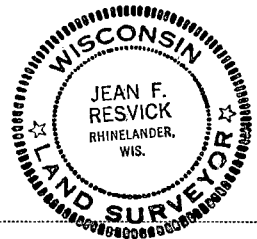

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 26 day of September 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113292

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 13, Index No. K-25, Page No.

43515133000

K
25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 13 & 18,
T35N, R14 and 15E, 4th P.M.

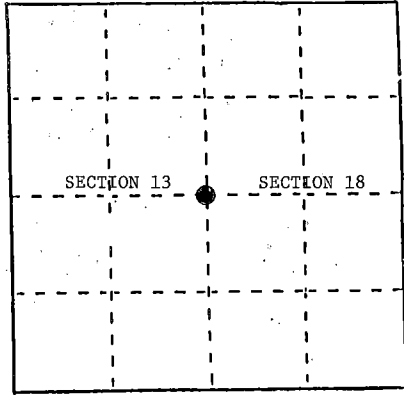

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day
of Sept A.D. 1989 at

10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 2

Paul H. Schenckner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed in the construction and reconstruction of State Highway #32 over the years, the last time in 1985.

In 1980 Forest Service surveyor William Cochrane restored this corner and placed a railroad spike in the highway and a reference monument N89°-00.3'W, 98.00 feet. He used this corner to subdivide Section 13, T35N, R14E.


On 7/10/85, DOT filed with the County Clerk a "Preservation of Landmarks" form on the corner whereby four additional Witness Corners were established.

On 3/28/89 I placed a PK nail for corner and ran traverse to point and beyond. After confirmation that this position conforms to the survey to the west, I restored on 7/1/89 and placed a railroad spike in the surface of Highway #32 and placed a steel sign post SE of DOT W.C. #3, .63 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) Brass tablet on a 2" x 60" iron pipe, N89°-00.3'W, 98.00'
- 3) DOT Berntsen aluminum monument W.C. #1, N50°-22'E, 102.57'
- 4) DOT Berntsen aluminum monument, W.C. #2, S58°-32'E, 88.03'
- 5) DOT Berntsen aluminum monument, W.C. #3, S50°-22'W, 74.51'
- 6) DOT Berntsen aluminum monument, W.C. #4, N58°-32'W, 84.95'
- 7) Steel sign post, SE of DOT W.C. #3, .63'

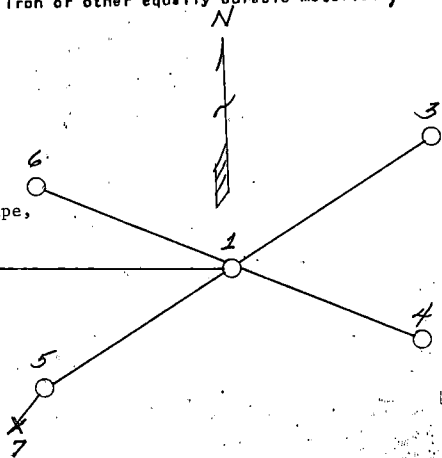

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (i) 1. Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date



CERTIFICATE READY FOR FILING:

Dale S. Stage
District Ranger

138178

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner common to Sections 7, 8, 17 & 18, T35N, R15E, 4th P.M.

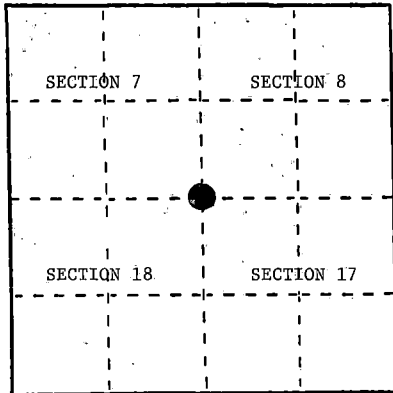

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day
of Sept. A.D., 1987 at

10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 5

Paul Hickenbender
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride established this corner and set a wood post and BTs:

8" Cedar, N17°E, 34 links 12" Sugar, S47°E, 30 links
12" Sugar, S8°W, 45 links 18" Hemlock, N82°W, 25 links


6/8/34 - 874 calls old snag with marking and placed a location poster on fence post. No information on where snag was or where corner may have been from location poster.

4/18/89 - Milo E. Stefan searched area of road intersection and came up with the 1934 location poster with fence northerly, all down now. Old roads east, west and south. I accept the road centerline and intersection of the old fence line northerly as the best evidence remaining of this corner location and restore this corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 3/4" x 24" Steel Bar, 8" below surface of road.
- 2) 6" Basswood, S78°E, 96.88'
- 3) 5" White Birch, S52°W, 45.14'
- 4) 14" Red Pine, N69°W, 138.94'
- 5) 14" Red Pine, N11°W, 172.43'
- 6) 2 1/2" x 36" Aluminum Monument for Witness Corner
- 7) Steel Sign Post, NW of W.C. .65'

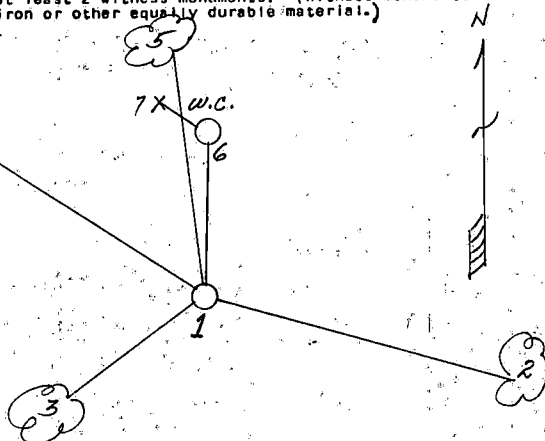

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Milo E. Stefan

- (i) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

6/24/89

Date

Certificate ready for filing:

Dale S. Staeger
District Ranger

Affix Land Surveyor Seal



138179

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 8 & 17, T35N, R15E, 4th P.M.

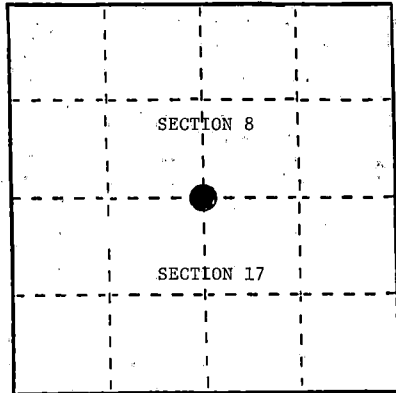

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day of Sept. A.D., 1944 at

10:25 o'clock A.M. and recorded in Vol. 10 CORNER RESTORATIONS page 5-7

Paul H. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride established this corner and set a wood post and BTs:
20" Hemlock, S14°E, 25 links 20" Sugar, N34°W, 13 links

6/9/34 - 874 calls two BTs but no distance to corner. Placed a location poster on a 17" Maple.

4/18/89 - Milo E. Stefan located the Maple and location poster still attached. A fence line runs northerly from this. Both Maples as called on 874 here, faces to the west for corner. Our search located the very decayed remains of a large Hemlock and from this Hemlock, if used as the original BT, uncovered a mound of stone that I feel was the perpetuated original corner position. The original Sugar was rooted out for the old abandoned road running east-west. I restore the corner in the plan view drawing below, provide reference ties to at least 5 witness monuments, the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 6" Sugar Maple, N88°E, 33.99'
- 3) 11" Sugar Maple, S4°E, 75.04'
- 4) 5" Sugar Maple, S24°W, 19.63'
- 5) 7" Sugar Maple, N74°W, 34.09'
- 6) Steel Sign Post, NE, 1.28'

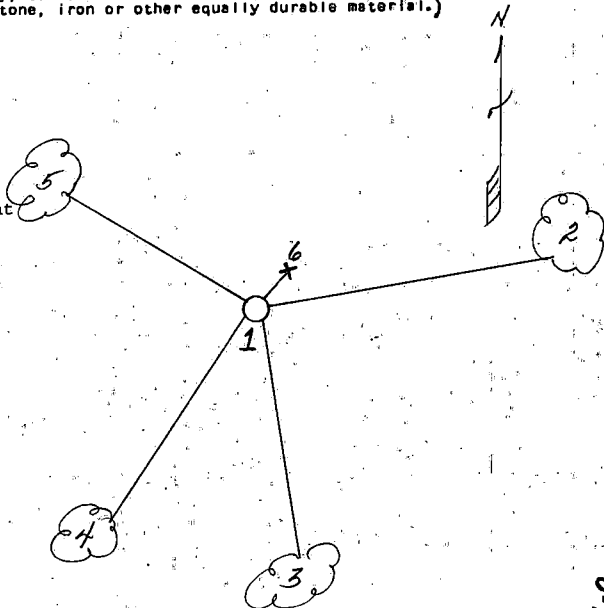

43515080020

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location/

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing:

Dale S. Blazeg
District Ranger

Affix Land Surveyor Seal

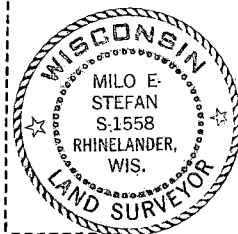

138180

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 8, 9, 16 & 17,
T35N, R15E, 4th P.M.

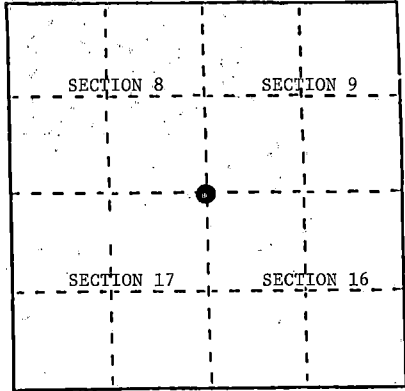

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day

of Sept A.D. 1989 at

10:25 o'clock A.M. and recorded

in Vol. 159 of CORNER RESTORATIONS

page 1-9

Paul H. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post with BTs:


24" Elm, N71°E, 27 Links 12" Sugar, S20°E, 27 Links
24" Y. Birch, S45°W, 10 Links 10" Sugar, N78°W, 30 Links

6/7/82 - Stefan and Neider found a 1 1/4" x 48" iron pipe with a 30" Y. Birch stump S45°W, 6.60 feet with stump holes for the other three BTs to support this as the original corner position. We set a 2 1/2" x 30" aluminum monument in mound of stone for the corner and made four new bearing trees and set a steel sign post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 30" aluminum monument in mound of stone
- 2) 14" Sugar Maple, N20°E, 13.17'
- 3) 13" Hemlock, S38°E, 8.06'
- 4) 16" Hemlock, S46°W, 52.96'
- 5) 12" Sugar Maple, N67°W, 23.20'
- 6) Steel Sign Post, West, 1.40'

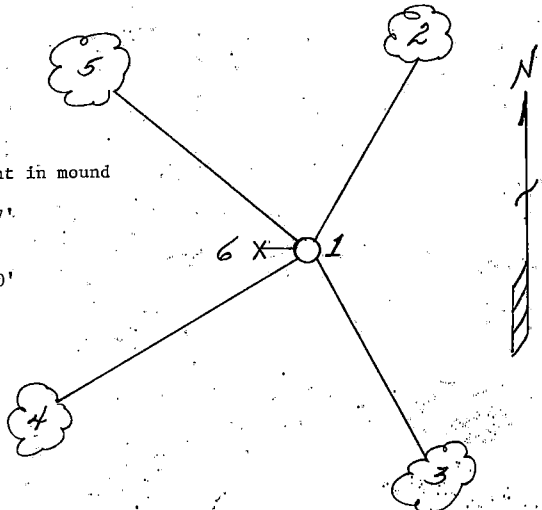

43515080000

J-9

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Milo E. Stefan

- (i) I, Milo E. Stefan (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

July 8, 1989

Date



CERTIFICATE READY FOR FILING:

Dale R. Staeger
District Ranger

138182

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 17 & 18,
T35N, R15E, 4th P.M.

REGISTER'S OFFICE }
Forest County, Wis. } *th*
Received for record this *16* day
of *Sept.* A.D. 19*89* at
10:25 o'clock A.M. and recorded
in Vol. *100* CORNER RESTORATIONS
page *5*
Paul A. Schenck
Register of Deeds

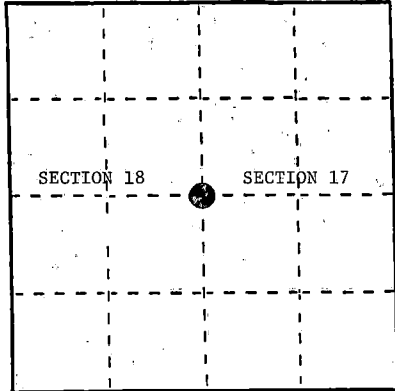

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride established this corner and set a wood post and BTs:
10" Sugar, S42°E, 6 links 8" Ironwood, N74°W, 21 links

4/19/89 - Milo E. Stefan found a 1" x 12" high iron pipe at end of fence from the south and centerline of County Highway "T" from the east. No evidence of the original corner was located. This position has been the accepted corner for many years and I accept it as the perpetuated corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 4" White Ash, N55°E, 16.69'
- 3) 8" Sugar Maple, S65°E, 30.77'
- 4) 12" Sugar Maple, S2°E, 18.96'
- 5) 3" Red Pine, S85°W, 15.43'
- 6) Steel Sign Post, SE, 1.05'

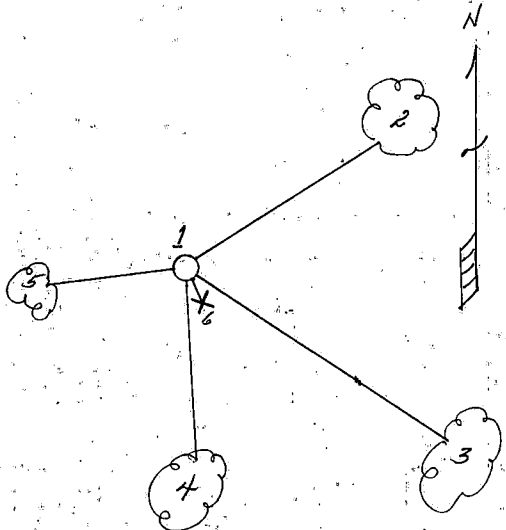

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89

Date

Certificate ready for filing:

Dale B. Stage
District Ranger

Affix Land Surveyor Seal



138183

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 16 & 17,
T35N, R15E, 4th P.M.


REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept A.D., 1987 at

10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

page L-9

Paul H. Schenck
Register of Deeds

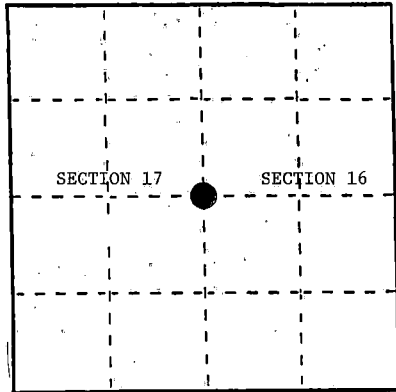

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride established this corner and set a wood post and BTs:
8" Sugar, S22°E, 26 Links 8" Sugar, N32°W, 9 Links

5/10/89 - No evidence remains of the original corner as I feel it falls in County Highway "T". We restore this corner on the centerline of County Highway "T" and on a line between the Section Corners north and south. A marked (painted blue) timber line runs northerly along our line.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) A railroad spike in surface of blacktop highway
- 2) 4" Sugar Maple, N48°E, 98.49'
- 3) 4" Yellow Birch, S46°E, 74.57'
- 4) 6" Sugar Maple, S20°W, 38.63'
- 5) 6" Basswood, N31°W, 51.25'
- 6) 2 1/2" x 36" Aluminum Monument, Witness Corner
- 7) Steel Sign Post, NE of W.C. .98'

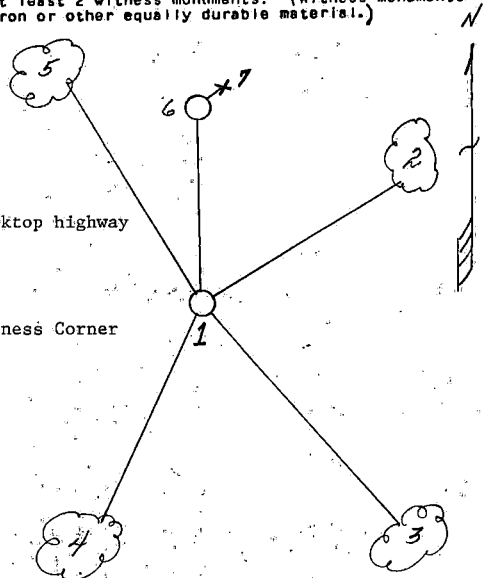

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence, or used for proportioning in determining the corner location?

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Milo E. Stefan
Signature

6/24/89

Date

Certificate ready for filing:

Dale S. Staeger
District Ranger

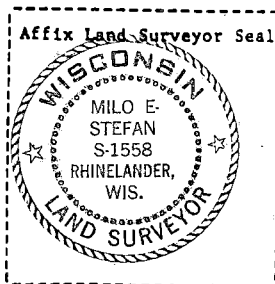

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.


O = Corner monument restored.

Quarter corner to Sections 15 and 16, T.35N., R.15E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of October, A.D., 1986 at
2:45 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page L-13

Paul Hachenbammer
Register of Deeds

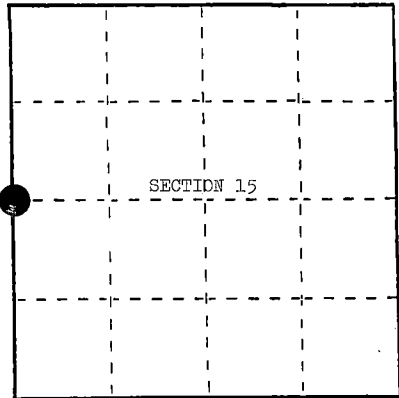

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set quarter post and made the following BTs: Birch, 6", N.50°W., 20 links; Sugar, 10", N.60°E., 25 links.


In 1904, Nathan Smith found corner and original witnesses okay. Distance to section corner north 38.795 chains and distance to section corner south 40.50 chains.

In 1986, Alan Harrison found 1 1/2" iron pipe 6" below surface of C.T.H. "H." Distance to section corner north 2554.21' fits Smith survey.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1 1/2" iron pipe marking corner position; 6" below surface of C.T.H. "H."
- Northwest corner of concrete slab, N.68°E., 35.10 feet
- Southwest corner of community building, S.72°E., 59.82 feet
- Railroad spike for property corner, S.87°W., 8.77'
- 2" x 36" aluminum reference monument, N.88°W., 39.13'

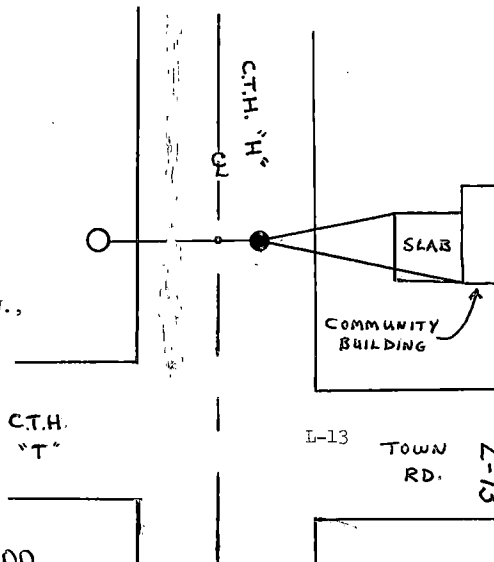

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


Alan D. Harrison

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

10/9/86

Date

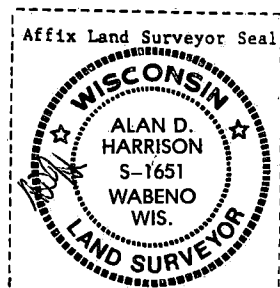


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 14 and 15, T.35N., R.15E.

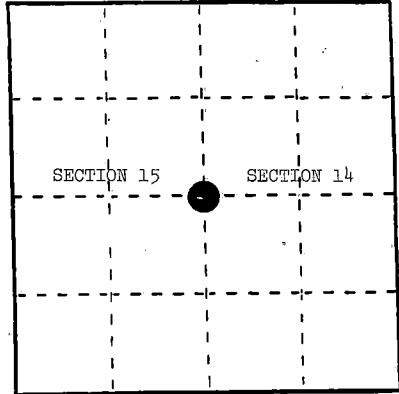

REGISTER'S OFFICE }
 Forest County, Wis.

Received for record this 17th day
 of March, A.D., 1986, at
10:40 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS

page 17

Paul Aschauer
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post with the following BTs: Hemlock, 24", N.73°E., 20 links; Fir, 8", N.75°W., 22 links.

December 30, 1908, J. J. Melindy set 5" x 5" x 36" Cedar post and a new BT--Cedar; 18", N.89°E., 13.59 feet.


April, 1985, H. Neider found 2" x 2" x 18" stake and remains of old post in a rock pile. He also found Hemlock stump hole, N.73°E., 13.2 feet; Stump hole, N.75°W., 14.52 feet; Cedar stump, 20", N.89°E., 13.59 feet.

June 3, 1985, Alan Harrison found corner as per Neider and accepted as corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument, in a mound of stone, stamped to identify the corner.
- Balsam, 10", N.89°E., 13.64 feet
- Red Maple, 8", S.89°W., 12.66 feet
- Red Maple, 6", N.39°W., 18.81 feet
- Steel Sign Post, South, 1.50 feet

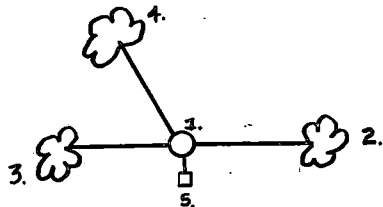

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

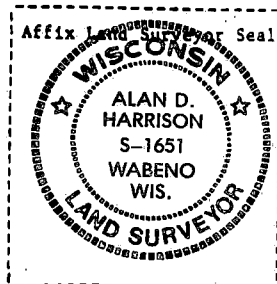

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

1/3/86
Date

Register

DOCUMENT NUMBER 129872

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 13 and 14, T.35N., R.15E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day
of March A.D., 1986 at
10:40 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

page 1-2
Paul Hochstetler
Register of Deeds

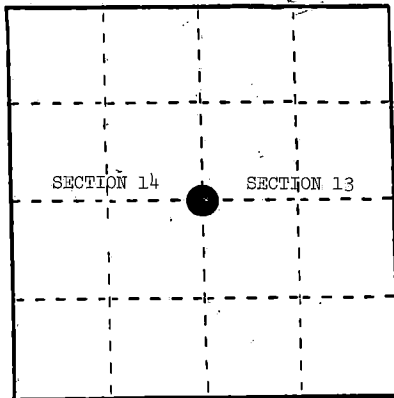

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post with the following BTs: Sugar, 12", N.65°W., 13 links; Hemlock, 12", N.10°E., 20 links.

December 24, 1908, J. J. Melindy set new Tamarack post (4" x 4" x 48"). Original Maple decayed, N.65°W., 8.58 feet; however, original Sugar still alive, N.74°W., 20.3 feet. New BT--Hemlock, 12", N.10°E., 13.2 feet.


April, 1985, H. Neider--1 1/2" iron pipe with rock and old post alongside, Hemlock stump, N.10°E. 13.2 feet and Hemlock stump hole, N.74°W., 20.3 feet.

June 3, 1985, Alan Harrison found corner as per Neider.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument, in a mound of stone, stamped to identify the corner.
- Yellow Birch, 12", N.67°E., 35.77 feet
- Sugar, 6", S.25°E., 37.90 feet
- Yellow Birch, 6", N.33°W., 42.47 feet
- Steel Sign Post, West, 1.25 feet

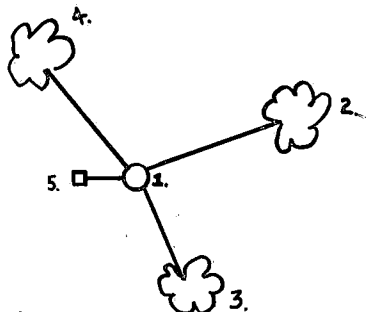

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Alan D. Harrison


(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

1/3/86

Date

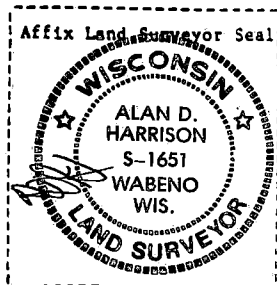

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 4 day of May, 19 77, I found evidence of the East quarter corner of Section 13 Township 35 North Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Surveyed in 1857 by Artemas Curtis
40.00 chains North between Sections 13 and 18, set post
Hemlock 10, N70W, 17 lks.
Hemlock 10, S35E, 14 lks.
10.00 chains North enter swamp bears East
13.50 chains South enter stream
11.50 chains South leave stream, 125 lks. wide runs SE
18.40 chains North, stream 2 lks. wide runs SE

Description of corner evidence found:

1 1/4" galvanized pipe and old cedar post in mound of stone
N70W, 17 lks. hemlock stump
10 chains North enter swamp bears east and west
Distance South to section corner is S0°70'E, 2619.87 feet

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced the iron pipe found with a 2 inch inside diameter, galvanized iron pipe, 3 feet long, filled with concrete, with brass cap stamped:
T35N, R15E, R16E, 1/4, S13, S18, 1977, S-802
Blazed and scribed the following new bearing trees
Yellow birch 9, S12E, 27.16 ft.
Maple 7, S65W, 25.30 ft.
Set steel sign post 6 inches North of monument

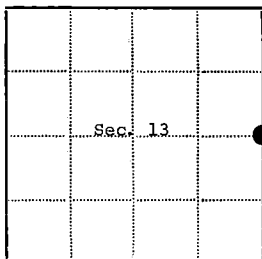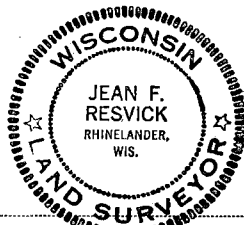

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 31 day of August 19 77.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113293

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 19 78, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 13, Index No. L-25, Page No.

138184

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 13, 24, 18 & 19,
T35N, R14 - 15E, 4th P.M.

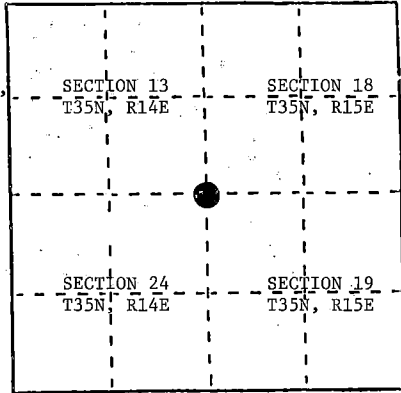

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day
of Sept A.D., 1989 at

10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 151

Paul Fickelmeier
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed in the construction and reconstruction of State Highway #32 over the years, the last time in 1985.


In 1980 Forest Service surveyor William Cochrane recovered this corner and placed a reference monument, N50°W, 75.00 feet. He used the corner to subdivide Section 13, T35N, R14E.

On 7/10/85 the DOT filed with the County Clerk a "Preservation of Landmarks" form on this corner whereby they placed four Witness Corners to reference this corner.

On 3/28/89 I ran a traverse to a PK nail in the highway which we set from the Forest Service and DOT references. After confirmation of this corner position, I returned on 7/1/89 and replaced the PK nail with a railroad spike and placed a steel sign post SW of the DOT W.C. #3, .57'. We also made a new BT to the Forest Service reference monument, a 16" Sugar Maple, S81°W, 52.70'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

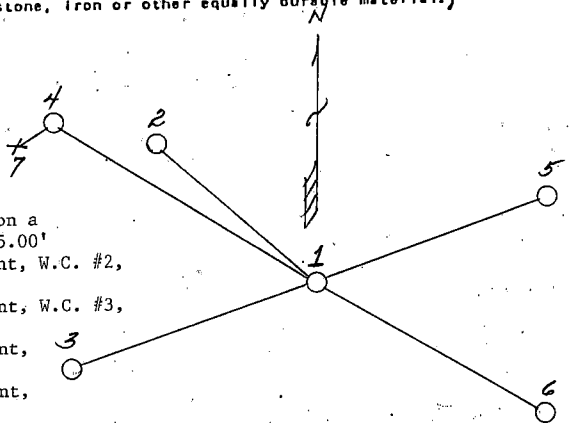

- 1) Railroad spike
- 2) Forest Service brass tablet on a 2" x 60" iron pipe, N50°W, 75.00'
- 3) DOT Berntsen aluminum monument, W.C. #2, S68°-01'W, 75.91'
- 4) DOT Berntsen aluminum monument, W.C. #3, N53°-52'W, 91.75'
- 5) DOT Berntsen aluminum monument, W.C. #4, N68°-01'E, 81.37'
- 6) DOT Berntsen aluminum monument, W.C. #5, S53°-52'E, 56.76'
- 7) Steel sign post, SW of DOT W.C. #3, .57'

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal



- (i) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date

CERTIFICATE READY FOR FILING:

Dale B. Stange
District Ranger

138185

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
● = Corner monument restored.

Quarter Corner to Sections 18 & 19,
T35N, R15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day
of Sept, A.D., 1989, at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page N-3

Paul Hochstetler
Register of Deeds

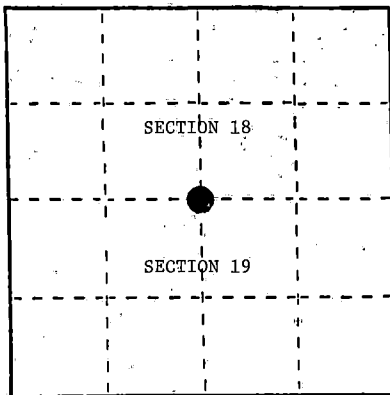

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post and BTs:
7" Fir, N20°E, 8 Links. 8" Hemlock, S32°W, 28 Links.


5/2, 5/8 and 5/15/89 - Searched area with intensity and plantation posts east and west of area 100' to 200' found. These could have been on or close to the section line.

We restored this corner from evidence of corners easterly.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 14" Red Pine, N65°E, 61.37'
- 3) 14" Red Pine, S70°E, 8.12'
- 4) 10" Red Pine, S58°W, 28.43'
- 5) 12" Red Pine, N38°W, 10.85'
- 6) Steel Sign Post, NE, 1.00'

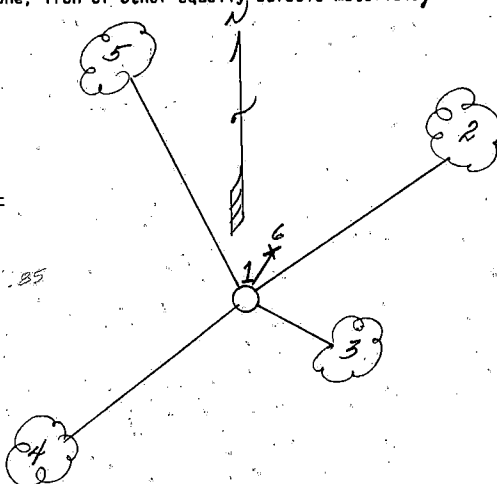

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated position.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) I, Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89

Date

Certificate ready for filing:

Dale S. Stage
District Ranger

Affix Land Surveyor Seal



138186

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 17, 18, 19 & 20; T35N, R15E, 4th P.M.

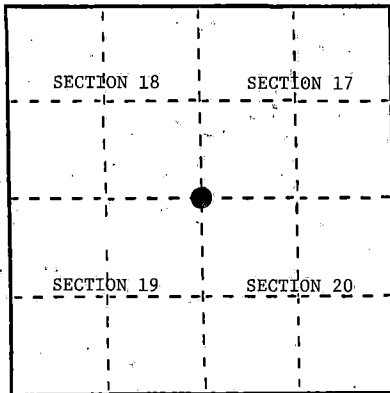

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day

of Sept. A.D. 1989 at

10:35 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page 175

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post with BTs:

12" Hemlock, N72°E, 47 Links

16" Birch, S12°E, 36 Links

12" Birch, S28°W, 49 Links


10" Lynn, N86°W, 6 Links

5/9/89 - We found evidence of restorations in the past, a large pine stump with "BT" scribe clear. A recently cut off fence post. From this area we have evidence of the Hemlock BT, N72°E, 31.0'; the Birch, S12°E, 23.8' and the Birch S28°W, 34.5'. We restore this corner from the remains of these three original BTs. No record of who or when the large pine stump was scribed. Looks to be the Smith or Melindy era, however.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 6" Red Pine, S9°W, 37.95'
- 3) 8" Red Pine, S63°W, 51.58'
- 4) 12" Sugar Maple, N12°W, 103.01'
- 5) 14" Sugar Maple, N58°W, 96.87'
- 6) Steel Sign Post, SW, 1.73'

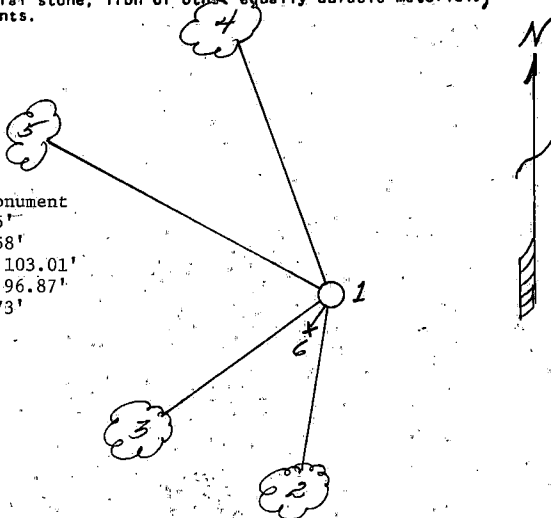

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing: Dale S. Stage

District Ranger



138187

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 17 and 20, T35N R15E, 4th P.M.

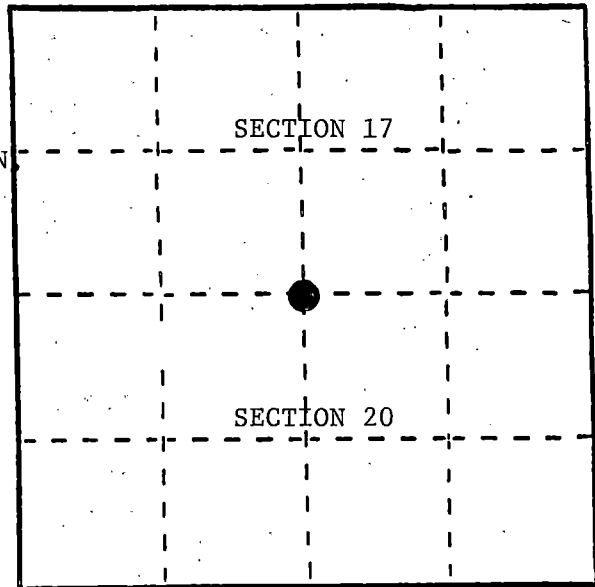

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept A.D., 1989 at

10:25 o'clock A. M. and recorded
in Vol. CORNER RESTORATIONS
page N-7

Paul A. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 James McBride established this corner and set a wood post and BTs:
10" Birch, N35°E, 17 Links 10" Birch, S28°E, 21 Links


5/8/89 - After a thorough search of the area, we could find no evidence of this corner and I declare it lost.

6/18/89 - I restore this corner by lost methods between the Section Corners east and west.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 7" Red Pine, N88°E, 23.93'
- 3) 7" Red Pine, S60°E, 25.72'
- 4) 14" Tamarack, S13°E, 139.33'
- 5) 7" Red Pine, N27°W, 53.38'
- 6) Steel Sign Post, Northeast, 1.00'

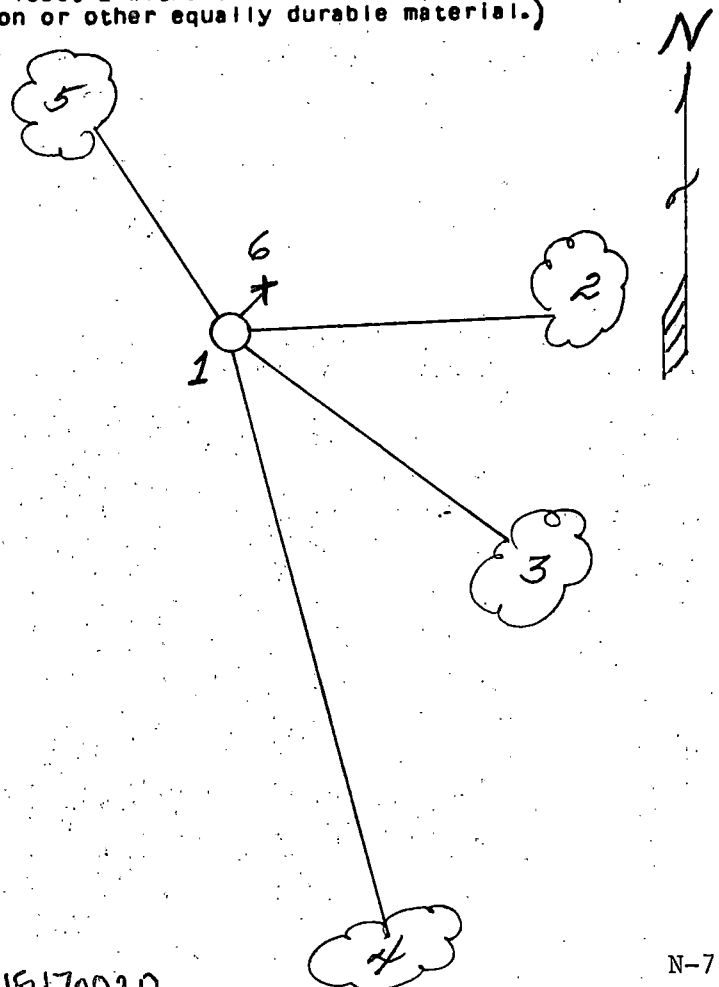

43515170020

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes

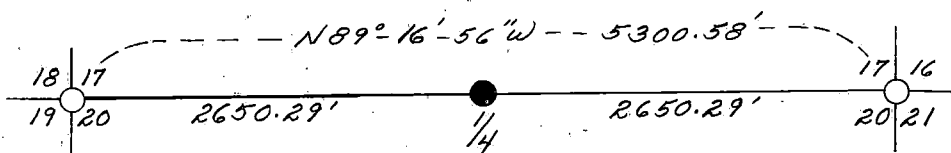

- (1) I, Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing:

Doris Stager
District Ranger

Affix Land Surveyor Seal



138188

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner to Sections 16; 17, 20 & 21; T35N, R15E, 4th P.M.

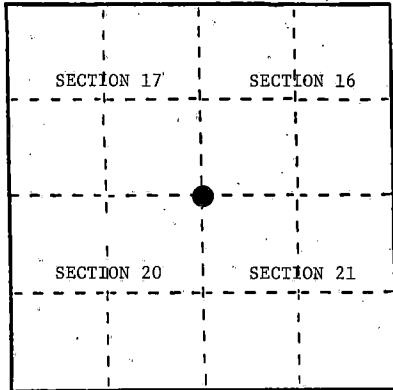

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept, A.D. 1989 at

10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page N-9

Paul A. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride established this corner and set a wood post with BTs:

16" Sugar, N12°E, 43 Links

24" Birch, S32°E, 47 Links

18" Birch, S57°W, 80 Links

10" Sugar, N40°W, 74 Links


1/18/89 - Melindy found this corner and all four BTs. He ran from Quarter Corner easterly and from Quarter Corner southerly. Our proportional distance fits nearly perfect with the fallen cedar post and post point we recovered. No positive proof of any of the original BTs remain.

4/30/89, 5/8/89 and 6/6/89 - Milo E. Stefan searched area thoroughly and restore the corner from the fallen cedar post and recovered post point. A plantation post is easterly 6 - 7 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Aluminum Monument
- 2) 10" Red Pine, N35°E, 55.24'
- 3) 12" White Spruce, S48°E, 160.22'
- 4) 10" Red Pine, S73°W, 113.73'
- 5) 10" Red Pine, N32°W, 81.46'
- 6) Steel Sign Post, Northwest, 1.61'

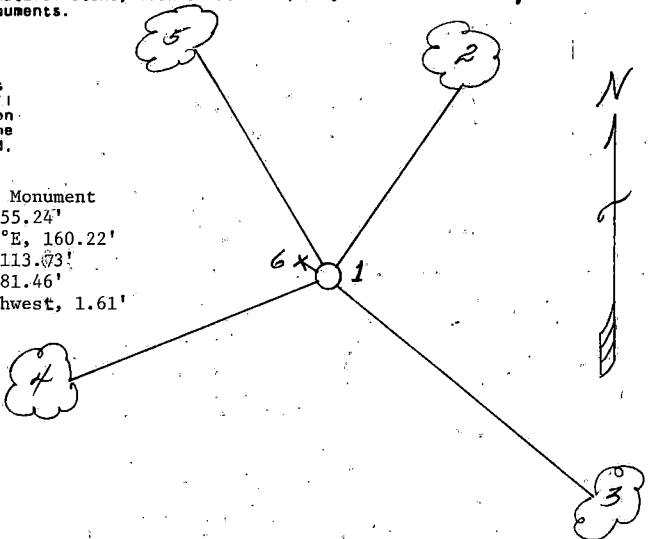

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing:

Dale S. Staege
District Ranger

Affix Land Surveyor Seal



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 11th day of August, 1983, I found evidence of the North Quarter corner of Section 21 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.05 chains, set wood post
Cedar, 14", N.37°W., 7 links, 4.62 feet
Tamarack, 16", S.42°E., 11 links, 7.26 feet

Description of corner evidence found:


Cedar (clump of stumps), N.37°W., 3 feet, 4 feet, 5 feet
Tamarack (large stump), S.42°E., 7.30 feet
Local Evidence: Fallen 4" x 4" x 30" Cedar post with 2 post points deep in soil

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 60" aluminum monument with tablet stamped as follows:
T35N, R15E, S16, 1/4, S21, 1983, RLS-1558
From which the following bear:
White Spruce, 10", S7°E., 9.77 feet
Cedar, 6", S.58°W., 26.00 feet
Cedar, 8", N.75°W., 28.69 feet
Steel Sign Post, Northeast, 1.40 feet



DOCUMENT NO.
124186

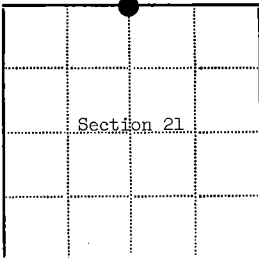

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 11th day of August, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983 and was filed in Book No. Page No. of County Records.

Signature Eugene H. Harty Title Register of Deeds

Township 35 North, Range 15 East, Section 21, Index No. N-11, Page No. B-7, P-69

4351516 0020

NI

Document Number

191721

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 3rd day

of AUGUST A.D., 2006 at

8:55 o'clock A.M., and recorded

in Vol. WENE RESTORATIONS

page N-13

Paul H. Schaefer

Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
BIRCH 8" N24°W 25 LINKS
HEMLOCK 18" N63°E 55 LINKS
SUGAR MAPLE 6" S86°E 29 LINKS
SUGAR MAPLE 14" S62°W 24 LINKS

1904 - N.H. SMITH FOUND ORIGINAL CORNER AND RAN EAST TO QUARTER CORNER.

1934 - JOHN LAIRD (CCC) FOUND AN IRON PIPE 6" ABOVE GROUND LEVEL AND PLACED A METAL LOCATION TAG ON A TELEPHONE POLE FROM WHICH THE CORNER BEARS WEST 3 FEET.

1990 - SURVEY MONUMENT RECORD DOC #144429, ALAN HARRISON, SURVEYOR, S-1851, FOUND A RAILROAD SPIKE IN CTH "H" WHICH IS IN LINE WITH FENCE LINES EAST AND WEST EXTENDED. SPIKE ALSO FITS 1904 SURVEY TO THE EAST WELL AND IS ACCEPTED AS THE CORNER LOCATION.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 5" S60°E 76.35 FEET
P. POLE #351521E10 S77°W 41.11 FEET
WHITE ASH 8" N37°W 89.42 FEET
WITNESS CORNER, 1" x 36" MONUMENT WEST 47.21 FEET

2005 - WISDOT PLANS 9334-02-00 SHOWS FOUND NAIL.

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2006 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND MAG NAIL IN BIT.


FOUND THE FOLLOWING WITNESSES:

3.5" ALUMINUM WITNESS MONUMENT N86°W 47.14 FEET


WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:

3.5" MONUMENT CAP IN CONCRETE N35°W 86.54 FEET
3.5" MONUMENT CAP IN CONCRETE N42°E 90.19 FEET
3.5" MONUMENT CAP IN CONCRETE S61°E 66.58 FEET

THE NORTHEAST
CORNER OF SECTION 21,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

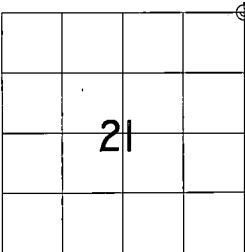

⊕ = LOCATION OF CORNER

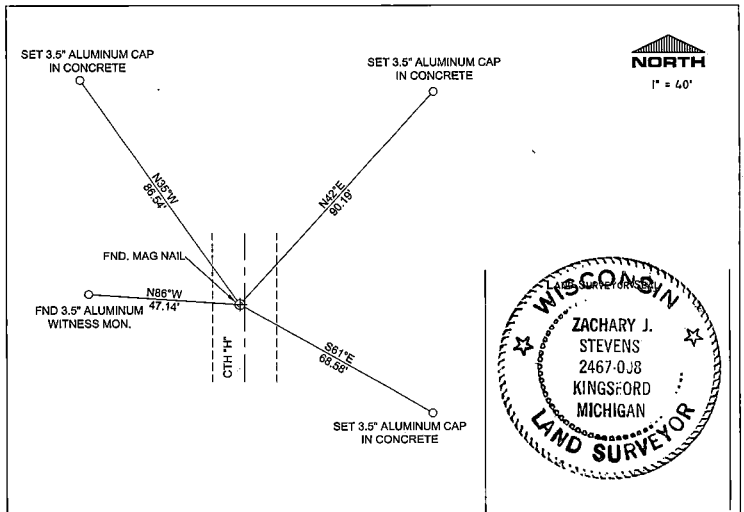

I, ZACHARY J. STEVENS, R.L.S. S-2467-008

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. N-13

Zachary J. Stevens 7/31/06
SIGNATURE DATE

4351516 0000


N-13

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

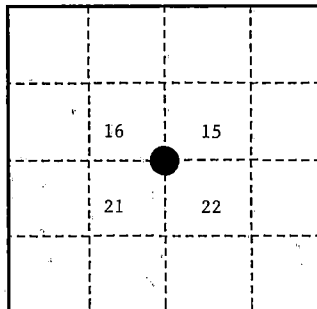

Section corner to Sections 15, 16, 21 and 22,
T.35N., R.15E., Forest County, Wisconsin.

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Birch, 8", N.24°W., 25 links; Hemlock, 18", N.63°E., 55 links; Sugar, 6", S.86°E., 29 links; Sugar, 14", S.62°W., 24 links.

In 1904, N.H. Smith found original corner and ran east to quarter corner.


In 1934, John Laird (CCC) found iron pipe 6" above ground level and placed a metal location tag on a telephone pole from which the corner bears West 3 feet.

In 1990, Alan Harrison (RLS) found a railroad spike in County Hwy. "H" which is in-line with fence lines east and west extended. Spike also fits Smith 1904 survey to the east well and is accepted as the corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Railroad spike in county highway "H" marking the corner location.
2. Sugar, 5", S.60°E., 76.35 feet (slope tape)
3. Power pole #351521E10, S.77°W., 41.11 feet
4. Witness Corner, 1"x 36", West, 47.21 feet
5. White Ash, 8", N.37°W., 89.42 feet

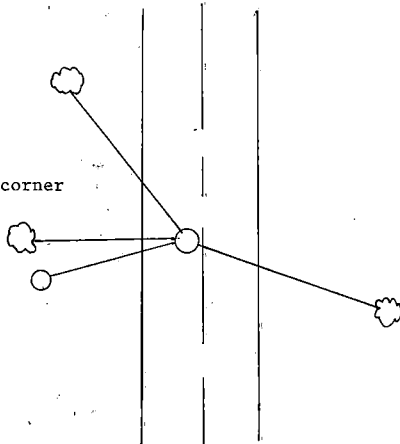

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 13th day
of May A.D., 1992 at
11:32 o'clock A.M. and recorded
in Vol Case Restoration
page 11-13

Paul Achenbrenner
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

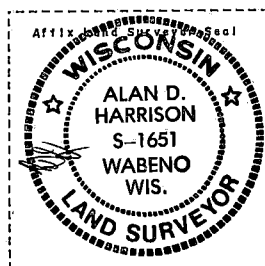

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I Milo E. Stefan, do hereby certify that on the 11th day of August, 1983, I found evidence of the North Quarter corner of Section 22 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
39.75 chains, set wood post
Basswood, 14", S.36°E., 14 links, 9.24 feet
Sugar, 14", N.2°E., 20 links, 13.20 feet


Description of corner evidence found:

Basswood Sprouts, 10" - 12", S.36°E., 9 feet 11 inches
Stump Hole, N.2°E., 13 feet - 14 feet
Local Evidence: 1 1/2" x 4" iron pipe in large mound of stone with
4" x 4" x 30" rotted post

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument with tablet stamped as follows:
T35N, R15E, S15, 4, S22, 1983, RLS-1558
From which the following bear:
Sugar, 14", N.28°E., 30.41 feet
Sugar, 6", S.45°W., 24.29 feet
Basswood, 12", N.43°W., 23.05 feet
Steel Sign Post, Southwest, 2.80 feet

DOCUMENT NO.
124187

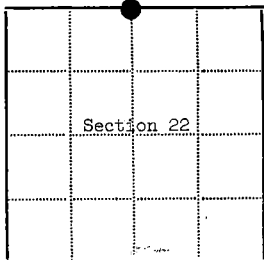

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 11th day of August, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene J. Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 22, Index No. N-15, Page No. B-2, P. 1

43515150020

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 14-15-22-23, T.35N., R.15E. Forest County, Wisconsin.

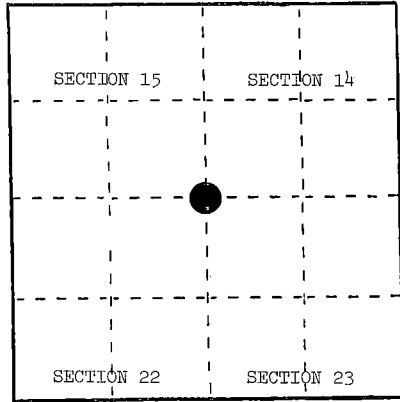


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Birch, 10", N.82°W., 5 links; Sugar, 14", N.28°E., 38 links; Sugar, 12", S.64°E., 50 links; Hemlock, 10", S.28°W., 40 links. In 1905, N. H. Smith was at corner and set an Elm post with no new BTs. In 1909, J. J. Melendy found an Elm post and remains of original BTs. He placed a mound of rock around Elm post. In 1982, R. Widmar, a BLM surveyor found a 2½" iron pipe set in a mound of stone with no original evidence. He found the following local BTs: Maple, 15", S.78°E., 1¼ links; Maple, 7", S.88°W., 27 links; Maple, 11", N.2°W., 19½ links. He replaced iron pipe with 2½" x 30" aluminum monument and set the following new BTs: Maple, 10", N.89°E., 54 links; Maple, 14", S.54°E., 57 links; Yellow Birch, 5", S.13°W., 37 links; Maple, 7", N.45°W., 56 links. In 1987, Alan Harrison found monument as set by Widmar and added BTs as shown in sketch.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 30" monument in a mound of stone, stamped to identify the corner.
2. Sugar, 8", N.85°E., 35.30 feet
3. Sugar, 11", S.44°E., 37.90 feet
4. Yellow Birch, 4", S.15°W., 24.42 feet
5. Sugar, 6", N.37°W., 36.78 feet
6. Steel Sign Post, North, 1.20 feet

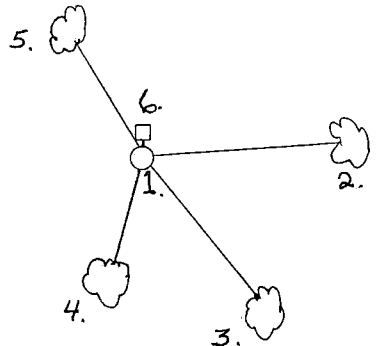

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 19th day
of September A.D., 1990 at
3:15 o'clock P.M. and recorded
in Vol. Corner RESTORATION
PAGE 4-17

Paul Anderson
Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

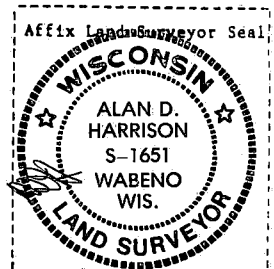

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/28/88
Signature Date

Certificate ready for filing: Darrell E. Richards
Act. District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 14 and 23, T.35N., R.15E.

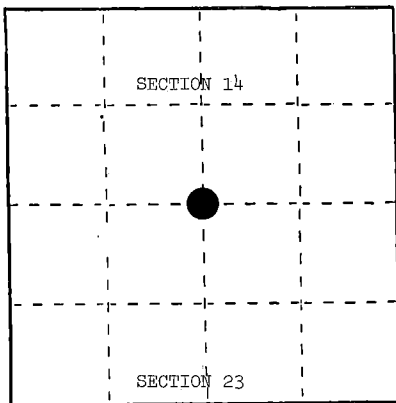

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 31st day

March A.D., 1988 at

11:00 o'clock P.M. and recorded

in Vol. 19

Page 19

Register of Deeds

Paul A. Schenck

Corner Restorations

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Sugar, 8", N.28°W., 34 links; Birch, 16", S.43°W., 13 links.


In 1908, J. J. Melendy found both original BTs standing with marks plain. He set a new Cedar post 5" x 5" x 48".

In 1987, Alan Harrison searched area and found no evidence. He then restored corner position retracement of J. Melendy's survey from the southeast section corner of Section 14 through the east one-sixteenth corner on the south line of Section 14.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- Chiseled "X" on south edge of a 2' x 4' Rock to mark corner.
- Aspen, 10", N.32°E., 24.40 feet
- Witness Corner, 2 1/2" x 36", East, 5.60 feet
- Sugar, 5", S.69°W., 65.74 feet
- Sugar, 5", N69°W., 62.47 feet
- Steel Sign Post, East, 4.75 feet

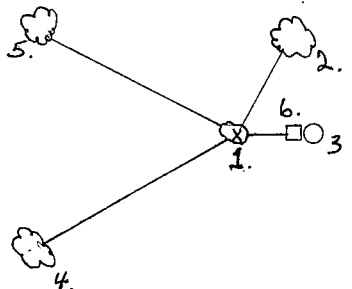

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/28/88
Signature Date

Certificate ready for filing: Dale S. Stage
District Ranger

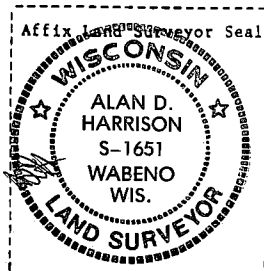

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 14-13-23-24, T.35N., R.15E.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 31st day
of March, A.D., 1988 at
1:10 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page N-21
Paul Aschentrener
Register of Deeds

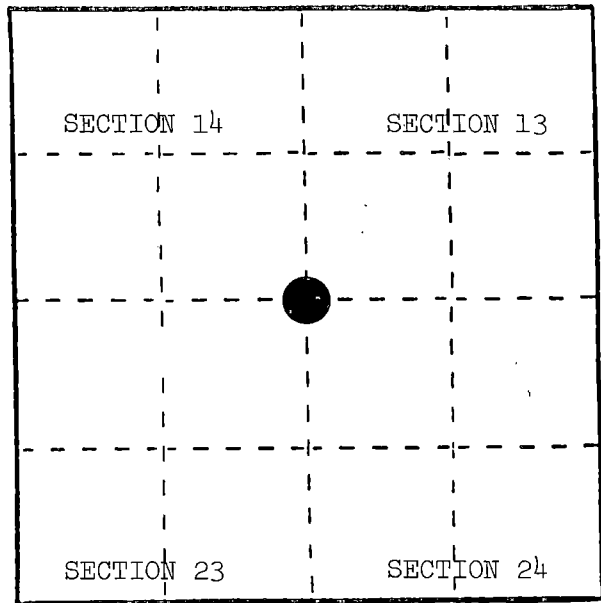

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Hemlock, 14", N.77°W., 36 links; Fir, 10", N.40°E., 38 links; Hemlock, 12", S.41°E., 19 links; Birch, 12", S.40°W., 12 links.


In 1909, J. J. Melendy found original corner and BT remains. Set a new Cedar post and made an "X" on a 3' x 4' x 12" stone, S.75°W., 24.8 feet.

In 1986, Alan Harrison (RLS) found wood post lying next to a 2" iron pipe in a mound of stone and "X" on a 3' x 4' x 12" rock, S.75°W., 25 feet from found pipe. Accepted pipe as true location of corner and monumented same.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify corner.
2. Sugar, 6", N.82°E., 36.40 feet
3. Red Maple, 7", S.48°E., 11.25 feet
4. Chiseled "X" on 3' x 4' x 12" Rock, S.76°W., 25.13 feet.
5. Sugar, 7", N.14°W., 20.23 feet
6. Steel Sign Post, Southwest, 1.3 feet

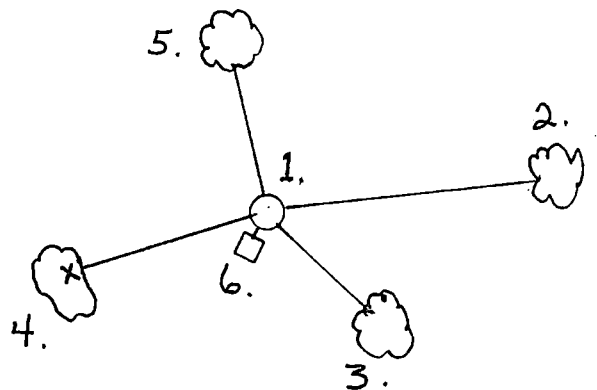

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

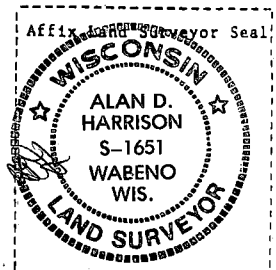

(i) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/28/88
Signature Date


Certificate ready for filing: Dennis Stagg
District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 13-24, T.35N., R.15E.

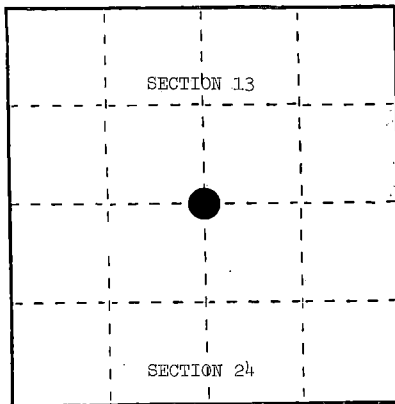

REGISTER'S OFFICE }
 Forest County, Wis. }
 Received for record this 31st day
 of March A.D. 1986 at
 1:10 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 page N-23
Paul H. Schenck
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set a wood post with the following BTs: Sugar, 12", N.20°W., 34 links; Sugar, 9", S.18°E., 25 links.

In 1986, Alan Harrison (RLS) found a 2" iron pipe in a mound of stone. From pipe, there was a blazed line east and west. Pipe fits section well and is accepted as the corner. He replaced the iron pipe with a 2½" x 36" aluminum monument stamped for the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped for the corner.
2. Sugar, 20", N.53°E., 31.92 feet
3. Ash, 10", S.27°W., 17.61 feet
4. Sugar, 6", N.15°W., 7.05 feet
5. Steel Sign Post, Southeast, 1.20 feet

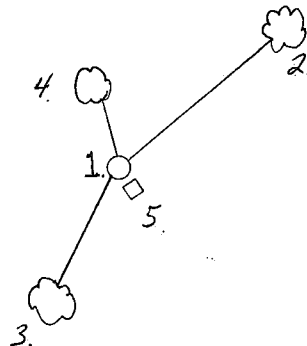

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(i) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/28/88
Signature Date

Certificate ready for filing: Dale S. Staeger

District Ranger

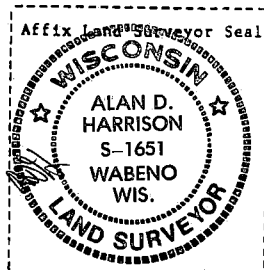

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 5 day of May, 1977, I found evidence of the Southeast section corner of Section 13 Township 35 North Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis
80.00 chains North between Sections 19 and 24, set post
Yellow birch 14, S60W, 41 lks.
Sugar 20, N70W, 34 lks.
Yellow birch 10, N45E, 36 lks.
Sugar 11, S82E, 50 lks.
11.50 chains North intersect stream 125 lks. wide runs SE
13.50 chains North leave stream
19.50 chains East, stream 250 lks. wide, runs SE

Description of corner evidence found:



1 1/2 inch steel pipe in mound of stone
11.6 ch. North river
19.5 ch. East river

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced the iron pipe found with a 2 inch inside diameter galvanized iron pipe, 3 feet long, filled with concrete, with a brass cap stamped:
T35N, R15E, R16E, S13, S18, S24, S19, 1977, S-802

Blazed and scribed the following new bearing trees:

Maple 6, N66E, 26.34 feet
Maple 8, N9W, 27.61 feet

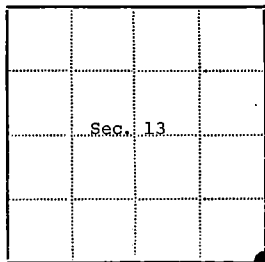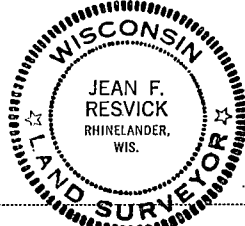

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 31 day of August, 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113294

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the..... day of..... 19....., and was filed in Book No..... Page No..... of County Records.

Signature Eugene Staszny Title Register of Deeds

Township 35 North, Range 15 East, Section 13, Index No. N-25, Page No. 25

43515130000

138189

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● - Corner monument restored.

Quarter Corner to Sections 24 & 19,
T35N, R14-15E, 4th P.M.

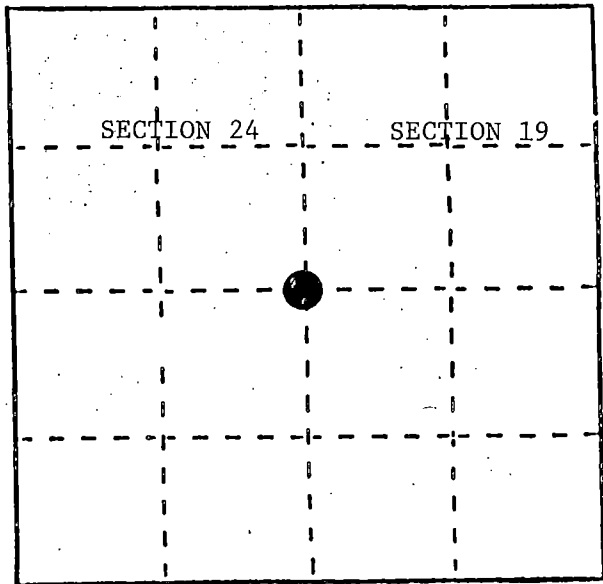

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept, A.D., 1989 at
10:25 o'clock A. M. and recorded
in Vol. P-1 **CORNER RESTORATIONS**
page P-1
Paul Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed by construction and reconstruction of State Highway #32 over the years, the last time in 1985.

In 1981 I restored this corner by lost methods. I placed a railroad spike in the highway for the corner and established a reference monument 50.00 feet east. This all being destroyed by the 1985 construction.


On 7/10/85 the DOT filed with the County Clerk a "Preservation of Landmark" form whereby four Witness Corners were established.

On 3/28/89 we found the Witness Corners and set a PK nail in surface of highway for the corner. We ran a traverse to this point to confirm the position. I returned on 6/28/89 and replaced the PK nail with a railroad spike and set a steel sign post SE of DOT W.C. #4, .77 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) Railroad spike
- 2) DOT Berntsen aluminum monument, W.C. #1, S57°-25'W, 57.66'
- 3) DOT Berntsen aluminum monument, W.C. #2, N51°-39'W, 69.59'
- 4) DOT Berntsen aluminum monument, W.C. #3, N57°-25'E, 101.17'
- 5) DOT Berntsen aluminum monument, W.C. #4, S51°-39'E, 67.40'
- 6) Steel sign post, SE of DOT W.C. #4, .77'

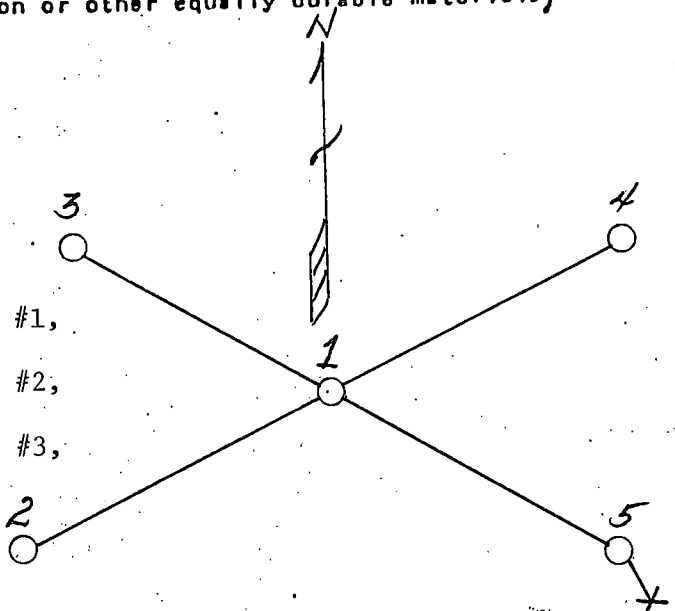

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location

- (g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date



CERTIFICATE READY FOR FILING: Dale S. Stage

District Ranger

232164

FOREST COUNTY, WI
CORTNEY BRITTEN CLEEREMAN
REGISTER OF DEEDS
RECEIVED FOR RECORD


OCT 23 2020

Time: 9:00 a.m.
Vol.: Corner Restoration
Page Number: P-1

U.S. PUBLIC LAND SURVEY MONUMENT RECORD
FOREST COUNTY

TYPE OF MONUMENT: BERNTSEN STEEL SURVEY MARKER NAIL
WISCONSIN COUNTY COORDINATE SYSTEM (FOREST)
DATUM: NAD 83 (2011 ADJUSTMENT)
NORTHING 545055.725
EASTING 894179.176
DRAWN BY: ANDREW HUNTER

SECTION 19
TOWN 35 NORTH
RANGE 15 EAST

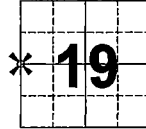

BASIS FOR MONUMENT LOCATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL OR OTHER EVIDENCE CONSIDERED:

SEE PREVIOUS TIE SHEET PREPARED BY
MILO E. STEFAN DATED JULY 7, 1989 FOR
MONUMENT HISTORY.

I COMPLETED A FIELD SURVEY PRIOR TO HIGHWAY
CONSTRUCTION ALONG S.T.H. "32" AND FOUND A R.R.
SPIKE IN ASPHALT AS CALLED FOR.

THIS MONUMENT FIT WELL WITH THE 4 EXISTING
WITNESS MONUMENTS AND THE PUBLISHED COUNTY
COORDINATES, AND WAS ACCEPTED AS THE TRUE
CORNER LOCATION. I SET A BERNTSEN STEEL SURVEY
MARKER NAIL, AND VERIFIED EXISTING WITNESS TIES
AFTER CONSTRUCTION WAS COMPLETED.

SEAL:




CERTIFIED CORRECT:

Andrew L. Hunter
PROFESSIONAL LAND SURVEYOR

DATE OCTOBER 15, 2020


TIE SKETCH

SHOW AT LEAST FOUR TIES, ALSO FENCE LINES, ROADS, TOPO, SIZE AND TYPE OF WITNESS TREES AND ANY OTHER PERTINENT SITE DETAILS. IF OFF THE ROAD, THE BEST WAY TO ARRIVE AT THE CORNER.

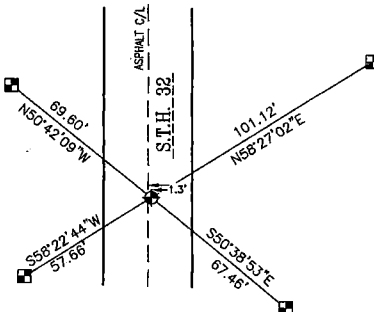

□ FOUND DOT BERNTSEN
ALUMINUM MONUMENT

⊙ SET BERNTSEN STEEL SURVEY MARKER NAIL



SCALE 1"=50'

43515242000

P-1

138190

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner to Sections 19 & 20,
T35N, R15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 6th day
of Sept. A.D., 1989 at
10:35 o'clock A.M. and recorded
in Vol. 85
page 55
CORNER RESTORATIONS
Paul H. Schenckner
Register of Deeds

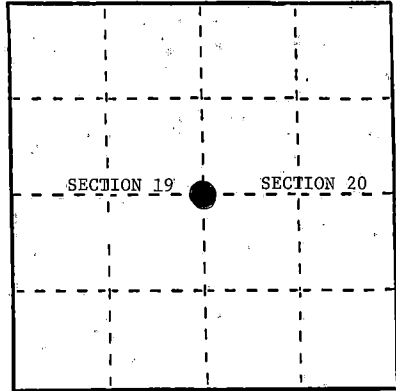

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride established this corner and set a wood post and BTs:
18" Birch, S67°E, 18 Links 8" Sugar, N79°W, 18 Links


4/21/89 - 4/22/89 - 5/8/89 searched area very thoroughly and found fallen cedar post with location poster attached with small mound of stone. This post is supported by remains of the original birch BT stump and a stump hole for the sugar.

6/6/89 I restore this corner at the old post point location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" Alum. Monument
- 2) 8" Sugar Maple, N80°E, 22.09'
- 3) 4" Sugar Maple, S5°W, 13.80'
- 4) 6" Sugar Maple, N72°W, 50.29'
- 5) 4" Sugar Maple, N7°W, 16.75'
- 6) Steel Sign Post, Southeast, 3.62'

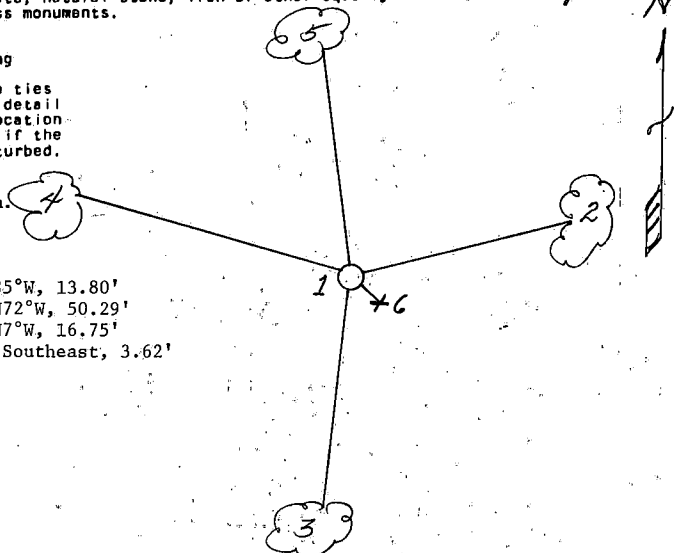

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

- (g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

6/24/89
Date

Certificate ready for filing.

Dale B. Staeger
District Ranger



Document Number

191722

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 3rd day
of AUGUST A.D., 2006 at
2:45.0 o'clock AM and recorded
in Vol. CORNER RESTORATIONS
page P-13

Paul A. Haldeman
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
HEMLOCK 12" S72°W 14 LINKS
SUGAR MAPLE 12" N65°E 41 LINKS

1908 - N.H. SMITH FOUND ORIGINAL CORNER AND ORIGINAL SUGAR BT OK.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 20" N36°W 57-1/3 LINKS
SUGAR MAPLE 24" N81-1/4°E 44 LINKS

1991 - SURVEY MONUMENT RECORD DOC #144428. ALAN HARRISON, SURVEYOR, S-1651, FOUND VERY OLD FENCE LINES RUNNING EAST AND WEST WITH NO ORIGINAL OR SUBSEQUENT CORNER EVIDENCE. SET RAILROAD SPIKE AS CORNER LOCATION IN CENTERLINE OF COUNTY HIGHWAY "H" AT THE INTERSECTION OF THE FENCE LINES EXTENDED. THIS POSITION FITS THE 1908 N.H. SMITH SURVEY AND IS ACCEPTED AS THE CORNER POSITION.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 7" S51°E 46.48 FEET
SUGAR MAPLE 7" N82°W 68.88 FEET
STEEL SIGN POST EAST 46.74 FEET
WITNESS CORNER, 2.5" x 36" N80°E 45.78 FEET

2005 - WISDOT PLANS 9334-02-00 SHOWS A FOUND NAIL.

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2006 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND MAG NAIL IN CENTERLINE OF BIT.

FOUND THE FOLLOWING WITNESSES:


2.5" ALUMINUM WITNESS MONUMENT S86°E 45.75 FEET

WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:


3.5" MONUMENT CAP IN CONCRETE N48°W 49.83 FEET
3.5" MONUMENT CAP IN CONCRETE S40°E 55.10 FEET
3.5" MONUMENT CAP IN CONCRETE S51°W 59.43 FEET

THE EAST 1/4

CORNER OF SECTION 21,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

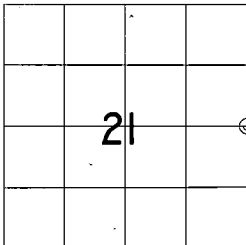

⊕ = LOCATION OF CORNER

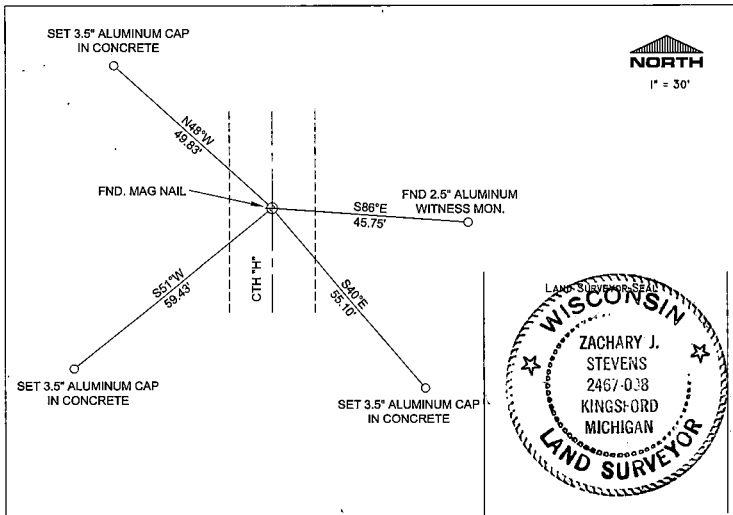

I, ZACHARY J. STEVENS R.L.S. S-2467-008

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX NO. P-13

Zachary J. Stevens 7/31/06
SIGNATURE DATE

43515212000

P-13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

One-quarter corner common to Sections 20 & 21, T35N, R15E, 4th P.M., Forest County, WI.

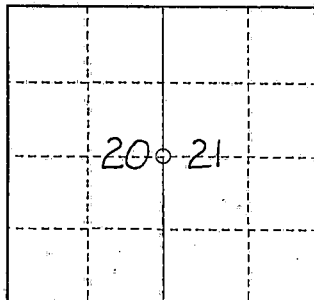

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride, Deputy Surveyor.

40 chains set wood post from which:

Birch 6", N19°W - 20 links (13.20 feet)
 Sugar 10", S60°E - 19 links (12.54 feet)


- In 1981, Milo Stefan, RLS #1558, found a location poster on a fallen fence post and a stump hole at record bearing and distance from the post with maple roots evident. He set a 2 1/2" x 36" aluminum monument with a stamped tablet.
- In 1993, I recovered the aluminum monument set by Milo Stefan and established accessories as noted below

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Found a 2 1/2" aluminum monument.

- 1- Sugar, 10"- N48°E - 13.03 feet
- 2- Steel sign post - South - 1.05 feet
- 3- Red Pine, 13" - S69°W - 68.80 feet
- 4- Sugar, 10" - N47°W - 23.66 feet

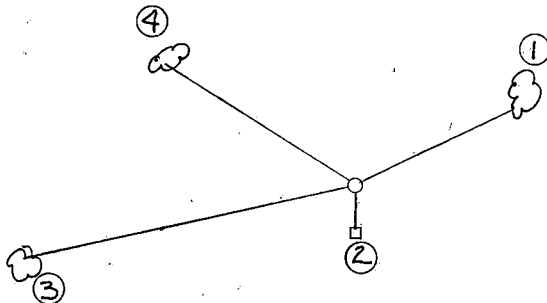

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 2nd day
 of June A.D., 19 93 at
12:00 o'clock P.M. and recorded
 in Vol. 149 of Restoration
 page 53

John Chiles, Deputy
 Register of Deeds

- (a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) found perpetuated location?

(2) A found perpetuated location

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

- (i) I, John R. Garske, S-1685

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John R. Garske 3/24/93
Signature Date

CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 21 and 22,
T.35N., R.15E., Forest County, Wisconsin.

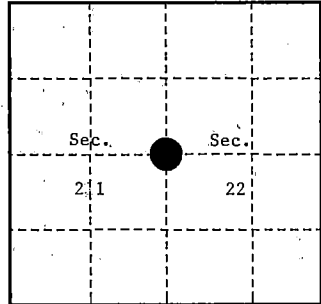

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Hemlock, 12", S.72°W., 14 links; Sugar, 12", N.65°E., 41 links.


In 1908, N.H. Smith found original corner and original Sugar BT ok. Made the following BTs: Sugar, 20", N.36°W., 57 1/3 links; Sugar, 24", N.81 1/4°E., 44 links.

In 1991, Alan Harrison (R.L.S.) found very old fence lines running east and west with no original or subsequent corner evidence. Set corner position in centerline of county highway "H" at the intersection of the fence lines. extended. This position fits the 1908 N.H. Smith survey and is accepted as the corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- Railroad spike in centerline of county highway "H" marking the corner location.
- Witness Corner, 2 1/2" x 36", N.90°E., 45.78 feet.
- Sugar, 7", S.51°E., 46.48 feet.
- Sugar, 7", N.82°W., 68.88 feet.
- Steel Sign Post, East, 46.74 feet.

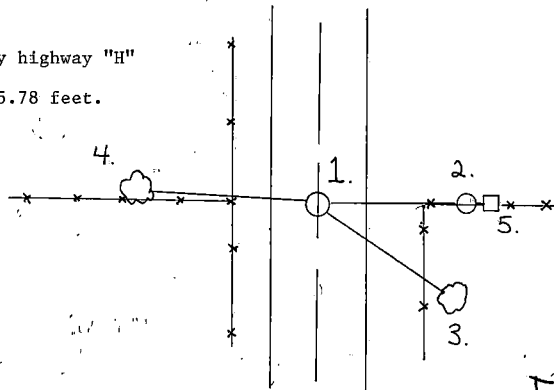

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 13th day
of May A.D. 1992 at
11:30 o'clock A.M. and recorded
in Case Registrations
page 518

Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) An obliterated evidence location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

4/29/92
Date

CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger

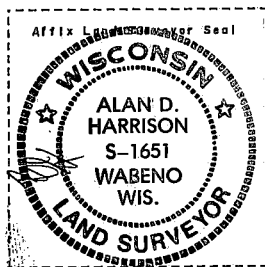

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I William B. Cochran, do hereby certify that on the 29 day of June, 1978, I found evidence of the East Quarter corner of Section 23 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in 1859 by James McBride
40 chains North between Sections 23 and 24, set post
Hemlock 30, N81W, 22 lks.
Hemlock, N52E, 57 lks.
2.50 chains south enter swamp
8.40 chains south stream

Description of corner evidence found:

Cedar post with old cedar point alongside of post.
Stream 8.4 chains south
Swamp line south not definite

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced cedar post point with a 2 inch inside diameter galvanized iron pipe, 3 feet long, filled with concrete with brass cap stamped T35N, R15E, 1/4, S23, S24, 1978, S-1107
Blazed and scribed the following new bearing trees
Spruce 12, N66E, 44.07 ft.
Spruce 9, N61W, 36.96 ft.
Set steel sign post 0.5 ft. northwest of monument

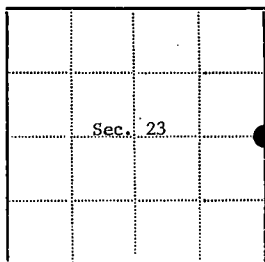

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Laona, Wisconsin, this 29 day of August 1978.

Signature William B. Cochran Title Surveying Technician
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1107 DOCUMENT NUMBER- **115177**

Office of Register of Deeds, County of Forest

I hereby certify that the within instrument was filed in this office for record on the 27th day of November, 1978, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stegny Title Register of Deeds

Township 35 North, Range 15 East, Section 23, Index No. P-21, Page No. _____

127707

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 19 and 24, T.35N., R.15-16E., Forest County, Wisconsin.

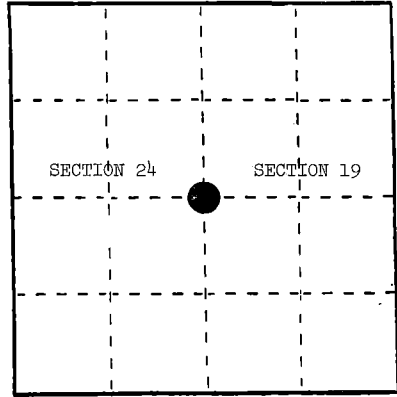

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, Artemas Curtis established this corner at 40.00 chains and set wood post with the following BTs: 14" Sugar, N.76°W., 13 links; 11" Hemlock, N.18°E., 8 links.


October 12, 1966, District Crew of Miller, Williams, Gentz, Mallow, and Klepper found scribed wood post at fence corner--fence south and west.

August 23, 1984, Milo Stefan found fence corner and post hole with fence south. Placed a 2" x 30" aluminum monument in mound of stone with tablet stamped to identify corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 10" Red Pine, S.16°W., 61.36 feet
2. 8" Red Pine, S.53°W., 53.10 feet
3. 6" Balsam Fir, N.29°W., 37.29 feet
4. Steel Sign Post, Northeast, 1.6 feet
5. 2" x 30" aluminum monument stamped to identify the corner.

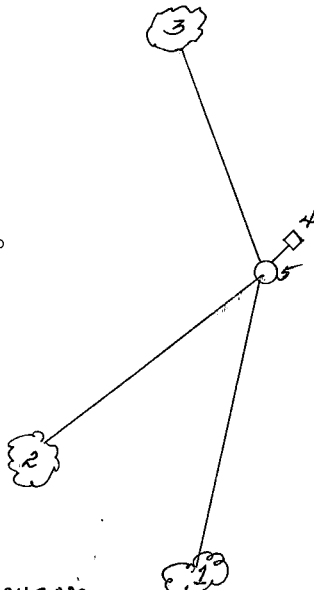

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 1st day
of... April... A. D., 1985 at
2:05 o'clock... P... M. and
recorded in Vol. CORNER RESTORATIONS
on page... 25

Paul A. Schuchman
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

2/4/85
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 19 and 24, T.35N., R.15-16E.

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 14th day

of March A.D. 1986 at


12:25 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

Page P-25

Saul Aschenbrenner

Register of Deeds

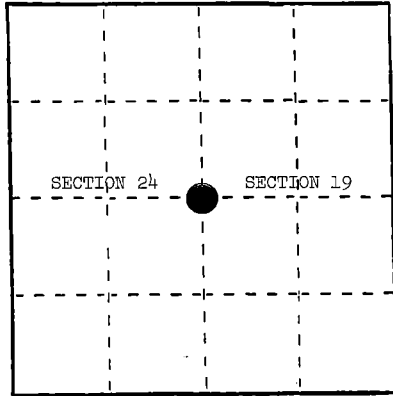

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set wood post and made the following BTs: Sugar, 14", N.76°W., 13 links; Hemlock, 11", N.18°E., 8 links.


In 1966, Jean Resvick found scribed Cedar post and old fence lines running west and south.

In 1984, Milo Stefan found post point off old fence line south. No other evidence was recovered. Set monument and made new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner location.
2. Red Pine, 10", S.16°W., 61.36 feet
3. Red Pine, 8", S.53°W., 53.10 feet
4. Balsam, 6", N.29°W., 37.29 feet
5. Steel Sign Post, Northeast, 1.60 feet

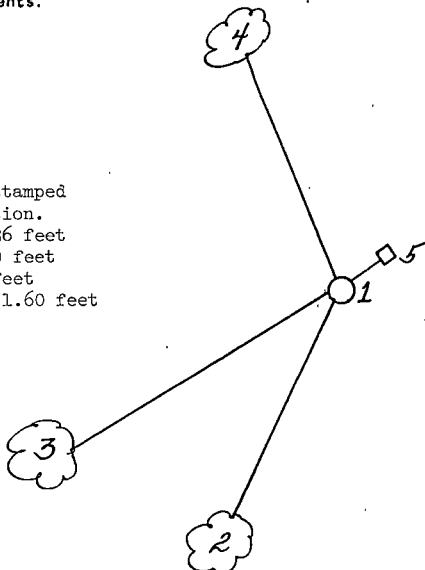

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/12/86
Date



CERTIFIED CORNER ESTABLISHMENT

BEING THE SOUTH SIXTEENTH CORNER BETWEEN
SECTIONS 23 AND 24, TOWNSHIP 35 NORTH, RANGE 15 EAST,
FOURTH PRINCIPAL MERIDIAN, COUNTY OF FOREST, STATE OF WISCONSIN

Legend

2 inch inside galvanized iron pipe, 3 feet long, filled with concrete with brass cap stamped to identify corner.



Corners monumented and recorded.

U.S.A.


U.S. Government Land.

I.L.

Indian Land.

DOCUMENT NUMBER
115178

REGISTER'S OFFICE
FOREST COUNTY, WIS.

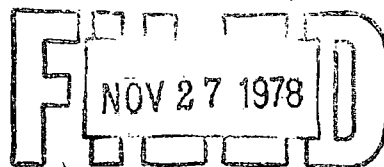

Scale 1 inch = 600 feet

Survey Notes

Eugene A. Staley
10:20 O'clock A.M.
Register of Deeds

The south sixteenth corner between Sections 23 and 24, Township 35 North, Range 15 East, Fourth Principal Meridian was established by the U.S. Department of Agriculture, Forest Service.

The purpose of this survey was to establish the south sixteenth between Sections 23 and 24 between corner positions of the original Government survey of 1859.

The U.S. Government acquired title to the SESE of Section 23 in 1935 and title to the SWSW of Section 24 in 1938. Bearings shown are magnetic bearings.

Corners Recovered

1. Section Corner to Sections 23-24-25-26.

Recorded as document number 90971, dated December 17, 1965.

2. Quarter Corner between Sections 23 and 24.

Monument at the same time as this survey and recorded at same time as this document.

Corner Established

1. South Sixteenth Corner between Sections 23-24.


Established South Sixteenth at the mid point on line between the section corner and quarter corner.

New Corner References:

Maple 7 N62E 2.31 feet

Maple 5 N74W 7.95 feet

Steel sign post set 0.5 feet SE of corner

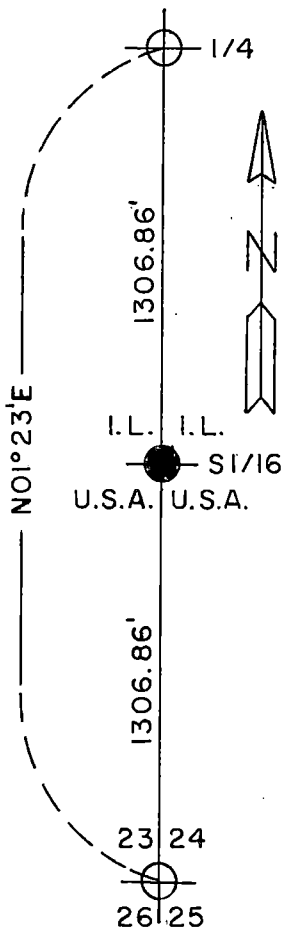

43515230000

T35N R15E

0-21

021


Sheet 2 of 2

Surveyor's Affidavit

State of Wisconsin)
County of Forest) ss

I, Jean F. Resvick, Land Surveyor, U.S. Forest Service, and a registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed the East Line of SE 1/4 Section 23, Township 35 North, Range 15 East, Fourth Principal Meridian.

The plat map and the survey notes are a correct representation of the corners recovered and corner located.

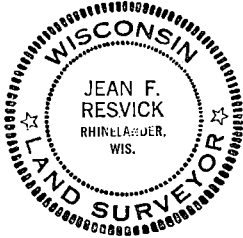

Land Surveyor, U.S. Forest Service
R.L.S. State of Wisconsin
Certificate S-802

Date of Survey: 1978

127708

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 19, 24, 25, and 30,
T.35N., R.15-W., Forest County, Wisconsin.

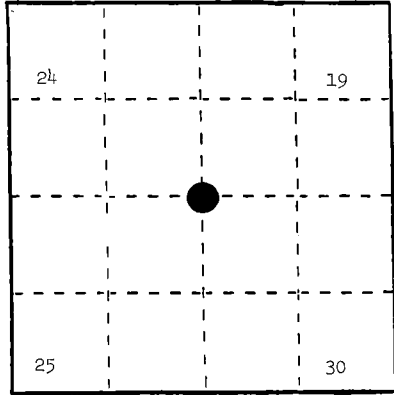

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, Artemas Curtis established this corner at 80.00 chains and set a wood post with the following BTs: 10" Tamarack, S.60°W., 48 links; 8" Tamarack, N.52°W., 76 links; 8" Tamarack, N.64°E., 59 links; 10" Tamarack, S.26°E., 24 links.

August 23, 1984, Milo Stefan found point of original post by Curtis supported by stumps of all four original BTs. Remains of very old fence line south and east. Placed a 2" x 60" aluminum monument with tablet stamped to identify the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 8" Cedar, N.78°E., 41.05 feet
2. 8" Tamarack, S.58°E., 40.87 feet
3. 5" Tamarack, S.60°W., 45.62 feet
4. 6" Tamarack, N.33°W., 4.02 feet
5. Steel Sign Post, South, 1.4 feet
6. 2" x 60" aluminum monument stamped to identify the corner.

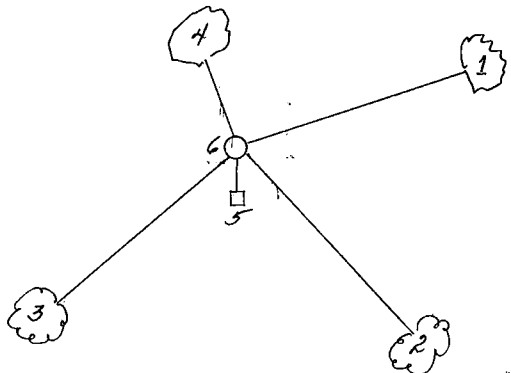

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this.....1st.....day

of April.....A.D., 1985

at 2:05.....o'clock.....P.M. and

recorded in Vol. CORNER RESTORATIONS

on page R-1

by Frank A. Schenckner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

2/4/85
Date

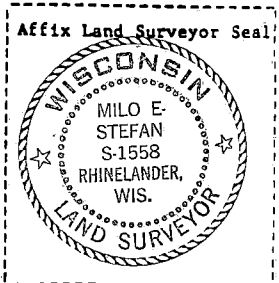

138191

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.


● = Corner monument restored.

Section Corner to Sections 24, 25, 19 and 30, T35N, R14-15E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day
of Sept. A.D., 1989 at
10:30 o'clock A.M. and recorded
in Vol. 10 **CORNER RESTORATIONS**
page 8-1

Paul A. Berntsen
Register of Deeds

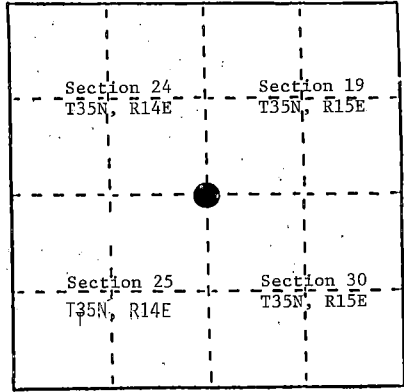

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner. All evidence being destroyed by construction and reconstruction of State Highway #32 over the years.


In 1965 Forest Service surveyor Jean Resvick perpetuated this corner and placed a brass capped 2" x 60" iron pipe, N47°12'E, 70.00' from the corner.

On 7/10/85 the DOT filed with the County Clerk a "Preservation of Landmark" from whereby four additional Witness Corners were set.

On 6/28/89 I placed a railroad spike in the surface of the blacktop road for the Section Corner. We also placed a steel sign post northwest of DOT, W.C. #3, .68 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

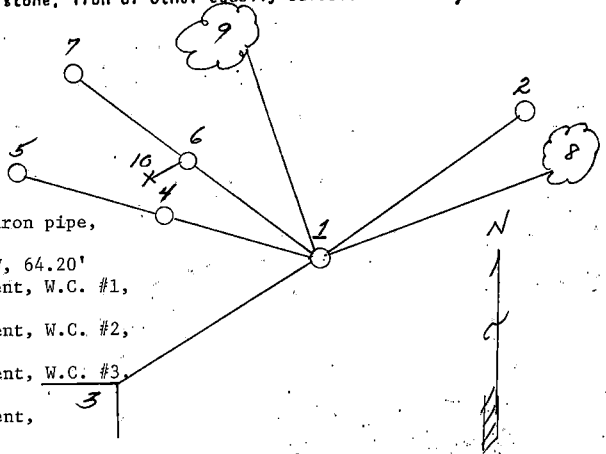

- 1) Railroad spike
- 2) Brass tablet on a 2" x 60" iron pipe, N47°-12'E, 70.00'
- 3) NE corner of building, S63°W, 64.20'
- 4) DOT Berntsen aluminum monument, W.C. #1, NW, 41.52'
- 5) DOT Berntsen aluminum monument, W.C. #2, NW, 66.91'
- 6) DOT Berntsen aluminum monument, W.C. #3, NW, 53.84'
- 7) DOT Berntsen aluminum monument, W.C. #4, NW, 75.17'
- 8) 18" Basswood, N63°E, 89.12'
- 9) 10" Basswood, N34°W, 73.80'
- 10) Steel sign post, NW of DOT W.C. #3, .68'

43519240000

R-1

R-1

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal.



- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 7, 1989
Date

CERTIFICATE READY FOR FILING:

Dee B. Stager
District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 19 and 30, T.35N., R.15E.

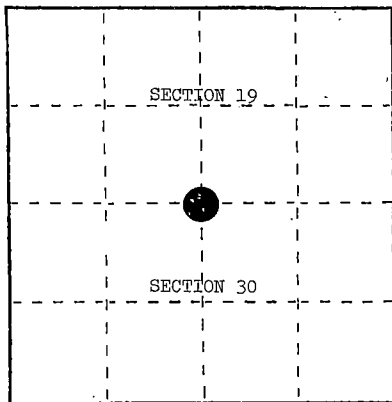

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post 42.50 chains with the following BTs: Birch, 14", S.54°E., 14 links; Birch, 10", N.57°W., 33 links.

In 1909, N. H. Smith set $\frac{1}{2}$ " iron rod and used same for the "Bonesteel Plat" of Padus.


In 1982, Department of Transportation found $\frac{1}{2}$ " iron 9" below road surface.

August 31, 1984, R. Belliveau found $\frac{1}{2}$ " iron rod 9" below road surface.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 12", N.60°E., 129.64'
3. Red Pine, 14", S.71°E., 88.22'
4. Power Pole, S.74°W., 97.55'
5. SE corner of house foundation, N.35°W., 92.96'

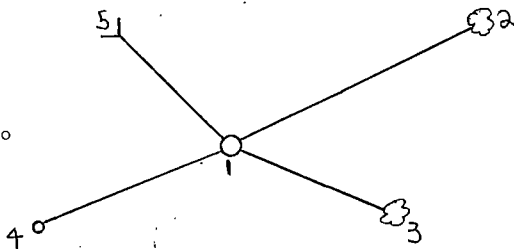

REGISTER'S OFFICE }

Forest County, Wis. }

Received for record this 21st day

of January, 1985, at

11:00 o'clock, A.M. and

recorded in Vol. CORNER RESTORATIONS

on page R-3

Paul A. Schindler

REGISTER

4351519 0020

R-3

35-14

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). ~~20098~~; Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/24/84
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

⊙ = Corner monument restored.

Section Corner to Sections 19, 20, 29 & 30,
T35N, R15E, 4th P.M.

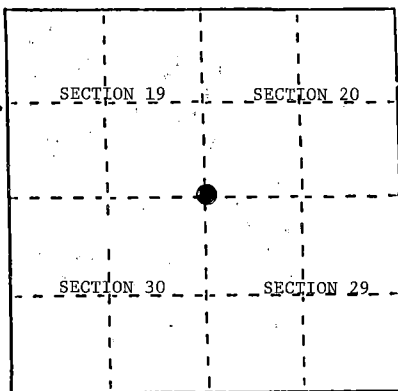

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6th day
of Sept. A.D., 1989 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page R-5

Paul H. Schaeffer
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 James McBride established this corner and set a wood post with BTs:

10" Hemlock, N82°E, 40 Links

20" Basswood, S68°E, 28 Links

16" Elm, S4°W, 55 Links

10" Sugar, N57°W, 85 Links

6/17/09 - N. Smith found original bearing tree and made a new one, a 12" Birch,
N37 1/4°W, 81 3/4 Links.

Date Unknown - Owen Smith made a bearing tree, a 24" Birch, N 1 1/2°E, 78 links.


11/19/81 - Milo Stefan and Alan Harrison of the Forest Service found large birch stump at N 1 1/2°E, 53.9 feet. We restored the corner. As the corner falls in the middle of an old road, we established two reference monuments north and south of true corner position. We also made four new bearing trees to the corner and placed a steel sign post.

6/8/89 - Forest Service crew; Young, Huettle and Downs set a 1 1/4" iron pipe in road for corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 1 1/4" iron pipe in road below surface
- 2) Reference monument #1, north, 32.01'
- 3) Reference monument #2, south, 24.10'
- 4) 7" Sugar Maple, N59°E, 71.44'
- 5) 5" Yellow Birch, S31°E, 22.23'
- 6) 10" Black Ash, S12°W, 52.19'
- 7) 22" Hemlock, N39°W, 45.91'
- 8) Steel sign post, North of R.M. #1, 1.50'

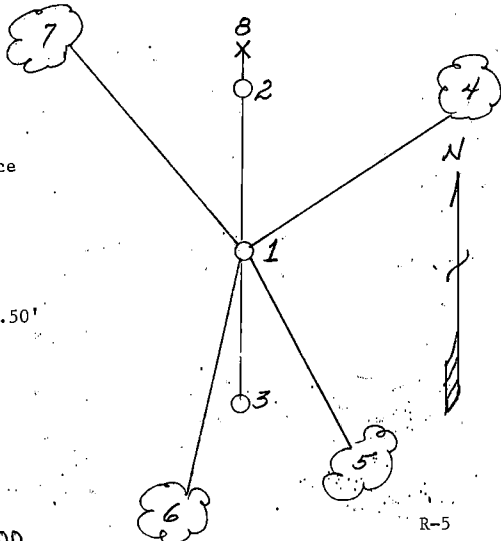

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

an obliterated location

- (gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal



(i) Milo E. Stefan

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 8, 1989
Date

CERTIFICATE READY FOR FILING:

Dale B. Steege
District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner common to Sections 20 and 29,
 T.35N., R.15E., Forest County, Wisconsin.

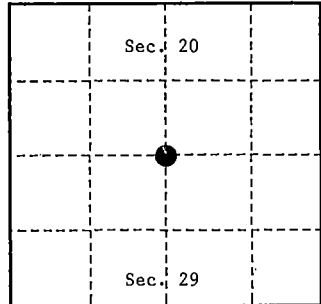

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride corrected west and at 40.00 chains set one quarter post and made the following B.T.'s: Sugar, 10", N.27°E., 31 links (20.46 feet); Sugar, 10", S.18°E., 22 links (14.52 feet).


In 1909, Nathan Smith found quarter corner at 39.31 chains (2594.46 feet) from West. Set new post and said original witness' okay.

In November 1990, Al Harrison (RLS) chained from west and at 2595 feet found squared old wood post on ground. Stump holes of original B.T.'s at original bearings and distances. Old blazed line running east and west. Set aluminum monument and made new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument stamped to identify corner location.
2. Sugar, 11", N.32°E., 3.81 feet.
3. Sugar, 7", S.36°W., 10.90 feet.
4. Sugar, 11", N.54°W., 15.27 feet.
5. Steel Sign Post, Southeast, 1.22 feet.

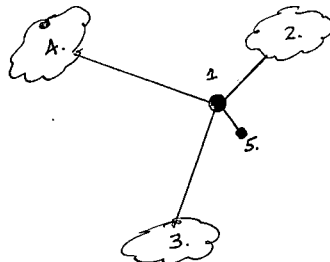

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 19th day
 of December A.D., 1990 at
8:45 o'clock A.M. and recorded
 in Vol. 1000 Restoration
 page R-7

Paul H. Hahn
 Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/30/90
Date

CERTIFICATE READY FOR FILING:

Dale S. Stacey
District Ranger

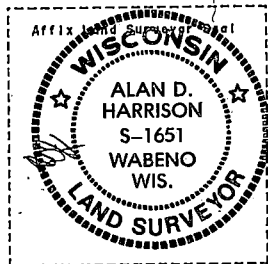


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Corner common to Sections 20, 21,
 28 & 29, T35N, R15E, 4th P.M., Forest
 County, WI.

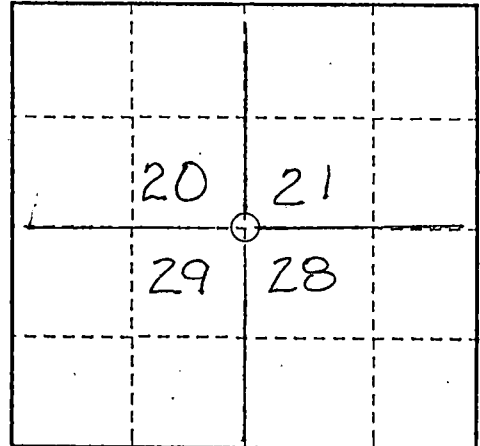

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride, Deputy Surveyor.

Set wood post at 80 chains from which he established:

Hemlock, 36" - N36°W - 41 links (27.06 feet)
 Hemlock, 20" - N31°E - 16 links (10.56 feet)
 Hemlock, 12" - S16°E - 61 links (40.26 feet)
 Hemlock, 14" - S85°W - 40 links (26.40 feet)


- In 1981, Milo Stefan, RLS 1558, found a fence corner intersection running East and North from which he found stump holes at record bearing and distance from three of the original bearing trees. He set a 2" diameter x 36" long aluminum monument with a stamped cap at the fence corner.
- In 1993, I found the 2" x 36" aluminum monument set by Stefan in good condition and established references as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Found monument noted above.

- 1- Steel Sign Post - East - 1.14 feet
- 2- Sugar, 14" - S45°E - 54.14 feet
- 3- Basswood, 11" - S85°E - 32.22 feet
- 4- Sugar, 14" - N84°W - 29.86 feet
- 5- Sugar, 16" - N23°W - 25.70 feet

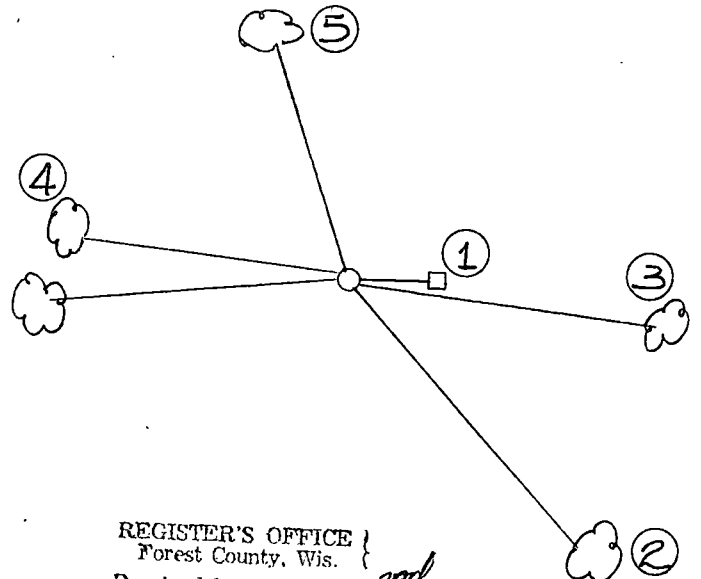

REGISTER'S OFFICE
 Forest County, Wis.
 Received for record this 2nd day
 of June A.D. 1993 at
12:00 o'clock P.M. and recorded
 in Vol. Gen. Restoration
 page R-9
David C. H. Deputy
 Register of Deeds

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) A found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) I, John R. Garske, S-1685

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John R. Garske
Signature

3/23/93
Date

CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger



155238

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required By s. A-E 5.02, WI Adm. Code)

History of original corner establishment and subsequent restorations and description of any record, monument, occupational, testimonial or other evidence considered:

1859--ORIGINAL SURVEY BY JAMES McBRIDE, SET $\frac{1}{4}$ POST.

1909--JOHN MELENDY, FOUND EVIDENCE OF ORIGINAL B.Ts., SET ELM POST WITH NEW B.Ts.

1992--ALAN HARRISON R.L.S.# S-1651 (U.S.F.S.) FOUND OLD SQUARED POST & B.T. STUMP HOLES WHICH FIT MELENDY'S TIES. HARRISON SET A $2\frac{1}{2}$ " X 36" ALUMINUM AT $\frac{1}{4}$ CORNER B.Ts AS FOLLOWS: SUG. 12° N. 34° E. 23.62FT., SUG. 10° S. 48° W. 29.38FT., SUG. 6° N. 56° W. 22.53FT., STEEL SIGN POST-S.E. 1.72 FT., RESTORATION SHEET FILED AT FOREST COUNTY.

1996-WAYNE G. DOBBRATZ R.L.S. #S-973, FOUND MONUMENT & B.Ts AS PER HARRISON'S RESTORATION.


1996- WAYNE G. DOBBRATZ CONTRACTED BY POTAWATOMI COMM. TO SET NEW WITNESS POINTS

Corner was: (Check All That Apply)

- ☐ Restored through acceptance of an obliterated evidence location
☒ Restored through acceptance of a found perpetuated location
☐ Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location)
☐ Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found)

Describe the monument and accessories used to perpetuate the location of this corner. (include a plan view drawing and indicate what was set and/or found) WITNESS

- 1 FOUND $2\frac{1}{2}$ " DIA. ALUMINUM MONUMENT AT $\frac{1}{4}$ CORNER.
- 2 DROVE A 1" X 24" IRON PIPE S. 48° W. 27.01FT.
- 3 DROVE A 1" X 24" IRON PIPE N. 56° W. 19.64FT.
- 4 DROVE A 1" X 24" IRON PIPE N. 34° E. 20.67FT.
- 5 FOUND A U.S. FOREST SERVICE METAL SIGN POST SE 1.72 ft.

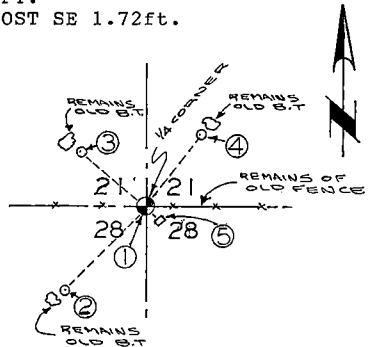


The S. $\frac{1}{4}$ CORNER

corner of Section 21,

T. 35 N., R. 15 E.,

Fourth Principal Meridian,
Marinette County, Wisconsin

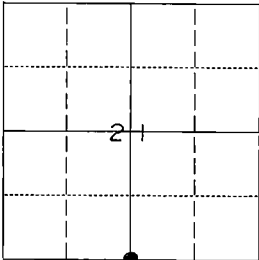


● = Location of Corner

DATA ENTRY ☒
 TRACT INDEX ☒
 RECORDING FEE ☒

REGISTER'S OFFICE
Forest County, WI

Received for record this 15th day
 of March A.D. 19 96
 at 2:00 o'clock A.M. and
 recorded in Vol. 35-15 corner
 on page 2-1 of records

Paul Little, Deputy
 REGISTER

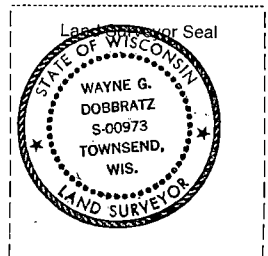

I, WAYNE G. DOBBRATZ
 (type or print name) certify that the corner location shown on this record was determined by
 me or under my direction and control and that this U.S. Public Land Survey Monument Record
 is correct and complete to the best of my knowledge and belief.

Signature

Date

3/13/96

Index No. R-11

43515210020

R-11

146368


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 • = Corner monument restored.

QUARTER CORNER COMMON TO SECTIONS 21 AND 28,
 T.35 N., R.15 E., FOREST COUNTY, WISCONSIN.

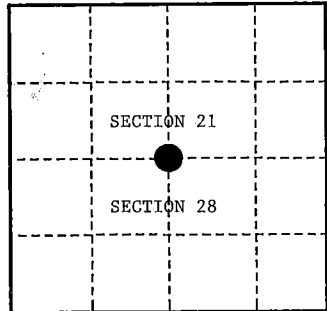

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

IN 1859 JAMES McBRIDE SET 1/4 CORNER POST AND MADE THE FOLLOWING REFERENCES:
 BIRCH 20" S.34°W. 16 LINKS (10.56'); HEMLOCK 16" N.31°E. 25 LINKS (16.50').


IN 1909 JOHN MELENDY FOUND ORIGINAL BIRCH STUB, 24", WITH MARKS PLAIN AND ORIGINAL HEMLOCK STUB WITH MARKS BURNT OFF. SET NEW ELM POST, 5"X5"X48", AND MADE NEW REFERENCES: MAPLE 20" N.86 3/4°E. 69 1/2 LINKS (45.70'); BIRCH 10" N.24 1/3°W. 62 7/8 LINKS (41.50').

IN 1992 ALAN HARRISON, R.L.S., FOUND OLD SQUARED POST IN MOUND OF ROCK. NO EVIDENCE OF ORIGINAL B.T.'S. MELENDY'S B.T.'S ARE NOW STUMP HOLES. EAST AND WEST POSITION FITS MELENDY'S MEASUREMENTS WITHIN 5'.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2 1/2" X 36" ALUMINUM MONUMENT STAMPED WITH CORNER LOCATION IDENTIFIED.
- SUGAR 12" N.34°E. 23.62 FEET
- SUGAR 10" S.48°W. 29.38 FEET
- SUGAR 6" N.56°W. 22.53 FEET
- STEEL SIGN POST S.E. 1.72 FEET

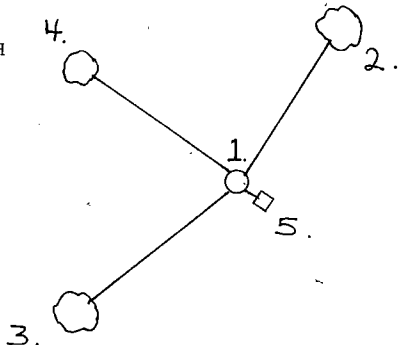

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 14th day
 of MARCH A.D., 1995 at
 10 o'clock A.M. and recorded
 in Vol. GENERAL RESTORATIONS
 page R-11

John F. Hochstetler
 Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) A FOUND PERPETUATED LOCATION

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO

(1) I, ALAN D. HARRISON

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison


Signature

3/16/93

Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards
Acting District Ranger

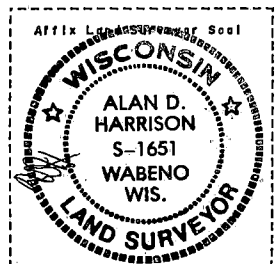

Document Number

191723

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 3rd day
of August, A.D., 2006 at
8:45 o'clock A.M. and recorded
in Vol 00000 RESTORATIONS
page 12-13

Paul A. Schaeffer
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES McBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
HEMLOCK 10" N12°W 50 LINKS
SUGAR MAPLE 10" N48°E 25 LINKS
ELM 10" S60°E 36 LINKS
HEMLOCK 12" S73°W 54 LINKS

1915 - N.H. SMITH FOUND CORNER AND BT'S OK, MADE A NEW BT: BIRCH 12" N62.5°E 80.5 LINKS.

1991 - SURVEY MONUMENT RECORD DOC #144427, ALAN HARRISON, SURVEYOR, S-1651, FOUND AN OLD FENCE LINE GOING WEST FROM THE INTERSECTION OF COUNTY HIGHWAY "H" AND KUFNER ROAD WITH NO ORIGINAL OR SUBSEQUENT EVIDENCE. SET RAILROAD SPIKE AT INTERSECTION OF ROADS AND FENCE LINE WHICH FITS WELL WITH N.H. SMITH'S SURVEY OF SECTION 27 AND IS ACCEPTED AS THE CORNER POSITION.

SET THE FOLLOWING WITNESSES:
ELM 8" N50°E 61.81 FEET
SUGAR MAPLE 7" S37°E 77.00 FEET
YELLOW BIRCH 6" S27°E 75.65 FEET
STEEL SIGN POST WEST 35.63 FEET
WITNESS CORNER, 2.5" x 36" WEST 35.10 FEET

2005 - WISDOT PLANS 9334-02-00 SHOWS FOUND RAILROAD SPIKE.

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED, IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2006 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND RAILROAD SPIKE IN CENTERLINE OF BIT.

WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:


3.5" MONUMENT CAP IN CONCRETE N39°W 70.48 FEET
3.5" MONUMENT CAP IN CONCRETE N48°E 64.49 FEET
3.5" MONUMENT CAP IN CONCRETE S39°E 73.87 FEET
3.5" MONUMENT CAP IN CONCRETE S67°W 45.56 FEET

THE NORTHEAST


CORNER OF SECTION 28

T. 35 N., R. 15 E.,

FOREST COUNTY, WISCONSIN

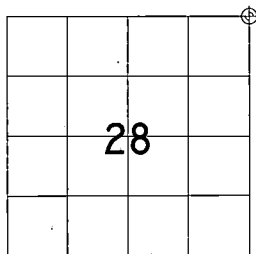

⊕ = LOCATION OF CORNER

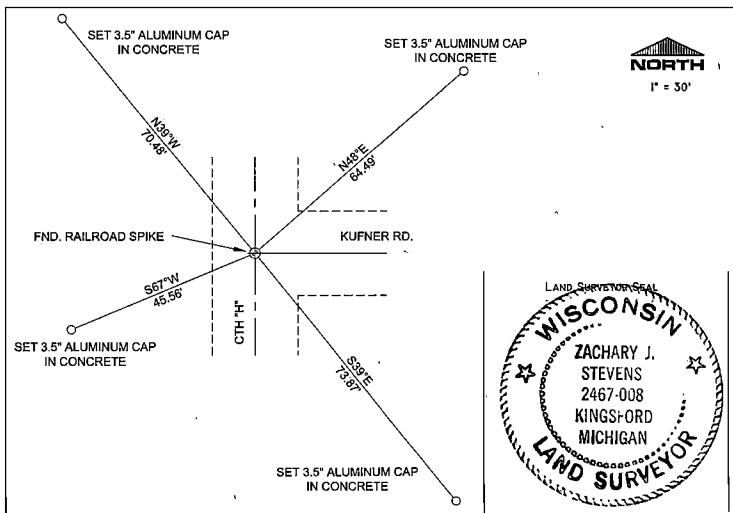

I, ZACHARY J. STEVENS R.L.S. S-2467-008

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

Zachary J. Stevens 7/31/06
SIGNATURE DATE

INDEX No. R-13

43515210000

R-13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section corner to Sections 21, 22, 27 and 28,
 T.35N., R.15E., Forest County, Wisconsin.

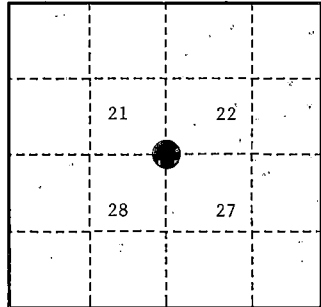

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Hemlock, 16", N.12°W., 50 links; Sugar, 10", N.48°E., 25 links; Elm, 10", S.60°E., 38 links; Hemlock, 12", S.73°W., 54 links.


In 1915, N.H. Smith found corner and BTs OK, made a new BT: Birch, 12", N.62½°E., 80½ links.

In 1991, Alan Harrison (RLS) found an old fence line going west from the intersection of county highway "H" and Kufner Road with no original or subsequent evidence. Set corner position at intersection of roads and fence line which fits well with N.H. Smith's survey of section 27 and is accepted as the corner position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- Railroad spike in centerline county highway "H" marking the corner location.
- Elm, 8", N.50°E., 61.81 feet
- Sugar, 7", S.37°E., 77.00 feet
- Yellow Birch, 6", S.27°E., 75.65 feet
- Witness Corner 2½"x 36", West, 35.10 feet
- Steel Sign Post, West, 35.63 feet.

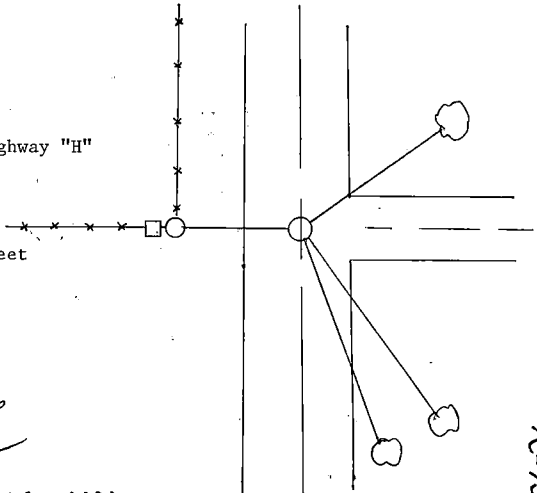

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 15th day
 of May A.D., 1992 at

11:32 o'clock A.M. and recorded
 in Vol. 1000 Registrations

page R-13

Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No


(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 4/9/92
Signature Date

CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger

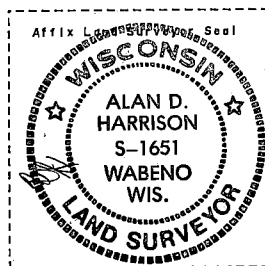


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 22 and 27, T.35N., R.15E.

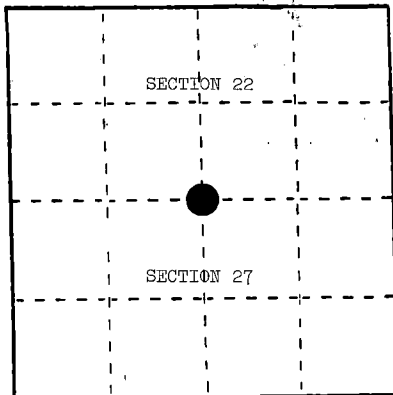

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of October, A.D., 1986, at
1:35 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 8-15

Paul Aschenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Sugar, 12", N.26°E., 19 links; Sugar, 10", S.17°E., 14 links.


In 1965, Jean Resvick found a 4" x 4" scribed post 30" above ground 50 links north of road centerline. Noted that post had been there for 30 or more years. At a point 66 feet south, a post point was found. He found that the road had had witness posts on each side at 50 links for several miles and the road was supposed to be on the line. He placed a 2" x 30" galvanized iron pipe 8" below the surface of the road and replaced point of post on south side of road with a 2" x 60" galvanized iron pipe and replaced post on north side of road with a 2" x 30" galvanized iron pipe.

In 1986, Lee Scheuerman found the corner as per Resvick and made references to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" galvanized iron pipe 8" below the surface of the road marking the corner location.
- Red Pine, 10", S.67°E., 76.92 feet
- Red Pine, 8", S.04°E., 36.32 feet
- Red Pine, 8", S.17°W., 39.09 feet
- 2" x 60" galvanized iron pipe, Witness Corner, South, 33 feet
- Steel Sign Post, 6', South, 33.3 feet

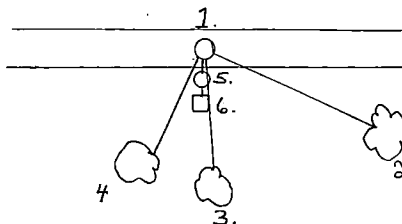

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

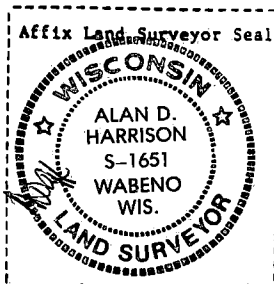


90410

R9-5680-5 (7/15/64)

H. C. MILLER CO., MILWAUKEE 448643

REGISTER'S OFFICE
FOREST COUNTY, WIS.

CERTIFIED LAND CORNER RESTORATION

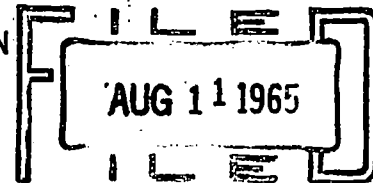

State of Wisconsin

County of Forest

ss.

At 9 o'clock A.M.
Anna Peterson Register of Deeds

I, Jean F. Resvick, do hereby certify that on the 10th day of June, 1965, I found evidence of the North quarter corner of Section 27 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 ch. West corrected between Sections 22 and 27.
Set wood post from which
Sugar, 12 in. diam., bears N26°E, 19 lks.
Sugar, 10 in. diam., bears S17°E, 14 lks.




Description of corner evidence found:

Forest Road Number 2139 runs East and West.
4 x 4 post, 30 in. above ground, scribed 50LN, 33 ft. North of center line of road.
3/4 in. iron pipe, 30 inches above ground along side of 4 x 4.
33 ft. South of center line of road found point of post.
The original B.T.'s would have been removed by road construction. The corners East have all been referenced by a post 33 ft. on each side of road. I accept the road as being the section line and the posts found as the best available evidence of the corner position, the post having been in place 30 years or more.


Description of monument and accessories I established to perpetuate the original location of this corner:

At a point on line between the two posts and 33 ft. from each, I set a 2 in. inside diam., galvanized iron pipe, 30 ins. long, and 8 ins. below the surface of the road for the quarter corner between sections 22 and 27. I then replaced the point of post found on the South side of the road with a 2 in. inside diam., galvanized iron pipe, 5 ft. long, flanged at bottom, filled with concrete, 18 ins. above ground with brass cap marked:

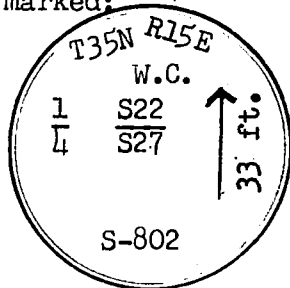

from which the following blazed and scribed new bearing trees bear:
Red pine 5 ins. diam., S49°E, 4.65 ft. or 7.04 lks.
Red pine 5 ins. diam., S65°W, 11.12 ft. or 16.84 lks.

I replaced the post found on the North side of road with a 2 ins. inside diam., galvanized iron pipe, 30 ins. long, 8 ins. above ground. The 3/4 in. iron pipe being left in place.

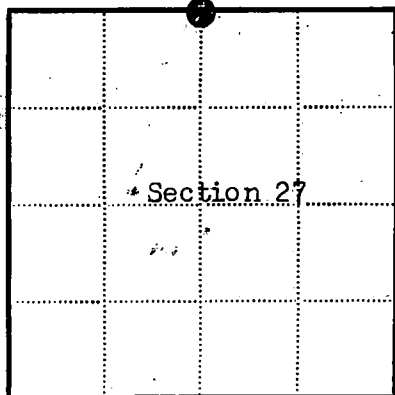

● = Corner monument restored

□ =

Resident witnesses

Dated at Rhinelander Wisconsin, this 9th day of Aug. 1965.

Signature *Jean F. Resvick* Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

Office of _____ County of _____

I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____, and was filed in Book No. _____ Page No. _____ of County Records.

Signature _____ Title _____

Township 35 North, Range 15 East, Section 27, Index No. R-15, Page No. _____

4351522 0020

Document Number

189306

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 18th day
of November, D., 2005 at
3:55 o'clock P. M. and recorded
in Vol. Corner Restoration
page B-17

Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR. 80.0 CHAINS NORTH BETWEEN SECTIONS 26 & 27, SET POST.

SET THE FOLLOWING WITNESSES:
BIRCH 10" N48°W 7 LINKS
HEMLOCK 14" N17°E 30 LINKS
SUGAR MAPLE 12" S32°E 43 LINKS
SUGAR MAPLE 16" S32°W 82 LINKS

1965 - JEAN RESVICK, SURVEYOR. S-802. FOREST ROAD NUMBER 2139 RUNS EAST AND WEST. AT 33 FEET NORTH OF ROAD FOUND SCRIBED POST. SCRIBED 50 LN. ALONG SIDE OF POST FOUND 3/4" DIAMETER IRON PIPE, 30" ABOVE GROUND. SCRIBED POST 33 FEET SOUTH OF ROAD. SCRIBED 50 LS. FOREST SERVICE POSTER ON NORTH SIDE OF ROAD, DATE 6-10-36. FROM A POINT ON LINE AND 33 FEET FROM EACH WITNESS POST, MAPLE STUMP BEARS S32°W, 54.1 FEET. ALL OTHER BEARING TREES WOULD FALL IN ROAD.

AT THE POINT IN LINE AND 33 FEET FROM EACH WITNESS POST RESVICK SET A 2" INSIDE DIAMETER GALVANIZED IRON PIPE, 30" LONG 8" BELOW THE SURFACE OF THE ROAD. RESVICK REPLACED THE SOUTH WITNESS POST WITH A 2" INSIDE DIAMETER GALVANIZED IRON PIPE, 30" LONG 8" ABOVE GROUND. RESVICK REPLACED THE NORTH WITNESS POST WITH A 2" INSIDE DIAMETER GALVANIZED IRON PIPE, 5' LONG, FLANGED AT BOTTOM, FILLED WITH CONCRETE, 18" ABOVE GROUND WITH BRASS CAP.

SET THE FOLLOWING WITNESSES:
WHITE ASH 4" N28°E 13.18 FEET, 19.96 LINKS
SUGAR MAPLE 7" S71°E 16.10 FEET, 24.39 LINKS
ELM 8" S41°W 16.77 FEET, 23.69 LINKS

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE.

FOUND THE FOLLOWING WITNESSES:


W.C. MONUMENT N00°E 33.00 FEET
(STEEL SIGN POST 1" NE, CAP STAMPED S-802 1965)

SET THE FOLLOWING WITNESSES:


MAPLE 7" N41°W 45.07 FEET - SET NAIL IN TREE.
MAPLE 9" N25°W 55.00 FEET - SET NAIL IN TREE.
IRONWOOD 5" N07°E 45.27 FEET - SET NAIL IN TREE.
SUGAR MAPLE 12" N29°E 32.25 FEET - SET NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTHWEST
CORNER OF SECTION 23
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

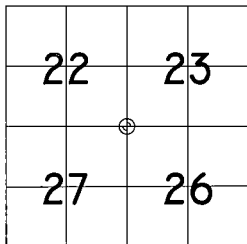

⊕ = LOCATION OF CORNER

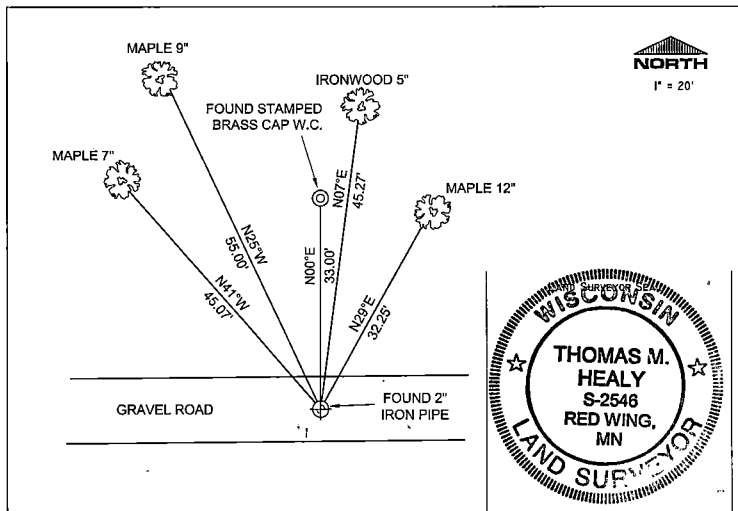

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

INDEX No. R-17

4351522 0000

R-17

DOCUMENT NUMBER 131259


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 22, 23, 26, and 27,
T.35N., R.15E.

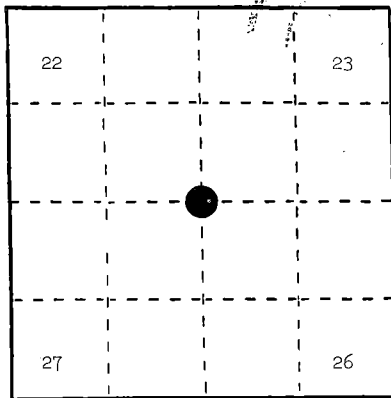

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 9th day
of October, A.D., 1986 at
1:35 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS

R-17
Paul Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Birch, 10", N.48°W., 7 links; Hemlock, 14", N.17°E., 30 links; Sugar, 12", S.32°E., 43 links; Sugar, 16", S.32°W., 82 links.


In 1965, Jean Resvick found a scribed post 33 feet north of centerline of road 30" above ground with a 3/4" iron pipe alongside post. Found a scribed post 33' south of centerline of road (lying down). Also found a Maple stump at S.32°W., 54.1 feet. Placed a 2" x 30" galvanized iron pipe 8" below the surface of the road to mark the corner. Replaced the north witness post with a 2" x 60" galvanized iron pipe and replaced the south witness post with a 2" x 30" galvanized iron pipe.

In 1986, Lee Scheuerman found the corner as per Resvick and made references to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" galvanized iron pipe 8" below the surface of the road marking the corner location.
- 2" x 60" galvanized iron pipe, Witness Corner, North, 33.0 feet
- Sugar, 5", S.43°E., 86.46 feet
- 2" x 30" galvanized iron pipe, Witness Corner, South, 33.0 feet
- Sugar, 4", N.44°W., 41.91 feet
- Steel Sign Post, South, 33 feet

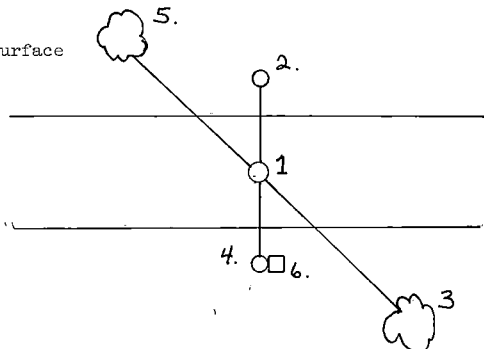

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

9/11/86
Date

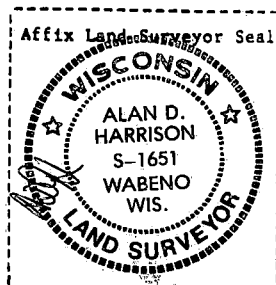


90411

REGISTER'S OFFICE
FOREST COUNTY, WIS.

R9-5680-5 (7/15/64)

H. C. MILLER CO., MILWAUKEE 448643

CERTIFIED LAND CORNER RESTORATION

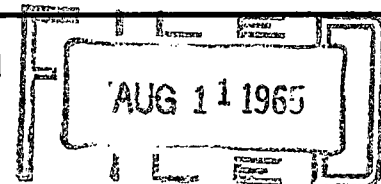


Ann Peterson Register of Deeds

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 10th day of June, 1965, I found evidence of the northeast corner of Section 27 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1959 by James McBride
80.0 ch. North between Sections 26 & 27
Set post
Birch 10 ins., N48°W., 7 lks.
Hemlock 14 ins., N17°E., 30 lks.
Sugar 12 ins., S32°E., 43 lks.
Sugar 16 ins., S32°W., 82 lks.

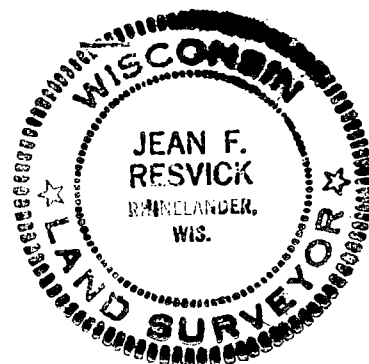


Description of corner evidence found:

Forest Road Number 2139 runs east and west. At 33 ft. north of road found scribed post, scribed 50 LN, along side of post found 3/4 in. diam. iron pipe, 30 ins. above ground. Scribed post 33 ft. south of road, scribed 50 LS. Forest Service poster on north side of road date 6/10/36. From a point on line and 33 feet from each witness post, maple stump bears S32°W., 54.1 ft. All other bearing trees would fall in road.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the point in line and 33 ft. from each witness post I set a 2 in. inside diam. galvanized iron pipe, 30 ins. long, 8 ins. below the surface of the road. I replaced the south witness post with a 2 ins. inside diam., galvanized pipe, 30 ins. long, 6 ins. above the ground. I replaced the north witness post with a 2 ins. inside diam., galvanized iron pipe, 5 feet long, flanged at bottom, filled with concrete, 18 ins. above ground with brass cap marked:

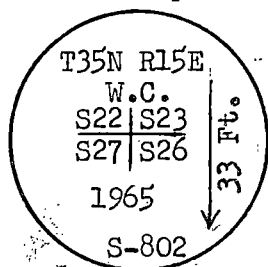

from which the following new blazed and scribed bearing trees bear.

White ash 4 ins., N28°E., 13.18 ft. or 19.96 lks.
Sugar 7 ins., S71°E., 16.10 ft. or 24.39 lks.
Elm 8 ins., S41°W., 15.77 ft. or 23.89 lks.

3/4 in. iron pipe placed along side of monument.

Resident witnesses

Dated at Rhineland Wisconsin, this 9th day of Aug. 1965.

Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

Office of _____ County of _____
I hereby certify that the within instrument was filed in this office for record on the _____ day of _____ 19_____, and was filed in Book No. _____ Page No. _____ of County Records.

Signature _____ Title _____

Township 35 North, Range 15 East, Section 27, Index No. R-17, Page No. _____

4351522 0000

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 18th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page B-19

Kay Swanson Deputy
Register of Deeds

Document Number

189305

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:

BIRCH 18" S03°W 22 LINKS, (14.52 FEET)
HEMLOCK 16" N49°E 19 LINKS, (12.54 FEET)

1909 - J. MELENDY, FOUND WOOD POST, ORIGINAL BIRCH BT AND HEMLOCK STUMP. SET A 4" X 4" X 48" WOOD POST AND MADE AN "X" ON A 4" X 4" X 2' ABOVE GROUND ROCK, N35°W, 75.25 LINKS, (49.67 FEET).

SET THE FOLLOWING WITNESSES:

MAPLE 10" N51-3/4°E 27.5 LINKS, 18.15 FEET

1965 - J. RESVICK, SURVEYOR, S-802, FOUND AN IRON ROD IN A MOUND OF ROCKS REPLACING WITNESS POST SCRIBED 50 LINKS WITH FOREST TAG ON IT, AND 50 LINKS SOUTH OF ROAD FOUND A WOOD POST SCRIBED 50 LINKS.

1990 - ALAN HARRISON, SURVEYOR, S-1851, FOUND MELENDY'S "X" ON ROCK. MOVED RESVICK'S CORNER WHICH IS NO LONGER ACCEPTABLE. ADDED TWO NEW BT'S AND MOVED THE TWO WITNESS CORNERS.

FOUND THE FOLLOWING WITNESSES:

MELENDY'S ROCK N35°W 49.67 FEET

SET THE FOLLOWING WITNESSES:

SUGAR MAPLE 4" S02°E 30.75 FEET
SUGAR MAPLE 10" N76°W 32.72 FEET
WIT. MON. SOUTH 33 FEET
WIT. MON. NORTH 33 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND "X" CHISELED ON 6" DIA. ROCK

FOUND THE FOLLOWING WITNESSES:

SUGAR MAPLE 12" N74°45'56"W 32.90' FEET
WIT. MON. S01°51'59"W 32.79' FEET
WIT. MON. N01°15'01"E 32.87' FEET

SET THE FOLLOWING WITNESSES:

MAPLE 9" S41°43'13"W 46.42 FEET


ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTH 1/4


CORNER OF SECTION 23

T. 35 N., R. 15 E.,

FOREST COUNTY, WISCONSIN

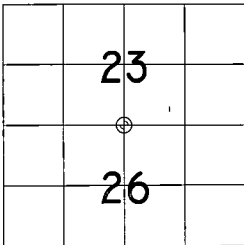

⊕ = LOCATION OF CORNER

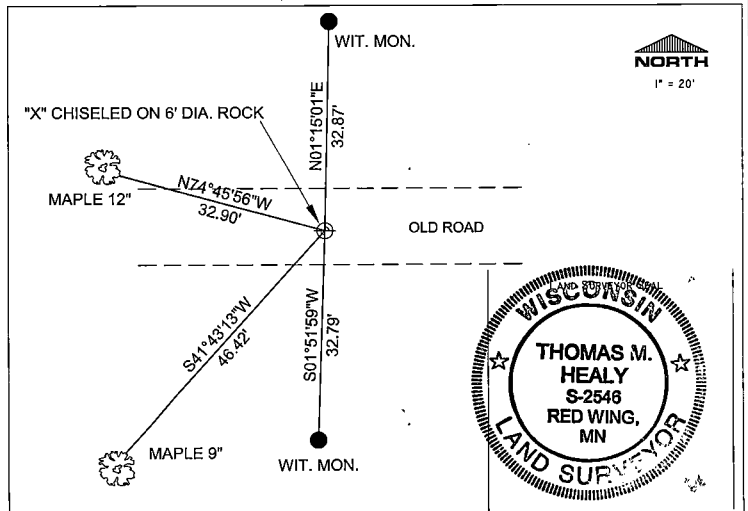

I, THOMAS M. HEALY R.L.S. 2546

CITY OR PRINT MANICERTIFY THAT THIS CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. R-19

Th M. Healy 11-17-05
SIGNATURE DATE

4351323 0020

R-19

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 23rd day of June, 19 65, I found evidence of the North quarter corner of Section 26 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1859 by James McBride

40.00 chains West corrected between Sections 23 and 26 Set wood post.

Birch 18", S.3°W., 22 lks.

Hemlock 16", N.49°E., 19 lks.



Description of corner evidence found:

Iron bar in mound of rock replacing witness post scribed 50 IN, with Forest Service poster on post dated 1935. Point of post found along side of bar. 66 feet South of iron bar and 33 feet south of road found post scribed 50 LS.

Corner and bearing trees would fall in East West road.

The two witness posts found and the East West road is accepted as being references to the original corner.

Description of monument and accessories I established to perpetuate the original location of this corner:

From the two witness posts found, I set a 2 in. inside diam., galvanized, iron pipe, 30 inches long and 6 ins. below the surface of the road and 33 ft. from each witness post, for the quarter corner between Sec. 23 and 26. From which the following blazed and scribed bearing trees bear.


Elm 4", N.31°E., 28.78 ft. or 43.61 lks.

Y. Birch 3", S.28°E., 27.86 ft. or 42.21 lks.

Sugar 5", N.45°W., 18.88 ft. or 28.61 lks.

I replaced North witness post with 2 in. inside diam., galvanized iron pipe, 30 ins. long, 6 ins. above ground and 33 feet north of quarter corner in road.
I replaced south witness post with 2 in. inside diam., galvanized iron pipe, 5 feet long, filled with concrete, flanged at bottom, 18 ins. above ground, and 33 ft. south of quarter corner in road, with brass cap marked:

T35N R15E
W.C.
1/4 S23
1/4 S26
1965
S-802
33 ft. North

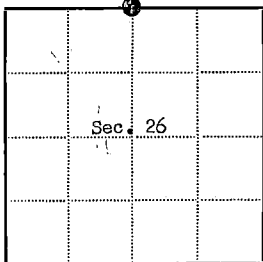

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 3rd day of Sept. 19 65

Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

30970

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 17 day of December, 19 65, and was filed in Book No. 1 Page No. of County Records at 4:00 P.M.

Signature Anna Peterson Title Register of Deeds

Township 35 North, Range 15 East, Section 26, Index No. R-19, Page No.

140456


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter Corner to Sections 23-26, T.35N.,
R.15E., Forest County, Wisconsin.

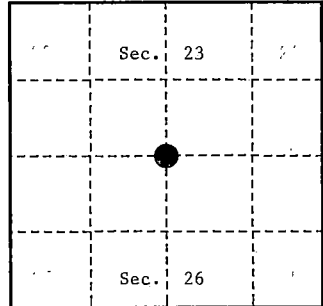

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following B.T.'s: Birch, 18", S.03°W., 22 links (14.52 feet); Hemlock, 16", N.49°E., 19 links (12.54 feet).

In 1909, J. Melendy found wood post, original Birch B.T. and Hemlock stump. Set 4" x 4" x 48" wood post and made an "X" on a 4' x 4' x 2' above ground rock, N.35°W., 75.25 links (49.665 feet); new B.T.'s: Maple, 10", N.51 3/4°E., 27.5 links (18.15 feet).


In 1965, J. Resvick, R.L.S., found an iron rod in mound of rocks replacing witness post scribed 50 links with Forest tag on it, and 50 links South of road found a wood post scribed 50 links.

In 1990, Alan Harrison, R.L.S., found Melendy's "X" on rock. Moved Resvick's corner which is no longer acceptable. Added 2 new B.T.'s and moved the two witness corners.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- "X" chiselled on a 6 foot diameter rock.
- Sugar, 4", S.02°E., 30.75 feet.
- Sugar, 10", N.76°W., 32.72 feet.
- Melendy's rock, N.35°W., 49.67 feet.
- Witness Monument, 2 1/2" x 36", South, 33 feet.
- Witness Monument, 2 1/2" x 36", North, 33 feet.

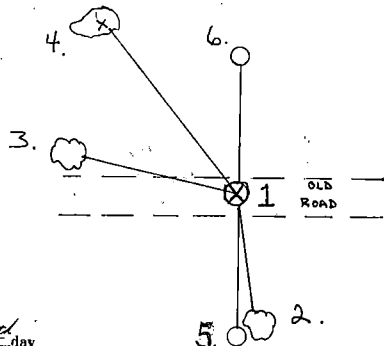

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 19th day
of September, A.D., 1990 at
3:15 o'clock P.M. and recorded
in Vol. 121 RESTORATIONS
page 312

Paul H. Schaeffer
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Previous monument location of Resvick's bears S.75°W., 19.06 feet from new location.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 9/18/90
Signature Date

CERTIFICATE READY FOR FILING:

Dale O. Staeger
District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to Sections 23 and 26, T.35N., R.15E.

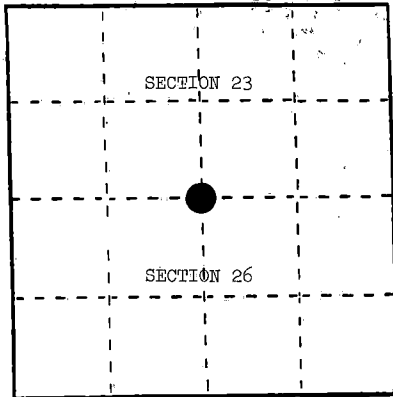

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of October, A.D., 1986, at
1:25 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS

page R-19

Paul A. Schuchman
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following ETs: Birch, 16", S.03°W., 22 links; Hemlock, 16", N.49°E., 19 links.


In 1965, Jean Resvick found an iron bar in mound of rock replacing witness post 33 feet north of centerline of road and a scribed post 33 feet south of centerline of road. He placed a 2" x 30" galvanized iron pipe 6" below surface of road in centerline and made the following references to it: Elm, 4", N.31°E., 28.78 feet; Yellow Birch, 3", S.28°E., 27.86 feet; Sugar, 5", N.45°W., 18.88 feet; 2" x 30" galvanized iron pipe, north, 33.0 feet; 2" x 60" galvanized iron pipe, south, 33.0 feet.

In 1986, Lee Scheuerman found the corner as per Resvick and made new references to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" galvanized iron pipe 6" below surface of road, in centerline, marking the corner location.
2. 2" x 30" galvanized iron pipe, Witness Corner, North, 33.0 feet
3. Sugar, 6", N.13°E., 46.47 feet
4. Sugar, 3", S.35°E., 33.07 feet
5. 2" x 60" galvanized iron pipe, Witness Corner, South, 33.0 feet
6. Sugar, 8", N.42°W., 19.05 feet
7. Steel Sign Post, South, 33.7 feet

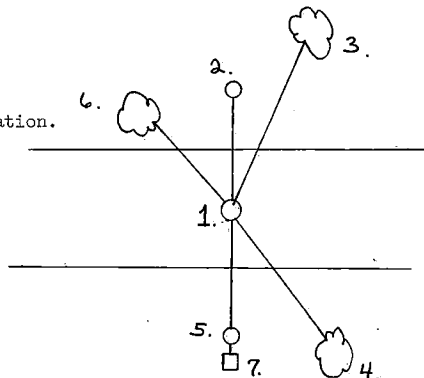

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

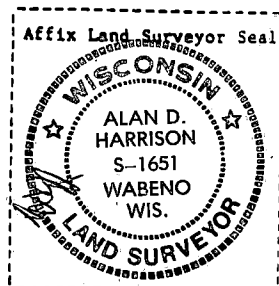

Alan D. Harrison
Signature

9/11/86
Date

DOCUMENT NUMBER **131257**


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements, (a) through (i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Section corner to Sections 23, 24, 25, and 26,
 T.35N., R.15E.

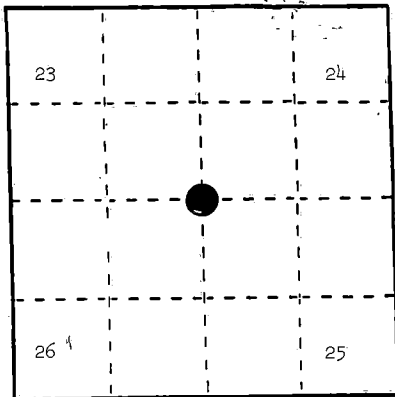

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 27 day
 of October, A.D. 1986 at
1:25 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS

page R-21

Paul H. Schenck
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Hemlock, 8", N.17°W., 26 links; Hemlock, 30", N.52°E., 57 links; Hemlock, 10", S.37°E., 40 links; Elm, 12", S.77°W., 40 links.


In 1965, Jean Resvick found a witness post 33 feet north of centerline of road and a witness post 33 feet south of centerline of road. Also found an 18" scribed Sugar BT stump, S.25°E., 31.0 feet. He placed a 2" x 30" galvanized iron pipe 6" below surface of road in centerline and replaced witness post 33 feet south with a 2" x 30" galvanized iron pipe and replaced witness post 33 feet north with a 2" x 60" galvanized iron pipe.

In 1986, Lee Scheuerman found the corner as per Resvick and made references to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" galvanized iron pipe 6" below surface of road, in centerline, marking the corner location.
2. 2" x 60" galvanized iron pipe, Witness Corner, North, 33.0 feet
3. 2" x 30" galvanized iron pipe, Witness Corner, South, 33.0 feet
4. Sugar, 12", S.47°W., 44.83 feet
5. Sugar, 12", N.07°W., 43.82 feet
6. Steel Sign Post, South, 33.0 feet

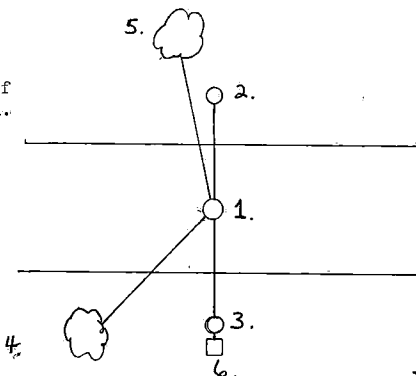

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

9/11/86
Date

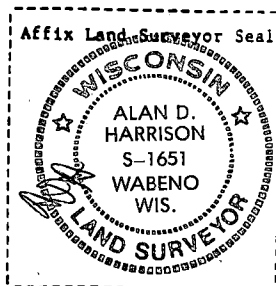


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 25 and 26, T.35N., R.15E.

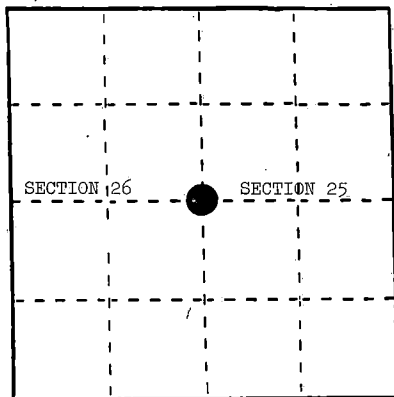

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 14th day

of March, A.D., 1982, at 10:30 o'clock A.M. and recorded in Vol. CORNER RESTORATIONS

page 1-2
 Paul Archendinger
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set quarter post and made the following BTs: Ironwood, 8", S.57°E., 8 links; Sugar, 16", S.86°W., 6 links.

In the 1930s, E. Cloutier found rotted, scribed Maple stake and made new Elm stake.

In 1985, H. Neider found rock pile with blazed trees facing it. Blazed line running east. Also, Alan Harrison found remains of Elm post next to rock pile with location poster attached. Distances through center of Section 25 fit well with 1930s' survey.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 2" x 36" aluminum monument stamped to identify the corner location.
 - Sugar, 6", N.40°E., 31.75 feet
 - Sugar, 10", S.9°E., 9.25 feet
 - Sugar, 8", N.34°W., 13.79 feet
 - Steel Sign Post, Southwest, 1.89 feet

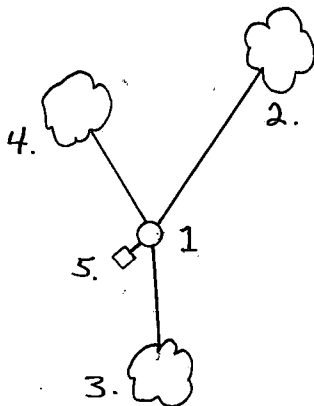

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

2/18/86
Date

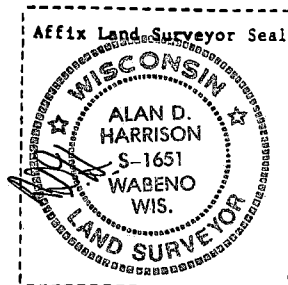

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 23rd day of June, 1965, I found evidence of the Northwest Section corner of Section 25 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
80.00 chains north between Sec. 25 and 26 set wood post
Hemlock 8", N.17°W., 26 lks.
Hemlock 30", N.52°E., 57 lks.
Hemlock 10", S.37°E., 40 lks.
Elm 12", S.77°W., 40 lks.

Description of corner evidence found:

Witness post found 33 ft. north of road scribed 50 LN, with F.S. poster on
Witness post found 33 ft. south of road
From point in East West road 33 ft. from each witness post a
Sugar stump, scribed B.T. bears S.25°E. 31.0 ft. approx. 18 in. diam. when alive.

Description of monument and accessories I established to perpetuate the original location of this corner:


At the point for the section corner as located from the witness posts set 2 ins. inside diam. galvanized iron pipe, 30 ins. long, 6 ins. below surface of road. Replace the south witness post with 2 in. inside diam., galvanized iron pipe, 30 ins. long, 6 ins. above ground from which the corner is 33 ft. north. Replaced the north witness post with a 2 in. inside diam., galvanized iron pipe, 5 ft. long, filled with concrete, flanged at bottom, 18 ins. above ground, with brass cap marked:

T35N R15E
W.C.
S23 | S24
S26 | S25
1965
S-802

from which the following blazed and scribed bearing trees bear

yellow birch 7", N.53°W., 12.50 ft. or 18.94 lks.

yellow birch 4", N 80°E., 6.58 ft. or 9.97 lks.

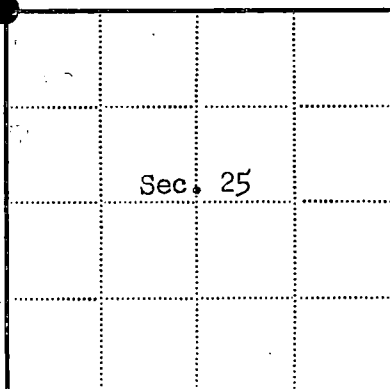

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland Wisconsin, this 3rd day of Sept. 1965.Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)Surveyors Registration No. S-802

90971

Office of Register of Deeds County of ForestI hereby certify that the within instrument was filed in this office for record on the 17 day of December 1965, and was filed in Book No. 1 Page No. _____ of County Records. 4 PMSignature Anna Peterson Title Register of DeedsTownship 35 North, Range 15 East, Section 25, Index No. R-21, Page No. _____

43515230000


R21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Quarter corner to Sections 24 and 25, T.35N., R.15E.

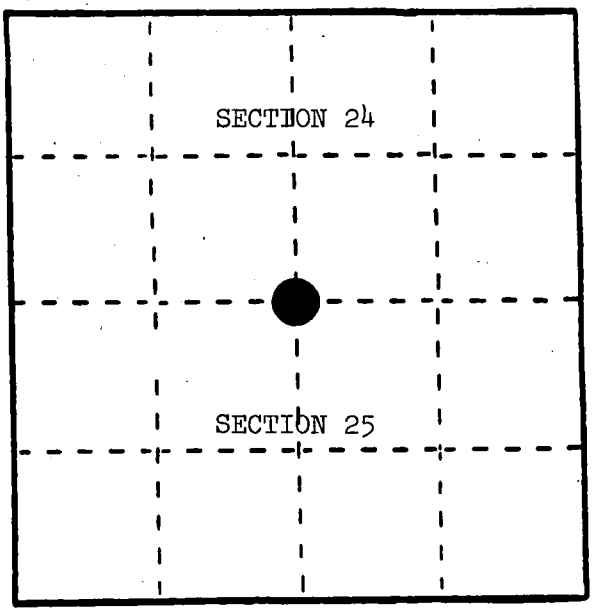

REGISTER'S OFFICE /
Forest County, Wis.
Received for record this 14th day
of March A.D. 1986 at
10:25 o'clock A.M. and recorded
in Vol CORNER RESTORATIONS
page R-23
Paul A. Schreiber
Register of Deeds


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, at 39.75 chains James McBride set wood post and made the following BTs: Hemlock, 12", N.17°W., 8 links; Hemlock, 8", N.17°E., 12 links.

In 1984, Milo Stefan found decayed 5" x 5" post and post point in mound of rock. Also, found location poster on Spruce just south of post and location poster on west side of Indian Market Road, 50 feet east of corner. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
1. 2" x 30" aluminum monument stamped to identify corner location.
 2. White Spruce, 12", S.83°E., 27.88 feet
 3. White Spruce, 4", S.10°E., 9.05 feet
 4. White Spruce, 10", N.79°W., 11.24 feet
 5. Steel Sign Post, North, 2.10 feet

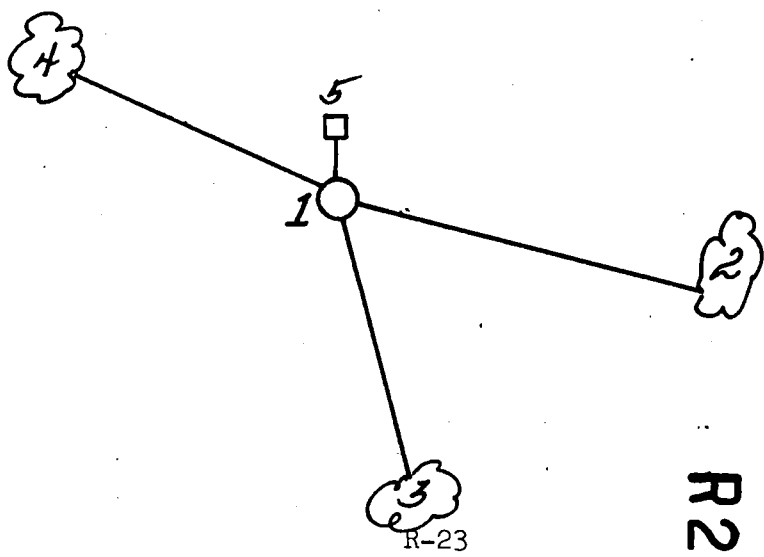

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal



- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 29 and 30, T.35N., R.15E.

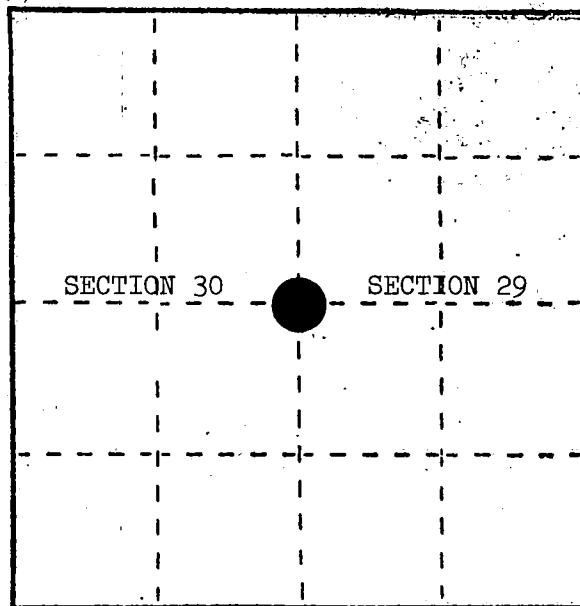

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set $\frac{1}{4}$ section post with the following BTs: Linn, 14", N.67°E., 19 links; Elm, 16", S.84°W., 57 links.


In 1909, Smith found original stumps with iron marks. Made the following new BTs: Sugar, 6", S.66 $\frac{1}{2}$ °E., 9 links; Hemlock, 10", N.57°E., 27 links.

August 31, 1984, USDA-FS, found a Forest County brass cap 2' above ground, set by S-887 (T. Arnott). Found Smith's BTs: Sugar (alive), 22", S.66°E., 5.94' and decayed Hemlock stump, N.57°E., 17.82'. Found stump holes at N.67°E., 12.54' and at S.84°W., 37.62' for original BTs. Old fence line north and west.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Sugar, 14", N.15°E., 15.30'
2. Sugar, 10", S.46°E., 30.97'
3. Sugar, 18", S.7°W., 48.59'
4. Steel Sign Post, 7', North, 2.3'
5. Forest County cap stamped to identify the corner.

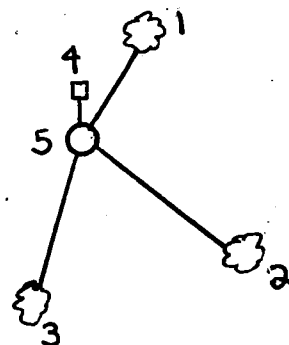

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 21st day

January A.D., 1985

at 11:00 o'clock A. M. and

recorded in Vol. CORNER RESTORATIONS

on page T-5
Paul Aschenbrenner
REGISTER

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/24/94
Date

Affix Land Surveyor Seal




State of Wisconsin }
County of Forest } ss.

I, Thomas R. Arnoitt, do hereby
certify that on the 26 th day
of September, 19 77, I found
evidence of the 1/4
corner of sections 29 & 30
Township 35, North, Range
15 E, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

Clifford Krauel

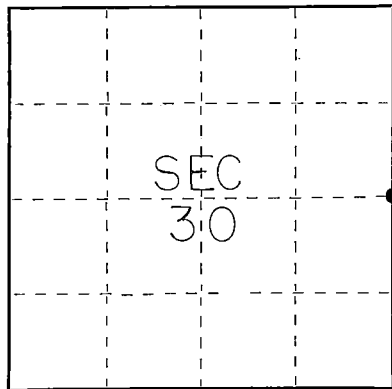

○ = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. I-5

History of original corner establishment:

Original survey by James McBride 10 June - 15 June, 1859

Lind 14 N67E 19 lks.
Elm 16 S84W 57 lks.

Description of corner evidence found:


Found old wood post at fence corner

Description of monument and accessories I established to perpetuate the original location of this corner.

Set 5' long 2" steel pipe with brass cap.

Ties:

Maple 14 N22E 15.53 feet
Maple 12 S46E 30.97 feet

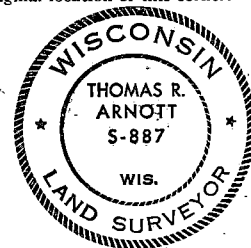

Dated at Crandon, Wis., this 3rd day of November, 19 77.

Signature Thomas R. Arnoitt Title Surveyor Registration No. S-887
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 3rd day of November, 19 77.
at 11 o'clock A. M.

Eugene Stetson Doc. No. 112704
(Register of Deeds)

By _____ Deputy

43515302000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 26th day of April, 1983, I found evidence of the West Quarter corner of Section 28 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set wood post
Hemlock, 12", N17°E, 16 lks., 10.56 feet
Birch, 12", S12°W, 12 lks., 7.92 feet

Surveyed in 1908 by Nathan Smith
Smith found both original BTs and set two new BTs:
Hemlock, 8", N25°50'W, 64½ lks., 42.57 feet
Hemlock, 20", S85½W, 77 lks., 50.82 feet

Description of corner evidence found:


No original evidence found

Local Evidence: Fence line north and west
Centerline of County Trunk "H" east and south

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument in mound of stone at intersection of road centerline and fence lines, with tablet stamped as follows:
T35N, R15E, ¼, S29, S28, 1983, RLS-1558
From which the following bear:
Red Pine, 12", N54°E, 87.54 feet
White Spruce, 8", N16°E, 57.75 feet
Power Pole #3515-29E1, N41°W, 45.61 feet
Steel Sign Post, SE, 1.60 feet

DOCUMENT NO.
124195

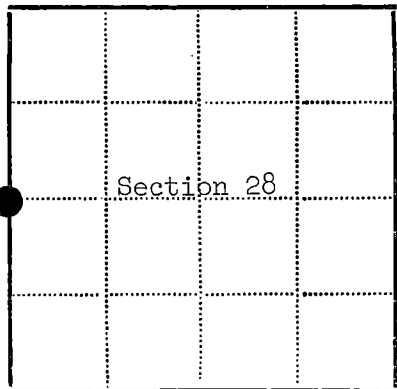

● - Corner monument restored
□ -

Resident witnesses

Dated at Rhinelander Wisconsin, this day of 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of September 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene Statyng Title Register of Deeds


Township 35 North, Range 15 East, Section 28, Index No. T-9, Page No. 48

43515292000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. T-9

QUARTER _____ Corner to Section 29 28 T 35 N, R 15 E
(Section/Quarter)

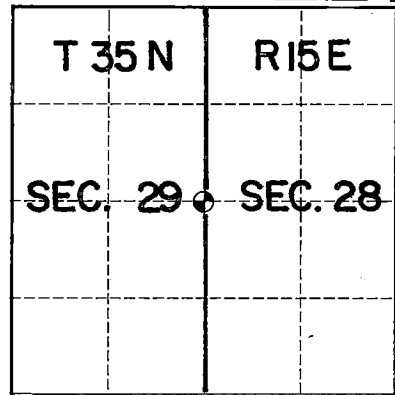

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



CORNER CONSISTS OF 2" ALUMINUM MONUMENT SET IN MOUND OF STONE WITH TIES AS SHOWN BEARINGS ARE MAGNETIC. STEEL SIGN POST BEARS SE, 1.60 FT.

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 300 day of JANUARY, A.D. 1992, at 9:30 o'clock A.M. and recorded in Vol. Chas. E. Richardson

PAGE T-9
Paul H. Richardson
Register of Deeds

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

SURVEYED IN 1859 BY JAMES MCBRIDE WHO SET A WOOD POST AT 40.00 CHAINS


HEMLOCK 12", N 17E, 16 LINKS
BIRCH 12", S 12W, 12 LINKS

SURVEYED IN 1908 BY NATHAN SMITH WHO SET TWO NEW HEMLOCK BTs

RESURVEYED IN 1983 BY MILO STEFAN, RLS WHO SET A 2" ALUMINUM MONUMENTS AT THE CORNER POSITION FROM OCCUPATION EVIDENCE FOUND.

RESURVEYED IN 1991 BY KIM PRITZLAFF WHO FOUND MILO STEFAN'S MONUMENT AND SET ONE ADDITIONAL TIE FOR STATUTORY FULFILLMENT.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

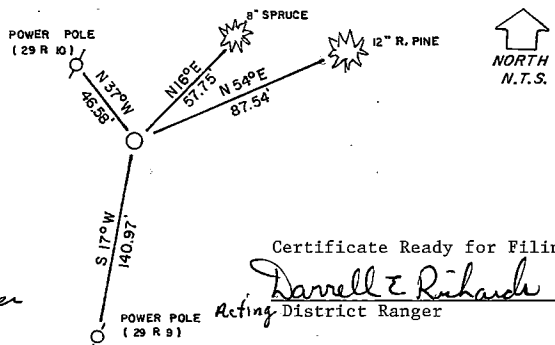

I, KIM H PRITZLAFF, RLS 1991
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1991
Date

Certificate Ready for Filing:

Darrell E. Richardson
Acting District Ranger

DOCUMENT NUMBER
143535

43515 29 2000

Document Number

191724

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 31 day

of August A.D., 2006 at

2:45 o'clock P.M. and recorded

in Vol. CORNER RESTORATION

Page T-13

Paul H. Schaeffer

Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 10" WEST 20 LINKS
HEMLOCK 8" N64°E 16 LINKS

1983 - CERTIFIED LAND CORNER RESTORATION DOC #124188. MILO E. STEFAN, SURVEYOR, S-1558, FOUND LOCAL EVIDENCE: PINE (STUMP), S47°E, 46 FEET FROM FACE TO 1" IRON PIPE SET JUST BELOW SURFACE IN SOUTH RUT OF DRIVE TO HUNTING SHACK. THIS PINE STUMP WAS MARKED BY N.A. SMITH ON NOVEMBER 8, 1910; ALSO, FOUND LOCATION POSTER ATTACHED TO 3" CEDAR POST ON NORTH EDGE OF DRIVEWAY. PLACED A 2" X 36" ALUMINUM MONUMENT WITH TABLET STAMPED AS FOLLOWS:
T35N, R15E, S28, 1/4, S27, 1983, RLS-1558, 1983, RLS-1558

SET THE FOLLOWING WITNESSES:
BASSWOOD 5" N34°E 59.31 FEET
WHITE SPRUCE 14" S62°E 129.62 FEET
P. POLE #35-15, 28R2 S82°W 28.48 FEET
STEEL SIGN POST SOUTH 4.40 FEET

2006 - WISDOT PLANS 9334-02-00 SHOWS A FOUND ALUMINUM MONUMENT.

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST-CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2006 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND 1.5" O.D. PIPE DOWN 1.5".
FOUND 1.5" PIPE APPEARS TO BE PREVIOUSLY SET ALUMINUM MONUMENT w/TABLET MISSING. PULLED CLOTH TAPE TO BASSWOOD & WHITE SPRUCE TO VERIFY POSITION.


WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:

3.5" MONUMENT CAP IN CONCRETE N38°W 101.59 FEET
3.5" MONUMENT CAP IN CONCRETE N38°E 55.24 FEET
3.5" MONUMENT CAP IN CONCRETE S01°W 28.67 FEET
3.5" MONUMENT CAP IN CONCRETE S62°W 45.07 FEET

THE EAST 1/4
CORNER OF SECTION 28
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

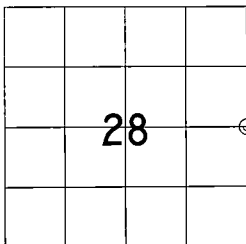

⊕ = LOCATION OF CORNER

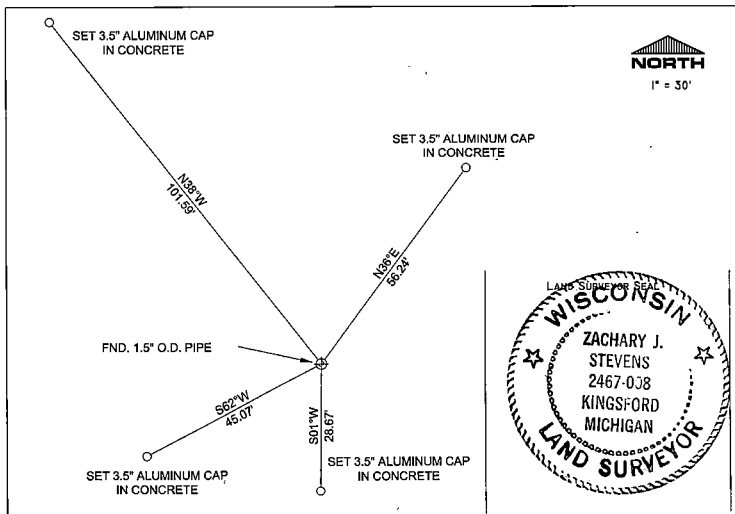

I, ZACHARY J. STEVENS, R.L.S. S-2467-008

(TYPE OR PRINT HANDCERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

INDEX No. T-13

Zachary J. Stevens 7/31/06
SIGNATURE DATE

43519 2820 00

T-13

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 11th day of August, 1983, I found evidence of the West Quarter corner of Section 27 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set wood post
Sugar, 10", West, 20 links
Hemlock, 8", N.64°E., 16 links

Description of corner evidence found:

No original evidence found

Local Evidence: Pine (stump), S.47°E., 46 feet from face to 1" iron pipe set just below surface in south rut of drive to hunting shack. This Pine stump was marked by N. A. Smith on November 8, 1910; also, found location poster attached to 3" Cedar post on north edge of driveway.

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument with tablet stamped as follows:

T35N, R15E, S28, 1/4, S27, 1983, RLS-1558, 1983, RLS-1558


From which the following bear:

Basswood, 5", N.34°E., 59.31 feet
White Spruce, 14", S.62°E., 129.82 feet
Power Pole #35-15, 28R2, S.82°W., 28.48 feet
Steel Sign Post, South, 4.40 feet



DOCUMENT NO.

124188

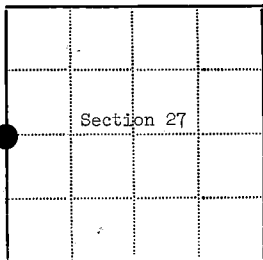

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 11th day of August, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 12th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene D. Stegman Title Register of Deeds

Township 35 North, Range 15 East, Section 27, Index No. T-13, Page No. B-7, P-65

43515 28 2000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.


Quarter Corner to Sections 26 and 27,
 T35N, R15E.

REGISTER'S OFFICE

Forest County, Wis.

Received for record this 20th day
 of November A.D., 19 90 at
1:00 o'clock P.M. and recorded
 in Vol. Corner Restorations
 page 7-17

Register of Deeds

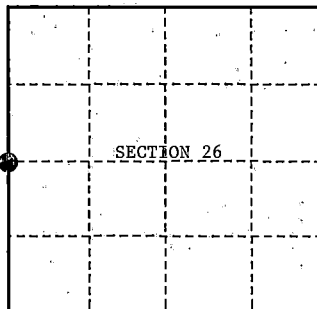

- (b) Describe the direct evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 corner was established by James McBride. He set a wood post with two BTs:
 Birch, 16", S.82°W., 30 Links Birch, 14", N.70°E., 28 Links

1900 - 1910 W. S. Harris made a new BT, a Sugar, 26", S.87°W., 54 1/2 Links.
 Melindy and Owen Smith used this corner to establish 1/16 Corners, North, South, East and West.


In 1936 Rifleman states on an 874 from Forest Service records that he saw corner (an Aspen stake) and placed a location poster on a Maple snag, 10", N.72°E., 10 Links.

On 5/21/1990 Milo E. Stefan found group of stone with large, very decayed Maple stump remains, S.87°E., 10 Links. We also found the tag placed by Rifleman at base of a stump hole, N.72°E., 10 Links from the group of stones. From the evidence we were able to restore the corner to it's original location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2" x 36" aluminum monument in mound of stone with tablet stamped to identify corner.
- 2) Sugar Maple, 20", N.23°E., 164.55'
- 3) W. Spruce, 6", S.19°W., 13.09'
- 4) W. Spruce, 11", N.66°W., 28.42'
- 5) W. Spruce, 8", N.86°E., 24.70'
- 6) Steel Sign Post, 6", Northeast 1.5'

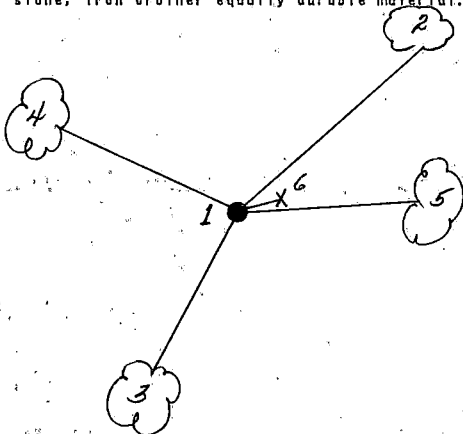

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

July 16, 1990

Date

CERTIFICATE READY FOR FILING:

District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 25 and 30, T.35N., R.15-16E.

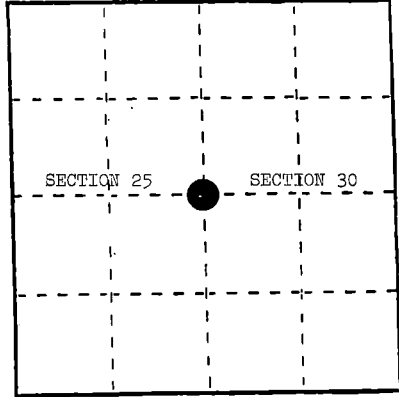

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 17th day
 of March A.D., 1986 at
10:40 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 85
Paul Achenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Yellow Birch, 10", N.52°W., 34 links; Fir, 10", S.67°E., 21 links.


In the 1930s, Everett Cloutier found 4" x 4" x 36" new Cedar post.

April 8, 1985, Alan Harrison set proportionate position--it falls in an old logging road. Searched area and found a Cedar post with location tag buried in road edge. Believe post was disturbed by road building. Continued search and found post hole with Cedar remains. At N.52°W., 22.44 feet, found stump depression. There was no evidence at S.67°E., 13.9 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. W. Ash, 9", N.69°E., 50.33 feet
3. B. Cherry, 10", S.35°E., 46.22 feet
4. W. Ash, 6", N.32°W., 49.28 feet
5. Steel Sign Post, North, 1.25 feet

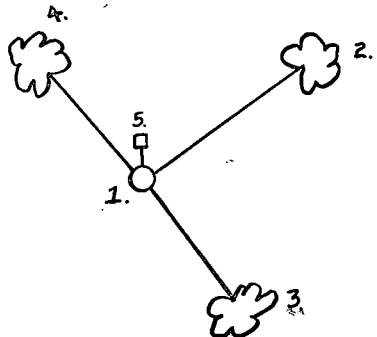

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 1/3/86
Signature Date

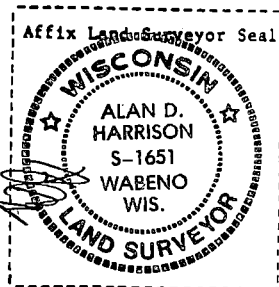

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 30 and 31, T.35N., R.15E.

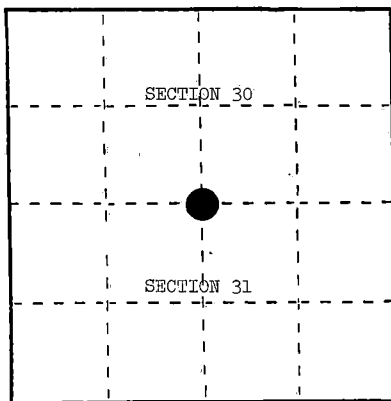

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post 42.10 chains with the following BTs: Birch, 8", S.48°E., 18 links; Sugar, 14", N.12°E., 25 links.


In 1909, N. H. Smith found post and made new BT: Sugar, 6", S.29°W., 13.86'

August 30, 1984, Belliveau found old Elm post point 3" below surface, next to fence corner post—old fences run south and west. Rock pile around corner post and post point. No trace of original BTs or Smith's 6" Sugar were found.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. White Ash, 18", S.24°E., 16.52'
3. Sugar, 16", S.72°W., 39.97'
4. White Ash, 14", N.17°W., 35.01'
5. Steel Sign Post, West, 2.1'

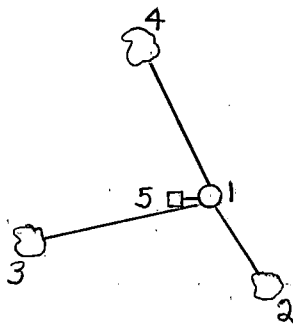

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this... 21st ... day

of... January ... A.D., 1985

at... 11:00 ... o'clock... M. and

recorded in Vol. CORNER RESTORATIONS

on page 1-3
Paul Aschenbrenner
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated corner.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal



(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Milo E. Stefan
Signature

12/24/84
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. U.V-5

MEANDER Corner to Section 29 30 T 35 N, R 15 E
(Section/Quarter)

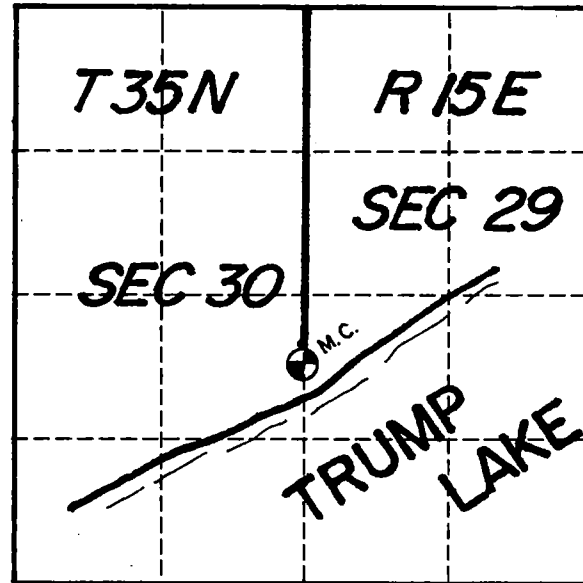

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

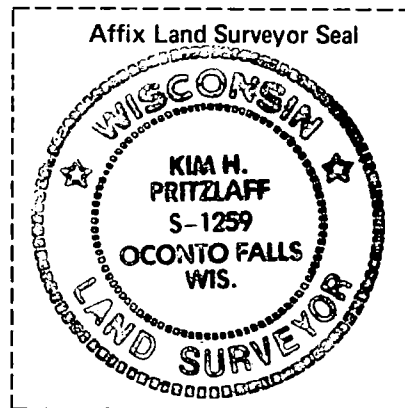

THE 1" SOLID IRON WAS REPLACED WITH A 2" DIAMETER, 36" LONG ALUMINUM MONUMENT WITH STAMPED CAP. BEARINGS SHOWN ARE MAGNETIC.

Certificate Ready for Filing:

Darrell E. Richards
Acting District Ranger

I, KIM H PRITZLAFF, RLS 1991

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1991
Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.


SURVEYED IN 1857 BY ARTEMAS CURTIS WHO SET A WOOD POST AT THE MEANDER CORNER 15.15 CHAINS OVER LAKE WITH THE FOLLOWING BTs:
HEMLOCK 12", WEST, 17 LINKS
BIRCH 7", S 63E, 4 LINKS

SURVEYED IN 1911 BY NATHAN SMITH FOR SUBDIVISIONS IN SECTIONS 29 & 30, FOUND MC AND PERPETUATED CORNER. MARKED NEW HEMLOCK, 14", S 47 30'W, 62-1/3 LINKS.

MC PERPETUATED BY LOCAL SURVEYORS THROUGH THE YEARS TO A 1" SOLID IRON ROD.

SURVEYED IN 1991 BY KIM PRITZLAFF WHO RECOVERED 1" SOLID IRON ROD. THE IRON ROD FIT LOT DIMENSIONS OF THE CONNORS AND SHAUERS PLATS. SMITH'S BT'S WERE DESTROYED BY LAKE SHORE MAINTENANCE. SMITH'S S 1/8 CORNER WAS PERPTUATED BY A HEMLOCK BT. FOUND WITHIN THENTHS OF A FOOT FROM HIS RECORDED DISTANCE OF 4.92 CHAINS NORTH OF THE MC. LINE BETWEEN THE IRON ROD, SMITH'S S 1/8 CORNER, AND THE QUARTER CORNER FELL COINCIDENT AND DISTANCES WERE REMARKABLY CLOSE TO THE RECORD 25.22 CHAINS.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

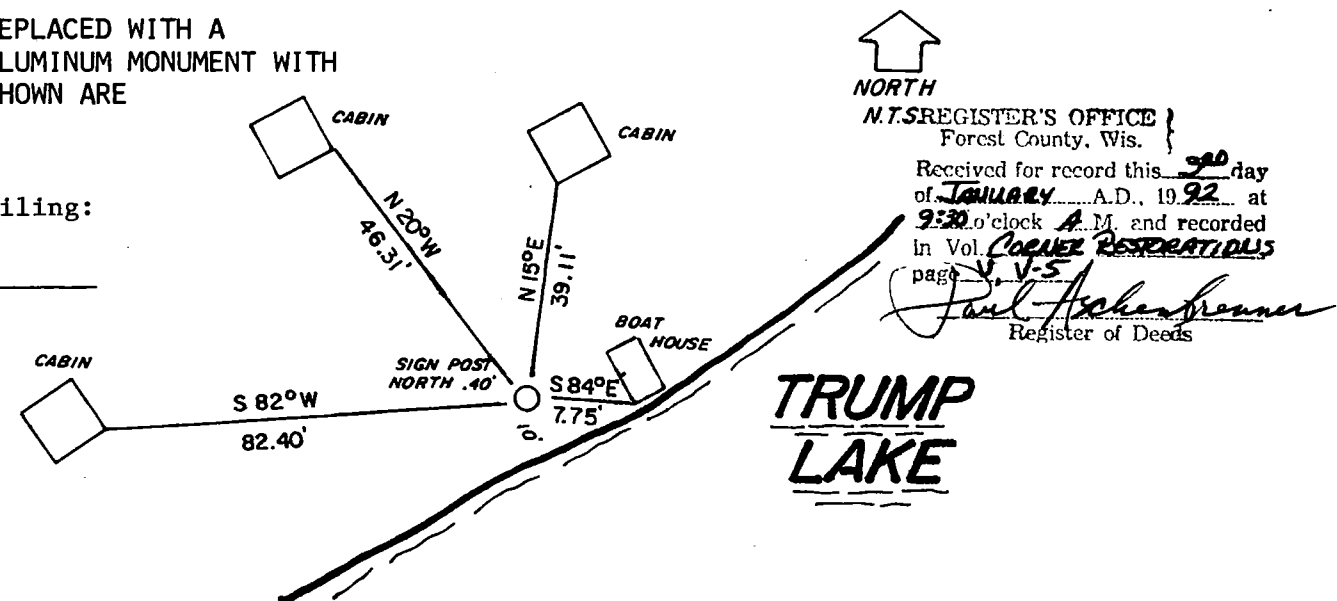

NORTH
N.T.S. REGISTER'S OFFICE
Forest County, Wis.

Received for record this 20 day
of JANUARY A.D., 1992 at
9:30 o'clock A.M. and recorded
in Vol. COOPER RESTORATION
page V.V-5

Paul Fischer
Register of Deeds

DOCUMENT NUMBER
143533


43515301920

V, W-5

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. V, W-5

MEANDER Corner to Section 31 30 T35 N, R15 E
(Section/Quarter)

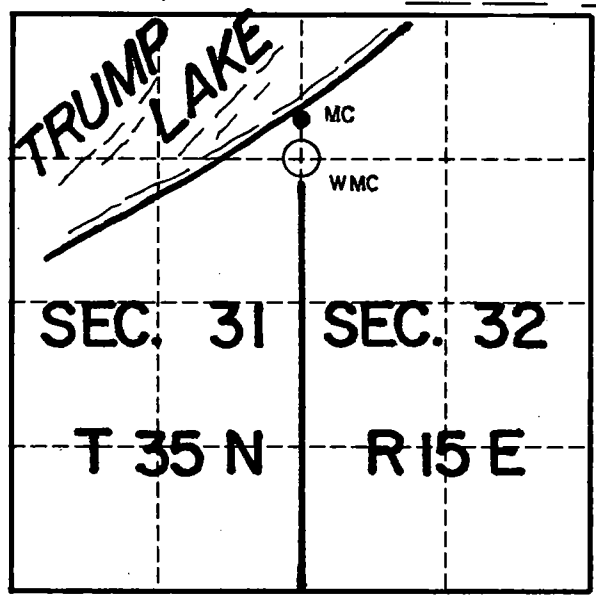

Show distances and bearings if set by proportional measurement.

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

SURVEYED IN 1857 BY ARTEMAS CURTIS WHO SET A WOOD POST AT 57.62 CHAINS WITH THE FOLLOWING BEARING TREES:
WHITE PINE , 18" , S86E, 83 LINKS
BIRCH , 10" , S34W, 41 LINKS

SURVEYED IN 1911 AND 1905 BY NATHAN SMITH WHO RESTORED THIS CORNER WITH A NEW STAKE AND PLATTED OUT THE PLAT OF LONG BEACH SUMMER RESORT.


In 1991 KIM PRITZLAFF FOUND A 1 1/2" IRON PIPE AT THIS CORNER LOCATION WHICH IRON PIPE MONUMENTS ON SMITH'S LONG BEACH SUMMER RESORT PLAT FIT MARKING THE INDIVIDUAL LOTS. PLATS TO THE SOUTH OF SMITH'S ALSO FIT THIS PIPE LOCATION. BEARING TREE EVIDENCE WAS DESTROYED BY LAKE LOT IMPROVEMENTS. I ACCEPTED THE IRON PIPE AS SMITH'S CORNER PERPETUATION AND MONUMENTED A WITNESS TO THIS MEANDER CORNER FIVE FEET SOUTH.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

○ = Corner monument restored.



THE MEANDER CORNER CONSISTS OF A 1 1/2" IRON PIPE WITH A 2" DIAMETER BY 36" LONG ALUMINUM MONUMENT SET FIVE FEET SOUTH ON THE SECTION LINE AS A WITNESS MEANDER CORNER. BEARINGS ARE MAGNETIC.

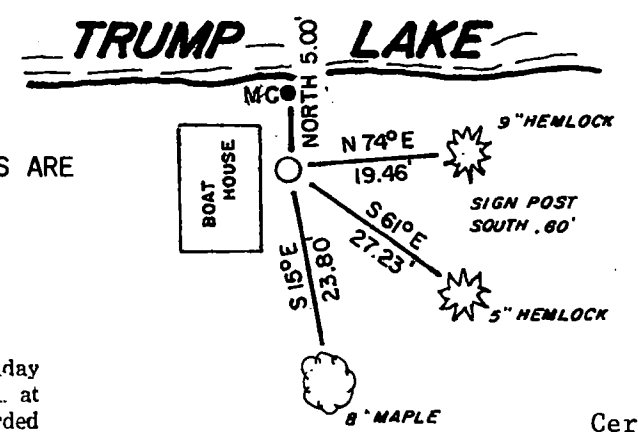

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 320 day
of JANUARY A.D. 1992 at
9:30 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page V, W-5
Paul H. Schramm
Register of Deeds

I, KIM H PRITZLAFF, RLS 1991
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

Date

Certificate Ready for Filing:
Darrell E. Rubardt
Acting District Ranger

DOCUMENT NUMBER


143534

43515343024

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. V-4.5

MEANDER Corner to Section 30 31 35 N, R15 E
(Section/Quarter)

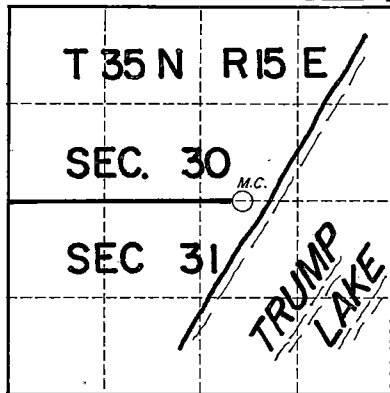

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



I, KIM H. PRITZLAFF, RLS 1991
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H. Pritzlaff
Signature

1991 Acting
Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

SURVEYED IN 1857 BY ARTEMAS CURTIS WHO SET A WOOD POST AT 70.50 CHAINS ON HIS EAST CORRECTED LINE FOR THE MEANDER CORNER
HEMLOCK, 24", N24E, 18 LINKS
HEMLOCK, 10", S50W, 20 LINKS


SURVEYED IN 1911 BY NATHAN SMITH WHO SET A NEW STAKE FROM THE ORIGINAL BTs AND MARKED A BIRCH, 16", S 64½E, 8½ LINKS. LATER ON SMITH SURVEYED THE SCHAUER'S PLAT AND SET CONCRETE MONUMENTS ON THE SOUTH LINE OF LOT 1 WITNESSING THE SECTION LINE AND THE MEANDER CORNER.

IN 1977, THOMAS ARNOTT FOUND A 2" IRON PIPE AND REPLACED IT WITH A FOREST COUNTY MONUMENT NEAR THIS CORNER POSITION. CERTIFICATE ON FILE IN THE FOREST COUNTY COURTHOUSE.

IN 1991, KIM PRITZLAFF FOUND THOMAS ARNOTT'S FOREST COUNTY MONUMENT. ORIGINAL BT EVIDENCE WAS GONE, BUT FOUND NATHAN SMITH'S CONCRETE MONUMENTS AT HIS RECORD DISTANCES FROM THE FOREST COUNTY MONUMENT SET BY ARNOTT. I ACCEPTED THE FOREST COUNTY MONUMENT THROUGH SMITH'S PERPETUATION EVIDENCE AND ADDED THE FOLLOWING TIES.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

CORNER CONSISTS OF A 2" ALUMINUM FOREST COUNTY MONUMENT PROTRUDING 30" ABOVE GROUND #,
BEARINGS ARE MAGNETIC.

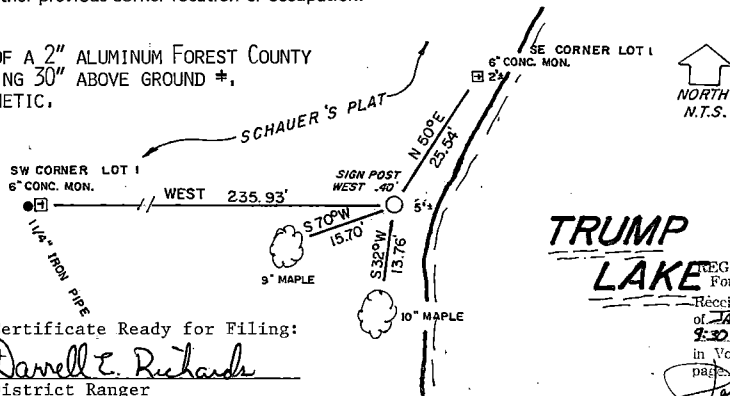

Certificate Ready for Filing:

Darrell E. Richards
District Ranger

TRUMP LAKE

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 3RD day of JANUARY A.D. 19 92 at 9:32 o'clock A.M. and recorded in Vol. 698 RESTORATIONS page V-4.5
Paul A. Schaeffer
Register of Deeds

DOCUMENT NUMBER
143531

435153020106


CERTIFIED LAND CORNER RESTORATION

Index No. **V-55**

State of Wisconsin }
County of **Forest** } ss.

I, **Thomas R. Arnott**, do hereby certify that on the **18** th day of **October**, 19**77**, I found evidence of the **M.C.** corner of **sections 30 & 31** Township **35** North, Range **15 E**, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

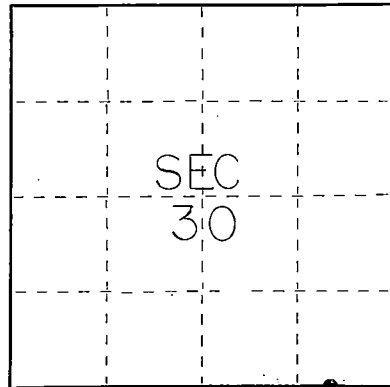

○ = Corner monument restored.

History of original corner establishment:

Original Survey by **James McBride** 10 June - 15 June, 1859

Hemlock	2 1/4	N21E	18 lks.
Hemlock	10	S50W	20 lks.

Description of corner evidence found:

2" iron pipe found



Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced iron pipe with Forest County Aluminum monument.

Ties:

Maple	5	N46E	22.71 feet (lawn tree, no BT blaze)
Maple	6	S22W	8.17 feet (lawn tree, no BT blaze)
Balsam	8	N70W	8.45 feet (lawn tree, no BT blaze)

Dated at **Grandon**, Wis., this **3rd** day of **November**, 19**77**.

Signature **Thomas R. Arnott** Title **Surveyor** Registration No. **S-887**
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of **Forest**, I hereby certify that the within instrument was filed in this office for record on the **3rd** day of **November**, 19**77** at **11** o'clock **A.** M.

Eugene Staszny Doc. No. **112703**
(Register of Deeds)


By _____ Deputy

FORM 953 H. C. MILLER CO., MILWAUKEE


4351530 000016

DOCUMENT NUMBER
143532

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

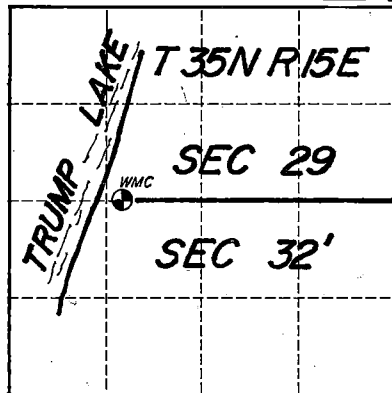INDEX NO. V-5,6MEANDER Corner to Section 29 30 T 35 N R 15 E
(Section/Quarter)Show distances and bearings if set by
proportional measurement.

○ = Corner monument restored.

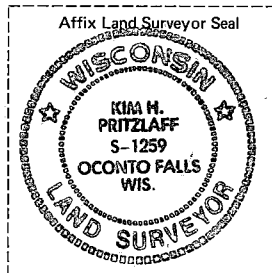


THE MEANDER CORNER FELL IN A WOOD DOCK. I SET A WITNESS TO THE MEANDER CORNER BEING A 2" DIAMETER X 36" LONG ALUMINUM MONUMENT 8.00 FEET EAST ON THE SECTION LINE FLUSH WITH THE GROUND AND LYING JUST WEST OF A SMALL STONE RETAINING WALL. BEARINGS ARE MAGNETIC.

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

SURVEYED IN 1857 BY ARTEMAS CURTIS WHO SET A WOOD STAKE AT 72.93 CHAINS.
HEMLOCK 18", N20E, 19 LINKS
HEMLOCK 18", S22E, 7 LINKS

SURVEYED IN 1906 BY NATHAN SMITH WHO FOUND THE ORIGINAL BTs AND RESTORED THE CORNER WITH MONUMENTATION OF THE LONG BEACH SUMMER RESORT PLAT. THE CONNORS PLAT IN SECTION 29 WAS ALSO TIED INTO THIS MEANDER CORNER WITH LOTS 1-16 OF BLOCK 4.

IN 1991 KIM PRITZLAFF LOCATED IRON PIPE MONUMENTATION OF BOTH THE CONNORS PLAT AND THE LONG BEACH SUMMER RESORT PLAT. LOT LINE OCCUPATION COUPLED WITH MONUMENTS FOUND AT THE SOUTH QUARTER AND WEST SIXTEENTH CORNERS OF THE COMMON SECTION LINE PROVIDED THE LOCATION FOR THIS MEANDER CORNER. THE DISTANCE RECORDED ON THE CONNORS PLAT OF 818 FEET BETWEEN THE MEANDER CORNER AND SOUTH QUARTER CORNER OF SECTION 29 FIT WITHIN AHALF OF A FOOT BEING MEASURED AT 818.40 FT. BETWEEN THE TWO CORNER POSITIONS. USING THE SECTION LINE AS MONUMENTED FROM THE PLATS AND LOCAL LOT CORNER EVIDENCE, I RESET THE MEANDER CORNER AT RECORDED DISTANCES. In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

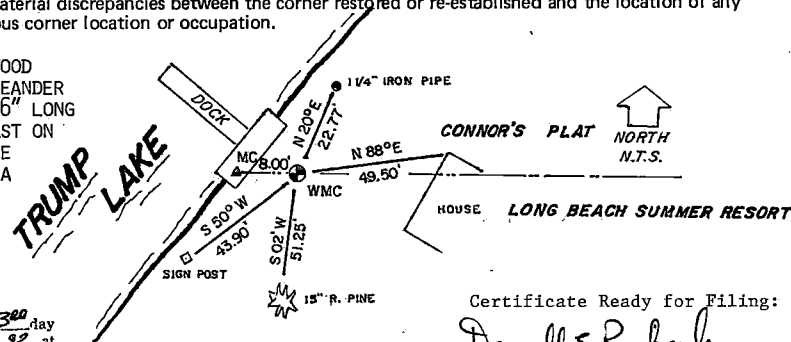I, KIM H PRITZLAFF, RLS 1991

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1991
Date

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 300 day
at JANUARY A.D., 19 92 at
2:30 o'clock A.M. and recorded
in Vol. 155 page 155

Samuel Schenck
Register of Deeds

Certificate Ready for Filing:

Acting Danell E. Richards
District Ranger

43515292029

Document Number

189319

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 18th day
of November A.D., 2005, at
2:55 o'clock P.M., and recorded
in Vol. Corner Restoration
page V-7

Kay Swanson Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:

SUGAR 10" S41°W 22 LINKS
BIRCH 18" N57°E 82 LINKS

1908 - N.H. SMITH MADE NEW BT'S

SET THE FOLLOWING WITNESSES:

YELLOW BIRCH 10" N48°W 119 LINKS
YELLOW BIRCH 28" S72°W 145 LINKS

1934 - J.W. WHITE FOUND IRON STAKE 14" ABOVE GROUND, METAL LOCATION TAG ON FENCE CORNER POST.

1977 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND A 2" IRON PIPE AND A 1" IRON ROD. REPLACED IRON PIPE WITH A FOREST COUNTY ALUMINUM MONUMENT

SET THE FOLLOWING WITNESSES:

MAPLE 8" S17°E 30.04 FEET
MAPLE 6" N81°W 58.29 FEET

1984 - R. BELLVEJA, FOUND FOREST COUNTY BRASS CAP 18" ABOVE GROUND IN MOUND OF STONE, METAL LOCATION POSTER ON OLD FENCE POST, FENCE LINES RUN NORTH AND EAST, ORIGINAL BT STUMP HOLE, S41°W, 22 LINKS, SMITH'S BT'S: STUMP HOLE N48°W, 119 LINKS; STUMP HOLE, S72°W, 145 LINKS.

SET THE FOLLOWING WITNESSES:

SUGAR MAPLE 10" S01°W 30.12 FEET
YELLOW BIRCH 8" S86°W 59.23 FEET
IRONWOOD 6" N14°W 23.68 FEET
STEEL SIGN POST EAST 1.10 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND FOREST COUNTY BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


SUGAR MAPLE 13" SOUTH 30.26' FEET - SET NAIL IN TREE.
YELLOW BIRCH 11" S80°W 59.20 FEET - SET NAIL IN TREE.
IRONWOOD 8" N12°W 23.65 FEET - SET NAIL IN TREE.
STEEL SIGN POST EAST 1.10 FEET

SET THE FOLLOWING WITNESSES:


YELLOW BIRCH 9" N48°E 18.48 FEET - SET NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE NORTH 1/4
CORNER OF SECTION 32,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

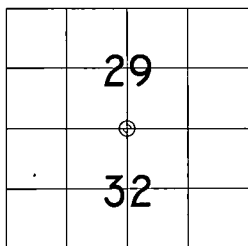

⊕ = LOCATION OF CORNER

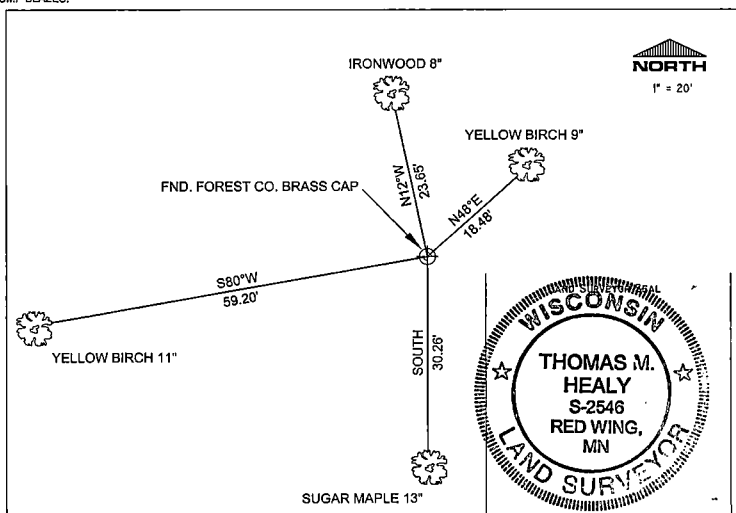

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT AND CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS OBSERVED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

THOMAS M. HEALY 11-17-05
SIGNATURE DATE

INDEX No. V-7

43515.29 0020


CERTIFIED LAND CORNER RESTORATION

Index No. **V 7**

State of Wisconsin }
County of Forest } ss.

I Thomas R. Arnott, do hereby certify that on the 1/4 18 th day of October, 1977, I found evidence of the 1/4 corner of sections 29 & 32 Township 35, North, Range 15 E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

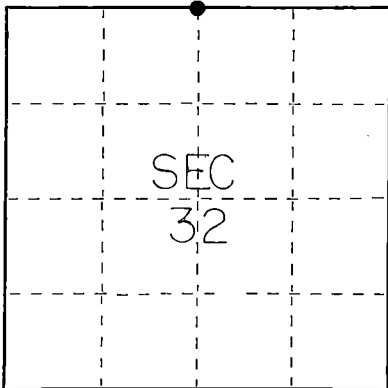

○ = Corner monument restored.

History of original corner establishment:

Original survey by James McBride 10 June - 15 June, 1859

Sugar	10	S1W	22 lks.
Birch	18	N57E	82 lks.

Description of corner evidence found:

Found 2" iron pipe and a 1" iron rod.



Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced iron pipe with a Forest County Aluminum Monument.

Ties:

Maple	8	S17E	30.04 feet
Maple	6	N81W	58.29 feet

Dated at Crandon, Wis., this 3rd day of November, 1977.

Signature Thomas R. Arnott Title Surveyor Registration No. S-887
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within instrument was filed in this office for record on the 3rd day of November, 1977 at 11 o'clock A. M.

Eugene Stutzman Doc. No. **112702**
(Register of Deeds)

By _____ Deputy

43515290020

SEE NEXT PG.

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i),

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner between Sections 29 and 32,
T.35N., R.15E.

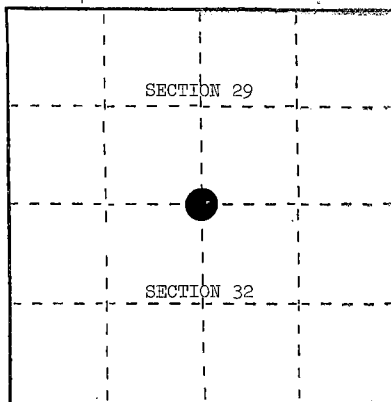

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post 40.25 chains with the following BTs: Sugar, 10", S.41°W., 22 links; Birch, 18", N.57°E., 82 links.

In 1908, N. H. Smith made new BTs: Yellow Birch, 10", N.48°W., 11.9 links; Yellow Birch, 28", S.72°W., 145 links.


June 7, 1934, J. W. White found iron stake 14" above ground, metal location tag on fence corner post.

August 30, 1984, R. Belliveau found Forest County brass cap 18" above ground in mound of stone, metal location poster on old fence post, fence lines run north and east, original BT stump hole, S.41°W., 22 links, Smith's BTs: Stump hole, N.48°W., 11.9 links; Stump hole, S.72°W., 145 links.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A Forest County brass cap stamped to identify the corner.
2. Sugar, 10", S.01°W., 30.12'
3. Yellow Birch, 8", S.86°W., 59.23'
4. Ironwood, 6", N.14°W., 23.68'
5. Steel Sign Post, East, 1.1'

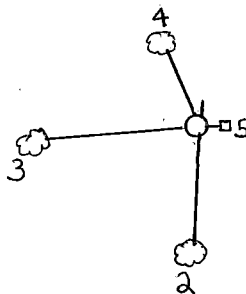

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 21st day

of... January... A. D., 1985 at

... 11:00 o'clock... A... M. and

recorded in Vol. CORNER RESTORATION

on page 11

by... Aschenbrenner... REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/24/84
Date

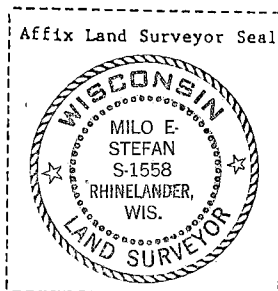

Document Number

191725

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 3rd day
of August, A.D. 2006 at
2:45 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page V-9

Paul H. Heston
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 12" N17°W 37 LINKS
SUGAR MAPLE 10" N20°E 55 LINKS
SUGAR MAPLE 10" S78°E 56 LINKS
HEMLOCK 16" S51°W 12 LINKS

1908 - NATHAN SMITH, FOUND ORIGINAL BT'S AND SET TWO NEW BT'S.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 10" S86.5°E 74 LINKS, 49.84 FEET
YELLOW BIRCH 18" N81.75°W 74.5 LINKS, 49.17 FEET

1983 - LAND CORNER RESTORATION DOC #124197, MILO E. STEFAN, SURVEYOR, S-1558, SEARCHED AREA, FOUND NO ORIGINAL EVIDENCE, FOUND 1" X 30" IRON ROD, 20" BELOW ROAD SURFACE, FOUND A SUGAR MAPLE 24", S85°E @ 49.8 FEET WITH OVERGROWN SEAM. STEFAN FEELS THIS IS SMITHS BT FROM 1908, FOUND FENCE LINE EAST AND WEST, CENTERLINE OF COUNTY TRUNK "H". SET A 2" X 36" ALUMINUM MONUMENT 6" BELOW ROAD SURFACE WITH TABLET STAMPED.

FOUND THE FOLLOWING WITNESS:
SUGAR MAPLE 24" S66°E 49.22 FEET

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 14" S34°E 62.74 FEET
BASSWOOD 10" S87°E 80.89 FEET
P. POLE #35-15-32-E-11 WEST 35.03 FEET
STEEL SIGN POST EAST 24.0 FEET

2005 - SURVEY MONUMENT RECORD DOC #189304 - THOMAS M. HEALY, SURVEYOR, S-2548, FOUND HOLE IN BIT, BUT NO MONUMENT WAS FOUND. SET 3/4" REBAR w/3" ALUMINUM CAP AT RECORD DISTANCES FROM FOUND WITNESSES.

FOUND THE FOLLOWING WITNESSES:
SUGAR MAPLE 30" S88°E 49.22 FEET - SET NAIL IN TREE.
SUGAR MAPLE 18" S32°E 62.74 FEET - SET NAIL IN TREE.

SET THE FOLLOWING WITNESSES:
MAPLE 17" S87°W 70.57 FEET - SET NAIL IN TREE.
P. POLE #3515-32E11 WEST 35.16 FEET - SET NAIL IN POLE.

ALL TREES HAVE CHEST & STUMP BLAZES.

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


2006 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND 3" ALUMINUM CAP DOWN ±0.2" IN BIT.

WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:


3.5" MONUMENT CAP IN CONCRETE N82°W 60.40 FEET
3.5" MONUMENT CAP IN CONCRETE NS2°E 52.61 FEET
3.5" MONUMENT CAP IN CONCRETE S70°E 38.90 FEET
3.5" MONUMENT CAP IN CONCRETE S68°W 56.29 FEET

THE NORTHEAST

CORNER OF SECTION 32,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

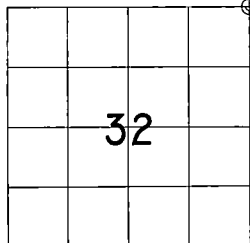

⊕ = LOCATION OF CORNER

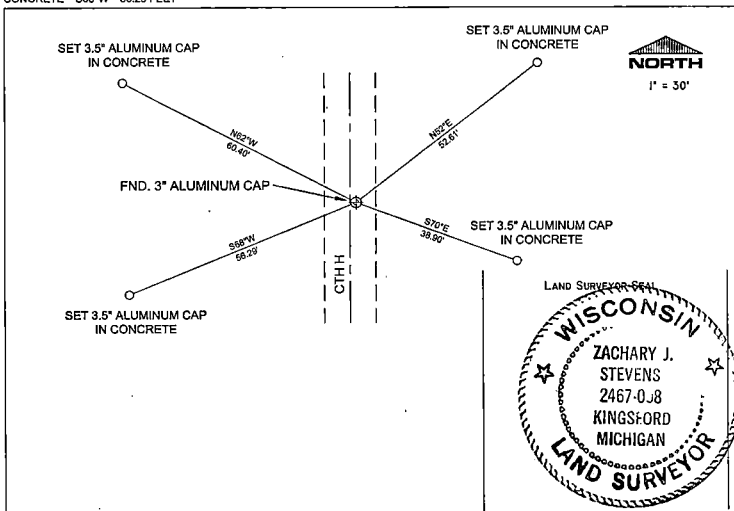

I, ZACHARY J. STEVENS R.L.S. S-2467-008

(TYPE OR PRINT AND CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

INDEX No. V-9

Zachary J. Stevens 7/31/06
SIGNATURE DATE

4351519000

V-9

Document Number

189304

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 19th day
of November A.D., 2005 at
3:55 o'clock P.M. and recorded
in Vol. Corner Restoration
page V-9

Kay Swanson, Deputy
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 12" N17°W 37 LINKS
SUGAR MAPLE 10" N20°E 55 LINKS
SUGAR MAPLE 10" S78°E 56 LINKS
HEMLOCK 16" S61°W 12 LINKS

1908 - NATHAN SMITH, FOUND ORIGINAL BT'S AND SET TWO NEW BT'S.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 16" S86.5°E 74 LINKS, 48.94 FEET
YELLOW BIRCH 16" N81.75°W 74.5 LINKS, 49.17 FEET

1883 - MILO E. STEFAN, SURVEYOR, S-1558, SEARCHED AREA, FOUND NO ORIGINAL EVIDENCE, FOUND 1" X 30" IRON ROD, 20" BELOW ROAD SURFACE, FOUND A SUGAR MAPLE 24", S86°E @ 48.8 FEET WITH OVERGROWN SEAM. STEFAN FEELS THIS IS SMITH'S BT FROM 1908. FOUND FENCE LINE EAST AND WEST. CENTERLINE OF COUNTY TRUNK "H". SET A 2" X 36" ALUMINUM MONUMENT 6" BELOW ROAD SURFACE WITH TABLET STAMPED.

FOUND THE FOLLOWING WITNESS:
SUGAR MAPLE 24" S86°E 49.22 FEET

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 14" S34°E 62.74 FEET
BASSWOOD 10" S67°E 90.89 FEET
P. POLE #35-15-32-E-11 WEST 35.03 FEET
STEEL SIGN POST EAST 24.0 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND HOLE IN BIT, BUT NO MONUMENT WAS FOUND. SET 3/4" REBAR W/3" ALUMINUM CAP AT RECORD DISTANCES FROM FOUND WITNESSES.

FOUND THE FOLLOWING WITNESSES:


SUGAR MAPLE 30" S88°E 49.22 FEET - SET NAIL IN TREE.
SUGAR MAPLE 18" S32°E 62.74 FEET - SET NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


MAPLE 17" S67°W 70.57 FEET - SET NAIL IN TREE.
P. POLE #3515-32E11 WEST 35.16 FEET - SET NAIL IN POLE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE NORTHEAST
CORNER OF SECTION 32
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

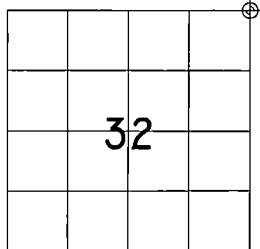

⊕ = LOCATION OF CORNER

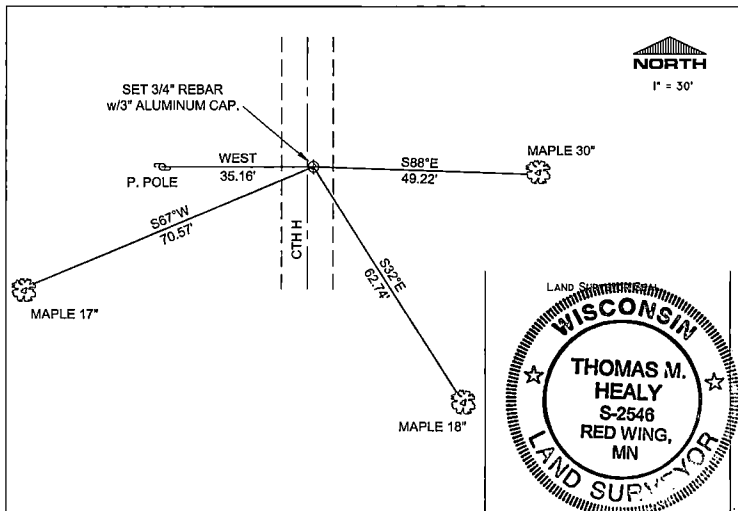

I, THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT AND SIGNIFY THAT THIS CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

SIGNATURE

DATE

INDEX No. V-9

4351529 0000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Milo E. Stefan, do hereby certify that on the 26th day of April, 1983, I found evidence of the Northwest corner of Section 33 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
80.00 chains, set wood post
Sugar, 12", N17°W, 37 lks.
Sugar, 10", N20°E, 55 lks.
Sugar, 10", S78°E, 56 lks.
Hemlock, 16", S61°W, 12 lks.

Surveyed in 1908 by Nathan Smith
Smith found original BTs and set two
new BTs:
Sugar, 16", S86½°E, 74 lks., 48.84 feet
Yellow Birch, 16", N81 3/4°W, 74½ lks., 49.17 feet

Description of corner evidence found:


No original evidence found

Local Evidence: 1" x 30" iron rod, 20" below road surface
Sugar, 24", S86°E, 48.8 feet--with an overgrowth seam. (I feel this is
Smith's BT from 1908.)
Fence line east and west
Centerline of County Trunk "H"

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument 6" below road surface with tablet stamped as follows:
T35N, R15E, S29, S28, S32, S33, 1983, RLS-1558
From which the following bear:
Sugar, 24", S86°E, 49.22 feet
Sugar, 14", S34°E, 62.74 feet
Basswood, 10", S67°E, 90.89 feet
Power Pole #35-15-32-E-11, West, 35.03 feet
Steel Sign Post, East, 24.0 feet

DOCUMENT NO.
124197

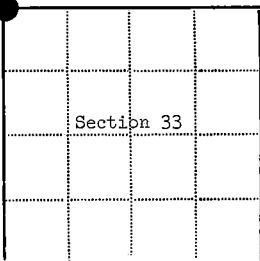

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 26th day of April, 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene Statynsky Title Register of Deeds

Township 35 North, Range 15 East, Section 33, Index No. V-9, Page No. 59

43515290000

7
6

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 25th day of April, 1983, I found evidence of the North Quarter corner of Section 33 Township 35 North Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set wood post
Cedar, 24", N.14°E., 27 links
Birch, 18", S.64°E., 23 links


Description of corner evidence found:

Cedar (large-fallen), N.14°E., 27 links
Local Evidence: Found location poster set on Yellow Birch, 18", N.25°E., approximately 27 links, as described on Form 874-9 from April 3, 1935; also, found fence corner, fence south and west.

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument in mound of stone with tablet stamped as follows:
T35N, R15E, S28, 1, S33, 1983, RLS-1558
From which the following bear:
Black Ash, 5", N.90°E., 17.78 feet
Sugar Maple, 8", S.35°E., 9.37 feet
Yellow Birch, 5", S.58°W., 34.86 feet
Steel Sign Post, North, 2.00 feet

DOCUMENT NO.
124198

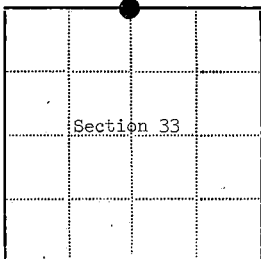

- - Corner monument restored
- -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 19.83 day of September

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 15th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene J. Staty Title Register of Deeds

Township 35 North, Range 15 East, Section 33, Index No. V-11, Page No. B-7, P-63

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 5th day of May, 19 69, I found evidence of the Northwest Section corner of Section 34, Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride. 80.00 chains north between sections 33 & 34 set wood post.

Elm, 24 ins. diameter bears N35W, 22 lks.

Elm, 20 ins. diameter bears N27E, 36 lks.

Elm, 18 ins. diameter bears S60E, 30 lks.

Elm, 16 ins. diameter bears S61W, 45 lks.

Stream, 8 links wide, running east, bears north 50 links.

Stream, 8 links wide, running northeast, bears west 56 links.

Description of corner evidence found:

Found fallen cedar post along side post point 30 links south of stream. Found Forest Service location poster on ash dated 4/9/59. Set a point 50 links south of the stream at the bend running east. Measured 56 links west and hit stream running northeast. Measured N35W, 22 lks. to rotted hardwood stump. Found bark to identify stump as elm.

Description of monument and accessories I established to perpetuate the original location of this corner:

At a point S34E, 14.52 feet from elm stump set a 2 inch inside diameter galvanized wrought iron pipe 5 feet long, filled with concrete with a brass cap marked:

From which the following new blazed and scribed bearing trees bear:



Yellow Birch, 9 inch diameter bears N35E, 18.20 feet or 27.57 lks.

Black Ash, 8 inch diameter, S30E, 3.54 feet or 5.36 lks.

White Spruce, 11 inch diameter, bears S42W, 19.33 feet or 29.28 lks.

Sugar, 4 inch diameter, bears N29E, 24.47 feet or 31.07 lks.

4 x 4 cedar post SW, 1.8 feet.

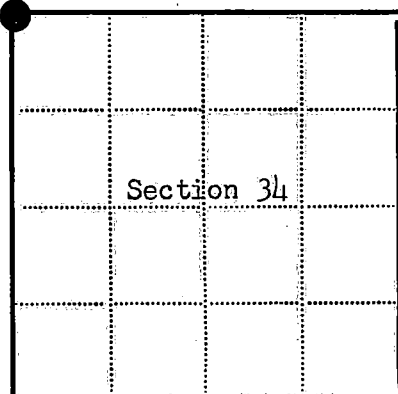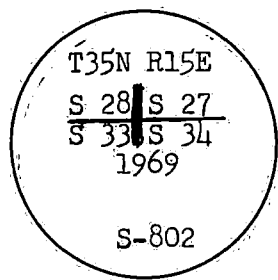

● - Corner monument restored

□ -



Resident witnesses

Dated at Rhinelanders

19 69

Wisconsin, this 5th day of May

Signature Jean F. Resvick

Title Cadastral Surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT Number 98038

Office of Register of Deeds

County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 19 70, and was filed in Book No. V-13 Page No. V-13 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 15 East, Section 34, Index No. V-13, Page No. V-13

4351528 0000

138193


U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner Between Sections 27 and 34
T35N, R15E, Forest County, Wisconsin

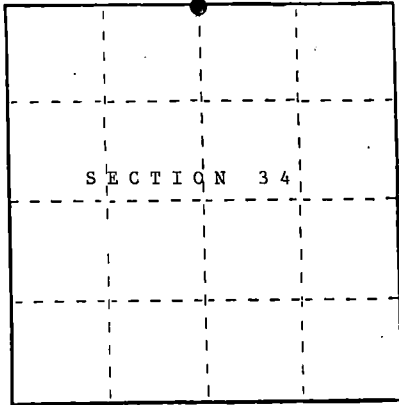

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 16th day

of Sept. A.D., 1989 at

10:25 o'clock A.M. and recorded

in Vol. 15

page 15

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set a wood post for the corner and the following corner references:
Birch 24" N41°E 28 lks. Birch 14" S09°W 19 lks.

In 1989, Schulke found no evidence.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2 1/2" X 36" aluminum magnetic cap monument stamped to identify the corner.
- Monument in a mound of stones.
- Sugar Maple 10" N73°W 37.00 ft.
- Sugar Maple 4" N21°W 9.38 ft.
- Sugar Maple 5" S26°E 31.62 ft.
- Sugar Maple 10" S70°W 21.25 ft.
- Set a steel sign post 0.8 ft. WEST of the monument.

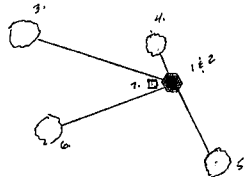

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No discrepancy, first corner restoration.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No, see g and h.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


Corner restored by proportionate method.

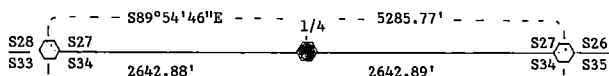

(1) I, John C. Schulke

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke June 7th, 1989
Signature Date
Certificate ready for filing: Dale S. Staeger
District Ranger

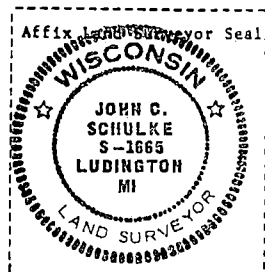

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 27 & 34
 T.35N., R.15E., Forest County, WI.

State Plane Coordinates
 Wisconsin North Zone
 116709.82401-N
 2326892.63065-E

Geographic Coordinates
 45-28-41.10890-N
 088-36-10.20708-W

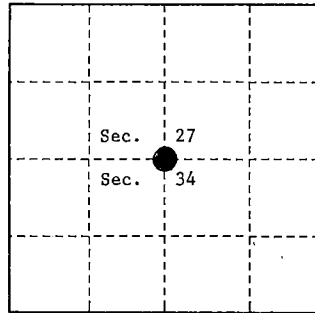

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1859 by James McBride. Set wood post and made the following bearing trees; Birch, 24", N.41°E., 28 links, Birch, 14", S.09°W., 19 links.


In 1989 J. Schulke, R.L.S. found no corner evidence. He re-established the corner position at mid-point and on line between opposing section corners. Set a 2 1/2" x 36" aluminum monument with an aluminum tablet stamped to identify corner. Blazed and scribed new bearing trees.

On 7/11/94, Alan Harrison, R.L.S., found monument and bearing trees as set by J. Schulke in 1989. Cut down all bearing trees for G.P.S. observations. After completion of G.P.S. observations on the section line between sections 27 and 34, found the monument as set by J. Schulke to be 1.18 feet out of position. Moved the monument as set by Schulke S.85°, 45'29"W., 1.18 feet. Made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" x 36" aluminum monument with tablet stamped to identify corner.
2. Sugar, 7", N.36°E., 33.37 feet.
3. Sugar, 11", S.85°W., 53.90 feet.
4. Sugar, 8", N.58°W., 57.60 feet.
5. Steel sign post, East, 1.30 feet.

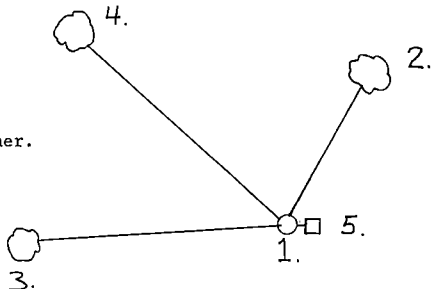

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

J.Schulke position of 1989 survey

A. Harrison position 1994 G.P.S. survey

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

No

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 23rd day
of December, A.D., 19 94 at
2:00 o'clock P.M. and recorded
in Vol. County Restorations
page 3515-1-15
Seal With Deputy
Register of Deeds

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature


10/27/94

Date

CERTIFICATE READY FOR FILING:

Sue Vog

District Ranger

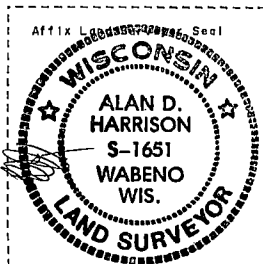


DOCUMENT NUMBER **131256****U. S. PUBLIC LAND SURVEY MONUMENT RECORD**

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section corner to Sections 26, 27, 34, and 35,
 T.35N., R.15E.

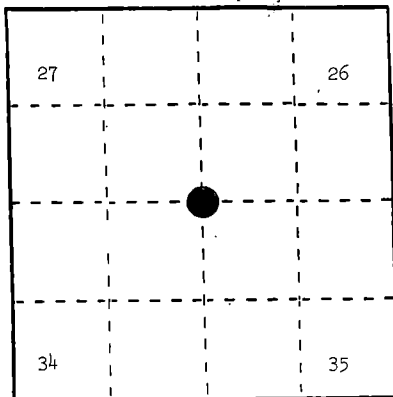

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 10th day
 of October, A.D., 1986, at
1:35 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS

page 17

Paul Aschenbrenner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Sugar, 14", N.64°W., 18 links; Ironwood, 8", N.48°E., 28 links; Sugar, 12", S.33°E., 32 links; Sugar, 14", S.77°W., 68 links.

In 1906, N. Smith ran exterior of Section 35 and called 3 of original witnesses standing--set 1/16 corners (20.06½ East) and (20.45½ South).


In 1935, Karl Wild found a squared post and placed a location poster on a 5" Elm, ½ chain west of corner.

In 1986, Alan Harrison found an Elm post with location poster lying on pile of rock. Found stump remains of an Elm at N.75°E., 10.23 feet; a stump hole at S.77°W., 44.9 feet; a large turnout of 2 or more trees at N.64°W., 11.9 feet. Placed a 2" x 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 4", N.18°E., 6.96 feet
3. Black Cherry, 8", S.19°E., 23.72 feet
4. Sugar, 4", S.54°W., 9.51 feet
5. Sugar, 6", N.45°W., 8.68 feet
6. Steel Sign Post, South, 1.90 feet

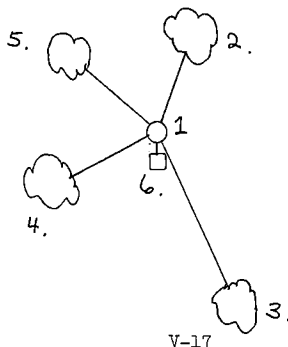

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

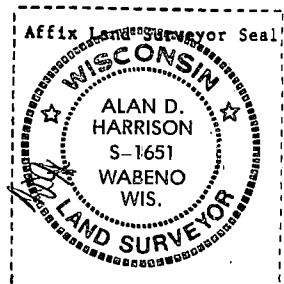

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

9/11/86
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 26 and 35,
T35N, R15E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 20th day
of November A.D., 19 90, at
1:00 o'clock P. M. and recorded
in Vol. Cor. & Restorations
page 119

Paul Aschenbrenner
Register of Deeds

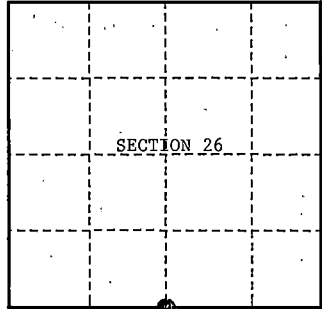

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 corner was established by James McBride. He set a wood post for the corner and made two BTs: Hemlock, 8", S.10°W., 12 Links and Hemlock, 6", N.23°W., 18 Links.


1936 - Forest Service has an 874 stating corner was resurveyed by Rifleman. He placed a location poster on an Aspen stake.

On 5/14/1990 Milo E. Stefan found a mound of stone with post hole in center with the location poster lying in duff 3 feet Northeast of mound of stone. I accept this location as the restored corner location and monumented same to subdivide Section 26.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2" x 36" aluminum monument in mound of stone/tablet stamped to identify corner
- 2) Sugar, 10", N.23°E., 30.37'
- 3) Sugar, 10", S.34°E., 26.98'
- 4) Sugar, 10", South, 24.50'
- 5) Sugar, 6", N.58°W., 40.37'
- 6) Steel Sign Post, 6', East, 1.0'

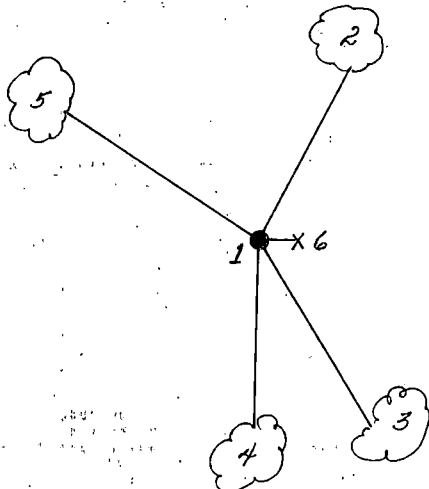

- (a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found restored position.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 16, 1990
Date

CERTIFICATE READY FOR FILING:

Dale B. Staeger

District Ranger



140864

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 25, 26, 35 and 36,
 T35N, R15E.

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 20th day
 of December A.D., 1992 at
1:22 o'clock P.M. and recorded
 in Vol. County Registrations
 page 1-21

Paul A. Bohlen
 Register of Deeds

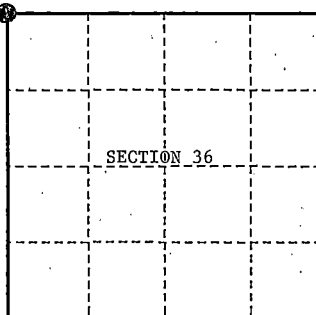

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 corner was established by James McBride. He set a wood post for the corner and made four BTs:

Sugar Maple, 14", N.42°E., 16 Links

Sugar Maple, 8", N.49°W., 29 Links

Sugar Maple, 12", S.11°E., 21 Links


Hemlock, 12", S.40°W., 53 Links

In 1990 Milo E. Stefan found post hole supported by remains of the original Hemlock BT, a very decayed stump, S.40°W., 53 Links and stump holes where the Sugar Maples were at N.42°E., 19 Links and S.11°E., 21 Links. I restored this corner from the above evidence of the original survey.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2" x 36" aluminum monument in mound of stone
- 2) Sugar Maple, 10", S.81°E., 23.68'
- 3) Sugar Maple, 14", S.24°W., 44.04'
- 4) Sugar Maple, 10", N.77°W., 10.93'
- 5) Sugar Maple, 14", N.15°W., 13.73'
- 6) Steel Sign Post, 6', Northeast, 1.65'

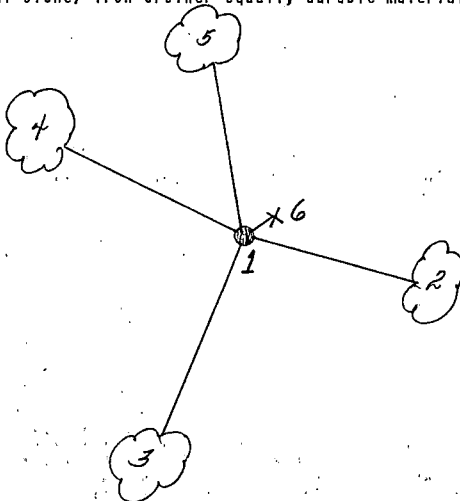

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 16, 1990

Date

CERTIFICATE READY FOR FILING:

David S. Stage

District Ranger



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I Jean F. Resvick, do hereby certify that on the 23d day of June, 19 65,
I found evidence of the North quarter corner of Section 36
Township 35 North, Range 15 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:


Description of original monument and accessories and subsequent restorations:

Survey in 1859 by James McBride

40.00 chains west corrected between Sections 25 and 36 set wood post

W. Ash 6", N.21° E., 16 lks.

Hemlock 10", S.37° E., 14 lks.

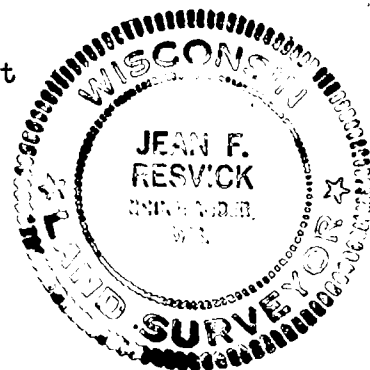

Description of corner evidence found:

4x4 post, scribed 1/4S, S25, S36 on both east and west side of road.

4x4 posts measure 66 ft. East and West between them. West 4x4 has F.S. poster
rusted beyond reading.The two posts are accepted as being witnesses to the quarter corner which falls in
the road on a curve.



Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2 in. inside diam., galvanized iron pipe, 30 inches long, 6 ins. below surface
of the road and 33 ft. from each witness post for quarter corner between Sections
25 and 26. Replaced 4x4 witness post on west side road with 2 in. inside diam.,
galvanized iron pipe, 30 ins. long, 6 ins. above ground. Replaced 4 x4 witness post
East side road with 2 ins. inside diam., galvanized iron pipe, 5 feet long, filled with
concrete, flanged at bottom, with brass cap marked:

from which the following blazed and scribed bearing trees bear.

Elm 4", N.64° 30' E., 17.50 ft. or 26.52 lks.

Elm 3", S5° E., 4.66 ft. or 7.06 lks.

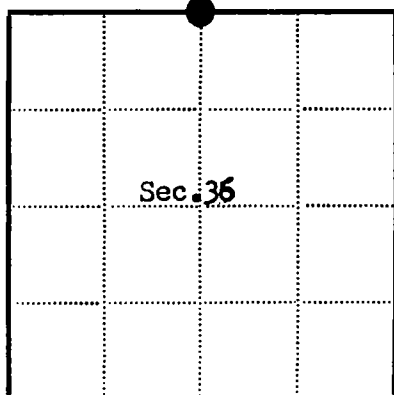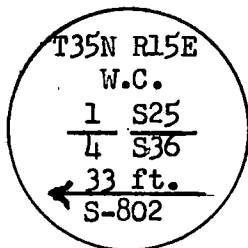

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland Wisconsin, this 3rd day of Sept,
19 65.Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)Surveyors Registration No. S-802

90972

Office of Register of Deeds County of ForestI hereby certify that the within instrument was filed in this office for record
on the 17 day of December, 1965, and was filed in Book
No. 1 Page No. 4 of County Records. 4 PMSignature Anna Peterson Title Register of DeedsTownship 35 North, Range 15 East, Section 36, Index No. V-23, Page No. 4

4351525 0020

V23

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 31 and 32, T.35N., R.15E.

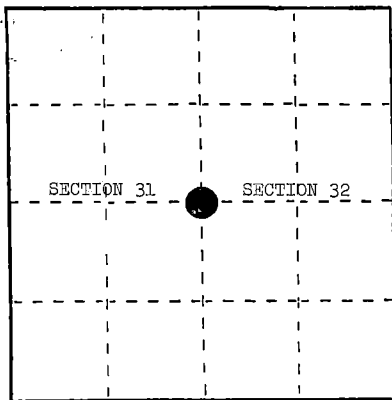

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set quarter section post with the following BTs: Elm, 24", N.71°E., 25 links; Birch, 16", N.73°W., 42 links.

August 30, 1984, Forest Service found a 2" iron pipe in rock pile with large white post alongside. Stump hole at N.73°W., 27.72'. Old fallen fence lines north, south, and west. Replaced pipe with a 2" x 30" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. White Birch, 8", N.40°E., 17.70'
2. Sugar Maple, 9", S.16°E., 64.16'
3. Black Cherry, 7", N.24°W., 66.80'
4. Steel Sign Post, 7', Northeast, 1.5'
5. 2" x 30" aluminum monument stamped to identify the corner.

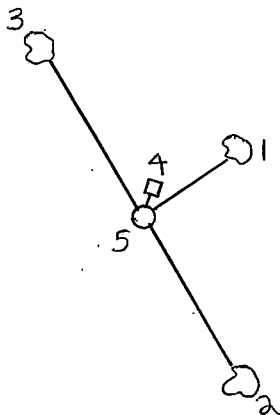

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 21st day
of... January... A. D., 1985

at... 11:00 o'clock... A. M. and

recorded in Vol. CORNER RESTORATIONS
on page 5

REGISTER

X-5

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

12/04/84
Date



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 25th day of April, 1983, I found evidence of the East Quarter corner of Section 32 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by James McBride
40.00 chains, set wood post
Sugar, 16", N51°E, 30 lks.
Sugar, 12", S46°W, 16 lks.

Surveyed in 1908 by Nathan Smith
Smith set two new BTs:
Sugar, 10", N61½°W, 62½ lks., 41.25 feet
Sugar, 14", S47½°E, 44 lks., 29.04 feet

Description of corner evidence found:

No original evidence found


Local Evidence: Centerline of County "H" and intersection of centerline of old town road running east and old fence running west

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument 6" below road surface with tablet stamped as follows:
T35N, R15E, ¼, S32, S33, 1983, RLS-1558
From which the following bear:
Sugar, 14", S66°E, 57.33 feet
Yellow Birch, 8", S49°W, 110.41 feet
White Spruce, 8", N68°W, 56.65 feet
Steel Sign Post, West, 30.85 feet

DOCUMENT NO.

124196

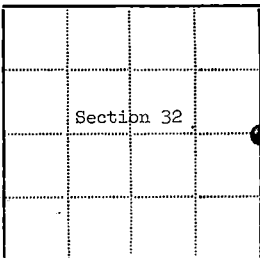

Resident witnesses.....

Dated at Rhinslander, Wisconsin, this day of , 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 35 North, Range 15 East, Section 32, Index No. X-9, Page No. 57

42512 322000

Document Number

191726

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 3rd day
of APRIL A.D., 2006 at
8:45 o'clock A.M. and recorded
in Vol. COENB RE-STORE AT MMS
page X-9
Paul H. Ashenbrenner
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 16" N51°E 30 LINKS
SUGAR MAPLE 12" S46°W 16 LINKS

1908 - NATHAN SMITH, SET TWO NEW BTS.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 10" N81.5°W 62.5 LINKS, 41.25 FEET
SUGAR MAPLE 14" S47.5°E 44 LINKS, 29.04 FEET

1983 - MILO E. STEFAN, SURVEYOR, S-1558, FOUND NO ORIGINAL EVIDENCE. LOCAL EVIDENCE FOUND WAS CENTERLINE OF COUNTY ROAD "H" AND INTERSECTION OF CENTERLINE OF OLD TOWN ROAD RUNNING EAST AND OLD FENCE RUNNING WEST. SET A 2" X 36" ALUMINUM MONUMENT 6" BELOW ROAD SURFACE WITH TABLET STAMPED.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 14" S66°E 57.33 FEET
YELLOW BIRCH 8" S49°W 110.41 FEET
WHITE SPRUCE 8" N68°W 58.65 FEET
STEEL SIGN POST WEST 30.85 FEET

2005 - LAND SURVEY MONUMENT RECORD DOC #189320, THOMAS M. HEALY, SURVEYOR, S-2546, FOUND 2" ALUMINUM PIPE IN ROAD. SET A 3/4" REBAR W/3" ALUMINUM CAP IN CENTER OF FOUND 2" ALUMINUM PIPE.

SET THE FOLLOWING WITNESSES:
YELLOW BIRCH 12" S55°14'3"W 98.89 FEET
MAPLE 9" S81°28'38"E 42.83 FEET
IRONWOOD 7" S49°11'38"E 63.65 FEET
MAPLE 14" S81°08'51"E 52.76 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

2005 - ZACHARY J. STEVENS, SURVEYOR, S-2467-008, FOUND 3" ALUMINUM CAP IN BIT.


WISDOT SET THE FOLLOWING WITNESSES:
Z. STEVENS MEASURED THE FOLLOWING:

3.5" MONUMENT CAP IN CONCRETE N62°W 51.46 FEET
3.5" MONUMENT CAP IN CONCRETE N54°E 62.58 FEET
3.5" MONUMENT CAP IN CONCRETE S64°W 44.57 FEET
3.5" MONUMENT CAP IN CONCRETE S40°E 48.16 FEET

THE EAST 1/4
CORNER OF SECTION 32,
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

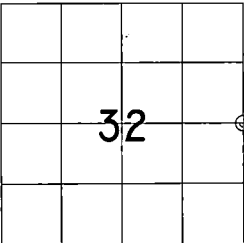

⊕ = LOCATION OF CORNER

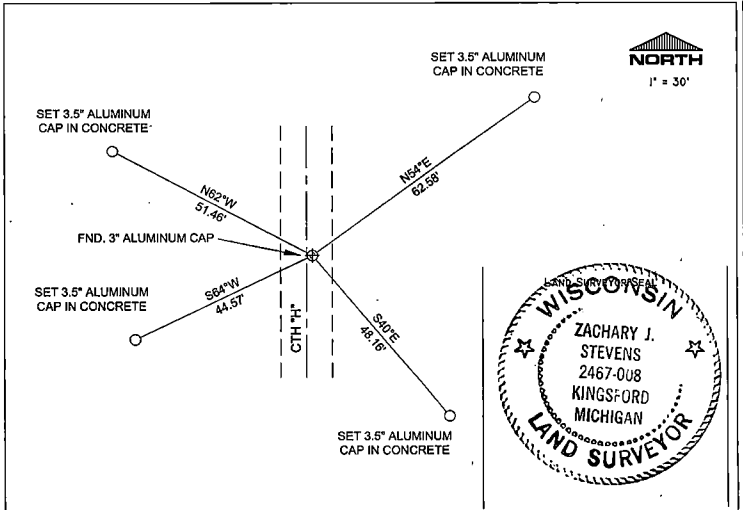

I, ZACHARY J. STEVENS R.L.S. S-2467-008

(TYPE OR PRINT AND CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.)

INDEX No. X-9

Zachary J. Stevens 7/31/06
SIGNATURE DATE

4351532-2000

X-9

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 18th day
of November, A.D., 2005 at
3:55 o'clock P.M., and recorded
in Vol. Corner Restoration
page X-9
Kay Swanson, Deputy
Register of Deeds

Document Number
189320

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required By S. A-E 5.02, WI Adm. Code)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1859 - JAMES MCBRIDE, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 16" N51°E 30 LINKS
SUGAR MAPLE 12" S46°W 16 LINKS

1908 - NATHAN SMITH, SET TWO NEW BT'S.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 10" N61.5°W 62.5 LINKS, 41.25 FEET
SUGAR MAPLE 14" S47.5°E 44 LINKS, 29.04 FEET

1993 - MILO E. STEFAN, SURVEYOR, S-1558, FOUND NO ORIGINAL EVIDENCE. LOCAL EVIDENCE FOUND WAS CENTERLINE OF COUNTY ROAD "H" AND INTERSECTION OF CENTERLINE OF OLD TOWN ROAD RUNNING EAST AND OLD FENCE RUNNING WEST. SET A 2" X 36" ALUMINUM MONUMENT 6" BELOW ROAD SURFACE WITH TABLET STAMPED.

SET THE FOLLOWING WITNESSES:
SUGAR MAPLE 14" S68°E 57.33 FEET
YELLOW BIRCH 8" S49°W 110.41 FEET
WHITE SPRUCE 8" N68°W 56.65 FEET
STEEL SIGN POST WEST 30.85 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION
- ☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
- ☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
- ☐ RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


FOUND 2" ALUMINUM PIPE IN ROAD. SET A 3/4" REBAR w/3" ALUMINUM CAP IN CENTER OF FOUND 2" ALUMINUM PIPE.

SET THE FOLLOWING WITNESSES:


YELLOW BIRCH 12" S55°14'43"W 98.89 FEET
MAPLE 9" S81°26'39"E 42.88 FEET
IRONWOOD 7" S49°11'39"E 53.85 FEET
MAPLE 14" S81°08'51"E 52.76 FEET

ALL TREES HAVE CHEST & STUMP BLAZES.

THE EAST 1/4
CORNER OF SECTION 32
T. 35 N., R. 15 E.,
FOREST COUNTY, WISCONSIN

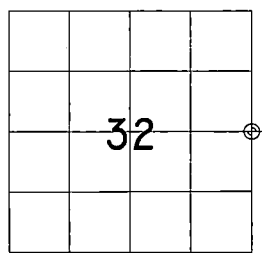

⊕ = LOCATION OF CORNER

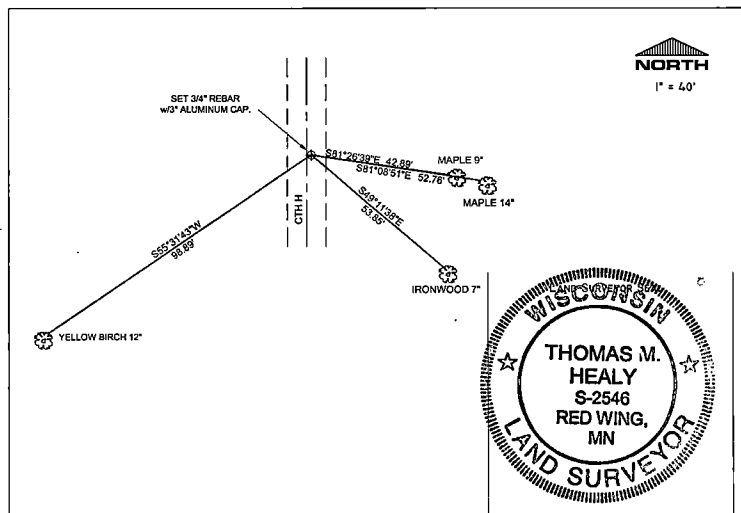

I, THOMAS M. HEALY R.L.S. 2546
(TYPE OR PRINT) MANIFESTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY
ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD
IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. X-9

THOMAS M. HEALY
SIGNATURE DATE

43515322000

X-6

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 3rd day of August, 1983, I found evidence of the East Quarter corner of Section 33 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by James McBride
40.00 chains, set wood post
White Pine, 10", N.51°E., 19 links, 12.54 feet
Black Ash, 18", N.43°W., 29 links, 19.14 feet


Description of corner evidence found:

No original evidence found
Local Evidence: 3½" x 3½" x 4' pointed concrete post

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument in mound of stone with tablet stamped as follows:
T35N, R15E, ¼, S33, S34, 1983, RLS-1558
From which the following bear:
Red Maple, 7", S.10°E., 29.28 feet
Black Ash, 8", S.50°W., 68.03 feet
Red Maple, 10", N.66°W., 37.14 feet
Steel Sign Post, West, 2.10 feet

DOCUMENT NO.
124199

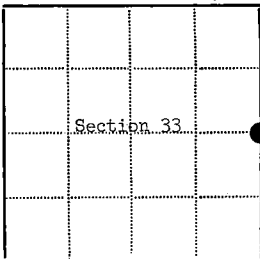

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this day of 1983.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of September, 1983, and was filed in Book No. Page No. of County Records.

Signature Eugene Stegany Title Register of Deeds

Township 35 North, Range 15 East, Section 33, Index No. X-13, Page No. B-7, P-66

43513332000

X13

138194

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter Corner Between Sections 34 and 35,
T35N, R15E, Forest County, Wisconsin.


REGISTER'S OFFICE
Forest County, Wis.

Received for record this 1st day
of Sept A.D. 1989, at

10:55 o'clock A.M. and recorded

in Vol. 11 CORNER RESTORATIONS
page 11

Paul Henderson
Register of Deeds

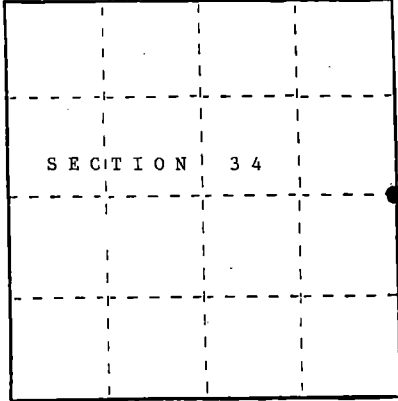

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1859, James McBride set a wood post for the corner and the following corner references:
Elm 30" N60°E 13 lks. Sugar 16" S56°W 40 lks.

In 1989, Schulke found no evidence.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2 1/2" X 36" aluminum magnetic cap monument stamped to identify the corner.
- Cherry 10" N72°W 49.09 ft.
- Basswood 11" S81°E 7.84 ft.
- Cherry 12" S10°E 46.44 ft.
- Cherry 8" S75°W 37.13 ft.
- Set a steel sign post 1.1 ft. North of the monument.

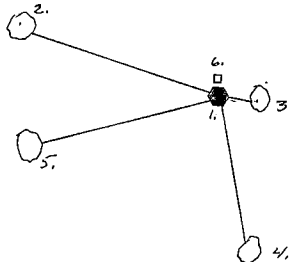

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



No discrepancy, first corner restoration.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No, see g and h.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Corner restored by proportionate method.

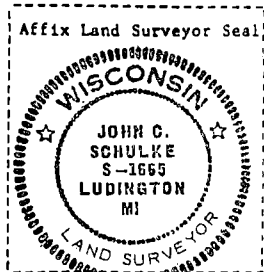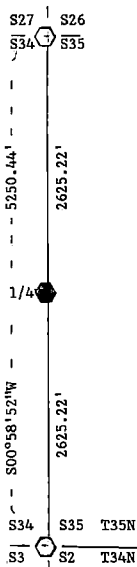

- (i) I, John C. Schulke

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke Date June 24, 1989
Signature Date

Certificate ready for filing:

Dale S. Staeger
District Ranger

140865

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 35 and 36,
 T35N, R15E.

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 20th day
 of March, A.D., 19 90 at
2:00 o'clock P.M. and recorded
 in Vol. 1000 of Registrations
 page 431.

Paul H. Schaeffer
 Register of Deeds

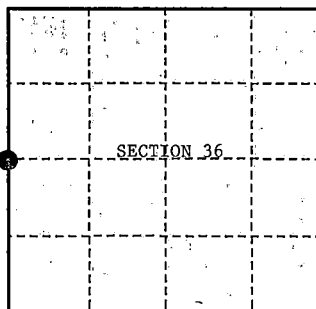

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859 corner was established by James McBride. He set a wood post for the corner and made two BTs:

Cedar, 8", S.77°W., 12 Links


Cedar, 12", S.60°E., 8 Links

On 6/20/1990 Milo E. Stefan declares the corner as lost and restores it by Lost Methods.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2" x 60" aluminum monument/tablet stamped to identify the corner
- 2) Black Ash, 6", N.78°E., 15.36'
- 3) Black Ash, 6", S.18°E., 21.90'
- 4) Cedar, 6", S.50°W., 20.92'
- 5) Black Ash, 6", N.38°W., 23.48'
- 6) Steel Sign Post, 6", N.49°W., 1.55'

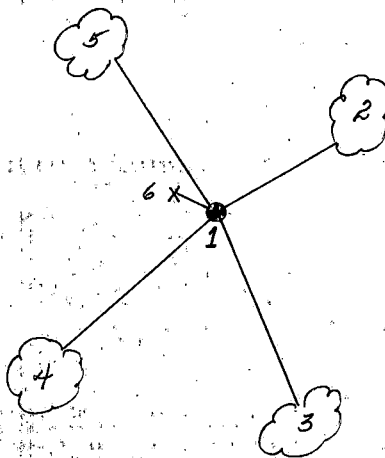


- (a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

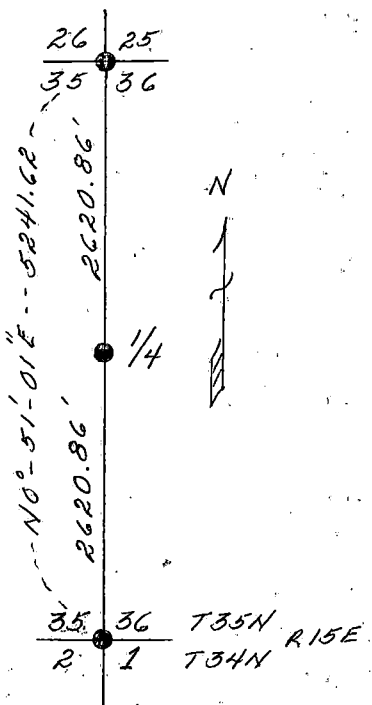

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

July 16, 1990

Date

CERTIFICATE READY FOR FILING:

Dale S. Steege
District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 36 and 31,
 T.35N., R15 & 16E., Forest County, Wisconsin.

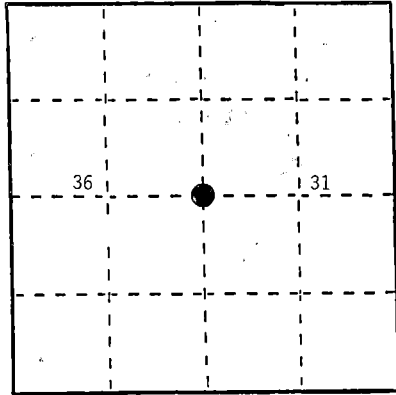

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 10th day

of May A.D., 1900 at

9:35 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page X-25

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1857, Artemas Curtis, set wood post with the following Bts: Yellow Birch, 11", N47W., 27 links; Hemlock, 14", S24E., 28 links.

In 1988, Al Harrison, found a 5"x 5" squared top of a cedar post 18" long. Found post hole with wood fragments vertical in hole. No original B.T. remains were recovered. Accepted post hole as the best available evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument stamped to identify the corner.
2. Red Maple, 4", N.03E., 24.88 feet
3. Balsam, 7", S.45E., 3.32 feet
4. "X" chisled on rock, 4½"x 5'x 6", N.26W., 36.75 feet
5. Steel Sign Post, 6', South, 0.60 feet

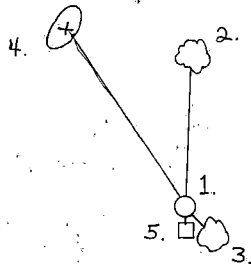

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Alan D. Harrison


(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

4/27/89
Date

Certificate ready for filing.

Dale S. Staege
District Ranger

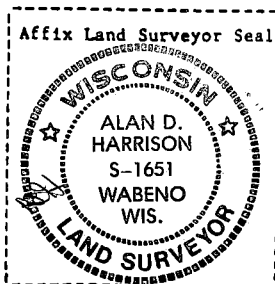

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 26 day of June, 1973, I found evidence of the south quarter corner of section 33 Township 35 north, Range 15 east, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in 1857 by Artemas Curtis
40 chains west between Section 4 and 33
Set quarter section post
Sugar 12, N23W, 51 lks.
Sugar 16, S47E, 3 lks.

Description of corner evidence found:


Fence north, south and west
Iron pipe by fence corner post
Fence corner post scribed as quarter corner
Sugar stump bears S47°E, 3 lks. from pipe

Description of monument and accessories I established to perpetuate the location of this corner:

Replace iron pipe found with a 2 inch inside diameter galvanized iron pipe, 3 feet long filled with concrete to weight 5 lbs. per foot, with brass cap stamped:

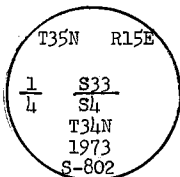

From which the following blazed and scribed new bearing trees bear:
S. Maple 8, N35E, 18.80 feet
S. Maple 16, S25E, 41.44 feet
sign post set 1 foot west of monument.

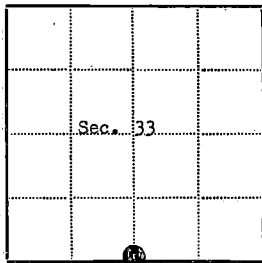

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland, Wisconsin, this 26 day of June, 1973.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 104435

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of November, 1973, and was filed in Book No. Page No. Z-11 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 north, Range 15 east, Section 33, Index No. Z-11, Page No. 211

43515330020

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

East One-Sixteenth Corner between Sections 4 and 33, T.35-36N., R.15E., Forest County, Wisconsin.

State Plane Coordinates

Wisconsin North Zone


N - 174321.42986

E - 2321802.61844

Geographic Coordinates

N - 45 - 38 - 10.68380

W - 088 - 37 - 07.56825

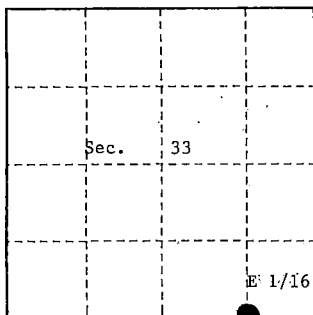

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence you considered, and whether the monument was found or placed.


In 1986 Glen Barker, RLS, with Consolidated Paper Industries established the corner at mid-point and on line between the South Quarter Corner and the Southeast Section Corner of Section 33. Set a 1" diameter iron pipe with a 2" diameter alloy cap stamped to identify corner. Made the following B.T.'s; Red Maple, 7", S.43°E., 33.95 feet, Spruce, 14", S.46°W., 23.28 feet.

In 1994, Alan Harrison, RLS, found monument and B.T.'s as set by Barker in 1986. Cut down all bearing trees for G.P.S. observations and made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 1" diameter iron pipe with alloy cap stamp to identify corner.
2. Red Maple, 13", North, 18°16' feet.
3. Cherry, 6", N.61°W., 43.28 feet.
4. Steel Sign Post, West, 2.00 feet.

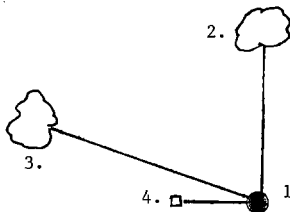

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May, A.D., 19 95 at
8:30 o'clock A.M. and recorded
in Vol. Corner Restorations
page 35-36-15-2-12

Shel Chitt Deputy
Register of Deeds

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 34, 35,
T.36N., R.15E. and Sections 2 and 3,
T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
Wisconsin North Zone
142864.76089-N
2328926.18239-E

Geographic Coordinates
45-32-58.93445-N
088-35-35.17227-W

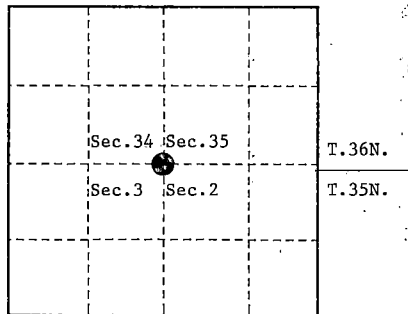

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1857 by Artemas Curtis. Set corner post and the following bearing trees; Sugar, 16", N.12°W., 57 links, Hemlock, 20", N.68°E., 89 links, Sugar, 10", S.26°E., 66 links, Sugar, 14", S.81°W., 31 links.


In 1980, William Cochrane, RLS, found a 2" diameter iron pipe and original bearing tree evidence. In place of pipe set a 2" x 36" galvanized iron pipe, with a brass cap stamped to identify corner. Made new bearing trees; Maple, 6", N.23°E., 11.54 feet, Maple, 8", S.08°E., 6.89 feet, Yellow Birch, 10", S.58°W., 13.28 feet, Basswood, 14", N.22°W., 30.38 feet.

On 11-16-93, Alan Harrison, RLS, found the monument and bearing trees as described above. Cut down all bearing trees for G.P.S. observations. Made the following new bearing trees; Maple, 11", N.25°E., 38.59 feet, Maple, 11", S.55°E., 52.48 feet, Maple, 6", S.42°W., 28.95 feet, Maple, 6", N.50°W., 49.12 feet, Steel Sign Post, 0.50 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" galvanized iron pipe with a tablet stamped to identify corner.
2. Maple, 11", N.25°E., 38.59 feet.
3. Maple, 11", S.55°E., 52.48 feet.
4. Maple, 6", S.42°W., 28.95 feet.
5. Maple, 6", N.50°W., 49.12 feet.
6. Steel Sign Post, South, 0.50 feet.

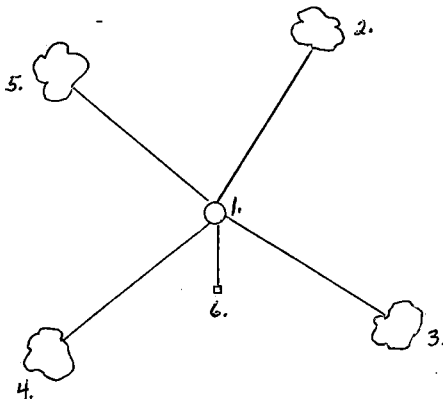

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day
of March, A.D., 1994 at
9:00 o'clock A.M. and recorded
in Vol. Conc. Restorations
page 35-15-17

Alan D. Harrison
Register of Deeds


(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

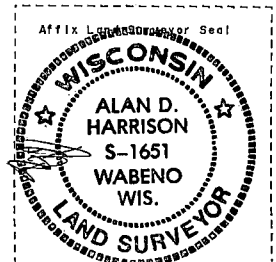


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Section corner to Sections 2, 3, 34, and 35,
T.34-35N., R.15E.

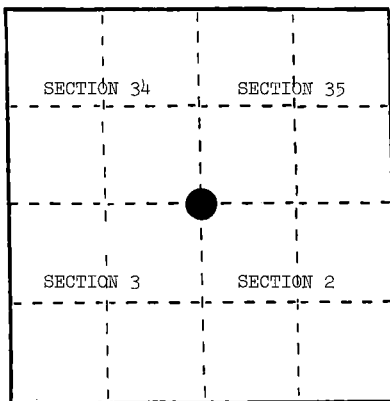

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, Artemas Curtis set wood post with the following BTs: Sugar, 14", N.24°W., 42 links; Sugar, 12", N.18°E., 52 links; Elm, 10", S.38°E., 35 links; Yellow Birch, 11", S.18°W., 30 links.

In 1934, J. W. White (874) found stake in good condition. Tag on 10" Elm. Believed to be original.


May 7, 1969, Resvick found squared post rotted off; piece of reinforcing rod on north side of post point.

October 24, 1984, Alan Harrison found corner, as found by Resvick. From post point and iron bar at N.24°W., 27.7', stump hole; at N.18°E., 34.3', stump hole; at S.38°E., 23.1', turned out tree--fell north.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 14", N.46°E., 32.85'
3. Sugar, 14", S.21°E., 34.72'
4. Sugar, 16", S.66°W., 35.38'
5. Sugar, 11", N.25°W., 19.38'
6. Steel Sign Post, South, 2.25'

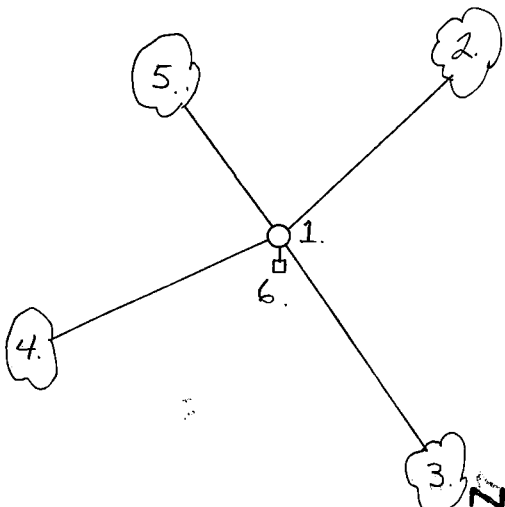

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day

of... January... A.D., 1985

at... 9:00 o'clock... A.M. and

recorded in Vol. CORNER... RESTORATIONS

on page 3-17

Paul A. Schenck
REGISTER

+35-15

43615 340000

2-17

717

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.


- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Affix Land Surveyor Seal

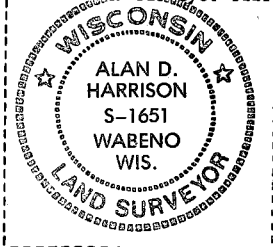

- (1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/14/84
Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I, Jean F. Resvick, do hereby certify that on the 25th day of June, 1969, I found evidence of the South Quarter corner of Section 35 Township 35 North, Range 15 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:
Surveyed in 1859 by James McBride. 40.00 chains West between Sections 2 and 35 set wood post.
Sugar 12 in. N10E, 37 lks.
Sugar 12 in. S10E, 40 lks.


A stream, 8 lks. wide, running NE bears west 18.55 chains.
A stream 6 lks. wide, running south, bears east 3.10 chains.
Enter Alder bottom, 2.50 chains East, bears North and South
Leave Alder bottom 6.50 chains east of post.

Description of corner evidence found:
A squared post 1.47 chains West of Alder Bottom from post West to stream measures 18.5 chains. From post East to stream measures 3.23 chains. From post east 6.67 chains leave Alder bottom. By evidence of natural calls to post found is accepted as being the true position of the corner. The post has been in place for 40 years plus. Signs of older post were found along side said post.


Description of monument and accessories I established to perpetuate the original location of this corner:
Replaced post with 2 inch inside diameter galvanized wrought iron pipe 5 feet long, filled with concrete with brass cap marked:

From which the following new blazed and scribed bearing trees bear:
Maple 13 inch. diameter bears S86E, 17.19 feet or 26.04 lks.
Maple 14 inch diameter bears N3W, 20.19 feet or 30.59 lks.
4 x 4 cedar post bears North 1.4 feet or 2.12 lks.

T35N R15E
1 S 35
4 S 2
T 34 N
1969
S-802

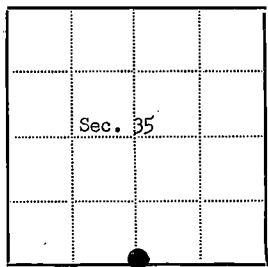

⊙ = Corner monument restored
□ =

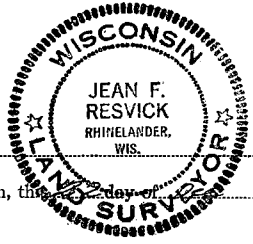

Resident witnesses.....
Dated at Rhineland Wisconsin, this 22nd day of May, 1969.
Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)
Surveyors Registration No. S-802 DOCUMENT No. 98040
Office of Register of Deeds County of Forest
I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. _____ Page No. 2-19 of County Records.
Signature Eugene Stutz Title Register of Deeds
Township 35 North, Range 15 East, Section 35, Index No. 2-19, Page No. _____

443515350020

719