

LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The West Quarter corner of Section 7, T. 30 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply)

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
- Determined to be lost and re-established through proportionate methods.
- Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- Restored/recovered/re-established in a location that differs from a previously established position.
- (Show difference in plan view below).
- Check here if additional information is shown on the reverse side of this form.

4 3010122000

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1853 by William J. Neely. Original bearing trees: elm, 8", N10°W, 17 links, and a birch, 10", S 46° E, 16 lks. In 1987, former surveyor Kelly, "Set RR spike at midpoint on W. Sect. line. Established 6 witness monuments, including a 3" x 42" aluminum witness monument." 05/23/2000 Dave Tlusty, Mike Kielcheski found PK nail @ CL-CL. Dug with backhoe. At 4' down, found a 3" dia. wood post point, approx. 7" long in the original soil layer. Accepted this wood post point as the best evidence of the corner and perpetuated this location as shown below.

Physical description of the monument set:


Road is to be rebuilt in near future, therefore nothing was set at this time.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

- Field book: FB10-47
- LEGEND**
- 3/4" x 30" rebar set
 - 3/4" iron pipe found (straightened & reset C & D)
 - ⊙ 2" aluminum monument found
 - ▽ RR spike found (Kelly's corner)
 - utility pole
 - ⊥ Set white vinyl sign post
- Tie bearings referenced to compass bearing of N80°W from A to B.



Index No. G1 30-11

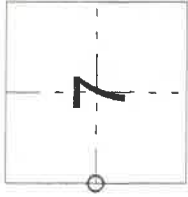

○ = corner perpetuated
The West Quarter
corner of Section 7,
T. 30 N., R. 11 E.,
Langlade County, WI



I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.