


4301129 0020 2023

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATION AND DESCRIPTION OF ANY RECORD, MONUMENT OCCUPATIONAL, TESTIMONIAL OR OTHER EVIDENCE CONSIDERED:

THE ORIGINAL CORNER WAS SET BY BRADLEY IN 1854 WITH THE ORIGINAL BEARING TREES OF:
14" BIRCH N25°W 26 LINKS
20" MAPLE S41°W 24 LINKS
1892 DORR MEASURED THE NORTH - SOUTH 1/4 LINE
1992 ARNOTT SET A 2" IRON PIPE WITH A BRASS CAP
MIDWAY BETWEEN THE SW AND SE CORNER OF SECTION 29
2023 I FOUND THE 2" IRON PIPE WITH BRASS CAP AND SET ADDITIONAL TIES

● = LOCATION OF CORNER

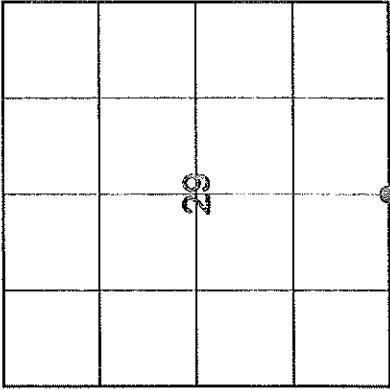

SECTION 29
TOWNSHIP 30 NORTH, RANGE 11 EAST
TOWN OF ROLLING
LANGLADE COUNTY, WISCONSIN

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED EVIDENCE LOCATION
- ☒ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
- ☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
- ☐ RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)
- ☐ CHECK IF THERE IS ADDITIONAL INFORMATION ON BACK

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THE CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND) ALSO INCLUDE FOUR TIES TO THE SECTION CORNER AND DESCRIPTION OF THE TIES.


○ SET 3/4"X 30" RE-BAR
WEIGHING 1.50 LBS/FT

⊙ FD 1" I. PIPE

● FD WITNESS MONUMENT

BEARINGS REFERENCED TO
THE LANGLADE COUNTY
COORDINATE SYSTEM

T SET 6 FOOT WHITE T-POST

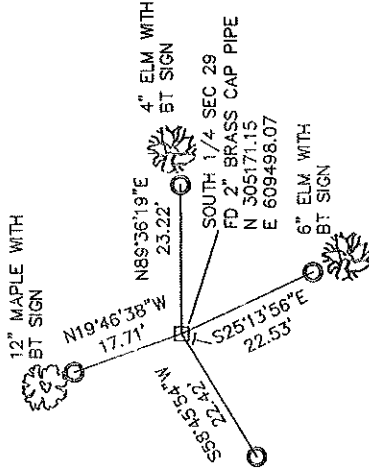


CHARLEY G. BRINKMEIER

(Type or print name) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

SIGNATURE

OCT 20 2023

DATE

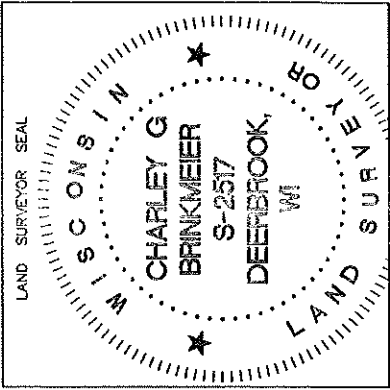

INDEX NO.

V7 30-11

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)


The South 1/4 corner of Section 29, T. 30 N., R. 11 E., Langlade County, WI

Corner was: (check all that apply)

- ☐ Restored through acceptance of an obliterated evidence location.
- ☐ Restored through acceptance of a found perpetuated location.
- ☒ Determined to be lost and re-established through proportionate methods.
(Show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/reestablished in a location that differs from a previously established position. (Show difference in plan view below.)
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

No evidence was found. There is an old fence line that is down running through the corner. Accepted the old fence as being on the section line. Set the new corner mid-way between the SE section corner and the SW section corner but on the old fence line which created an angle point at the 1/4 corner.

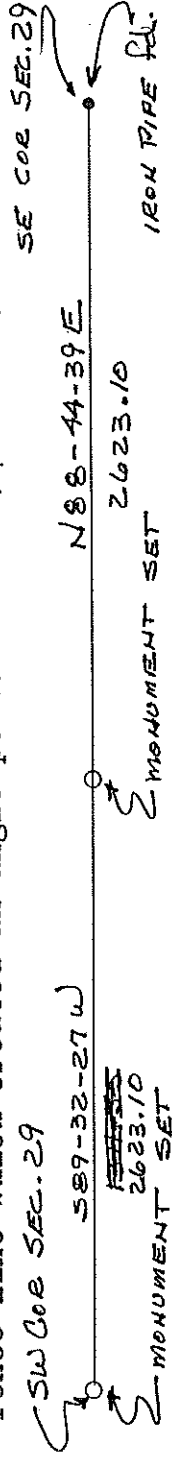


Physical description of the monument set:

Set a 2 inch iron pipe with a 4inch brass cap and stamped to identify the corner.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

Ties are made to aluminum nails in the stump of the trees. The stump of the trees were also blazed and painted with red tree marking paint. Bearings were done by compass. A white plastic post was set near the monument.

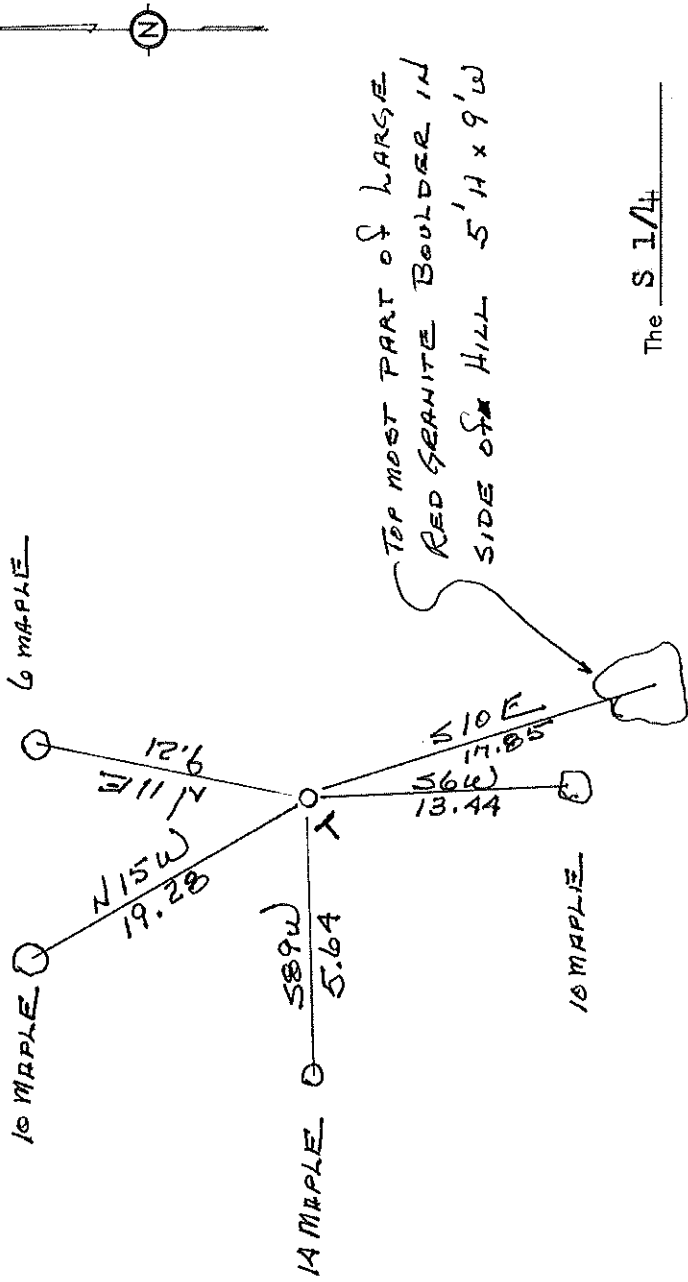


The S 1/4

SURVEYORS SEAL

corner of Section 29

T. 30 N., R. 11 E.
Langlade County, WI

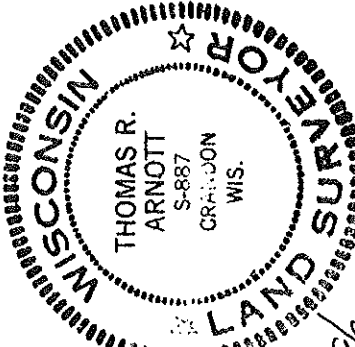

I, Thomas R. Arnett, certify that the corner location shown on this record was determined by me or under my direction and control and that the U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Thomas R. Arnett 1 Nov 1996

Signature

Date

INDEX No. 17

