

4310813 2000 2015

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

NOTE: THIS FORM IS INTENDED AND DESIGNED TO FULFILL ALL REQUIREMENTS OF WISCONSIN ADMINISTRATIVE CODE, CHAPTER A-E 7.08, U.S. PUBLIC LAND SURVEY MONUMENT RECORD (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). ADDITIONAL SHEETS MAY BE NECESSARY TO CONFORM TO SAID REQUIREMENTS.


(a) CORNER LOCATION:

EAST QUARTER CORNER, SECTION 13
TOWNSHIP 31 NORTH
RANGE 8 EAST
TOWN OF PINERIVER
LINCOLN COUNTY
WISCONSIN

(b) HISTORY OF ORIGINAL CORNER:

ORIGINAL SURVEYOR: James M. Marsh, Set post
COMMENCING DATE: July 8, 1851
COMPLETION DATE: July 28, 1851
ORIGINAL BEARING TREES:
7" Birch; S 50° E; 25 links
8" Birch; S 51° W; 19 links
8" Tamarack; N 21° W; 50 links
9" Maple; N 5° E; 26 links

T 31 N, R 8 E

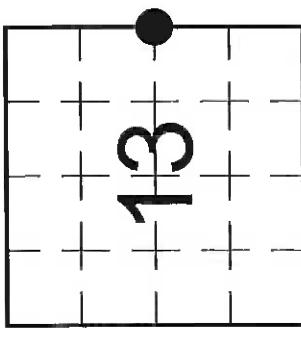

(f)(g)(h) DESCRIPTION OF MONUMENT FOUND AT THIS CORNER AND IF IT WAS ACCEPTED. STATE ALL EVIDENCE (MATERIAL, TESTIMONIAL, OCCUPATIONAL, PLATS, RECORDS, OTHER MONUMENTS) USED AS A BASIS FOR ESTABLISHING LOCATION. IF RE-ESTABLISHING THROUGH LOST CORNER PROPORTIONATE METHODS, INDICATE ALL MONUMENTS, DISTANCES, AND DIRECTIONS USED TO ESTABLISH. INDICATE TYPE OF MONUMENTS FOUND OR SET.

02/06/1975 - W. Kelly, RLS-1098, found a 1.5" galvanized Iron Pipe identified by a resident witness, E. Dittmar, as the East 1/4 Corner, along with remains of a wood post. He set a 2" x 36" black Iron Pipe with Brass Cap in place of the 1.5" galvanized Iron Pipe, which he then set as a witness post on the north side of the Brass Capped Iron Pipe. He notes that there is a blazed line running south from this corner and that the corner is located in a tag alder swamp. He made reference ties to perpetuate the corner location.



03/07/2006 - K. Walkowski, PLS-2717, found the 2" Iron Pipe during a remonumentation project for Lincoln County, shown on Lincoln County Surveyor's Office Map No. L423.

11/29/2012 - I, Anthony R. Dallman, PLS-2405, found the 2.25" (o.d.) Iron Pipe with Brass Cap at the corner location. The galvanized 2" (o.d.) Iron Pipe remains on the NW side of the Brass Capped Iron Pipe. I set new reference ties to further perpetuate the corner location, as shown in the sketch below.

(c)(d)(e) PLAN VIEW OF THE CORNER WITH TIES TO AT LEAST FOUR WITNESSES. IF IN DISAGREEMENT WITH PREVIOUSLY ESTABLISHED CORNER, SHOW THE DISTANCES BETWEEN THE TWO CORNERS AND ALSO THE TIES TO THE DISPUTED CORNER.



- Bearings by hand-held compass.
- Distances by steel tape.

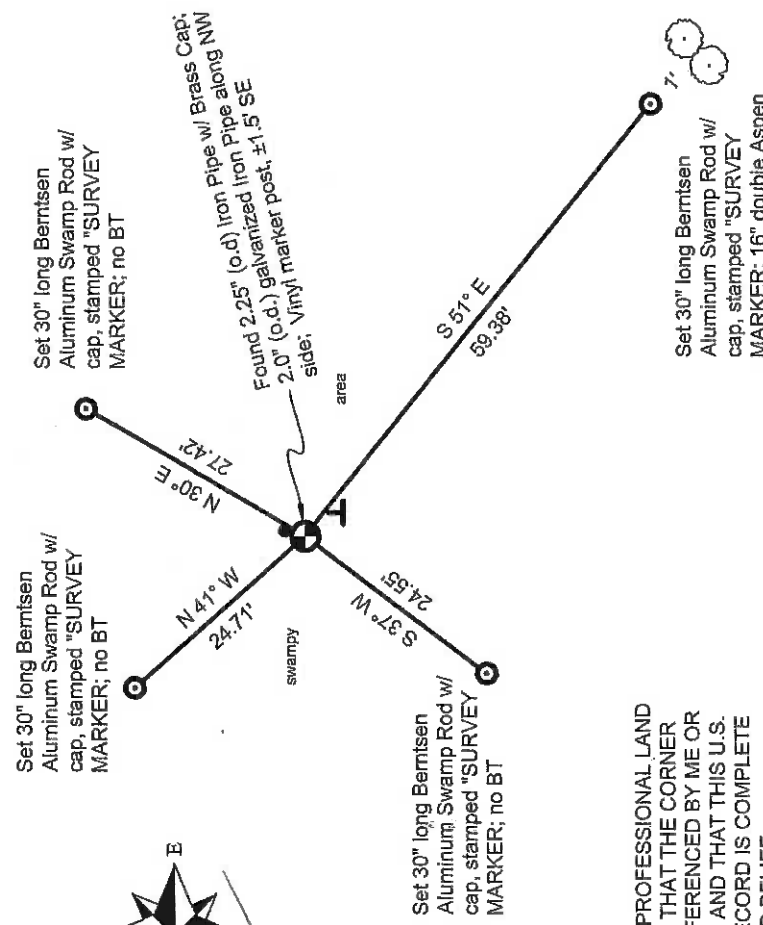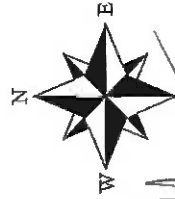

I, ANTHONY R. DALLMAN, WISCONSIN PROFESSIONAL LAND SURVEYOR, S-2405, HEREBY CERTIFY THAT THE CORNER LOCATION ON THIS RECORD WAS REFERENCED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.


Anthony R. Dallman 7/28/15
ANTHONY R. DALLMAN, PLS S-2405

INDEX NO. K-25

L-1 31-09

CERTIFIED LAND CORNER RESTORATION

Index No. 6-1
Filed

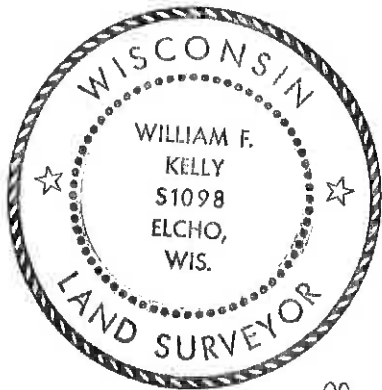

William F. Kelly

State of Wisconsin }
County of LANGLADE } ss.

History of original corner establishment:

I WILLIAM F. KELLY, do hereby
certify that on the 6th day
of FEBRUARY, 1975, I found
evidence of the 1/4 SECTION
corner of SECTIONS 13 & 18
Township 31, North, Range
8 & 9 EAST, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.


Description of corner evidence found:

LOCATED 1 1/2" GALVANIZED IRON PIPE IDENTIFIED BY RESIDENT WITNESS AS THE W 1/4 CORNER
SECTION 18. ALSO FOUND REMAINS OF WOOD POST.

Resident witnesses:


E. DITTMAR

Description of monument and accessories I established to perpetuate the original location of this corner.

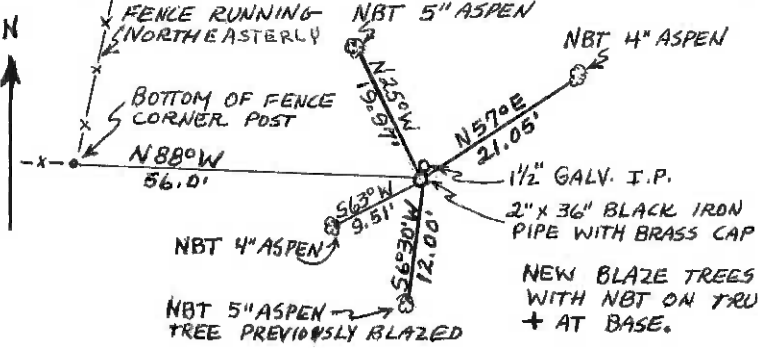

SET 2" x 36" BLACK IRON PIPE
WITH BRASS CAP AND RESET 1 1/2"
GALVANIZED IRON PIPE AS A
WITNESS POST.
BRASS CAP MARKED:

NOTE: THERE IS A BLAZED LINE RUNNING
SOUTH FROM CORNER TO THE SW
CORNER SECTION 18. CORNER IS
LOCATED IN A TAG ELDER SWAMP.

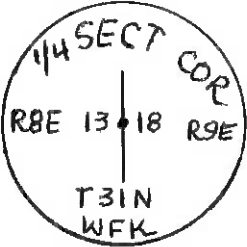

Dated at ELCHO, Wis., this 6th day of FEBRUARY, 1975.


Signature William F. Kelly Title REGISTERED LAND SURVEYOR Registration No. 51098
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within
instrument was filed in this office for record on the _____ day of _____, 19____
at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy

43168132000

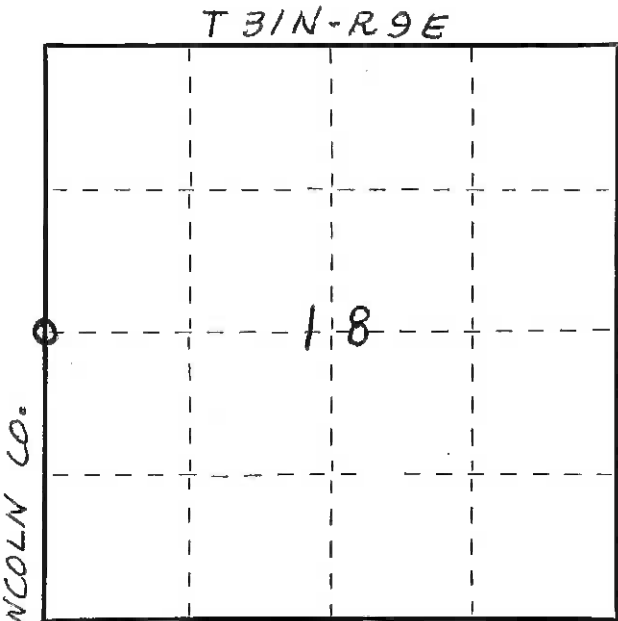

○ = Corner monument restored.
← LANGLADE CO.