

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The SOUTHEAST corner of Section 4, T. 31 N., R. 13 E., Langlade County, WI
Corner was (check all that apply)

- ☒ Restored through acceptance of an obliterated evidence location.
- ☐ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.


1857 - Original corner established by James McBride - bearing trees: Sugar, 16", N54°E, 11 links; Sugar, 8", S8°E, 16 links; Sugar, 18", S61°W, 44 links; Hemlock, 10", N65°W, 15 links. A stream 6 links wide is called for 32.5 chains (2145') west of this corner.
Date Unknown - In page 47 of "transcribed survey notes binder" at Langlade County Land Records, M. Hutchinson ran line between Sections 9 and 10. He notes an overall distance from the SE corner of Section 9 to the East 1/4 of 40.34 chains (2662.44') and East 1/4 to NE corner of 39.98 chains (2638.68'). He notes 3 original BT's standing at corner.

2025 - Working in Sections 9 and 10. I found no evidence of the BT's referenced by McBride and Hutchinson. I located stream called for in original notes and held Hutchinson's distance from the Southeast Corner of Section 9. This position works with the overall distance along the north line of Section 10 by Hutchinson (80.17 chains = 5291.22') and the original notes distance to the stream near Porkey Lake.

Physical description of the monument set:

I set a brass capped monument at the corner location and tied out as shown below.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

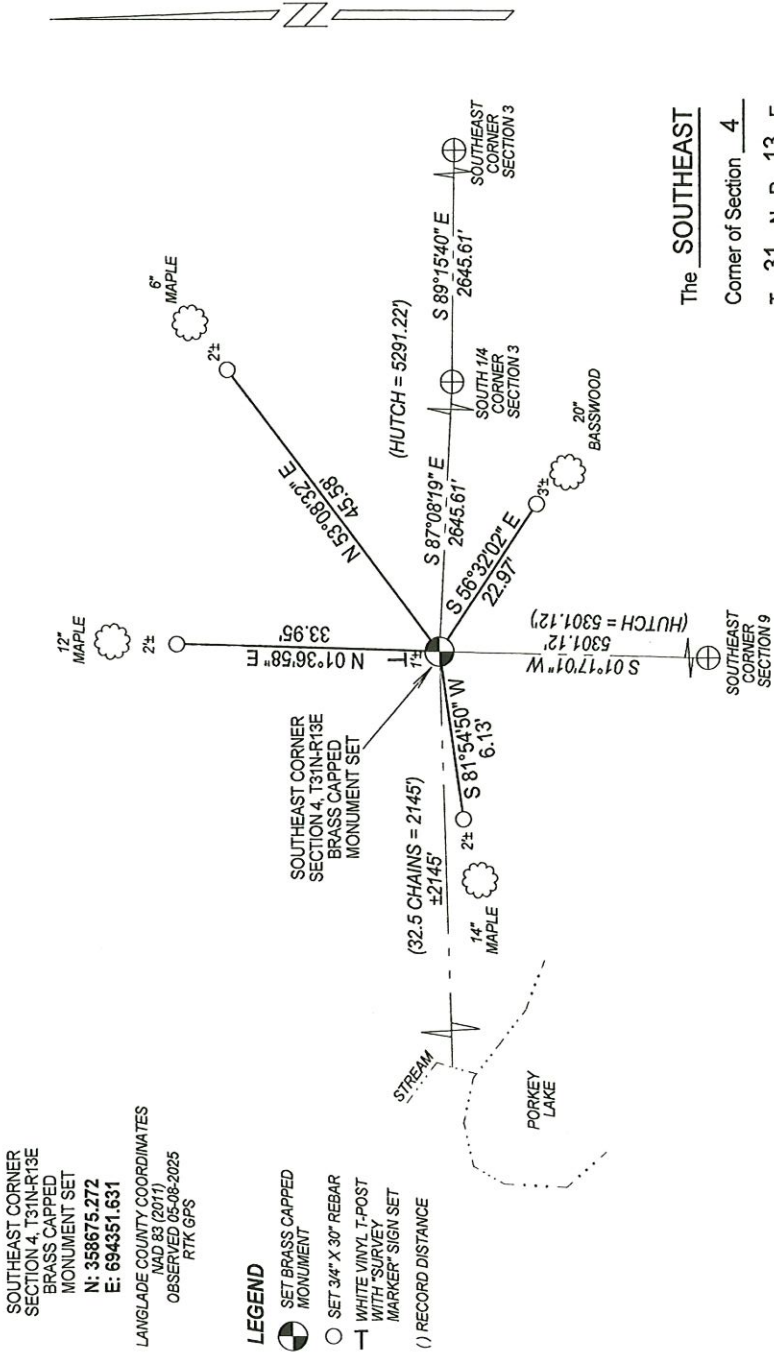

NOTES
- SKETCH NOT DRAWN TO SCALE.
- TIE BEARINGS SHOWN ARE LANGLAD COUNTY GRID BEARINGS.
- ALL TIES MEASURED ELECTRONICALLY WITH TOTAL STATION.

SURVEYORS SEAL



I, Michael J. Hoffman, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Michael J. Hoffman Signature
06/06/2025 Date