

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The EAST 1/4 corner of Section 8, T. 31 N., R. 13 E., Langlade County, WI
Corner was (check all that apply)

- ☐ Restored through acceptance of an obliterated evidence location.
- ☐ Restored through acceptance of a found perpetuated location.
- ☒ Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.

1857 - Original corner established by James McBride - bearing trees: Birch, 20", N84°W, 30 links; Hemlock, 8", N37°E, 35 links.

2025 - Working in Sections 9 and 10, I found no evidence of the BT's referenced by McBride. I set corner at midpoint between the Northeast and Southeast Corners of Section 8.

Physical description of the monument set:

I set an aluminum capped 3/4" rebar at the corner location and tied out as shown below.


Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

EAST 1/4 CORNER
SECTION 8, T31N-R13E
ALUMINUM CAPPED
3/4" REBAR SET
N: 355892.103
E: 688973.340

LANGLADE COUNTY COORDINATES
NAD 83 (2011)
OBSERVED 05-14-2025
RTK GPS

LEGEND

- SET ALUMINUM CAPPED 3/4" REBAR
- SET 3/4" X 30" REBAR
- WHITE VINYL T-POST WITH "SURVEY MARKER" SIGN SET

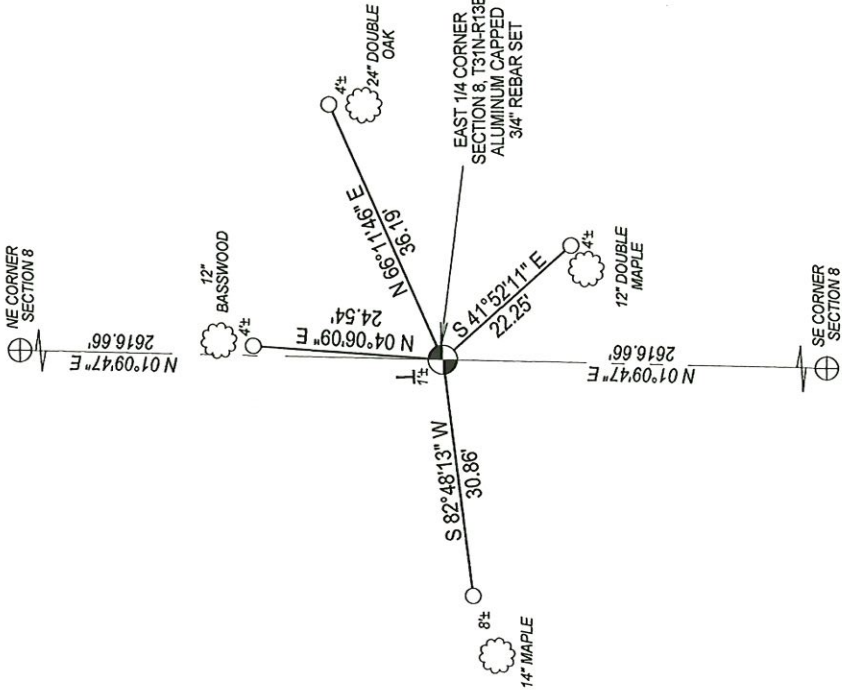


NOTES
- SKETCH NOT DRAWN TO SCALE.
- TIE BEARINGS SHOWN ARE LANGLADE COUNTY GRID BEARINGS.
- ALL TIES MEASURED ELECTRONICALLY WITH TOTAL STATION.

I, Michael J. Hoffman, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature Date



The EAST 1/4
Corner of Section 8
T. 31 N., R. 13 E.
Langlade County, WI

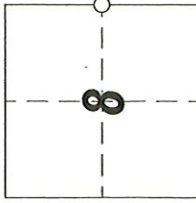

○ = Location of corner