

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The EAST 1/4 corner of Section 10, T. 31 N., R. 13 E., Langlade County, WI
Corner was (check all that apply)

- ☒ Restored through acceptance of an obliterated evidence location.
- ☐ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re-established through proportionate methods.
(show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.


1857 - Original corner established by James McBride - bearing trees: Hemlock, 12", N48°W, 29 links; Hemlock, 16", N67°E, 44 links. McBride notes a "cedar swamp" at 2.5 chains (165') north of corner location.

2025 - Working in Sections 9 and 10, I found no evidence of the BT's referenced by McBride. I found fence remnants heading north, and an old roadbed heading south and east. Using the extension of the fence with the centerline-centerline intersection of the road, this position matches with the swamp call made by McBride. I accept this position as the best available evidence of the original corner location.

Physical description of the monument set:

I set a brass capped iron pipe at the corner location and tied out as shown below.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

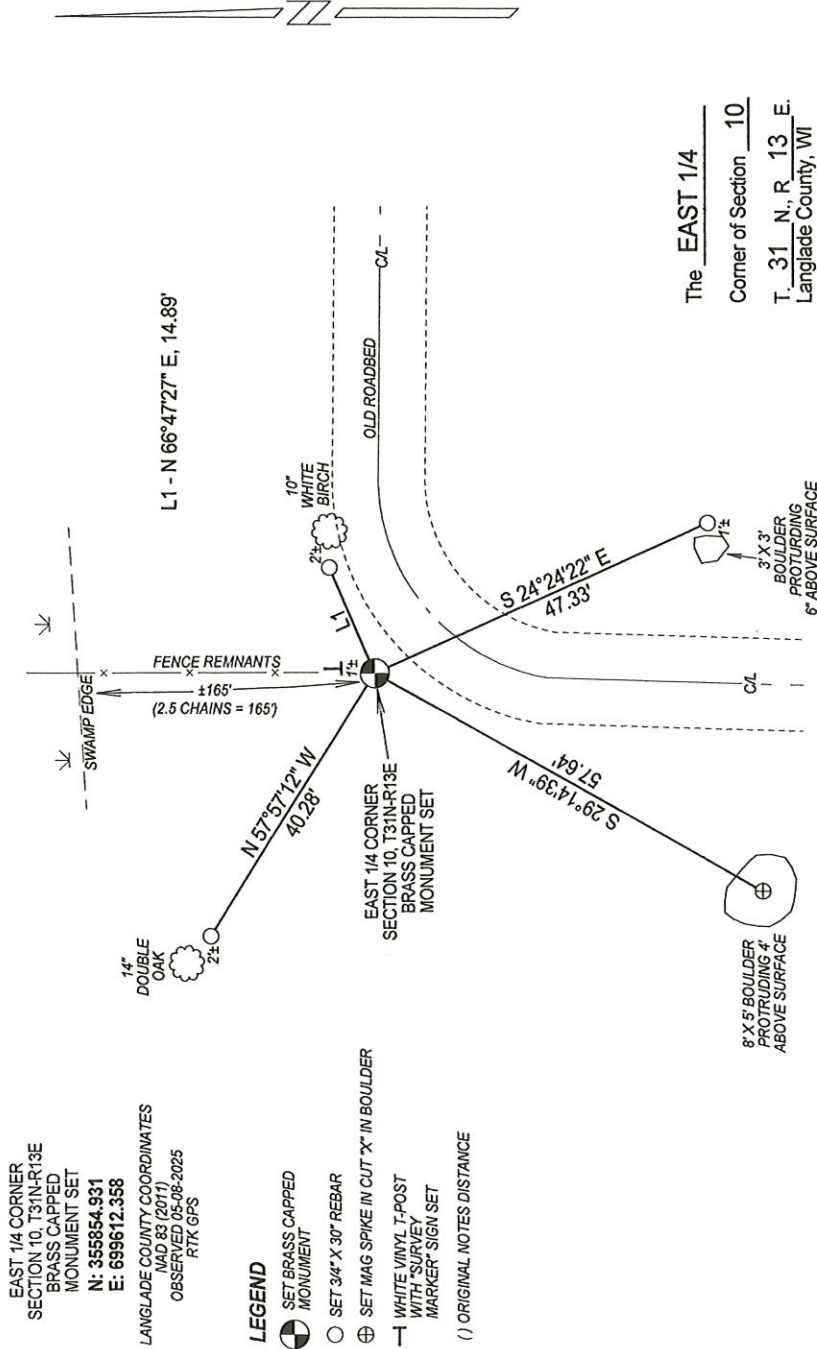

NOTES
- SKETCH NOT DRAWN TO SCALE.
- TIE BEARINGS SHOWN ARE LANGLAD COUNTY GRID BEARINGS.
- ALL TIES MEASURED ELECTRONICALLY WITH TOTAL STATION.


SURVEYORS SEAL



I, Michael J. Hoffman, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Michael J. Hoffman Date 06/06/2025
Signature

The EAST 1/4
Corner of Section 10
T. 31 N., R. 13 E.
Langlade County, WI

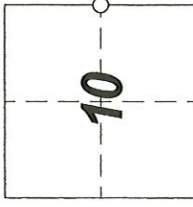

○ = Location of corner