

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The SOUTH 1/4 corner of Section 19, T. 32 N., R. 14 E., Langlade County, WI
Corner was (check all that apply)

- ☐ Restored through acceptance of an obliterated evidence location.
- ☒ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.

1857 - Original corner established by A. Millard - bearing trees: Y. Birch, 11", N73°E, 20 links; Hemlock, 16", S20°W, 10 links.


1967 - Typed notes in County record #10328 indicates a wood post was set at the corner location while running the South line of Section 19. A BT was referenced - 14" Maple, N5°E, 0.25 chains. Distance from the South 1/4 Corner to SE Corner = 39.7 chains - 2620.20'
Members of the survey crew included - Ken Steiro, Bruce Oleson, Bruce Krueger and Gary Lensert.

2025 - I found a 2" iron pipe with cap. Checked distance to the SE Corner of Section 19 (measured - 2615.95') (record - 2620.20').

Physical description of the monument set:

I accept the capped 2" iron pipe at the corner location and tied out as shown below.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

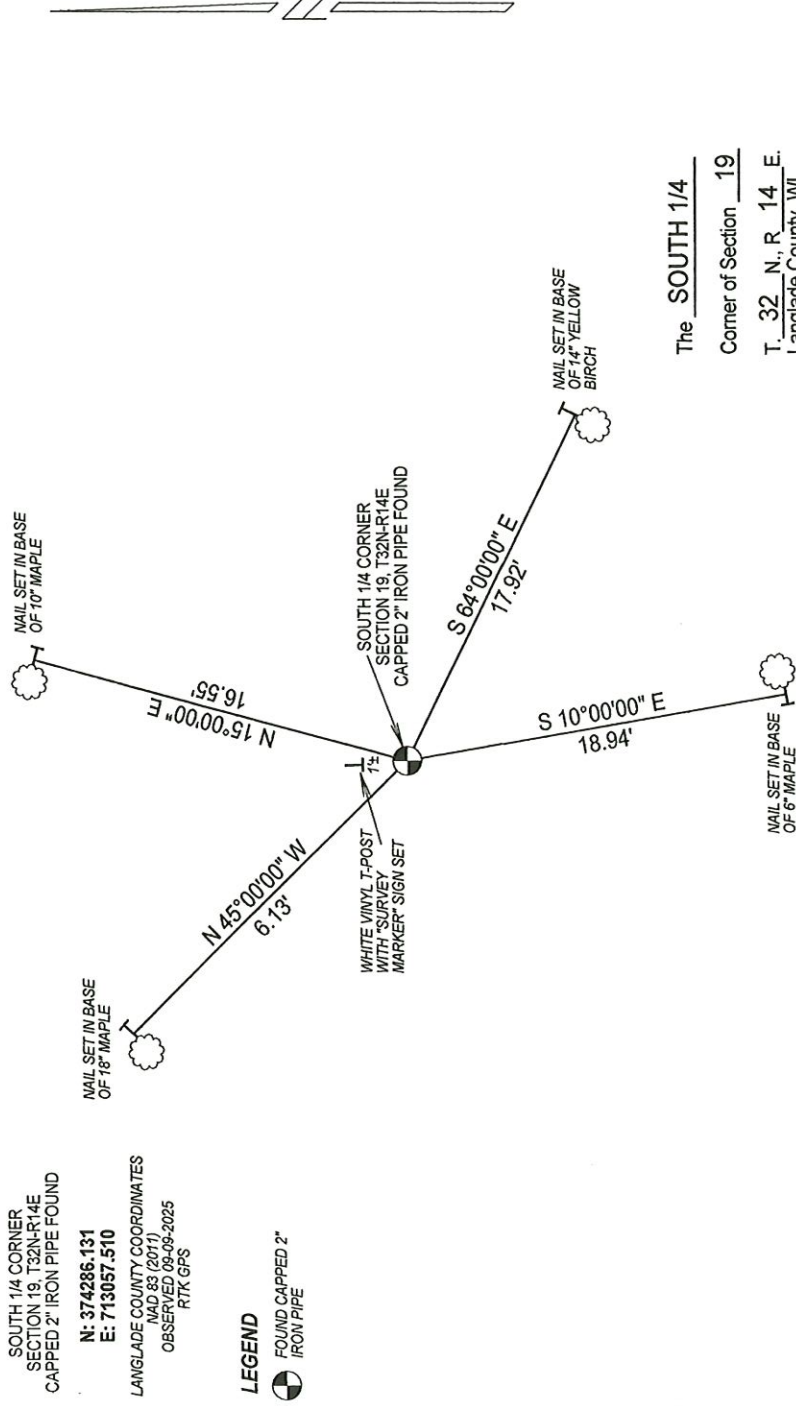

NOTES
- SKETCH NOT DRAWN TO SCALE
- TIES MEASURED WITH A HAND COMPASS AND STEEL TAPE.
- BT SIGN PLAQUARD SET IN EACH BT.


SURVEYORS SEAL



I, Michael J. Hoffman certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Michael J. Hoffman 10/02/2025
Signature Date

The SOUTH 1/4
Corner of Section 19
T. 32 N., R. 14 E.
Langlade County, WI

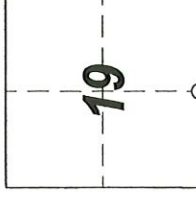

○ = Location of corner

INDEX No. R - 3 4321419 0020