


U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-f).

A-E 7.08(3)(a) Identity of corner
SOUTHEAST CORNER OF SECTION 15
TOWNSHIP 34 NORTH
RANGE 11 EAST OF THE 4TH PM
TOWN OF ELCHO,
COUNTY OF LANGLADE

WISCONSIN - LANGLADE COUNTY
N: 443,468.900 USft (443,468.800)
E: 635,957.900 USft (635,956.700)
Datum: NAD83 (2011)
GNSS Method RTN - Direct
GNSS Control WISCONSIN VRS

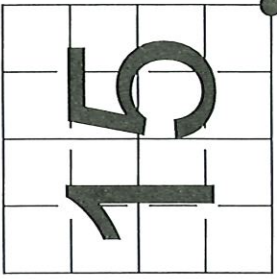

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Values shown in parenthesis, are previously published measurements.

A-E 7.08(3)(b) Description of any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence.

Original Surveyor: William E. Daugherty

Date of Original Survey Commenced: July 18, 1859
Completed: July 24, 1859

Original Accessories:
Sugar 24 S 59° W 11
Hemlock 15 N 66° E 17

See Previous Monument Record: Index No. N-17 - January 10, 1995 - Surveyor 1935 - Daniel E. Higginbotham - THENCE:

September 4, 1997, Surveyor 1390 - David E. Tlusty - indicates this position as "6" conc. monument with 4" brass cap" on Map 40305.
October 24, 2008 - Surveyor 2265 - Harry J. Smith - indicates this position as "concrete monument" on Map 30572.
May 11, 2020- Surveyor 2671 - Timothy J. Rusch - indicates this position as "found brass capped monument" on Map 11035.
October 29, 2020- Surveyor 2671 - Timothy J. Rusch - indicates this position as "found brass capped monument" on Map 20514.
April 24, 2021- Surveyor 3032 - Michael J. Hoffman - indicates this position as "found brass capped monument" on Map 20518.


A-E 7.08(3)(f) Whether the corner was restored through acceptance of an obliterated location or a found perpetuated location.

March 08, 2022 - I found a 5" diameter concrete monument with a 4" diameter brass tablet affixed to the top & stamped to identify the corner. I also found a vertical railroad rail 0.5 feet east of the concrete monument.
I did not find any witnesses recovered or established as noted on U.S. Public Land Survey Monument Record N-17

I accept this monument as a FOUND PERPETUATED LOCATION OF THE CORNER and established 4 new witnesses as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with references to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed. The directions and distances to other public land survey corners used as evidence or used for determining the corner location.

BEARINGS LISTED TO THE NEAREST
SECOND ARE REFERENCED TO WISCONSIN
COUNTY COORDINATE REFERENCE
SYSTEM - LANGLADE COUNTY ZONE.
ALL OTHER BEARINGS ARE MAGNETIC.

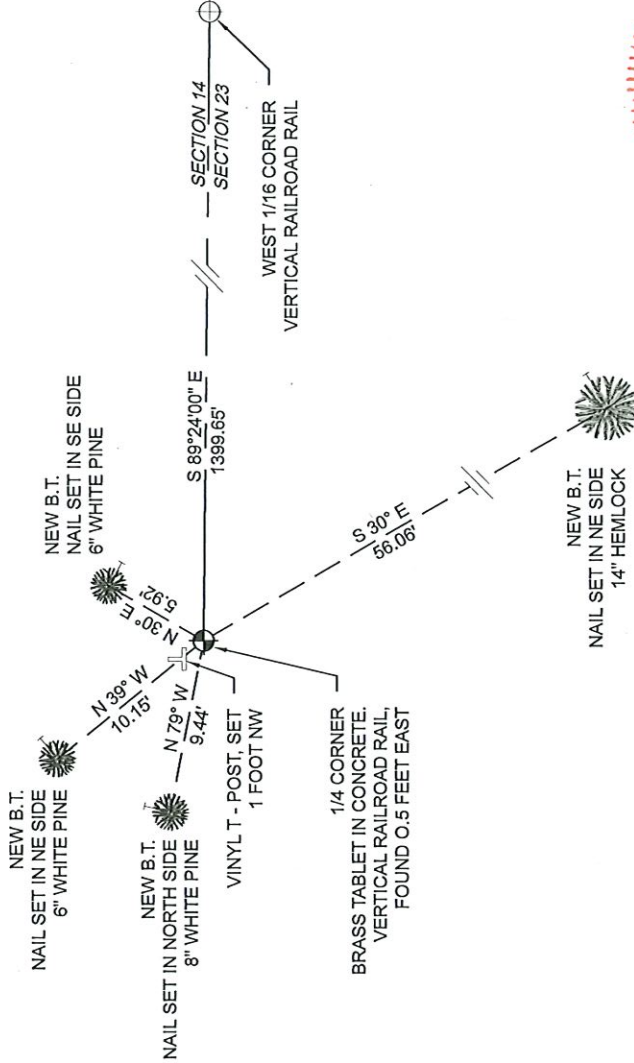

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief

Jeffrey L. DeMuth
Jeffrey L. DeMuth
S-2656
Arbor Vitae
WI



SIGNATURE August 16, 2022


DATE

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- O = Corner monument restored.

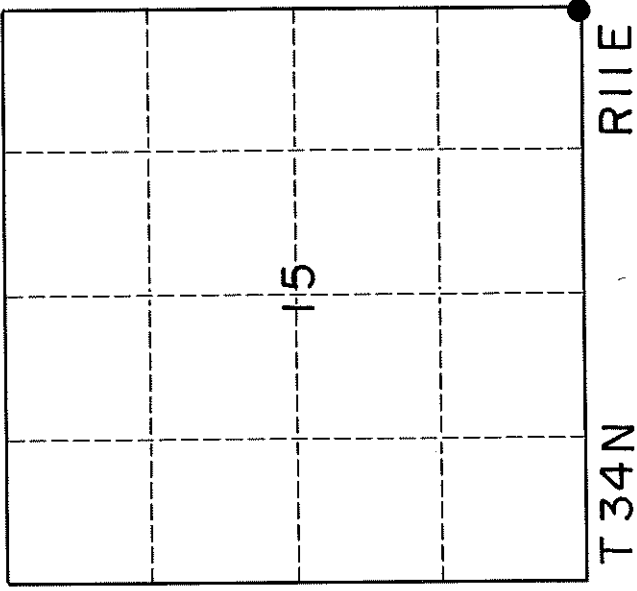


This corner was originally set by William E. Daugherty and was perpetuated by Robert J. Poss in 1968.

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

We re-tied this corner to perpetuate its location and to make it easier to locate for future users. This corner is located near a garden along the edge of a definite occupation line.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

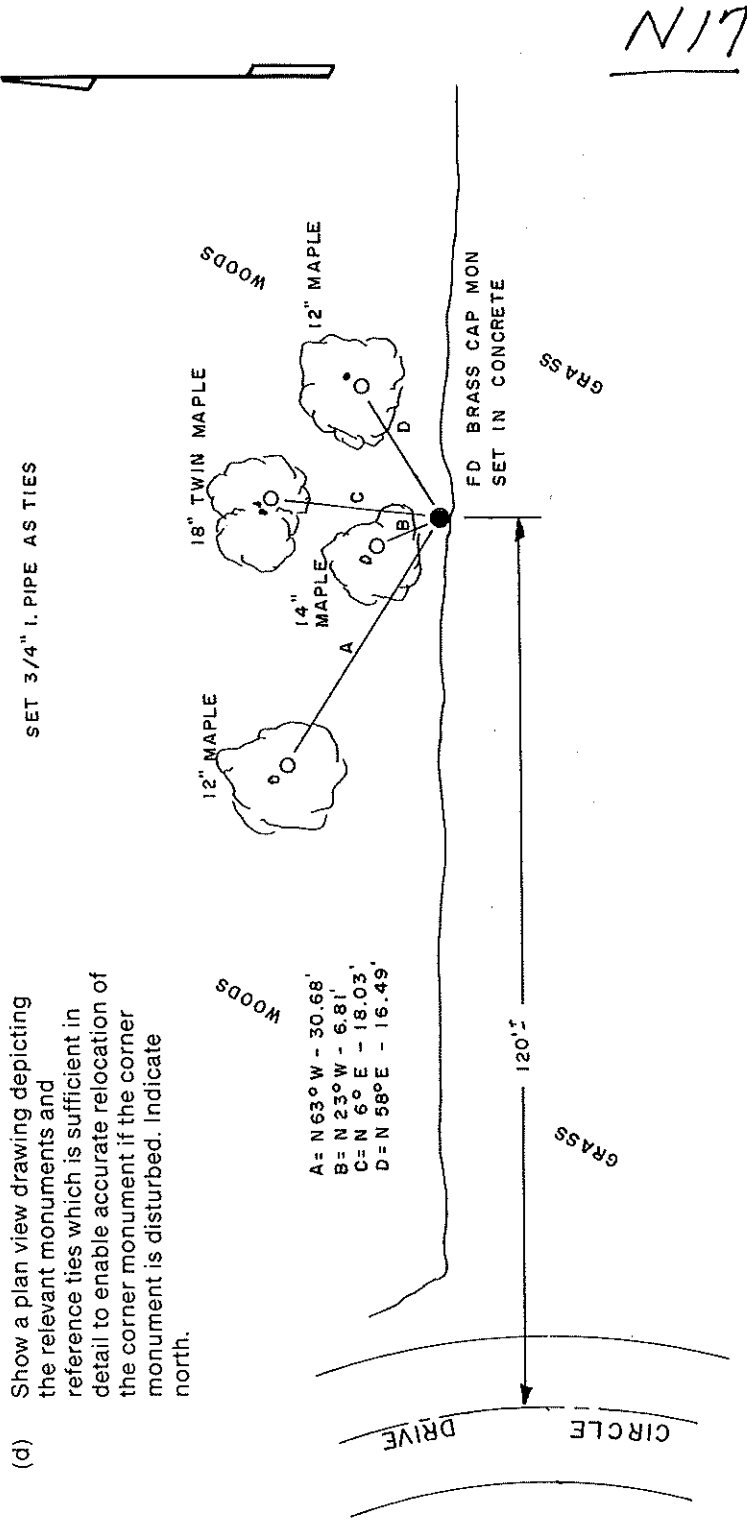

117


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location.?

2/

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.

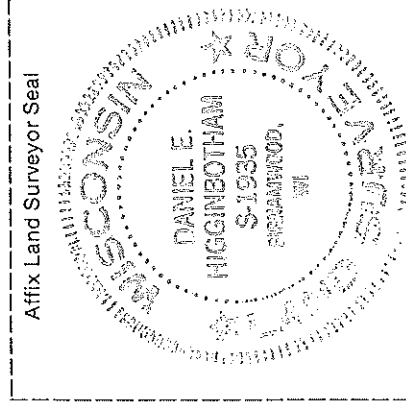

(i) I, DAN HIGGINBOTHAM (type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature


1-10-95 Date

FORM 985 H. C. MILLER CO., MILWAUKEE

State of Wisconsin }
County of LANGLADE } ss.

I, ROBERT J. POSS, do hereby
certify that on the 28TH day
of JUNE, 1968, I found
evidence of the
corner of SECS. 14-15-22-23
Township 34, North, Range
11, Fourth, Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

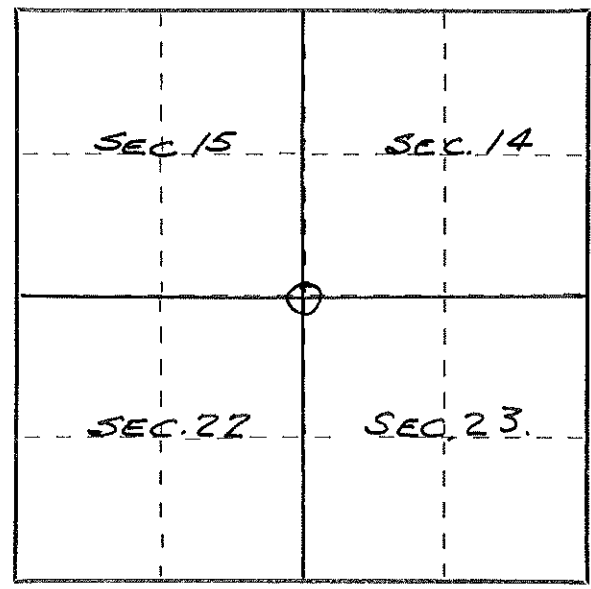

○ = Corner monument restored.


CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Description of corner evidence found:

FOUND RAILROAD IRON IN UPRIGHT POSITION.
ALSO FOUND B.T'S MARKED BY PREVIOUS
SURVEYOR

Description of monument and accessories I established to perpetuate the original location of this corner.

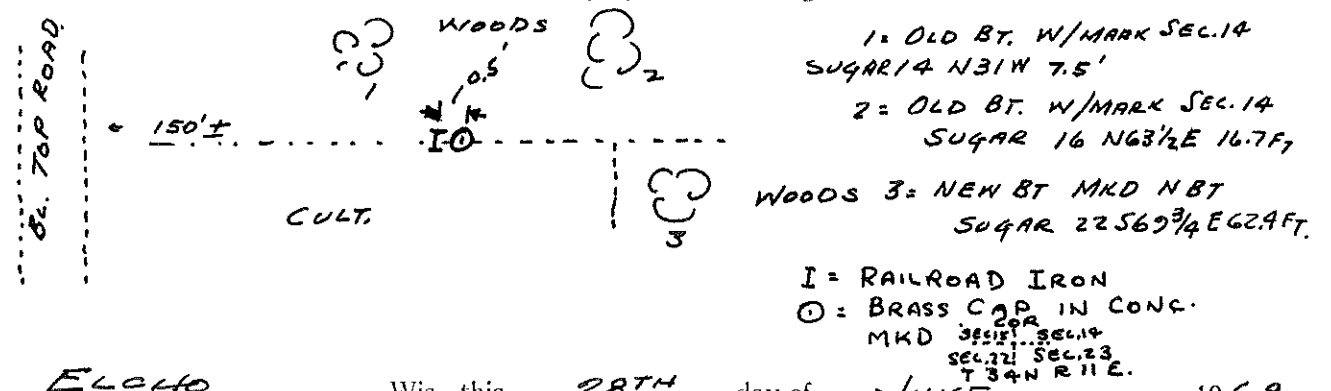

Dated at ELCHO, Wis., this 28TH day of JUNE, 1968.

Signature Robert J. Poss Title REG. LAND SURVEYOR Registration No. S-1
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within
instrument was filed in this office for record on the _____ day of _____, 19____
at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy

