


U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-f)

A-E 7.08(3)(a) Identity of corner
MEANDER CORNER - EAST LINE OF
GOVERNMENT LOT 2 SECTION 34
TOWNSHIP 34 NORTH
RANGE 11 EAST OF THE 4TH PM
TOWN OF ELCHO,
COUNTY OF LANGLADE

WISCONSIN - LANGLADE COUNTY
N: 429,052.041 USft (XXX.XXX.XX)
E: 636,002.482 USft (XXX.XXX.XX)
Datum: NAD83 (2011)
GNSS Method RTN - Direct
GNSS Control WISCONSIN VRS

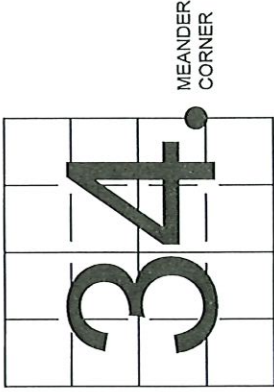

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Values shown in parenthesis, are previously published measurements.

A-E 7.08(3)(b) Description of any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence.

Original Surveyor: William E. Daugherty

Date of Original Survey July 18, 1859
Completed: July 24, 1859

Original Accessories:
Yellow Pine 16 N 8° W 16
Birch 10 S 88° E 9

See Previous Monument Record: Index No. X-Y-17 - June 21, 1969 - Surveyor 685 - Raymond J. Hallisy - THENCE:

March, 1982 - Surveyor 1098 - William F. Kelly - indicates corner position as "meander corner monument, found in place" on: Record #30206, CSM - V.2 P.272, CSM - V.2 P.273 , and CSM - V.2 P.274.

December 12, 2000 - Surveyor 1795 - Devon J. Vanden Heuvel - indicates corner position as "Meander Cor." on CSM - V.9 P.151.
December 11, 2008 - Surveyor 1910 - Matthew E. Hoglund - indicates corner position as "Found 4" brass cap in concrete" on CSM - V.15 P.092

A-E 7.08(3)(f) Whether the corner was restored through acceptance of an obliterated location or a found perpetuated location.

August 24, 2021 - I found a 5" diameter concrete monument with a 4" brass tablet affixed to the top & stamped to identify the corner.

I did not find any BT's recovered or established as noted on Certified Land Corner Restoration X-Y-17.

I did find find Hallisy's "original B.T. Norway Pine stump...N8°W, 16iks " (note, the original B.T. at this location, is a Yellow Pine), the stump is burned and decomposing.

I accept this monument as a FOUND PERPETUATED LOCATION OF THE CORNER and established 4 new witnesses as shown below.

BEARINGS LISTED TO THE NEAREST
SECOND ARE REFERENCED TO WISCONSIN
COUNTY COORDINATE REFERENCE
SYSTEM - LANGLADE COUNTY ZONE.
ALL OTHER BEARINGS ARE MAGNETIC.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with references to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed. The directions and distances to other public land survey corners used as evidence or used for determining the corner location.

NEW B.T.
NAIL SET IN SW SIDE
8" SPRUCE
TOP & BOTTOM BLAZE

NEW B.T.
NAIL SET IN NW SIDE
6" SPRUCE
N39°E - 1.35'

NEW B.T.
NAIL SET IN NORTH SIDE
10" SPRUCE
TOP & BOTTOM BLAZE

M.C.
BRASS TABLET
IN CONCRETE.

SOUTH
±15'

NEW B.T.
NAIL SET IN NE SIDE
8" SPRUCE
TOP & BOTTOM BLAZE

UN-NAMED
LAKE

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-26556, hereby certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief

Jeffrey L. DeMuth


August 10, 2022

DATE

SIGNATURE

43411341400

X-Y-17 34-11

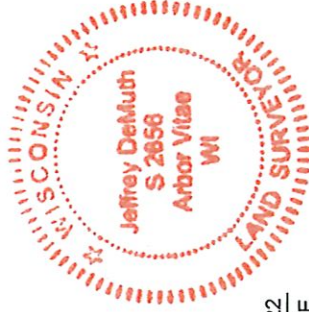


State of Wisconsin }
County of Lan glade } ss.

I Raymond J. Hallisy, do hereby
certify that on the 21st day
of June, 19 69, I found
evidence of the M.C.
corner of Bot. Sec. 34 & 35
Township 34, North, Range
11E, Fourth, Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

.....
.....
.....

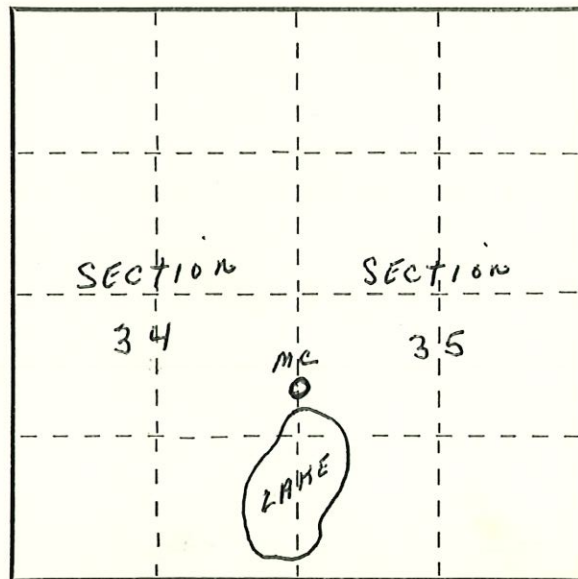

○ = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original Government Survey

Description of corner evidence found:

Found original B.T. Norway Pine 16" N8W 16 Lks
Is now 24" Stump, iron marks quite plain on face "M"


Description of monument and accessories I established to perpetuate the original location of this corner.

Reset 1 1/2" iron pipe with 4" brass cap in cement. Reset with
transet from original bearing and distance, from Norway pine B.T.
B.T.'s to M. C.

White Birch 9" S76E 26 Ft. 8 inches

Red Maple 4" S6W 10 Ft. 6 inches

B.T.'s faced at base and scribed BT

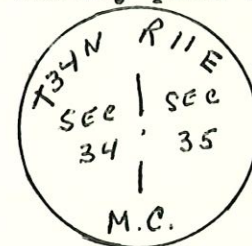

Dated at Antigo, Wis., this 21st day of June, 19 69.

Signature Raymond J. Hallisy Title Reg. Land Surveyor Registration No. S-685
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within
instrument was filed in this office for record on the _____ day of _____, 19 _____
at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy

34-11
Index No. X-Y-17