

LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The Southeast corner of Section 28, T34N, R12E, Langlade County, WI

4341228 0000 2025

Corner was: (check all that apply)

- ☐ Restored through acceptance of an obliterated evidence location.
☒ Restored through acceptance of a found perpetuated location.
☐ Determined to be lost and re-established through proportionate methods.
☐ Show bearings and distances to PLSS corners used for proportioning, and show original distances).
☐ Restored/recovered/re-established in a location that differs from a previously established position.
☐ (Show difference in plan view below).
☐ Check here if additional information is shown on the reverse side of this form.


Corner history:

The original corner was established in 1865 by J. L. Nowlin, deputy surveyor. Original bearing trees: Y. pine, 12", N40W, 30 lks and tamarac, 12", S86E, 200 lks. In 1909, Brooks found O pine down and rotten. Tam, 12" S86E stg. Brooks marked 3 new pine BT's. Hutchinson, in 1911: "Stake set by Brooks". 1932-1934 Chas. Borth set and scribed new cedar stake in 3" pipe. This cor is in edge of clearing and has one jack pine BT, S50E, 25.2'; others gone. Corner conforms to county field notes. Ogl BT's gone." Borth found one of Brooks' BT's. In 1968, Robert Poss "Found post to Secs S27, S28, S33 and S34 set inside a 4" iron pipe. Stake marked S27 S28 S33 S34." Poss set a brass cap in concrete on the south side of the existing 4" iron pipe. He found pine stump, S 48-1/2 E, 24.0'. 8/31/06 D. Tilusty found 4" ip (corner) and Poss's BC in conc (witness), both in good condition. Poss WC is 0.4' south of section corner. Borths SE BT is a pine slab on the ground. Poss's E and SW BT's are good. His SE BT is gone. On 9/7/06 I set a 2" stamped aluminum cap in concrete in the 4" iron pipe found. I stamped Poss's BC as "witness corner".

Physical description of the monument set:

For the corner I accept the existing 4" iron pipe and set a stamped 2" aluminum cap in concrete in said pipe. Poss's witness corner is 0.4' south of the corner monument.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

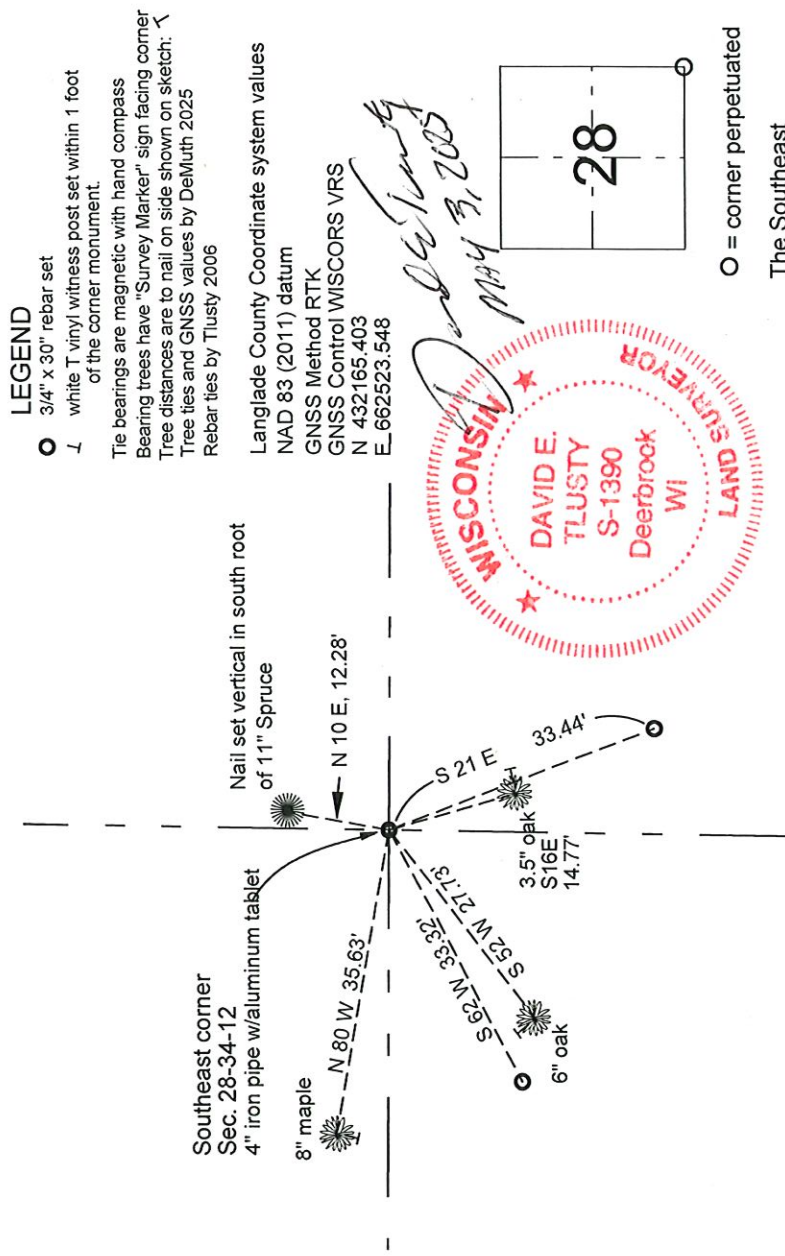


I, David E. Tilusty, Wisconsin Professional Land Surveyor S-1390, do hereby certify that the corner location and perpetuation shown on this record was made by me and that this U.S. Public Land Survey Monument Record as required by AE-7.08 of the Wisconsin Administrative Code is correct to the best of my knowledge and belief.

V-13 34-12

FORM 985 M. C. MILLER CO., MILWAUKEE

State of Wisconsin }
County of LANGLADE } ss.
I, ROBERT J. POSS, do hereby
certify that on the 4TH day
of JUNE, 19 68, I found
evidence of the SECTION
corner of SECS. 27-28-33-34
Township 34, North, Range
12 EAST, Fourth, Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

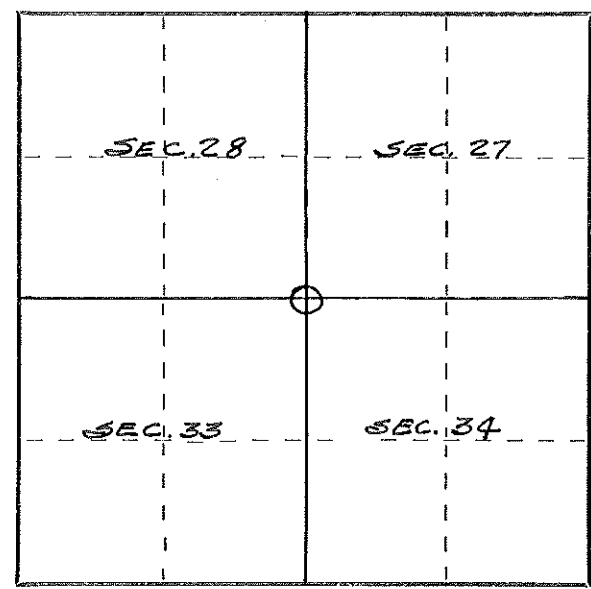

○ = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

ORIG J.L. NOONAN Y. PINE 12", N46W 30
TAM, 12" S86E 200
BROOKS 1909 FND O. PINE DOWN & ROTTEN TAM 12 S86E
5TH BUT DOWN MEASD. NOW B PINE 10 S50E 38
B PINE 10 S67 1/2 W 27 1/2. B. PINE 8 N69 1/2 W 13 1/4
4/13/97 V. T. Jy

Description of corner evidence found:

FOUND POST TO SECS. 27, 28, 33, 34 SET INSIDE
OF A 4" IRON PIPE. STAKE MARKED S27 S28 S33 S34.

Description of monument and accessories I established to perpetuate the original location of this corner.

- BRASS CAP. IN CONCRETE MKD.
SEC. COR
28 | 27
33 | 34
- 1. = J. PINE 8 S89E 23.8
2. = PINE STUMP S48 1/2 E 24.0 (BROOKS)
3. = J. PINE 10 S37 E 47.5
4. = J. PINE 8 S70 1/4 W 24.7
- WOOD STAKE IN 4" PIPE, GOOD COND.
△ BLACK PINE STUMP (BT?)

Dated at ELCHO, Wis., this 4TH day of JUNE, 19 68.

Signature Robert J. Poss Title REG. LAND SURVEYOR Registration No. S-1
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within
instrument was filed in this office for record on the _____ day of _____, 19____
at _____ o'clock _____ M.

(Register of Deeds)
By _____ Deputy

