


U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-i)

A-E 7.08(3)(a) Identity of corner
SOUTHEAST CORNER OF SECTION 35
TOWNSHIP 35 NORTH
RANGE 11 EAST OF THE 4TH PM
TOWN OF SCHOEPKE,
COUNTY OF ONEIDA

WISCONSIN - LANGLADE COUNTY
N: 458,913.220 USft (XXX.XXX.XX)
E: 642,201.390 USft (XXX.XXX.XX)
Datum: NAD83 (2011)
GNSS Method RTN - Direct
GNSS Control WISCONSIN VRS

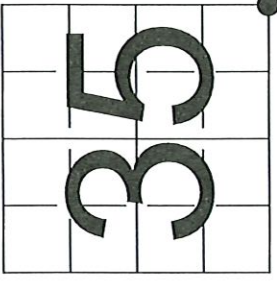

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Values shown in parenthesis, are previously published measurements.

A-E 7.08(3)(b) Description of any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence.

Original Surveyor: Hiram C. Fellows (Note: previous monument record Z-21 refers to Alfred Millard as the original surveyor)

Date of Original Survey	Commenced:	June, 1859	Original Accessories:	16	N 25° W	87 Links
	Completed:	July, 1859	Red Oak	10	N 63° E	20 Links
			Spruce	8	S 16° E	178 Links
			Aspen	8	S 23° W	12 Links

See Previous Monument Record: Index No. Z-21 - October 4, 1990 - Surveyor 1098 - William F. Kelly - THENCE:

April 27, 2000 - Surveyor 1795 - Devon J. Vanden Heuvel - indicates this position as "nail set from ties" on Langlade Co. Map #40335.
September 12, 2008 - Surveyor 2671 - Timothy J. Rusch - indicates this position as "calculated from ties" on Langlade Co. Map #20375.


A-E 7.08(3)(f) Whether the corner was restored through acceptance of an obliterated location or a found perpetuated location.

April 29, 2022 - I did not find Kelly's 1.25" I.P. or Vanden Heuvel's nail.
I did find both of Kelly's reference monuments and both B.T.'s recovered or established as noted on Certified Land Corner Restoration Z-21.


I reestablished the corner position from existing witnesses, and from a 1.3" diameter iron pipe found from Langlade County Map #20375. I set an Oneida County drivable monument, being a 1" diameter X 30" long aluminum pipe, with a 2.5" diameter aluminum cap stamped to identify the corner. The monument is in the east shoulder of County Trunk Highway Z, and 12" below gravel grade.

I accept this monument as a FOUND PERPETUATED LOCATION OF THE CORNER and established 1 new witnesses as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with references to at least 4 witness monuments.

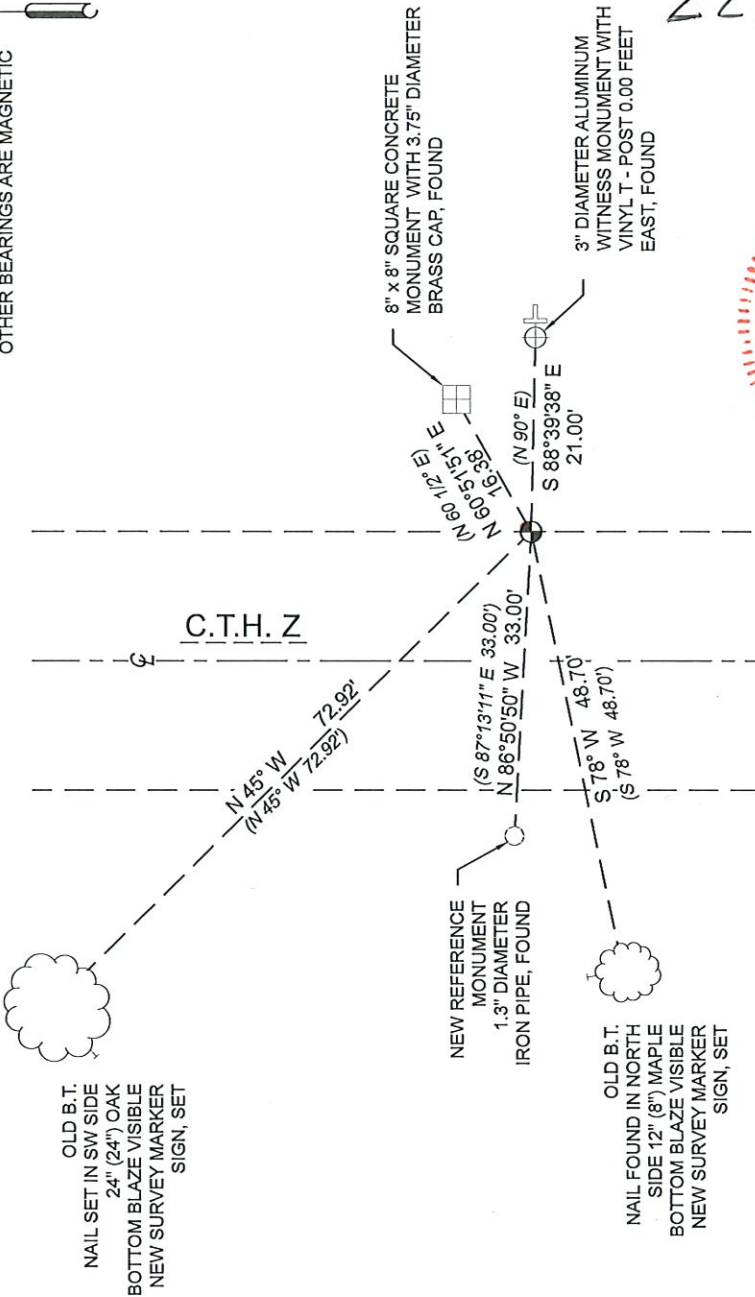

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief

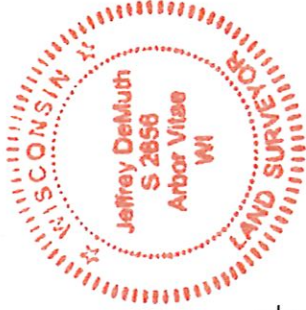

Jeffrey L. DeMuth
Jeffrey L. DeMuth

SIGNATURE _____ DATE August 16, 2022

43511350000
LANGLADE CO.

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.


1857 - ALFRED MILLARD ESTABLISHED ORIGINAL CORNER

BT'S : 16" R. OAK, N5°W, 87 LKS.

10" Spruce, N63°E, 20 LKS.

8" Spruce, S16°E, 178 LKS.

8" ASPEN, S23°W, 122 LKS.

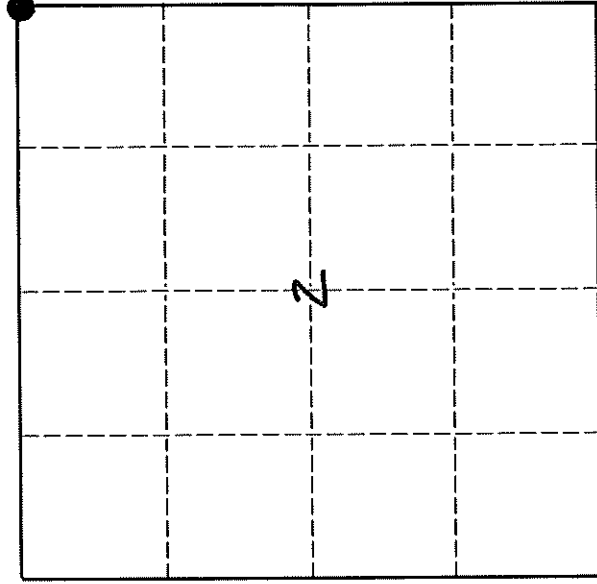

T 34 N - R 11 E


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

OCTOBER 1990 - I FOUND NO EVIDENCE OF CORNER OR BEARING TREES, SET CORNER BY SINGLE PROPORTION. CORNER LOCATION LANDED IN GRAVEL ON EAST EDGE OF COUNTY HWY Z. I SET 1 1/4" IRON PIPE 6" BELOW SURFACE & 3" AL. WITNESSES MONUMENT 21.00 FEET EAST.



* SEE REVERSE SIDE FOR DIRECTION & DISTANCES TO CORNER.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

BT'S:

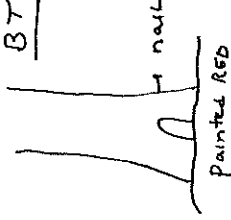

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

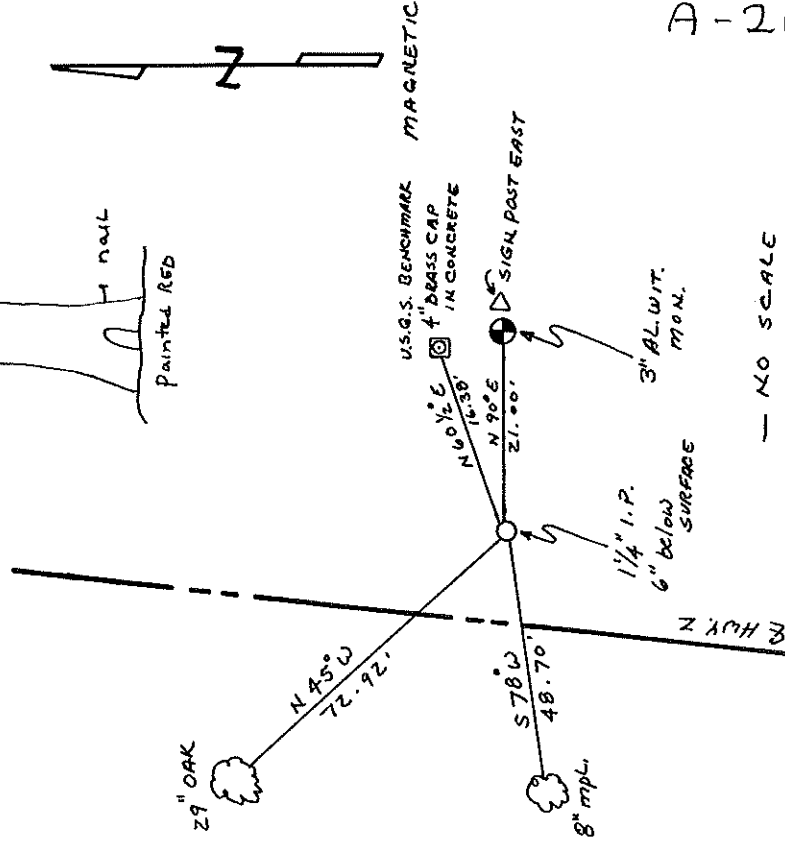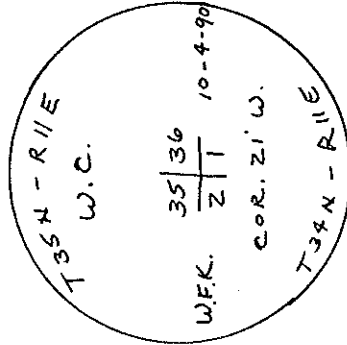


— NO SCALE

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
No


- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.

T 35 N - R 11 E

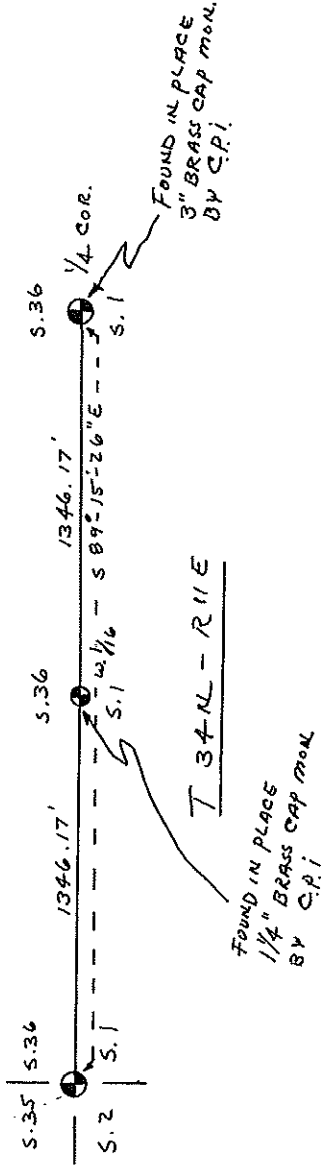

(i) I, WILLIAM F. KELLY
(type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

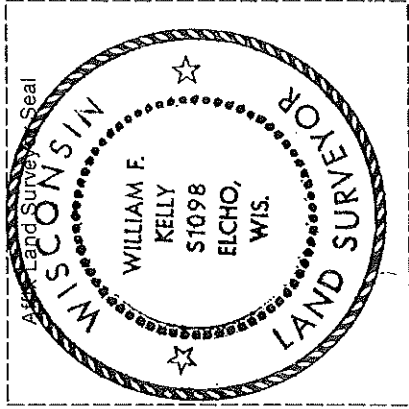

Signature William F. Kelly Date 10-30-90